

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 74586

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	STAR PRINCESS
IMO Number:	9296200
DOC Company:	Charterwell Maritime SA
Place of Inspection:	China, Huanghua
Name of Inspector:	Andrew Huang
Inspection Completion Date:	5/31/2026 12:00:00 AM
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

Number of Findings: 21

Section 3: Navigation

3.7 Has the vessel's manager produced a guideline for under keel clearance and air draft clearance? (M)

Findings: Sample inspection of UKC calculation for navigation from Huanghua anchorage to berth within confined water was conducted. The planned speed was set at 5 to 6.5 knots, while the actual transit speed recorded in the relevant ECDIS logbook ranged from 7 to 10 knots. No objective evidence was found to verify that the UKC calculation had been performed.

Attachments:



[Q307_15ea473e-e560-4f6e-8ff1-d0d2951358e9.jpg](#)


3.20 Are T&P NMs and navigation warnings being used correctly in voyage planning and monitoring?

Findings: Sampled Temporary Notices to Mariners 2414(T)/25, 2485(T)/25 and 5582(T)/25, situated approximately 2 nautical miles alongside the planned route, were not manually amended and displayed on ECDIS.

Attachments:



[Q320_9a57afc1-cb71-4642-b909-7e2c626ec5f5.jpg](#)

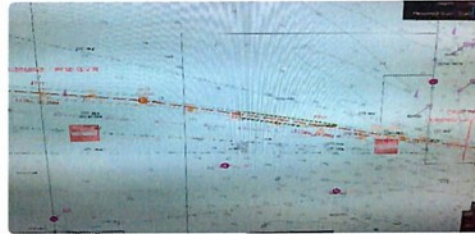

[Q320_a5781438-dfc3-4192-92e9-051d72bf26e9.jpg](#)



[Q320_ce07cb57-6861-4319-a917-36624616a332.jpg](#)

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 74586

A bulk carrier that is carrying solid bulk cargo

Vessel Name:	STAR PRINCESS
IMO Number:	9296200
DOC Company:	Charterwell Maritime SA
Place of Inspection:	China, Huanghua
Name of Inspector:	Andrew Huang
Inspection Completion Date:	5/31/2026 12:00:00 AM
Operational Variant:	

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

DISCLAIMER

THIS DOCUMENT AND THE CONTENTS HEREOF ARE PREPARED SOLELY FOR RIGHTSHIP'S CUSTOMER IN RESPECT OF THE VESSEL(S) NAMED FOR RIGHTSHIP INSPECTION AND ARE NOT INTENDED FOR ANY THIRD PARTY TO ACCESS, USE, RELY ON OR DISTRIBUTE WITHOUT RIGHTSHIP'S EXPLICIT WRITTEN CONSENT. NOTWITHSTANDING ANY CONSENT THAT MAY HAVE BEEN GIVEN BY RIGHTSHIP AS AFOREMENTIONED, RIGHTSHIP SHALL HAVE NO LIABILITY WHATSOEVER AND HOWSOEVER ARISING TO ANY SUCH PERSON OR ENTITY, OR THIRD PARTY RECIPIENT, WHETHER IN CONTRACT, TORT OR OTHERWISE.

IF, IN RELIANCE OF THIS DOCUMENT, YOU ELECT TO CHARTER ANY VESSEL OR MAKE ANY COMMERCIAL OR OTHER DELIBERATIONS IN CONNECTION WITH IT, YOU DO SO AT YOUR OWN RISK AND YOU MUST MAKE YOUR OWN ASSESSMENT AND SATISFY YOURSELF AS TO THE ACCURACY AND COMPLETENESS OF THE INFORMATION CONTAINED IN THIS DOCUMENT. RIGHTSHIP PROVIDE NO WARRANTY AS TO THE SAFETY OR QUALITY OF THAT VESSEL, ITS FITNESS FOR ANY PURPOSE, OR ANY OTHER FINDINGS ABOUT IT AND RIGHTSHIP DO NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR ANY INCOMPLETENESS OR INACCURACIES IN THE INFORMATION CONTAINED IN THIS DOCUMENT THAT MAY INCLUDE UNVERIFIABLE INFORMATION OF CUSTOMER AND/OR THIRD PARTIES.

THIS DOCUMENT CONTAINS CONFIDENTIAL AND/OR LEGALLY PRIVILEGED INFORMATION AND IS SUBJECT TO THE INTELLECTUAL PROPERTY RIGHTS AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS. UNAUTHORISED ACCESS, USE OR DISTRIBUTION OF THIS DOCUMENT OR ANY CONTENTS HEREOF CONSTITUTES BREACH OF OBLIGATION OF CONFIDENCE TO AND/OR INFRINGEMENT OF INTELLECTUAL PROPERTY AND OTHER PROPRIETARY RIGHTS OF RIGHTSHIP AND/OR ITS LICENSORS, WHICH MAY RESULT IN LEGAL ACTION TAKEN AGAINST YOU. FOR MORE INFORMATION ABOUT THE RIGHTS AND OBLIGATIONS OF RIGHTSHIP'S INSPECTION CUSTOMERS, PLEASE REFER TO TERMS AND CONDITIONS GOVERNING RIGHTSTORE, COPY OF WHICH MAY BE ACCESSED ON RIGHTSTORE OR SUCH OTHER PORTAL ON WHICH RIGHTSHIP MAY CHOOSE TO PUBLISH.

Number of Findings: 21

Section 3: Navigation

3.7 Has the vessel's manager produced a guideline for under keel clearance and air draft clearance? (M)

Findings: Sample inspection of UKC calculation for navigation from Huanghua anchorage to berth within confined water was conducted. The planned speed was set at 5 to 6.5 knots, while the actual transit speed recorded in the relevant ECDIS logbook ranged from 7 to 10 knots. No objective evidence was found to verify that the UKC calculation had been performed.

Attachments:




[Q307_15ea473e-e560-4f6e-8ff1-d0d2951358e9.jpg](#)


3.20 Are T&P NMs and navigation warnings being used correctly in voyage planning and monitoring?

Findings: Sampled Temporary Notices to Mariners 2414(T)/25, 2485(T)/25 and 5582(T)/25, situated approximately 2 nautical miles alongside the planned route, were not manually amended and displayed on ECDIS.

Attachments:

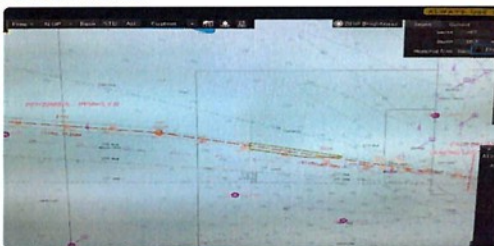

[Q320_9a57afc1-cb71-4642-b909-7e2c626ec5f5.jpg](#)

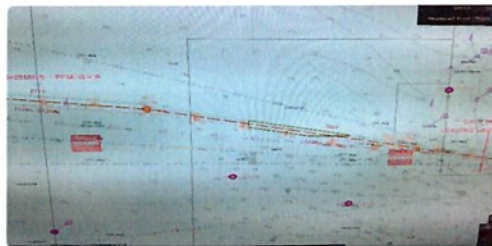

[Q320_a5781438-dfc3-4192-92e9-051d72bf26e9.jpg](#)



[Q320_ce07cb57-6861-4319-a917-36624616a332.jpg](#)


3.24 Was the ship's track monitored at sea and during pilotage, and were parallel indexing techniques used to monitor the passage in coastal and pilotage waters ,particularly during restricted visibility or nighttime conditions?

Findings: Parallel indexing technique was not utilised in the vicinity of sampled landmarks and course alteration points, including One Fathom Bank, deep water route within the Malacca Strait, the western sector of Singapore Strait TSS and Horsburgh Lighthouse.


Attachments:



[Q324_1eb6d6ce-8a34-422a-a1ac-a6cd9d9a2aed.jpg](#)

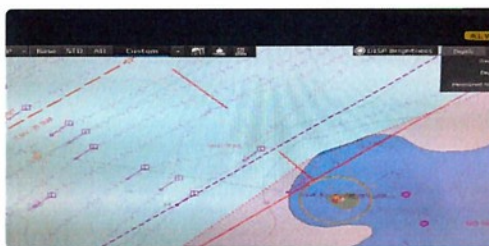

[Q324_4df2e0db-485a-4447-895c-00abe190c14e.jpg](#)

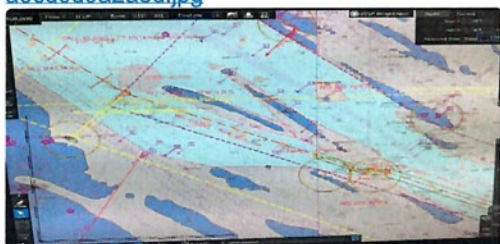


[Q324_ab4659ca-de60-4bbd-abdc-cc8a2c886e01.jpg](#)

Section 4: ISM System

4.13 Is a completed IMSBC/BLU Code ship/shore safety checklist for loading and unloading dry bulk carriers available and are the requirements of the checklist complied with?

Findings: Stevedore familiarisation section with emergency procedures and verify compliance with cargo hold entry procedures (at least once every watch) were not incorporated in the ship-shore safety checklist.

Attachments:

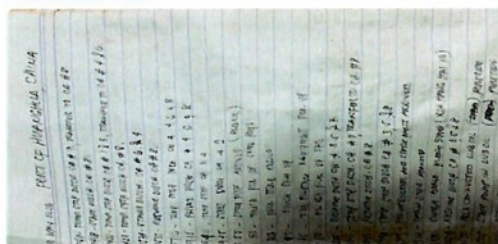

[Q413_0c84d71a-17a7-46a9-8a6a-c2113f68b367.jpg](#)



[Q413_2dd7a861-2780-4b82-ba8b-031162518990.jpg](#)

4.18 Are the lifeboats, rescue boat and davit-launched life raft their equipment and launching arrangements serviced periodically in good condition, and are the crew familiar with the launching procedure and operation?

Findings: 1. Approximately 200 millilitres of oily water was present underneath the engine of the port davit-launched lifeboat. 2. The starboard davit-launched lifeboat stowed with its weight not fully resting on the davit. 3. The engine of the starboard davit-launched lifeboat failed to start during initial testing, neither with a single dedicated battery nor two batteries together. It started successfully after the engineer manually turned the engine pulley.

Attachments:



[Q418_361c61fc-80e4-485e-b19a-6232019401cf.jpg](#)



[Q418_77c4c3d8-e0f3-4109-9a90-96f8268e30c5.jpg](#)



[Q418_b911e053-8eea-48ed-8515-a224bc65fd37.jpg](#)


4.36 Are accommodation ladders and gangways maintained in good condition, marked clearly, and inspected regularly

Findings: The rubber roller of starboard accommodation ladder was present with corrosion and rubber wear out.

Attachments:



[Q436_c30fb656-48b8-4532-963e-ef01c28c1371.jpg](#)

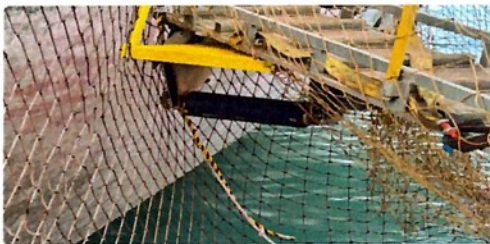


[Q436_f178d963-08f4-4856-a098-bcc2bdce5b8a.jpg](#)

Section 5: Pollution Prevention and Control

5.19 Has a Garbage Management Plan been provided and is the Garbage Record Book (GRB) being correctly maintained?

Findings: Approximately 150 litres of waste sediment with oil was stored in an open-topped drum (metal cover present) located at the engine room garbage station adjacent to the waste oil tank.

Attachments:

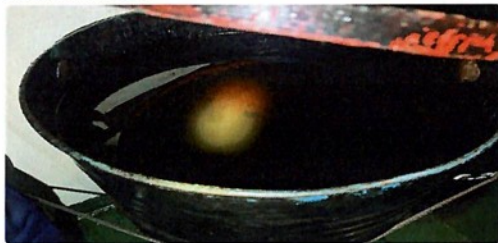

[Q519_ee72acb7-c4d7-46f0-90e8-03a55744d390.jpg](#)

Section 6: Ship's Structure

6.4 Are the access points to cargo holds, ballast tanks, and void spaces including vertical ladders, spiral ladders, rungs, stations, and platforms being maintained and in good order? (V)

Findings: Rungs 1 and 2 of the access ladder inside sampled No.1 starboard ballast tank (TST), rungs 2 and 4 of the access ladder inside sampled No.2 starboard ballast tank (TST), were corroded down to approximately 70% of their original dimensions.

Attachments:



[Q604_4dc0d425-b88f-48b3-b642-cff6ffaf85ae.jpg](#)



[Q604_5a2dc9d4-3e10-4baf-926c-699a7383ee4a.jpg](#)

Section 7A: Fuel Management (Oil)

7A.10 Are the Quick Closing Valves serving fuel and lubricating oil systems being regularly tested and in good order?

Findings: Fuel supply lines to generators (multi-engine common source) not fitted with quick closing valves operable from a safe position remote from the engines. The manual closing valve located beside generators.

Attachments:




[Q7a10_f97d3175-d0dc-48e7-8f30-c646b1b737e7.jpg](#)

7A.11 Are high pressure fuel delivery pipes of diesel engines protected with a jacketed piping and alarm system, and is the alarm system being tested regularly and in good order?

Findings: A makeshift drain pipe was fitted to the bottom of the oil leakage alarm arrangement for three generators, while a plug was specified at this position on relevant drawings. During functional test, leaked oil drained off immediately via the pipe, rendering the alarm ineffective.

Attachments:

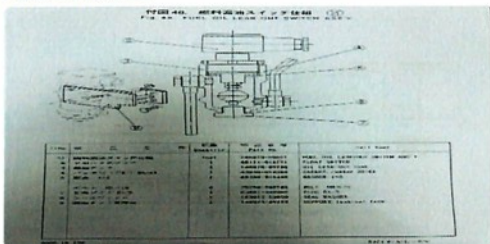

[Q7a11_1c695a8a-6ad4-4701-a14d-53c2945a06b0.jpg](#)



[Q7a11_61cfac0b-9cdf-41ec-a0d8-fb03226814a8.jpg](#)



[Q7a11_e520d26a-1b61-49c9-9972-929a0e347d8f.jpg](#)

7A.12 Are purifier rooms and fuel and lubricating oil handling areas ventilated, free of oil leaks and clean?

Findings: 1. The main power indicator light of the fuel oil purifier in the purifier room was out of service, and the multiple button was damaged. 2. Buttons including backwash manual and diff lamp rest of the second fuel oil filter were defective.

Attachments:



[Q7a12_e22597ea-7ab6-4537-bd4d-ea3e5d3dcd09.jpg](#)



[Q7a12_fd77c66a-ace7-4c2f-a948-5b8fe9cb3e1d.jpg](#)

Section 9A: Hatch Cover and Lifting Appliances**9A.1 Are the cargo holds, including the underside of hatch covers, free of loose rust scale and paint flakes? (V)**

Findings: Corrosion is present on the coating of No.6 cargo hold, covering 60% to 70% of the surface area.

Attachments:



[Q9a01_61348155-d040-4fe5-951d-26437817b95b.jpg](#)



[Q9a01_876e5b40-2bb5-4902-a9f1-741a3a357cfb.jpg](#)

9A.2 Is there a procedure in place for the safe operation and inspection of hatch covers and, has the Master/Chief Officer received appropriate training in hatch cover inspection and maintenance?

Findings: There was no records that measuring hatch cover component clearances been carried out every six months, the condition assessment of components sighted.


9A.6 Are quick-acting cleats and crutches all in place and in good working condition with the rubber washers flexible and free from paint and cracks? (V)

Findings: Two or three layers of rubber washers were stacked and fitted on all hatch cover quick acting cleats. Around 20% of these rubber washers were present with cracks.

Attachments:



[Q9a06_930c9997-f674-41b2-b846-00dd5be66dc5.jpg](#)

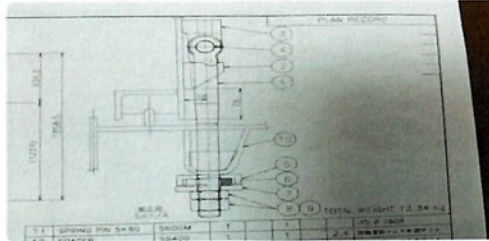

[Q9a06_a0454cc6-a632-4ff4-bb04-e0071c32975f.jpg](#)



[Q9a06_a3e79264-9dec-4b1c-bfcc-04f087977af8.jpg](#)

9A.13 Are the following parts of the hatch covers, where applicable, all in good order and do they appear to be well maintained?

- Wheels/bearings or trackway
- Hydraulic system including hoses
- Chains
- Link pin and safety pin
- Cargo holds' ventilator on the side and end of hatch panel

Findings: 1. Oil seepage was observed on one hydraulic jack at the forward part of No.2 cargo hold and another at the aft part of No.3 cargo hold, with oily water accumulated in the save-all. 2. The steel plates covering the trackways at the aft sections of No.2 and No.3 cargo holds were corroded and warped. 3. Evidence of oil leakage was found on hydraulic valve control units in the forecastle bosun store, midship store and main deck. 4. The hydraulic pipeline between No.2 and No.3 cargo holds was leaking, with a rag secured around the pipe.

Attachments:



[Q9a13_1f4d654b-88e8-470f-8418-1f588bb6b428.jpg](#)



[Q9a13_7496a2df-d628-45e0-a5e1-93d1a3b24bc1.jpg](#)




[Q9a13_a6dbd7ee-95fe-4c56-909f-3dbde995565c.jpg](#)

Section 13: Machinery Space

13.23 Are the spring-loaded drain valves and gauge glass self-closing valves/ cocks being maintained and in good order? (V)

Findings: 1. Improvised gagging devices were fitted to the spring-loaded drain valves of the fuel oil settling tank and service tank in the purifier room. 2. An improvised drain valve was installed on the pipeline downstream of the quick closing valve of the cylinder oil storage tank.

Attachments:

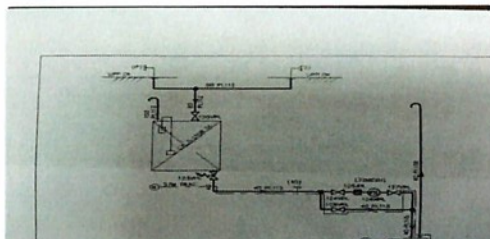

[Q1323_0be0741e-6a23-47c8-ab6a-9ad4d9dc05c8.jpg](#)



[Q1323_18e1bf52-8ef6-4e7e-a610-538cddd45366.jpg](#)



[Q1323_5d20bd58-c375-44da-96fd-149801fe74b9.jpg](#)

13.26 Is the workshop clean and tidy, and are the engine room workshop tools' protective guards, shields, and emergency stops in good condition? (V)

Findings: The lathe and drilling machine located in the workshop were not fitted with transparent, impact-resistant protective guards.

Attachments:



[Q1326_38667bd1-0497-44ea-8373-ea3228c638e4.jpg](#)



[Q1326_8830a09c-6f3c-4ede-b511-61181afd7f15.jpg](#)

13.29 Is the standard of housekeeping in the machinery space and steering gear room satisfactory, are these areas clean, free from obvious leaks, and is the engine room bilge clean and free of oil and sediment? (V)

Findings: The bilge fittings at the port side corner of the steering gear room were obstructed by pipes and spare parts which was not accessible.

Attachments:



[Q1329_50589b3e-4191-4aef-98c2-9aa01d4a0b3d.jpg](#)

Section 14: General Appearance - Hull and Superstructure


14.1 Is the ship's hull clean, free of significant corrosion, extensive coating breakdown and marine growth? (V)

Findings: Marine growth (barnacles) were attached to the aft hull shell, and dry green algae were observed over the vessel's underwater hull.

Attachments:



[Q1401_4f57f112-9f00-4a21-803d-798e78cd0ca8.jpg](#)

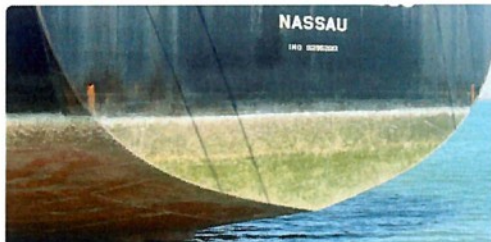

[Q1401_67337274-77ff-4527-b0a8-c95538dd705c.jpg](#)

14.16 Are the door seals, catches and alarm system of the refrigerated space in good order? (V)

Findings: Built up ice was present on the door frame around the door seal and on the pipes inside the refrigerated space.

Attachments:



[Q1416_b803d810-6215-4ca4-a240-b80b2f5b12de.jpg](#)

Section 15: Health and Welfare of Seafarers

15.2 Are the accommodation spaces safe, provided to a respectable level of health and hygiene and regularly inspected, including checks of ventilation, noise, heating, lighting, and sanitation? (V)

Findings: 1. Shower curtains were missing in two sampled crew cabins. 2. Extension cords connected to the projector and mobile charging sockets, with repair tape applied on the wiring, were plugged into bedside lamp sockets.

Attachments:



[Q1502_0db99030-390a-4210-b82d-52b2893ea553.jpg](#)



[Q1502_351ef761-e0be-41f0-bb0f-94926376b4d4.jpg](#)



[Q1502_565e93b4-11bf-4ab8-8020-421e9d90f8cc.jpg](#)

Vessel's Master Name

Capt. Glenn Bongat

Vessel's Master Email Address

star.princess@gtships.com

- ☒ By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.

Vessel's Master Signature:

A handwritten signature in black ink, appearing to read 'Glenn Bongat', written over a horizontal line.

Inspector Name

Andrew Huang

Inspector's Signature:

A handwritten signature in black ink, appearing to read 'Andrew Huang', written over a horizontal line.

CONTACT US

If you're interested and would like to know more, get in touch with our team today.

 www.rightship.com

 dryinspections@rightship.com

 RightShip

MELBOURNE

 Level 8/ 550 Bourke Street,
Melbourne VIC 3000,
Australia

 +61 3 8686 5750

LONDON

 4th Floor, 6 Dowgate Hill,
London EC4R 2SU, United
Kingdom

 +44 203 872 5900

SINGAPORE

 20 Cecil Street, PLUS,
#13-06
Singapore 049705

 +65 3138 3855

HOUSTON

 Suite 140 14141
Southwest Freeway,
Sugar Land TX 77478,
United States of America

 +1 832 770 8200

MALTA

 The Tower, 3rd Floor,
Fortunato Mizzi Street,
Ir-Rabat Għawdex
VCT 2517, Malta