

RightShip Ship Inspection Program

List of Findings

RightShip Ship Inspection Report - 56567

Bulk carrier - carrying solid bulk cargos other than grain

Vessel Name:	GOUVERNEUR
IMO Number:	9469649
DOC Company:	Danaos Shipping Co Ltd
Place of Inspection:	Singapore Anchorage
Name of Inspector:	Haseeb Ahmed
Inspection Completion Date:	12/Jul/2024
Operational Variant:	The vessel is gearless

This is a list of Findings made during my inspection of your vessel, completed today. As the scope and scale of the inspection has been limited by time and operational constraints, this does not necessarily constitute a comprehensive list of all Findings on board.

A copy of this list together with a detailed inspection report will be submitted to RightShip, who will liaise directly with your owners / managers in due course. The following Findings should not be considered as a final or comprehensive list and RightShip reserves the right to add to or amend these Findings. If RightShip adds to or amends the list of Findings, they will advise the owner/ship's manager.

When RightShip reviews the inspection report, the vessel's manager and Master will be given the opportunity to provide comments and response to each Finding on the list.

This list of Findings does not constitute any warranty of the fitness or suitability of the vessel. Thank you for the cooperation and hospitality accorded to me by yourself and your crew.

Number of Findings: 26

Inspected Item	Response	Finding description
2.1 Is the latest Class Survey Status available and are all statutory certificates listed in the Class Survey Status valid, and is the vessel free of condition of class or significant recommendations and are all classification and statutory surveys not overdue? (M)	No	There was a Statutory condition of class related to newly installed EGC, due date 03 Nov 2024.
2.7 Have officers and ratings responsible for cargo handling on ships carrying dangerous and hazardous substances in solid form in bulk, undergone formal training? (V)	No	There was no evidence that deck officers and ratings completed a formal training for carrying dangerous and hazardous substances in solid form in bulk.
4.2 Has a safety officer been appointed and trained, and is the safety officer familiar with the principles and practice of risk assessment? (V)	No	Third officer was the designated safety officer, however he was not trained to undertake this role.
4.5 Is the vessel provided with an enclosed space entry procedure, and is there documented evidence that it was followed, and is there evidence that the crew assigned to responsibilities requiring entry into enclosed spaces has attended a dedicated enclosed space entry course? (V)	No	None of the officers and ratings had attended a dedicated training course for entry into an enclosed spaces.
4.8 Has a specific permit to work and effective Lock-Out/Tag-Out (LOTO) system been introduced for high-risk duties and are the permits being used effectively? (V)	No	There was no specific permit to work for lock-out/Tag-out system and no locks and tags carried.
4.11 Has a PPE Matrix for use of personal protective equipment been provided and is it being worn as required? (V)	No	There were no self retractable fall arrestors on board for over side work.
4.17 Is welding and gas burning equipment in good order and properly stored? (V & M)	No	1) There was no evidence that an annual check of the oxygen and acetylene installation on board had been undertaken by a competent engineer from the manufacturer of the equipment. 2) To secure the hose to the hose tails for the oxygen acetylene hoses inside the engine room workshop, re-usable worm screw drive clamps were fitted, instead of crimp.

4.19 Are life rafts in good order and are hydrostatic release units maintained and installed correctly? (V & M)	No	Life raft launching instructions were not posted/missing on boat deck(P & S) and on main deck forward.
4.22 Are IMO symbols to identify the location of life saving equipment, firefighting equipment and hazardous areas displayed appropriately and in good condition? (V)	No	IMO symbols were partly torn or missing at many locations on weather deck and around superstructure.
4.33 Are ventilation fire dampers clearly marked with open/close positions and space served and is there evidence of regular testing and maintenance? (V)	No	No.1 engine room blower fire damper located at funnel deck(P) was not shutting from remote operation.
5.4 Are scupper plugs fitted, in satisfactory condition, and are scupper filters readily available for draining rainwater on deck when the vessel is involved in solid bulk cargo operations? (V)	No	Scupper plugs were not fitted with filter on main deck.
5.6 Are the cargo hold bilge pumping systems and bilge arrangements appropriately set, in good order and tested? (V)	No	The overhaul of cargo hold bilges non-return valve was not included in the PMS.
5.23 If the vessel has an Exhaust Gas Cleaning System (scrubber system), is it in good working order, are the engineers familiar with its safe operation, and have procedures been incorporated into the Safety Management System? (V)	No	Exhaust Gas Cleaning System was not included in the planned maintenance system.
7A.4 Are save-alls fitted around all fuel, diesel, and lubricating oil tank vents; are they clean and empty, and is the drain plug secured with a strap chain to a save-all? (V)	No	For all the fuel oil, diesel oil and lubricating oil air vents save all drain plugs around gangway(P & S) were either missing or loosely fitted without strap chain to save-all.
7A.5 Are there procedures for the analysis of fuel, lubricating and hydraulic oils, and are oil sampling requirements aligned with equipment manufacturer's recommendations? (V & M)	No	The fuel oil bunkers received on 26 June 2024; however there was no evidence that laboratory analysis was carried out.
7A.7 Are bunkering and oil fuel transfer procedures carefully planned and executed in accordance with industry standards, are the details of the last operation in accordance with industry standards, is the vessel equipped with a procedure for sampling the oil fuel used on board, and are bunker samples stored in a sheltered location? (V)	No	Following were not included in fuel oil transfer procedures. 1) Emergency procedures and contacts 2) Procedure for line draining and blowing off after completion of bunkering. 3) Procedure for bunker sampling management ,including the disposal of the sample to a shore reception facility when no longer required.
9A.1 Are the cargo holds, including the underside of hatch covers, free of loose rust scale and paint flakes? (V)	No	No.5 cargo hold was inspected internally and noted loose rust scale on lower stool(F & A).
9A.2 Is a procedure in place for the safe operation of hatch covers, and is the Master/Chief Officer appropriately trained in hatch cover inspection and maintenance? (V)	No	There was no objective evidence that Master and Chief officer had completed formal training for hatch cover inspection and maintenance.
10.12 Have heaving lines been constructed with a monkey's fist at one end and are they free of any added weighting material? (V)	No	Heaving lines were fitted with a heavy rubber cone, instead of monkey fist.
11.9 Is there a Shore-Based Maintenance Agreement in place to fulfil the maintenance requirements? (M)	No	The Shore-Based Maintenance Agreement was not yet provided by operators.
12.7 Are cyber security policies and procedures integrated into the safety management system, and has the cyber security management system been evaluated and certified? (V)	No	Cyber Security Managment System was not evaluated and Certified.
13.22 Are the main, emergency switchboards and local starter panels surrounded by non- conducting matting and are the mats in good order? (V)	No	There was no objective evidence that the non-conductive mats were suitably rated in accordance with their representative switchboard in engine control room and emergency generator room.
14.19 Are the ship's guard rails, walkways, and access ladders, as well as the steps and railings, maintained and in good working order?	No	The chain strung between guard rail stanchions in way of Pilot ladder access(P & S) were sagging below one meter.
15.3 Are the ship's staff provided with adequate recreation facilities on board the ship? (V)	No	No Internet and email communication facilities was provided for crew on board.
15.4 Has the master been provided with a monthly welfare budget? (V)	No	The Master was not provided with a monthly welfare budget.
15.12 Has company provided training for on-board key personnel in recognising signs of mental health problems? (V)	No	There was no objective evidence that all the senior key personnel had completed their training in recognising signs of mental health problems.

Vessel's Master Name


Capt. Igor Kashperuk

Vessel's Master Email Address

vsl_161@danaos.gr

☒ ***By signing the list of Findings, I confirm a closing meeting has taken place and the inspector has informed me that, where not already transmitted, the list of Findings will be sent via internet email once connectivity is restored.***

Vessel's Master Signature:

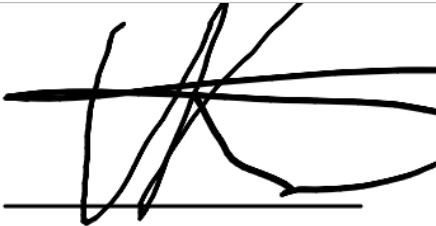


A handwritten signature in black ink, consisting of several overlapping loops and a long horizontal stroke at the bottom, written over a horizontal line.

Inspector Name

Haseeb Ahmed

Inspector's Signature:

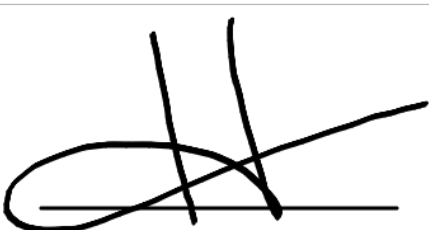

A handwritten signature in black ink, featuring a large loop on the left and a long horizontal stroke at the bottom, written over a horizontal line.