

“identification only”

Livorno Elementary/Middle School

Facility Condition Assessment Report



CAMPUS SUMMARY

Year Built ¹	1954-2002
GSF ²	43,482
Date of Assessment	07-Jan-2020

¹ Indicates range of dates of construction present on campus

² Only permanent and semi permanent facilities are included

SCHOOL SUMMARY

School	Assessed Condition		Annual Condition Report (June 2019)		2009 Congressional	Starting Grade	Ending Grade	Students
	Q-Rating	FCI	Q-Rating	FCI	Q-Rating			
Livorno Elementary/Middle School	Q 2	82	Q 3	77	Q 3	Kindergarten	Eighth	54

BUILDING SUMMARY

Building/School	Year Built	GSF	Type
Livorno ES/MS Building 200	2002	96	PERM
Livorno ES/MS Building 201	1954	43,386 ³	PERM

³ DoDEA utilizes approximately 97% of the total facility. The GSF value reported reflects 100% of Building 201

I. INTRODUCTION

Livorno Elementary/Middle School is part of Camp Darby, U.S. Army Garrison Italy. This report provides a summary of findings for the physical condition assessment of buildings at this campus. Building 201 is a partial-use facility. DoDEA utilizes approximately 97% of Building 201. The space utilized in Building 201 supports the Livorno Elementary/Middle School. The physical condition assessment includes a general description of typical building systems found and includes conditions present at the time of the site visit.

"identification only"

II. SCHOOL PHYSICAL DESCRIPTION

The summary below provides a physical description of the school. When multiple systems or materials are present, the predominant system or material observed during the facility condition assessment is shown.

- a. **STRUCTURAL/EXTERIOR ENCLOSURE:** The building exterior is an exterior insulation and finish system (E.I.F.S). Roof coverings are built-up. Exterior doors are pre-finished aluminum with glazing. Window systems are pre-finished aluminum with double-glazing.
- b. **INTERIORS:** Floor finishes used include ceramic tile and wood. Walls are painted hard surfaces. Ceilings are acoustical lay-in tiles.
- c. **MECHANICAL:** Campus facilities have heating, which is provided by boilers. All campus facilities have air conditioning, which is provided by chilled water. The campus has no elevators.
- d. **ELECTRICAL:** Major electrical upgrades have been completed to support the additions to Building 201, but not wiring appears to be original. Lighting is typically lay-in fixtures with fluorescent lamps. Ground-fault circuit interrupter (GFCI) receptacles appear to be present, but are not properly labeled. The campus has an intercom system. There is a security system, and security cameras are present.
- e. **PLUMBING:** Plumbing fixtures and piping have been partially upgraded. Domestic hot water is provided by indirect water heaters.
- f. **SITE:** The school has parking for approximately 32 privately owned vehicles. In addition, the school has two playgrounds.
- g. **LIFE SAFETY:** Fire safety inspection reports were not available for review.

"identification only"

III. OBSERVATIONS

The following observations were made: Exterior door security was observed and reported to be a problem. The exterior doors were weathered with some corrosion observed and sample tested hardware was difficult to operate and secure in some cases. The skylights in Building 201, above the entry hall/corridor, were deteriorated and appeared broken beyond repair. Further, in Building 201, the joint sealants at the exterior wall expansion joints have lost flexibility with cracks observed; this may potentially allow water infiltration of the facility. Exterior windows in Building 201 were also weathering and wall-to-window sealants were failing with wall spalling noted in some locations, however, windows were observed and reported to operate correctly. All interior finishes are aging as expected and the walls appear to have been painted within the last two years.

It appears that outside air is being introduced into the HVAC system. The make-up air units and exhaust fans appear to be in poor condition and are showing signs of rust and possibly biological growth. Additionally, the chiller at Building 201 had no data plate and appeared to be weathered, discolored, and deteriorated. The roof covering at Building 201 had potentially damaging organic growth observed encroaching and this growth was also observed around the mechanical units at the Kitchen. The plumbing fixtures, enclosed circuit breakers, and electrical distribution panels appeared to be in good condition and were showing minimal signs of deterioration.

The Facility Utilization Survey (FUS) drawings were updated to reflect the assessment findings, including room-use and room number changes observed throughout the campus. No buildings were added or removed from the site since the time of the previous assessment. Building 201 is a partial-use facility and is shared between Livorno Elementary/Middle School and the Child and Youth Services (CYS). Livorno Elementary/Middle School utilizes approximately 97% of Building 201 (41,915 SF), and CYS utilizes approximately 3% of Building 201, specifically Room C06 (1,471 SF) for a GSF total of 43,386 SF. As DoDEA is the predominant user (>90% occupant), 100% of the square footage for Building 201 is being reported. A portion of Playground 1 was demolished, and the construction of a new playground was observed during the assessment. Further, there were areas around Building 201 where the pavers are beginning to sink, causing a potential tripping hazard.


Building 200 remained a Q-1.

Building 201 improved from a Q-3 to a Q-2. Since the time of the previous assessment, ALPHA updated the algorithm to estimate quantities of the plumbing concealed systems; Domestic Water Distribution System, and Sanitary Waste System, which resulted in a reduction of the costs for these work items.

"identification only"

IV. QUALITY / CONDITION RATINGS

Table 1 shows building-specific information to include Real Property Unique Identifier (RPUID), type of construction, year built, gross area, Facility Condition Index (FCI), and Q-Rating. Table 2 shows buildings that are classified as temporary (TEMP) or relocatable (RELO) and therefore, by definition, are not included in Quality/Condition calculations.

TABLE 1: QUALITY / CONDITION RATINGS								
Photo	Building	RPUID	Type	Year Built	GSF	Assessed		Plant Replacement Value ⁴
						FCI	Q-Rating	
	200	250870	PERM	2002	96	100	Q 1	
	201	250871	PERM	1954	43,386 ³	82	Q 2	

³ DoDEA utilizes approximately 97% of the total facility. The GSF value reported reflects 100% of Building 201.

⁴ The Plant Replacement Value is calculated according to the DoD Facility Pricing Guide.


TABLE 2: TEMPORARY / RELOCATABLE BUILDINGS					
Photo	Building	Type	Year Built	GSF	Current Use
	X201A	RELO	2008	152	Storage Shed
	X201B	RELO	2008	152	Storage Shed

Appendix A

"identification only"

Site Plan

"identification only"

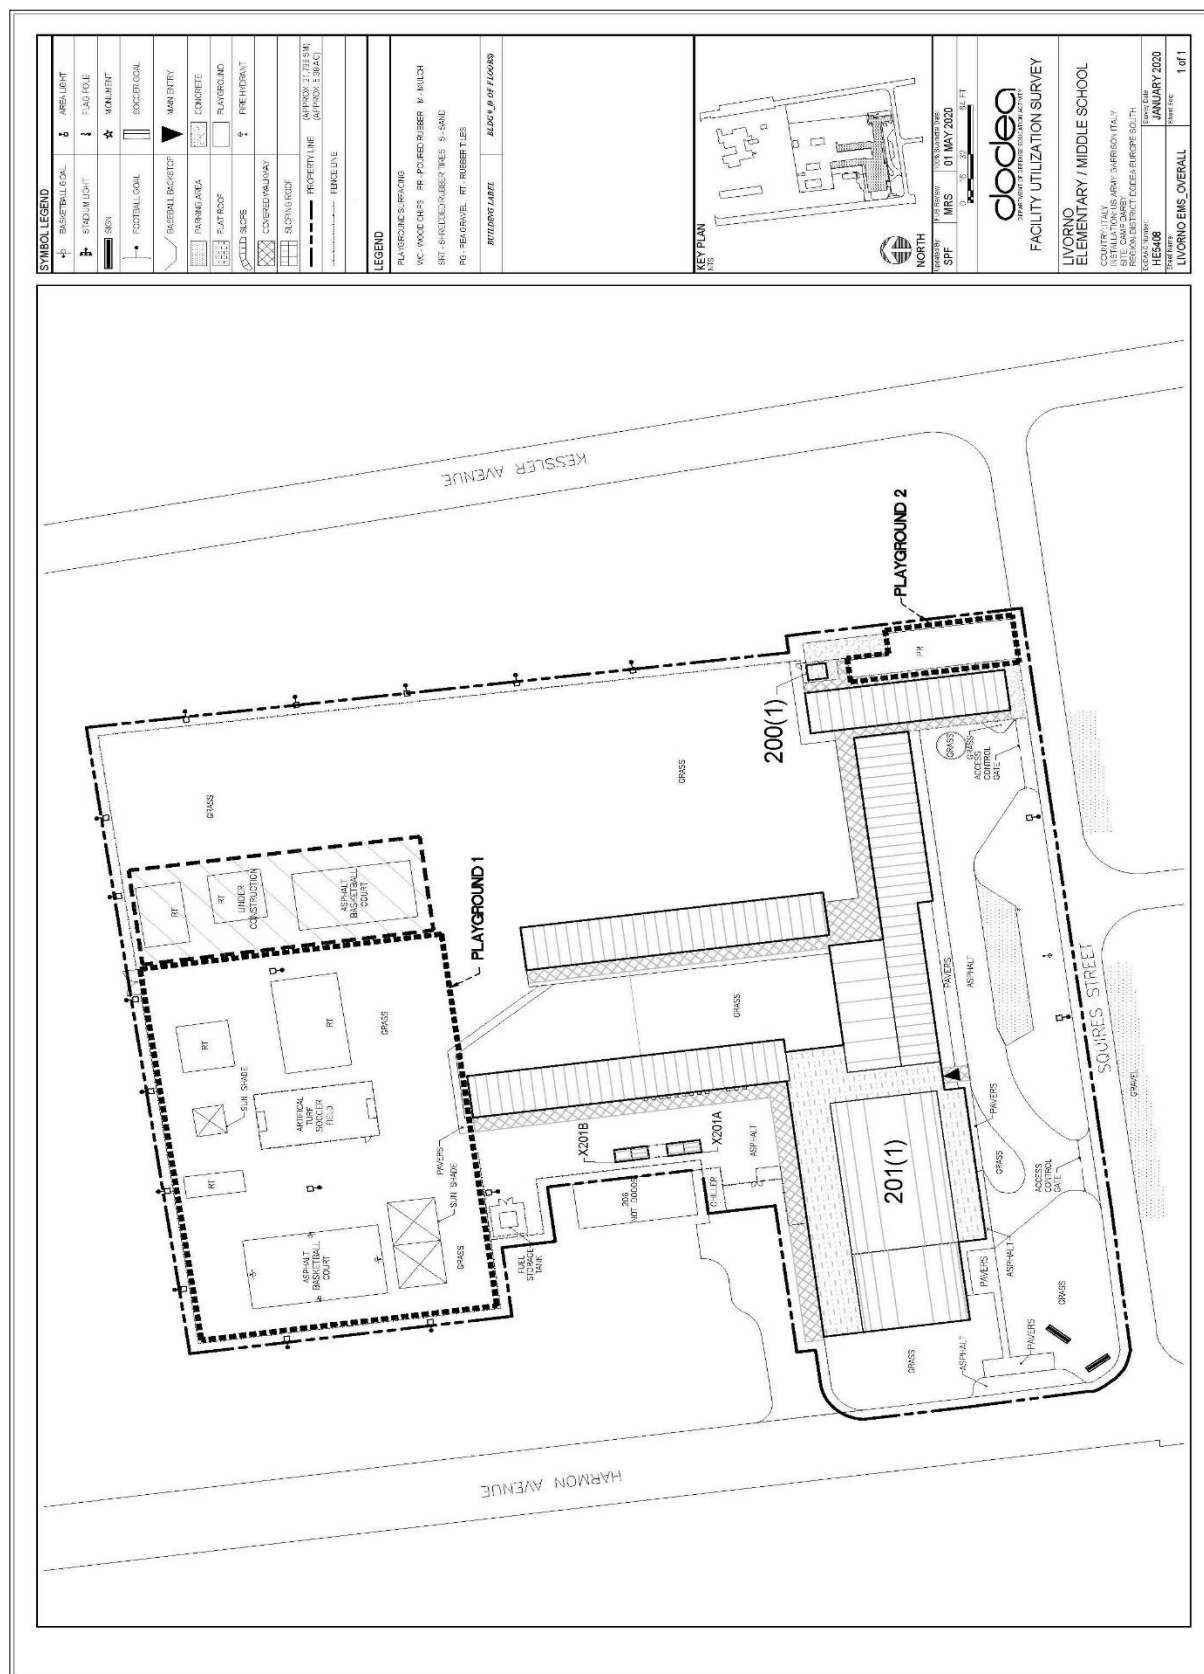

Appendix B

"identification only"

**Overview of Sustainment Management System (SMS) and
BUILDER™ Engineered Management System (EMS)**

"identification only"

Overview of Sustainment Management System (SMS) and BUILDER™ Engineered Management System (EMS)

Sustainment Management System (SMS)

The Sustainment Management System (SMS) is a suite of web-based software applications developed by the United States Army Corps of Engineers - Engineer Research Development Center - Construction Engineering Research Laboratory (USACE-ERDC-CERL) to help facility engineers, technicians, and managers decide when, where, and how to best maintain the built environment. The SMS modules include BUILDER™ and ROOFER™ for assessing building conditions, PAVER™ for pavements, and RAILER™ for railroad infrastructure.

Because real property assets are so vast and diverse, a "knowledge-based" philosophy drives the SMS process. The process starts with the automated download of real property data, and then more detailed system inventory is modeled and/or collected which identifies components and their key life cycle attributes such as the age and material.

From this inventory, Condition Index (CI) measures for each component are predicted based on its expected stage in the life cycle. Objective and repeatable inspections can then be performed on various components to verify their condition with respect to the expected life cycle deterioration. The level of detail and frequency of these inspections are not fixed like other processes; they are dependent on knowledge of component criticality, the expected and measured condition and rate of deterioration, and remaining maintenance and service life. This "knowledge-based" inspection focuses attention to the most critical components at the time. In addition to these condition assessments, functionality assessments can be performed to evaluate user requirement changes, compliance and obsolescence issues. This provides a comprehensive picture of the overall performance of real property assets and their key components.

BUILDER Engineered Management System (EMS)

In September 2013, the Under Secretary of Defense, Frank Kendall, issued a memo indicating the Department of Defense requires a standardized process for facility condition assessments to ensure consistent and reliable data necessary for sound strategic investment decisions in managing the Department's built environment.

Establishing a DoD-wide facility condition assessment process will contribute to a more credible DoD asset management program and will support better buying power by allowing Department leadership to better target fiscal resources to those facilities most in need of investment. Further, adopting a standard process will help ensure that condition data will be audit-ready in accordance with the Under Secretary of Defense (Comptroller)'s "Financial Improvement and Readiness Guidance" issued in March 2013.

The facility condition assessment process used to generate this report is based on BUILDER Engineered Management System (EMS) Version 3. BUILDER EMS was developed by the Engineer Research and Development Center.

The facility condition assessment process addresses the requirements necessary for routine building facility management activities, including long range budgeting and sustainment/restoration/modernization (SRM) planning. This assessment approach provides an objective and generalized framework to help to identify problem areas that will require more investigation through detailed or specialized assessments. There may be times when detailed engineering assessments may be required to diagnose specific problems.

BUILDER is a software application for building asset life cycle management. The primary focus of BUILDER is work plan development. BUILDER stores real property building information and more detailed system inventory is modeled and/or collected which identifies building components and their key life cycle attributes such as the age, material and capacity. Inspections are then performed on the various components to

"identification only"

determine an objective and repeatable Condition Index (CI) measure, which relates the general physical health of the asset.

With information about condition and remaining service life, BUILDER guides the development of short- and long-range work plans based on sound investment strategies, prioritization criteria, and budget constraints. BUILDER consolidates a variety of building-related management issues into a single decision-support package.

The system gives functional managers and decision-makers instant access to building inventory, current building condition indices, and probabilities condition prediction models. It also employs a patented knowledge-based inspection scheduling process. BUILDER improves the allocation process and return of building life cycle investments by directing resources to the most condition critical components to avoid costly repair penalty costs, as well as, the most mission critical components to manage risks of failure.

BUILDER Facility Condition Assessment Process

Facility Condition Assessment (FCA) is one of the primary processes of a facility life cycle asset management program. The FCA process results in a better understanding of the physical condition and readiness of an organization's buildings along with the reliability of its systems and components. It also facilitates the identification of work candidates for facility SRM repair projects. It is a critical aspect of the shift towards a proactive versus reactive facility management strategy. Instead of keeping facilities operational by relying primarily on corrective repairs (after a system or component has failed due to significant loss of function), it focuses on condition-based repairs which can be planned prior to failure. A condition-based approach can result in higher performing facilities at lower life cycle costs.

Prior to an assessment, knowledge of the building systems and components present is necessary, since assessments are done against these components, not against the building as a whole. This information about the systems and components that make up a building is called the BUILDER Inventory. BUILDER has a vast library of predefined components which an assessor will select from, and the inventory collection process involves identifying the type, quantity, and year installed for all pertinent components. These components are also organized into systems and sub-systems according to the UNIFORMAT classification hierarchy. When a specific instance of a component is recorded, this is called a component-section in BUILDER, and represents a single component assembly or collection of like components to be managed as a single unit. The BUILDER facility condition assessment process directly supports the computation of a condition index for building component-sections, known as the Component-Section Condition Index (CSCI), which is the fundamental metric used in BUILDER. The CSCI is aggregated to compute a condition index metric at the system (SCI), building (BCI), and site/organizational levels.

A condition-based facility repair strategy requires condition information be collected at a component level, and that this condition information relate to loss of component function. Every component of a building has a primary function that it performs. This function is the reason that the component was constructed or installed in the building. It may also serve a number of secondary or tertiary functions. For example, for a door component, the primary function is to provide safe entry/egress of authorized movements while limiting unwanted movements of people (security), or other objects (water or moisture). The secondary functions would relate to aesthetics and thermal and air control, among others.

The condition assessment process in BUILDER uses the Direct Rating method.

1. The **Direct Rating** method uses a single qualitative rating for each component based on condition observations. This also results in a condition index metric, which relates to the level of deterioration and the loss of function. This abbreviated Direct Rating approach is often better suited to initial baseline assessments where the components are inventoried, and data is initially loaded into BUILDER.

"identification only"

The following figure illustrates the Direct Rating criteria used in this assessment.

RATING	SRM NEEDS	RATING DEFINITION
Green (+)	Sustainment consisting of possible preventive maintenance (where applicable)	Entire component-section or component-section sample is free of observable or known distress.
Green	Sustainment consisting of possible preventive maintenance (where applicable) and minor repairs (corrective maintenance) to possibly few or some subcomponents.	No component-section or sample serviceability* or reliability* reduction. Some, but not all minor (non-critical) subcomponents may suffer from slight degradation or few major (critical) subcomponents may suffer from slight degradation.
Green (-)		Slight or no serviceability or reliability or reliability reduction overall to the component-section or sample. Some, but not all minor (non-critical) subcomponents may suffer from slight degradation or more than one major (critical) subcomponents may suffer from slight degradation.
Amber (+)	Sustainment or restoration to any of the following: Minor repairs to several sub-components; or Significant repair, rehabilitation or replacement of one or more subcomponents, but not enough to encompass the component-section as a whole; or Combinations thereof.	Component-section or sample serviceability or reliability is degraded, but adequate. A very few major (critical) subcomponents may suffer from moderate deterioration with perhaps a few minor (non-critical) subcomponents suffering from severe deterioration.
Amber		Component-section or sample serviceability or reliability is definitely impaired. Some, but not a majority of major (critical) subcomponents may suffer from moderate deterioration with perhaps many minor (non-critical) subcomponents suffering from severe deterioration.
Amber (-)		Component-section or sample has significant serviceability or reliability loss. Most subcomponents may suffer from moderate degradation or a few major (critical) subcomponents may suffer from severe degradation.
Red (+)	Sustainment or restoration required consisting of major repair, rehabilitation or replacement to the component-section as a whole.	Significant serviceability or reliability reduction in component-section or sample. A majority of subcomponents are severely degraded, and others may have varying degrees of degradation.
Red		Severe serviceability or reliability reduction to the component-section or sample such that it is barely able to perform. Most subcomponents are severely degraded.
Red (-)		Overall component-section degradation is total. Few, if any subcomponents are salvageable. Complete loss of component-section or sample serviceability.

"identification only"

Once the component-sections have been rated with a Direct Rating, BUILDER calculates the Component-Section Condition Index (CSCI) of the component-section. The next step in the process is to create a work plan, which will list the component-sections that need repair or replacement and the estimated cost of the repair or replacement.

To create a work plan, condition standards, policies and a policy sequence are created. The standards serve as thresholds for CSCI and remaining service life. Policies link standards to component-sections and policy sequences link standards and policies together.

The table below summarizes the DoDEA standards and how they are applied to the component-sections for this assessment.

Standard and Component-section Cross-Reference		
Standard	CI Threshold	Component-section
Amber +	80	D4010 FIRE ALARM AND DETECTION SYSTEMS
Amber	71	B3010 ROOF COVERINGS D1010 ELEVATORS AND LIFTS D2010 PLUMBING FIXTURES D3020 HEAT GENERATING SYSTEMS D3030 COOLING GENERATING SYSTEMS D3040 DISTRIBUTION SYSTEMS (A) D3050 TERMINAL & PACKAGE UNITS D3060 CONTROLS & INSTRUMENTATION D3090 OTHER HVAC SYSTEMS AND EQUIPMENT D4020 FIRE SUPP WATER SUPPLY / EQUIP D4030 STANDPIPE SYSTEMS D4040 SPRINKLERS D4050 FIRE PROTECTION SPECIALTIES D4090 OTHER FIRE PROTECTION SYSTEMS D5010 ELECTRICAL SERVICE & DISTRIBUTION D5020 LIGHTING & BRANCH WIRING D5030 COMMUNICATIONS & SECURITY D5090 OTHER ELECTRICAL SERVICES
Amber -	61	B2030 EXTERIOR DOORS C1020 INTERIOR DOORS C3010 WALL FINISHES C3020 FLOOR FINISHES C3030 CEILING FINISHES C3040 INT COATINGS / SPECIAL FINISHES D3010 ENERGY SUPPLY
Red +	50	B2010 EXTERIOR WALLS B2020 EXTERIOR WINDOWS C1030 SPECIALTIES D1020 WEIGHT HANDLING EQUIPMENT D1030 ESCALATORS AND MOVING WALKS D1090 OTHER CONVEYING SYSTEMS D2020 DOMESTIC WATER DISTRIBUTION D2030 SANITARY WASTE D2040 RAIN WATER DRAINAGE D2090 OTHER PLUMBING SYSTEMS D3070 SYSTEMS TESTING & BALANCING
Service Life	40	Paint

"identification only"

For this project, the following building components are not included in the BUILDER Inventory and are not evaluated during the assessment unless significant damage or deterioration was observed or reported.

- A1010 STANDARD FOUNDATIONS
- A1020 SPECIAL FOUNDATIONS
- A1030 SLAB ON GRADE
- A2010 BASEMENT EXCAVATION
- A2020 BASEMENT WALLS
- B1010 FLOOR CONSTRUCTION
- B1020 ROOF CONSTRUCTION
- B2010 EXTERIOR WALLS
- C1010 PARTITIONS
- C2010 STAIR CONSTRUCTION

Damage that is not visible or that is unknown will not be reflected in facility condition index calculations. It is anticipated that unknown damage or deterioration is more likely to be present in older facilities than more modern facilities.

In addition, some building components are concealed or inaccessible. In accordance with BUILDER guidelines, quantities for concealed and inaccessible components have been estimated and recorded in the BUILDER Inventory but have not been rated. When concealed or inaccessible components are encountered, life cycle data contained within BUILDER is used to predict renewal requirements, which are included in facility condition index calculations. Components that are often concealed or inaccessible include:

- D2020 DOMESTIC WATER PIPING
- D2030 SANITARY WASTE PIPING
- D3040 HVAC DISTRIBUTION
- D4010 FIRE ALARM DISTRIBUTION
- D5020 ELECTRICAL BRANCH WIRING

In addition to the building components noted above, if a building component is concealed or inaccessible, life cycle data contained within BUILDER is used to predict renewal requirements.

When a work plan is created, the CSCI of a component-section is compared to its associated standard. If the CSCI is less than or equal to the threshold in the standard, the remaining service life is evaluated. If the service life is less than the standard's remaining service life, BUILDER will add this section to the work plan and generate dollars to estimate a cost for the replacement.

If the CSCI is less than or equal to the threshold in the standard and the service life is greater than the standard's remaining service life, BUILDER will conduct a cost benefit analysis. The cost benefit analysis will determine whether the component-section should be repaired or left to expire at the end of its service life. When BUILDER determines a repair is the correct action, BUILDER will add this section to the work plan and generate dollars to estimate a cost for the repair.

When BUILDER determines taking no action is more cost effective, BUILDER will not add the component-section to the work plan. For example, if the CSCI for an external door component-section is 50 with a remaining service life of five years, BUILDER will compare the CSCI of 50 to the CI Threshold set by DoDEA and determine that 50 is less than the threshold of 61. BUILDER will compare the five years of remaining services life against the zero years of the threshold and determine a cost benefit analysis is required. The results of the cost benefit analysis will typically suggest to take no action and let the component-section run until the end of its service life before generating an item in the work plan.

A typical life cycle of a component-section is explained below.

Condition	Work Plan
CSCI > threshold	Work plan does not generate an item for the component-section
CSCI = threshold or just below it	Work plan will generate a repair item for the component-section

"identification only"

CSCI < threshold and the remaining service life > service life threshold	Work plan will remove the repair item for the component-section. It is too costly to repair so it is better to wait to replace it.
Remaining service life < service life threshold	Work plan will generate a replace item for the component-section

Facility Condition Assessment Data Analysis

In multiple building portfolios and especially with widespread geographic portfolios, it is important to know how building conditions compare. The Condition Index (CI) and Quality Ratings (Q-Ratings) are determined for each building assessed using guidelines shown below.

Condition Index (CI) – A measure of the constructed asset's condition at a specific point in time with respect to physical condition and ability to support the current occupant or mission. CI is calculated as the ratio of estimated cost of maintenance and repair requirements to Plant Replacement Value (PRV). Maintenance and repair requirements consist of that work necessary to ensure that a constructed asset is restored to a condition substantially equivalent to the originally intended and designed capacity, efficiency or capability. The formula for Condition Index is:

$$CI = 1 - \left(\frac{\text{Requirements}}{\text{PRV}} \right) \times 100$$

Q-Rating Bands – Bands allow OSD, Military Services, and Defense Agencies/Activities to group facilities by condition for the purposes of developing investment strategies.

TABLE 1: Q-RATING DESCRIPTIONS		
Rating Band	Calculated Rating (Condition Index)	General Description
Q-1	100 to 90	Facility new or well-maintained (Good Condition)
Q-2	89 to 80	Facility is satisfactorily maintained (Fair Condition)
Q-3	79 to 60	Facility is under maintained (Poor Condition)
Q-4	59 to 0	Facility should be considered for replacement (Failing Condition)

Requirements – Sum of the work items from BUILDER.

Plant Replacement Value – Cost to design and construct a notional facility to current standards to replace an existing facility on the same site, (reference United Facilities Criteria UFC 3-701-01 23 May 2018, Change 3, 29 July 2019).

"identification only"

BUILDER Report Overview

Outlined below is a summary and description of the reports that are included.

Appendix C - Facility Summary Report – Provides a summation of FCA results. A Building Summary Report is included for each building that is considered permanent or semi-permanent construction and receives a Q-Rating. The purpose of this report is to provide a general overview of the building including key performance indicators. This report was generated using DoDEA's calculated Replacement Cost overwriting the data populated from real property records. This provides a more accurate Replacement Cost due to the inconsistencies with real property reconciliation between DoDEA and the Services. The DoD Facility Pricing Guide and DoDEA measurements for building square footage were used to calculate the Replacement Cost.

Appendix D - System Summary Report – Provides an overview of inspected systems and their condition index rating. A Building System Condition Index (SCI) By System Report is included for each building that is considered permanent or semi-permanent construction and receives a Q-Rating.

Appendix E - Work Items By Building – Provides a list of work items requiring repair or replacement of system/components, including budgets, for project planning purposes. A Work Plan Detail by Year Report is included for each building that is considered permanent or semi-permanent construction and receives a Q-Rating.

Appendix F - Remaining Service Life (RSL) Detail Report – Provides a detailed overview of systems/components, including descriptions, and their respective age, remaining service life and remaining paint life.

Appendix G - Direct Condition Rating Inspection By Section Report – Provides a summary of direct condition ratings for each component-section collected within each facility.

Appendix H - System Inventory Report – Provides a list of details for each component-section collected within each facility.

Appendix I - Fire Inspection Safety Report – This appendix is only applicable when a Fire Inspection Safety Report is provided at the time of the assessment for inclusion in the Facility Condition Assessment Report. The report provides a summary of the recent Fire Inspection to include any deficiencies.

Note: All reports are generated from the DoDEA BUILDER database. In the event line items within a report are compressed and difficult to read, this is a result of how BUILDER generates the report. It is our understanding that CERL is working to update the report format.

Summary of Terms

Acronyms	Description
BCI	Building Condition Index - Measures the condition of the building as a whole. The higher the BCI, the better.
BFI	Building Functionality Index - Measures the functionality of a building as a whole. The higher the BFI, the better.
BPI	Building Performance Index - Measures the overall performance of a building. The higher the BPI, the better.
EA	Each
ESC	Emergency Service Call
FCI	Facility Condition Index - The current maintenance, repair, and replacement deficiencies of the facility divided by the current replacement value of the facility, derives the FCI of a facility. The higher the FCI, the better.
GSF	Gross Square Foot
ISR	Installation Status Report - Measures installation condition against Army-wide standards.
LF	Linear Feet
MBH	Thousands of BTU per hour.
MDI	Mission Dependency Index - Measures how critical a facility is to the overall mission of its owner. The higher the MDI, the more critical.
PERM	Permanent
RELO	Relocatable
RPL	Remaining Paint Life - Displays the remaining paint life, in years, of a section.
RPUID	Real Property Unique Identifier - The unique identification number assigned to each asset.
RSL	Remaining Service Life - Displays the remaining service life, in years, of a section.
SCI	System Condition Index - Measures the condition of a system as a whole. The higher the SCI, the better.
SF	Square Foot
TEMP	Temporary
UM	Unit of Measure

"identification only"

Appendix C

Facility Summary Report

"identification only"

VS20160115 - Cplx

200 - Livorno ES/MS Bldg 200

Camp Darby - Livorno ES/MS



YEAR BUILT: 2002

AREA (SF): 96

PLANT REPLACEMENT COST: [REDACTED]

SURVEY DATE: January 2020

TOTAL DEFICIENCIES: \$0

BUILDER(TM) METRIC		SCORE
Facility Condition Index	FCI:	100

201* - Livorno ES/MS Bldg 201*

Camp Darby - Livorno ES/MS



YEAR BUILT: 1954

AREA (SF): 43,386

PLANT REPLACEMENT COST: [REDACTED]

SURVEY DATE: January 2020

TOTAL DEFICIENCIES: [REDACTED]

BUILDER(TM) METRIC		SCORE
Facility Condition Index	FCI:	82

Appendix D

"identification only"

System Summary Report

"identification only"

DoDEA SYSTEM SUMMARY

Camp Darby

Complex	Building #	Building Name	A10	A20	B10	B20	B30	C10	C20	C30	D10	D20	D30	D40	D50	E10	E20	F10	F20	G10	G20	G30	G40	G90
Livorno ES/MS	200	Livorno ES/MS Bldg 200				85	78																	
Livorno ES/MS	201*	Livorno ES/MS Bldg 201*				79	76	83	79	86		22	48	57	82	94								

A10 - Foundations

A20 -Basement Construction

B10 - Superstructure

B20 - Exterior Enclosure

B30 - Roofing

C10 - Interior Construction

C20 - Stairs

C30 - Interior Finishes

D10 - Conveying

D20 - Plumbing

D30 - HVAC

D40 - Fire Protection

D50 - Electrical

E10 - Equipment

E20 - Furnishings

F10 - Special Construction

F20 - Selective Building Demo

G10 - Site Preparations

G20 - Site Improvements

G30 - Site Civil / Mech Utilities

G40 - Site Electrical Utilities

G50 - Other Site Construction

Appendix E

"identification only"

Work Items By Building



"identification only"

Work Items by Building Report



Camp Darby

Cost Book: Reference

200 - Livorno ES/MS Bldg 200

Livorno ES/MS (HE5408)

Year	System	Component	Section Description	Qty (UM)	Activity	Project	Cost	Status	Score	Completion Date
-- Description										
2017	B20 EXTERIOR ENCLOSURE									
	B2010 EXTERIOR WALLS			1,040 (SF)	Paint					0.00
	2002 B201001 EXTERIOR CLOSURE CIP Concrete									
	-- Paint B2010 EXTERIOR WALLS B201001 EXTERIOR CLOSURE CIP Concrete									



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component Section Description -- Description	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
2015	C30 INTERIOR FINISHES						
	C3010 WALL FINISHES	2,868 (SF)	Replace				0.00
	1954 C301005 WALL COVERINGS Other						
	-- Replace C3010 WALL FINISHES 1954 C301005 WALL COVERINGS General						
2015	D20 PLUMBING						
	D2020 DOMESTIC WATER DISTRIBUTION	6,391 (LF)	Replace				0.00
	1954 D202001 PIPES & FITTINGS General						
	-- Replace D2020 DOMESTIC WATER DISTRIBUTION D202001 PIPES & FITTINGS General						
	D2030 SANITARY WASTE	1,033 (LF)	Replace				0.00
	1954 D203001 WASTE PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE D203001 WASTE PIPE & FITTINGS Unknown						
	D2030 SANITARY WASTE	521 (EA)	Replace				0.00
	1954 D203002 VENT PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE D203002 VENT PIPE & FITTINGS General						
	D2030 SANITARY WASTE	16 (EA)	Replace				0.00
	1954 D203003 FLOOR DRAINS General						
	-- Replace D2030 SANITARY WASTE D203003 FLOOR DRAINS General						
2015	D30 HVAC						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Replace				0.00
	1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	-- Replace D3030 COOLING GENERATING SYSTEMS Chiller 1 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	D3040 DISTRIBUTION SYSTEMS	1,000 (MBH)	Replace				0.00
	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General						
	-- Replace D3040 DISTRIBUTION SYSTEMS Hot Water Dist D304003 HOT WATER DISTRIBUTION SYSTEMS Unknown						



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component Section Description -- Description	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
	D3040 DISTRIBUTION SYSTEMS	150 (TON)	Replace				0.00
	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General						
	-- Replace D3040 DISTRIBUTION SYSTEMS Chilled Water Dist D304006 CHILLED WATER DISTRIBUTION SYSTEMS			Unknown			
	D3050 TERMINAL & PACKAGE UNITS	43 (EA)	Replace				0.00
	1954 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton						
	-- Replace D3050 TERMINAL & PACKAGE UNITS Fan Coils D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton						
2016	C30 INTERIOR FINISHES						
	C3010 WALL FINISHES	2,868 (SF)	Replace				0.00
	1954 C301005 WALL COVERINGS Other						
	-- Replace C3010 WALL FINISHES 1954 C301005 WALL COVERINGS			General			
2016	D20 PLUMBING						
	D2020 DOMESTIC WATER DISTRIBUTION	6,391 (LF)	Replace				0.00
	1954 D202001 PIPES & FITTINGS General						
	-- Replace D2020 DOMESTIC WATER DISTRIBUTION D202001 PIPES & FITTINGS			General			
	D2030 SANITARY WASTE	1,033 (LF)	Replace				0.00
	1954 D203001 WASTE PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE D203001 WASTE PIPE & FITTINGS			Unknown			
	D2030 SANITARY WASTE	521 (EA)	Replace				0.00
	1954 D203002 VENT PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE D203002 VENT PIPE & FITTINGS			General			
	D2030 SANITARY WASTE	16 (EA)	Replace				0.00
	1954 D203003 FLOOR DRAINS General						
	-- Replace D2030 SANITARY WASTE D203003 FLOOR DRAINS			General			
2016	D30 HVAC						



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component	Qty (UM)	Activity	Project	Cost	Status	Score
	Section Description						Completion Date
	-- Description						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Replace				0.00
	1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	-- Replace D3030 COOLING GENERATING SYSTEMS Chiller 1 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	D3040 DISTRIBUTION SYSTEMS	1,000 (MBH)	Replace				0.00
	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General						
	-- Replace D3040 DISTRIBUTION SYSTEMS Hot Water Dist D304003 HOT WATER DISTRIBUTION SYSTEMS			Unknown			
	D3040 DISTRIBUTION SYSTEMS	150 (TON)	Replace				0.00
	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General						
	-- Replace D3040 DISTRIBUTION SYSTEMS Chilled Water Dist D304006 CHILLED WATER DISTRIBUTION SYSTEMS			Unknown			
	D3050 TERMINAL & PACKAGE UNITS	43 (EA)	Replace				0.00
	1954 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton						
	-- Replace D3050 TERMINAL & PACKAGE UNITS Fan Coils D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton						
2017	B20 EXTERIOR ENCLOSURE						
	B2010 EXTERIOR WALLS	1,334 (SF)	Paint				0.00
	1954 B201001 EXTERIOR CLOSURE Cement Boards / Panels						
	-- Paint B2010 EXTERIOR WALLS 1954 B201001 EXTERIOR CLOSURE Cementitious Boards / Panels						
	B2010 EXTERIOR WALLS	26,576 (SF)	Paint				0.00
	1954 B201001 EXTERIOR CLOSURE E.I.F.S.						
	-- Paint B2010 EXTERIOR WALLS 1954 B201001 EXTERIOR CLOSURE E.I.F.S.						
	B2010 EXTERIOR WALLS	11,435 (SF)	Paint				0.00
	1954 B201007 EXTERIOR SOFFITS General						
	-- Paint B2010 EXTERIOR WALLS 1954 B201007 EXTERIOR SOFFITS General						
2017	C10 INTERIOR CONSTRUCTION						
	C1010 PARTITIONS	37,747 (SF)	Paint				0.00
	1954 C101001 FIXED PARTITIONS Wall - Concrete Block						
	-- Paint C1010 PARTITIONS 1954 C101001 FIXED PARTITIONS General						



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
Section Description							
-- Description							
	C1030 SPECIALTIES	19 (EA)	Replace				0.00
	1954 C103002 TOILET & BATH ACCESSORIES General						
	-- Replace C1030 SPECIALTIES 1954 C103002 TOILET & BATH ACCESSORIES General						
2017	C30 INTERIOR FINISHES						
	C3010 WALL FINISHES	2,868 (SF)	Replace				0.00
	1954 C301005 WALL COVERINGS Other						
	-- Replace C3010 WALL FINISHES 1954 C301005 WALL COVERINGS General						
	C3020 FLOOR FINISHES	4,400 (SF)	Replace				0.00
	1954 C302004 RESILIENT FLOOR FINISHES Composition Sheet						
	-- Replace C3020 FLOOR FINISHES 1954 C302004 RESILIENT FLOOR FINISHES Composition Sheet						
	C3030 CEILING FINISHES	2,392 (SF)	Paint				0.00
	1954 C303003 PLASTER CEILING FINISHES General						
	-- Paint C3030 CEILING FINISHES 1954 C303003 PLASTER CEILING FINISHES General						
2017	D20 PLUMBING						
	D2020 DOMESTIC WATER DISTRIBUTION	6,391 (LF)	Replace				0.00
	1954 D202001 PIPES & FITTINGS General						
	-- Replace D2020 DOMESTIC WATER DISTRIBUTION D202001 PIPES & FITTINGS General						
	D2030 SANITARY WASTE	1,033 (LF)	Replace				0.00
	1954 D203001 WASTE PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE D203001 WASTE PIPE & FITTINGS Unknown						
	D2030 SANITARY WASTE	521 (EA)	Replace				0.00
	1954 D203002 VENT PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE D203002 VENT PIPE & FITTINGS General						
	D2030 SANITARY WASTE	16 (EA)	Replace				0.00
	1954 D203003 FLOOR DRAINS General						
	-- Replace D2030 SANITARY WASTE D203003 FLOOR DRAINS General						



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component Section Description -- Description	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
2017	D30 HVAC						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Replace				0.00
	1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	-- Replace D3030 COOLING GENERATING SYSTEMS Chiller 1 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	D3040 DISTRIBUTION SYSTEMS	1,000 (MBH)	Replace				0.00
	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General						
	-- Replace D3040 DISTRIBUTION SYSTEMS Hot Water Dist D304003 HOT WATER DISTRIBUTION SYSTEMS Unknown						
	D3040 DISTRIBUTION SYSTEMS	150 (TON)	Replace				0.00
	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General						
	-- Replace D3040 DISTRIBUTION SYSTEMS Chilled Water Dist D304006 CHILLED WATER DISTRIBUTION SYSTEMS Unknown						
	D3050 TERMINAL & PACKAGE UNITS	1 (EA)	Replace				0.00
	1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls						
	-- Replace D3050 TERMINAL & PACKAGE UNITS MUA-1 D305001 UNIT VENTILATORS Make-Up Air Unit						
	D3050 TERMINAL & PACKAGE UNITS	43 (EA)	Replace				0.00
	1954 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton						
	-- Replace D3050 TERMINAL & PACKAGE UNITS Fan Coils D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton						
2017	D40 FIRE PROTECTION						
	D4010 FIRE ALARM AND DETECTION SYSTEMS	11 (SF)	Repair				0.00
	1954 D401001 FIRE ALARM DISTRIBUTION Other						
	-- Repair D4010 FIRE ALARM AND DETECTION SYSTEMS D401001 FIRE ALARM DISTRIBUTION Fire detection systems, 50 detectors						
2018	B20 EXTERIOR ENCLOSURE						
	B2010 EXTERIOR WALLS	11,435 (SF)	Paint				0.00
	1954 B201007 EXTERIOR SOFFITS General						
	-- Paint B2010 EXTERIOR WALLS 1954 B201007 EXTERIOR SOFFITS General						
2018	D20 PLUMBING						



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component Section Description -- Description	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
	D2020 DOMESTIC WATER DISTRIBUTION 1954 D202001 PIPES & FITTINGS General -- Replace D2020 DOMESTIC WATER DISTRIBUTION 1954 D202001 PIPES & FITTINGS General	12,681 (LF)	Replace				0.00
	D2030 SANITARY WASTE 1954 D203001 WASTE PIPE & FITTINGS General -- Replace D2030 SANITARY WASTE 1954 D203001 WASTE PIPE & FITTINGS General	13,110 (LF)	Replace				0.00
	D2030 SANITARY WASTE 1954 D203002 VENT PIPE & FITTINGS General -- Replace D2030 SANITARY WASTE 1954 D203002 VENT PIPE & FITTINGS General	1,542 (EA)	Replace				0.00
2018	D30 HVAC						
	D3030 COOLING GENERATING SYSTEMS 1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller -- Replace D3030 COOLING GENERATING SYSTEMS 1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller	1 (EA)	Replace				0.00
	D3040 DISTRIBUTION SYSTEMS 1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General -- Replace D3040 DISTRIBUTION SYSTEMS 1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General	1,085 (MBH)	Replace				0.00
	D3040 DISTRIBUTION SYSTEMS 1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General -- Replace D3040 DISTRIBUTION SYSTEMS 1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	108 (TON)	Replace				0.00
	D3040 DISTRIBUTION SYSTEMS 1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM -- Replace D3040 DISTRIBUTION SYSTEMS 1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM	10 (EA)	Replace				0.00
	D3050 TERMINAL & PACKAGE UNITS 1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls -- Replace D3050 TERMINAL & PACKAGE UNITS 1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls	1 (EA)	Replace				0.00

2018 D50 ELECTRICAL



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component Section Description -- Description	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
	D5030 COMMUNICATIONS & SECURITY 1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets -- Replace D5030 COMMUNICATIONS & SECURITY 1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets	1 (EA)	Replace				0.00
2019	D20 PLUMBING						
	D2020 DOMESTIC WATER DISTRIBUTION 1954 D202001 PIPES & FITTINGS General -- Replace D2020 DOMESTIC WATER DISTRIBUTION 1954 D202001 PIPES & FITTINGS General	12,681 (LF)	Replace				0.00
	D2030 SANITARY WASTE 1954 D203001 WASTE PIPE & FITTINGS General -- Replace D2030 SANITARY WASTE 1954 D203001 WASTE PIPE & FITTINGS General	13,110 (LF)	Replace				0.00
	D2030 SANITARY WASTE 1954 D203002 VENT PIPE & FITTINGS General -- Replace D2030 SANITARY WASTE 1954 D203002 VENT PIPE & FITTINGS General	1,542 (EA)	Replace				0.00
2019	D30 HVAC						
	D3030 COOLING GENERATING SYSTEMS 1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller -- Replace D3030 COOLING GENERATING SYSTEMS 1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller	1 (EA)	Replace				0.00
	D3040 DISTRIBUTION SYSTEMS 1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General -- Replace D3040 DISTRIBUTION SYSTEMS 1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General	1,085 (MBH)	Replace				0.00
	D3040 DISTRIBUTION SYSTEMS 1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General -- Replace D3040 DISTRIBUTION SYSTEMS 1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	108 (TON)	Replace				0.00
	D3040 DISTRIBUTION SYSTEMS 1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM -- Replace D3040 DISTRIBUTION SYSTEMS 1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM	10 (EA)	Replace				0.00



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component Section Description -- Description	Qty (UM)	Activity	Project	Cost	Status	Score Completion Date
	D3050 TERMINAL & PACKAGE UNITS	1 (EA)	Replace				0.00
	1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls						
	-- Replace D3050 TERMINAL & PACKAGE UNITS 1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls						
2019	D50 ELECTRICAL						
	D5030 COMMUNICATIONS & SECURITY	1 (EA)	Replace				0.00
	1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets						
	-- Replace D5030 COMMUNICATIONS & SECURITY 1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets						
	D5030 COMMUNICATIONS & SECURITY	1 (EA)	Replace				0.00
	1954 D503007 CLOCK & PROGRAM SYSTEMS General						
	-- Replace D5030 COMMUNICATIONS & SECURITY 1954 D503007 CLOCK & PROGRAM SYSTEMS General						
2020	D20 PLUMBING						
	D2020 DOMESTIC WATER DISTRIBUTION	10,995 (LF)	Replace				0.00
	1954 D202001 PIPES & FITTINGS General						
	-- Replace D2020 DOMESTIC WATER DISTRIBUTION 1954 D202001 PIPES & FITTINGS General						
	D2030 SANITARY WASTE	5,498 (LF)	Replace				0.00
	1954 D203001 WASTE PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE 1954 D203001 WASTE PIPE & FITTINGS General						
	D2030 SANITARY WASTE	1,337 (EA)	Replace				0.00
	1954 D203002 VENT PIPE & FITTINGS General						
	-- Replace D2030 SANITARY WASTE 1954 D203002 VENT PIPE & FITTINGS General						
2020	D30 HVAC						
	D3030 COOLING GENERATING SYSTEMS	1 (EA)	Replace				0.00
	1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						
	-- Replace D3030 COOLING GENERATING SYSTEMS 1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller						



Camp Darby

Cost Book: Reference

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Year	System Component	Section Description	Qty (UM)	Activity	Project	Cost	Status	Score	Completion Date
		-- Description							
	D3040 DISTRIBUTION SYSTEMS		1,085 (MBH)	Replace				0.00	
	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General								
	-- Replace D3040 DISTRIBUTION SYSTEMS	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General							
	D3040 DISTRIBUTION SYSTEMS		108 (TON)	Replace				0.00	
	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General								
	-- Replace D3040 DISTRIBUTION SYSTEMS	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General							
	D3040 DISTRIBUTION SYSTEMS		10 (EA)	Replace				0.00	
	1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM								
	-- Replace D3040 DISTRIBUTION SYSTEMS	1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM							
	D3050 TERMINAL & PACKAGE UNITS		1 (EA)	Replace				0.00	
	1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls								
	-- Replace D3050 TERMINAL & PACKAGE UNITS	1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls							
2020	D50 ELECTRICAL								
	D5030 COMMUNICATIONS & SECURITY		1 (EA)	Replace				0.00	
	1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets								
	-- Replace D5030 COMMUNICATIONS & SECURITY	1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets							
	D5030 COMMUNICATIONS & SECURITY		1 (EA)	Replace				0.00	
	1954 D503007 CLOCK & PROGRAM SYSTEMS General								
	-- Replace D5030 COMMUNICATIONS & SECURITY	1954 D503007 CLOCK & PROGRAM SYSTEMS General							

Appendix F

"identification only"

Remaining Service Life (RSL) Detail Report



Camp Darby

200 - Livorno ES/MS Bldg 200

Livorno ES/MS (HE5408)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE CIP Concrete	18	39	15
	B2010 EXTERIOR WALLS	2002 B201010 EXTERIOR JOINT SEALANT General	18	8	
	B2030 EXTERIOR DOORS	2002 B203001 SOLID DOORS Steel	18	8	
B30 ROOFING	B3010 ROOF COVERINGS	2002 B301002 LOW SLOPE ROOF SYSTEMS Built-Up	18	4	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	18	8	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Gutters	18	8	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	1954 B201001 EXTERIOR CLOSURE Cement Boards / Panels	40	12	Unknown
	B2010 EXTERIOR WALLS	1954 B201001 EXTERIOR CLOSURE E.I.F.S.	40	20	Unknown
	B2010 EXTERIOR WALLS	1954 B201001 EXTERIOR CLOSURE Wall Louver	40	12	20
	B2010 EXTERIOR WALLS	1954 B201004 PARAPETS General	15	10	
	B2010 EXTERIOR WALLS	1954 B201006 BALCONY WALLS & HANDRAILS Ladder	31	6	
	B2010 EXTERIOR WALLS	1954 B201007 EXTERIOR SOFFITS General	13	8	Unknown
	B2010 EXTERIOR WALLS	1954 B201010 EXTERIOR JOINT SEALANT General	31	4	
	B2020 EXTERIOR WINDOWS	1954 B202001 WINDOWS Aluminum Windows	31	31	
	B2020 EXTERIOR WINDOWS	1954 B202002 STOREFRONTS General	21	8	
	B2020 EXTERIOR WINDOWS	1954 B202090 OTHER EXTERIOR WINDOWS General	31	34	
	B2030 EXTERIOR DOORS	1954 B203001 SOLID DOORS Aluminum	21	8	
	B2030 EXTERIOR DOORS	1954 B203001 SOLID DOORS Wood	21	6	
	B2030 EXTERIOR DOORS	1954 B203090 OTHER EXTERIOR SPECIALTY DOORS Emergency Egress	21	6	
	B2030 EXTERIOR DOORS	1954 A B203001 SOLID DOORS Aluminum	6	8	
B30 ROOFING	B3010 ROOF COVERINGS	1954 B301002 LOW SLOPE ROOF SYSTEMS Built-Up	15	4	
	B3010 ROOF COVERINGS	1954 B301003 ROOF INSULATION & FILL General	15	5	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Apron	15	10	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Base	15	10	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Cap	6	7	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Embedded Edge Metal	15	10	
	B3010 ROOF COVERINGS	1954 B301005 GUTTERS & DOWNSPOUTS Downspouts	15	8	
	B3010 ROOF COVERINGS	1954 B301005 GUTTERS & DOWNSPOUTS Gutters	15	8	
	B3010 ROOF COVERINGS	1954 B301006 ROOF OPENINGS AND SUPPORTS Gravity Ventilator - 6"	66	8	
	B3010 ROOF COVERINGS	1954 B301006 ROOF OPENINGS AND SUPPORTS Skylights	20	7	
	B3010 ROOF COVERINGS	1954 B301090 OTHER ROOFING General	15	4	
C10 INTERIOR	C1010 PARTITIONS	1954 C101001 FIXED PARTITIONS Wall - Concrete Block	66	39	26
	C1010 PARTITIONS	1954 C101005 INTERIOR WINDOWS Interior Windows	30	20	
	C1010 PARTITIONS	1954 C101005 INTERIOR WINDOWS Metal Rollup / Coiling Grille	30	8	
	C1020 INTERIOR DOORS	1954 C102001 STANDARD INTERIOR DOORS Wood Door/Wood Frame	21	12	
	C1020 INTERIOR DOORS	1954 C102002 GLAZED INTERIOR DOORS General	21	16	
	C1030 SPECIALTIES	1954 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Toilet	30	6	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	C1030 SPECIALTIES	1954 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Urinal	30	6	
	C1030 SPECIALTIES	1954 C103002 TOILET & BATH ACCESSORIES General	27	6	
	C1030 SPECIALTIES	1954 C103003 MARKER BOARDS & TACK BOARDS General	12	8	
	C1030 SPECIALTIES	1954 C103008 COUNTERS Laminated Plastic	27	9	
	C1030 SPECIALTIES	1954 C103008 COUNTERS Stone	10	15	
	C1030 SPECIALTIES	1954 C103009 CABINETS Other	27	6	
C20 STAIRS	C2010 STAIR CONSTRUCTION	1954 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps	31	8	
	C2010 STAIR CONSTRUCTION	1954 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps - Concrete	31	8	
	C2010 STAIR CONSTRUCTION	1954 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES	31	8	
C30 INTERIOR FINISHES	C3010 WALL FINISHES	1954 C301004 TILE & TERRAZZO WALL FINISHES Tile	13	39	
	C3010 WALL FINISHES	1954 C301005 WALL COVERINGS Other	13	3	
	C3020 FLOOR FINISHES	1954 C302001 TILE FLOOR FINISHES Ceramic Tile	2	39	
	C3020 FLOOR FINISHES	1954 C302003 WOOD FLOORING General	31	12	
	C3020 FLOOR FINISHES	1954 C302004 RESILIENT FLOOR FINISHES Composition Sheet	31	5	
	C3030 CEILING FINISHES	1954 C303001 ACOUSTICAL CEILING TILES & PANELS General	27	21	
	C3030 CEILING FINISHES	1954 C303003 PLASTER CEILING FINISHES General	27	65	25
	C3030 CEILING FINISHES	1954 C303005 SUSPENSION SYSTEMS General	27	6	
	C3030 CEILING FINISHES	1954 C303006 METAL STRIP CEILINGS General	27	12	
D20 PLUMBING	D2010 PLUMBING FIXTURES	1954 D201001 WATERCLOSETS General	31	10	
	D2010 PLUMBING FIXTURES	1954 D201002 URINALS General	31	10	
	D2010 PLUMBING FIXTURES	1954 D201003 LAVATORIES General	31	10	
	D2010 PLUMBING FIXTURES	1954 D201004 SINKS Kitchen Sink	31	18	
	D2010 PLUMBING FIXTURES	1954 D201004 SINKS Service Sink	31	10	
	D2010 PLUMBING FIXTURES	1954 D201006 DRINKING FOUNTAINS AND COOLERS Water Cooler	3	10	
	D2010 PLUMBING FIXTURES	1954 D201090 OTHER PLUMBING FIXTURES Emergency Eye Wash	31	13	
	D2010 PLUMBING FIXTURES	1954 D201090 OTHER PLUMBING FIXTURES Emergency Shower	31	13	
	D2020 DOMESTIC WATER	1954 D202001 PIPES & FITTINGS General	66	0	
	D2020 DOMESTIC WATER	1954 D202003 DOMESTIC WATER EQUIPMENT Water Heaters, Residential,	6	10	
	D2020 DOMESTIC WATER	1954 M101 D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass	9	9	
	D2030 SANITARY WASTE	1954 D203001 WASTE PIPE & FITTINGS General	66	0	
	D2030 SANITARY WASTE	1954 D203002 VENT PIPE & FITTINGS General	66	0	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
	D2030 SANITARY WASTE	1954 D203003 FLOOR DRAINS General	66	8	
D30 HVAC	D3010 ENERGY SUPPLY	1954 D301002 GAS SUPPLY SYSTEM Fuel Storage Tank - Fuel Storage Tank,	66	15	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 D302004 AUXILIARY EQUIPMENT Expansion Tank - 30 gal	10	15	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 D302004 AUXILIARY EQUIPMENT Expansion Tank - 60 gal	10	15	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 B1 D302001 BOILERS Gas, Hot Water - 650-900 MBH	11	15	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 B2 D302001 BOILERS Gas, Hot Water - 650-900 MBH	11	15	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 B3 D302001 BOILERS Gas, Hot Water - 650-900 MBH	11	15	
	D3030 COOLING GENERATING	1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air	24	0	
	D3040 DISTRIBUTION SYSTEMS	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General	31	0	
	D3040 DISTRIBUTION SYSTEMS	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS Circulating Pump,	10	10	
	D3040 DISTRIBUTION SYSTEMS	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	24	0	
	D3040 DISTRIBUTION SYSTEMS	1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM	40	0	
	D3040 DISTRIBUTION SYSTEMS	1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump,	10	10	
	D3040 DISTRIBUTION SYSTEMS	1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump,	11	10	
	D3040 DISTRIBUTION SYSTEMS	1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS Heat Exchanger,	24	8	
	D3050 TERMINAL & PACKAGE UNITS	1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH,	31	0	
	D3050 TERMINAL & PACKAGE UNITS	1954 D305002 UNIT HEATERS Hydronic - 200 MBH	20	9	
	D3050 TERMINAL & PACKAGE UNITS	1954 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton	31	8	
	D3050 TERMINAL & PACKAGE UNITS	1954 A D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled	4	10	
	D3050 TERMINAL & PACKAGE UNITS	1954 B D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled	15	2	
D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION	1954 D401001 FIRE ALARM DISTRIBUTION Other	18	2	
	D4030 STANDPIPE SYSTEMS	1954 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 4" diam	6	10	
	D4090 OTHER FIRE PROTECTION	1954 D409004 HOOD & DUCT FIRE PROTECTION General	16	10	
D50 ELECTRICAL	D5010 ELECTRICAL SERVICE &	1954 D501004 PANELBOARDS Main lugs, 400 amp	20	8	
	D5010 ELECTRICAL SERVICE &	1954 D501004 PANELBOARDS Safety Switch, < 30 Amp	31	15	
	D5010 ELECTRICAL SERVICE &	1954 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 3, 50	31	21	
	D5020 LIGHTING & BRANCH WIRING	1954 D502001 BRANCH WIRING General	31	29	
	D5020 LIGHTING & BRANCH WIRING	1954 D502002 LIGHTING EQUIPMENT General	11	10	
	D5030 COMMUNICATIONS &	1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets	25	0	
	D5030 COMMUNICATIONS &	1954 D503003 INTERCOMMUNICATIONS SYSTEMS 25 stations	25	8	
	D5030 COMMUNICATIONS &	1954 D503005 SECURITY SYSTEMS General	18	10	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Age (yrs)	RSL (yrs)	RPL (yrs)
E10 EQUIPMENT	D5030 COMMUNICATIONS & EQUIPMENT	1954 D503007 CLOCK & PROGRAM SYSTEMS General	25	0	
	D5090 OTHER ELECTRICAL EQUIPMENT	1954 D509003 GROUNDING SYSTEMS General	6	44	
	E1090 OTHER EQUIPMENT	*CONVECTION OVEN SINGLE A E109002 FOOD SERVICE EQUIPMENT	6	13	
	E1090 OTHER EQUIPMENT	*CONVECTION OVEN SINGLE B E109002 FOOD SERVICE EQUIPMENT	11	13	
	E1090 OTHER EQUIPMENT	*DEEP FRYER E109002 FOOD SERVICE EQUIPMENT General	11	13	
	E1090 OTHER EQUIPMENT	*DISH WASHER E109002 FOOD SERVICE EQUIPMENT General	6	13	
	E1090 OTHER EQUIPMENT	*RANGE GAS E109002 FOOD SERVICE EQUIPMENT General	11	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR A E109002 FOOD SERVICE EQUIPMENT	11	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR B E109002 FOOD SERVICE EQUIPMENT	11	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR C E109002 FOOD SERVICE EQUIPMENT	6	13	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR D E109002 FOOD SERVICE EQUIPMENT	6	13	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER E109002 FOOD SERVICE EQUIPMENT General	6	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN A E109002 FOOD SERVICE EQUIPMENT	11	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN B E109002 FOOD SERVICE EQUIPMENT	11	13	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN C E109002 FOOD SERVICE EQUIPMENT	11	13	
	E1090 OTHER EQUIPMENT	*STEAMER 2 DOOR E109002 FOOD SERVICE EQUIPMENT General	11	13	

Appendix G

"identification only"

Direct Condition Rating Inspection By Section Report



Camp Darby

200 - Livorno ES/MS Bldg 200

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
2002 B201001 EXTERIOR CLOSURE CIP Concrete	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	400 (SF)
Last Inspection Date: 07-Jan-2020	Condition Rating: G-	Used Sampling? No	
Inspector: [REDACTED]	Paint Rating: A+	Inspection Source: Inspection	
Inspection Comments:			
2002 B201010 EXTERIOR JOINT SEALANT General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	20 (LF)
Last Inspection Date: 07-Jan-2020	Condition Rating: A+	Used Sampling? No	
Inspector: [REDACTED]		Inspection Source: Inspection	
Inspection Comments:			
2002 B203001 SOLID DOORS Steel	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	1 (EA)
Last Inspection Date: 07-Jan-2020	Condition Rating: A+	Used Sampling? No	
Inspector: [REDACTED]		Inspection Source: Inspection	
Inspection Comments:			
2002 B301002 LOW SLOPE ROOF SYSTEMS Built-Up	B30 ROOFING	B3010 ROOF COVERINGS	113 (SF)
Last Inspection Date: 07-Jan-2020	Condition Rating: A+	Used Sampling? No	
Inspector: [REDACTED]		Inspection Source: Inspection	
Inspection Comments:			
2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	B30 ROOFING	B3010 ROOF COVERINGS	9 (LF)
Last Inspection Date: 07-Jan-2020	Condition Rating: A+	Used Sampling? No	
Inspector: [REDACTED]		Inspection Source: Inspection	
Inspection Comments:			
2002 B301005 GUTTERS & DOWNSPOUTS Gutters	B30 ROOFING	B3010 ROOF COVERINGS	12 (LF)
Last Inspection Date: 07-Jan-2020	Condition Rating: A+	Used Sampling? No	
Inspector: [REDACTED]		Inspection Source: Inspection	
Inspection Comments:			



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
*CONVECTION OVEN SINGLE A E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*CONVECTION OVEN SINGLE B E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*DEEP FRYER E109002 FOOD SERVICE EQUIPMENT General	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*DISH WASHER E109002 FOOD SERVICE EQUIPMENT General	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*RANGE GAS E109002 FOOD SERVICE EQUIPMENT General	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*REFRIGERATOR REACH IN 2 DOOR A E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
*REFRIGERATOR REACH IN 2 DOOR B E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection
*REFRIGERATOR REACH IN 2 DOOR C E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection
*REFRIGERATOR REACH IN 2 DOOR D E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection
*SERVING LINE COOLER E109002 FOOD SERVICE	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection
*STEAM COUNTER ELECTRIC MULTI BASIN A E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection
*STEAM COUNTER ELECTRIC MULTI BASIN B E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection
*STEAM COUNTER ELECTRIC MULTI BASIN C E109002 FOOD	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? Inspection Source:	No Inspection



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
*STEAMER 2 DOOR E109002 FOOD SERVICE EQUIPMENT	E10 EQUIPMENT	E1090 OTHER EQUIPMENT	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G	Used Sampling? No Inspection Source: Inspection	
1954 B201001 EXTERIOR CLOSURE Cement Boards / Panels	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	1,334 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+ Paint Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B201001 EXTERIOR CLOSURE E.I.F.S.	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	26,576 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+ Paint Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B201001 EXTERIOR CLOSURE Wall Louver	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	248 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+ Paint Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B201004 PARAPETS General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	1,009 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 B201006 BALCONY WALLS & HANDRAILS Ladder	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	23 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B201007 EXTERIOR SOFFITS General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	11,435 (SF)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:		Condition Rating: A+ Paint Rating: A+	Used Sampling? No Inspection Source: Inspection
1954 B201010 EXTERIOR JOINT SEALANT General	B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2,343 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments: The joint sealants are cracking and shrinking, potentially allowing water infiltration.		Condition Rating: A- Used Sampling? No Inspection Source: Inspection	
1954 B202001 WINDOWS Aluminum Windows	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	77 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments: The windows are generally in operable condition although the exterior finishes are deteriorating.		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
1954 B202002 STOREFRONTS General	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	432 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
1954 B202090 OTHER EXTERIOR WINDOWS General	B20 EXTERIOR ENCLOSURE	B2020 EXTERIOR WINDOWS	71 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:		Condition Rating: G- Used Sampling? No Inspection Source: Inspection	
1954 B203001 SOLID DOORS Aluminum	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	14 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:		Condition Rating: A+ Used Sampling? No Inspection Source: Inspection	
1954 B203001 SOLID DOORS Wood	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments: The door finish is cracked and deteriorated.		Condition Rating: A Used Sampling? No Inspection Source: Inspection	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 B203090 OTHER EXTERIOR SPECIALTY DOORS	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	34 (EA)
Last Inspection Date: 07-Jan-2020 Condition Rating: A Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments: The doors are difficult to secure properly and finishes are weathered.			
1954 B301002 LOW SLOPE ROOF SYSTEMS Built-Up	B30 ROOFING	B3010 ROOF COVERINGS	45,386 (SF)
Last Inspection Date: 07-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments:			
1954 B301003 ROOF INSULATION & FILL General	B30 ROOFING	B3010 ROOF COVERINGS	45,386 (SF)
Last Inspection Date: 01-Jan-2005 Condition Rating: G+ Used Sampling? No Inspector: [REDACTED] Inspection Source: InstallDate Inspection Comments: Original Inspection			
1954 B301004 FLASHINGS & TRIM Flashings - Apron	B30 ROOFING	B3010 ROOF COVERINGS	1,147 (LF)
Last Inspection Date: 07-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments:			
1954 B301004 FLASHINGS & TRIM Flashings - Base	B30 ROOFING	B3010 ROOF COVERINGS	1,147 (LF)
Last Inspection Date: 07-Jan-2020 Condition Rating: A+ Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments:			
1954 B301004 FLASHINGS & TRIM Flashings - Cap	B30 ROOFING	B3010 ROOF COVERINGS	1,502 (LF)
Last Inspection Date: 07-Jan-2020 Condition Rating: A Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments: The flashing and roof detailing are showing deterioration.			
1954 B301004 FLASHINGS & TRIM Flashings - Embedded	B30 ROOFING	B3010 ROOF COVERINGS	5,497 (LF)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B301005 GUTTERS & DOWNSPOUTS Downspouts	B30 ROOFING	B3010 ROOF COVERINGS	671 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B301005 GUTTERS & DOWNSPOUTS Gutters	B30 ROOFING	B3010 ROOF COVERINGS	2,101 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B301006 ROOF OPENINGS AND SUPPORTS Gravity	B30 ROOFING	B3010 ROOF COVERINGS	91 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 B301006 ROOF OPENINGS AND SUPPORTS Skylights	B30 ROOFING	B3010 ROOF COVERINGS	129 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: The skylights above the entry hall are deteriorated and cracked beyond repair.	Condition Rating: R+	Used Sampling? No Inspection Source: Inspection	
1954 B301090 OTHER ROOFING General	B30 ROOFING	B3010 ROOF COVERINGS	8,136 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 C101001 FIXED PARTITIONS Wall - Concrete Block	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	59,000 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G- Paint Rating: G-	Used Sampling? No Inspection Source: Inspection	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 C101005 INTERIOR WINDOWS Interior Windows	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 C101005 INTERIOR WINDOWS Metal Rollup / Coiling	C10 INTERIOR CONSTRUCTION	C1010 PARTITIONS	20 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 C102001 STANDARD INTERIOR DOORS Wood	C10 INTERIOR CONSTRUCTION	C1020 INTERIOR DOORS	31 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 C102002 GLAZED INTERIOR DOORS General	C10 INTERIOR CONSTRUCTION	C1020 INTERIOR DOORS	26 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 C103001 COMPARTMENTS, CUBICLES & TOILET	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	16 (EA)
Last Inspection Date: 07-Jan- XXXX Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 C103001 COMPARTMENTS, CUBICLES & TOILET	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 C103002 TOILET & BATH ACCESSORIES General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	65 (EA)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? Inspection Source:	No Inspection
1954 C103003 MARKER BOARDS & TACK BOARDS General	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	100 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? Inspection Source:	No Inspection
1954 C103008 COUNTERS Laminated Plastic	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	420 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? Inspection Source:	No Inspection
1954 C103008 COUNTERS Stone	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	48 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 C103009 CABINETS Other	C10 INTERIOR CONSTRUCTION	C1030 SPECIALTIES	300 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? Inspection Source:	No Inspection
1954 C201001 INTERIOR AND EXTERIOR STAIRS Interior	C20 STAIRS	C2010 STAIR CONSTRUCTION	10 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? Inspection Source:	No Inspection
1954 C201001 INTERIOR AND EXTERIOR STAIRS Interior	C20 STAIRS	C2010 STAIR CONSTRUCTION	5 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? Inspection Source:	No Inspection



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 C201090 STAIR HANDRAILS, GUARDRAILS AND	C20 STAIRS	C2010 STAIR CONSTRUCTION	15 (LF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? Inspection Source:	No Inspection
1954 C301004 TILE & TERRAZZO WALL FINISHES Tile	C30 INTERIOR FINISHES	C3010 WALL FINISHES	6,500 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 C301005 WALL COVERINGS Other	C30 INTERIOR FINISHES	C3010 WALL FINISHES	3,200 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? Inspection Source:	No Inspection
1954 C302001 TILE FLOOR FINISHES Ceramic Tile	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	24,000 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 C302003 WOOD FLOORING General	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	6,500 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? Inspection Source:	No Inspection
1954 C302004 RESILIENT FLOOR FINISHES Composition	C30 INTERIOR FINISHES	C3020 FLOOR FINISHES	4,400 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? Inspection Source:	No Inspection
1954 C303001 ACOUSTICAL CEILING TILES & PANELS	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	27,870 (SF)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 C303003 PLASTER CEILING FINISHES General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	3,500 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G- Paint Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 C303005 SUSPENSION SYSTEMS General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	27,870 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 C303006 METAL STRIP CEILINGS General	C30 INTERIOR FINISHES	C3030 CEILING FINISHES	3,945 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 D201001 WATERCLOSETS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	24 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 D201002 URINALS General	D20 PLUMBING	D2010 PLUMBING FIXTURES	4 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 D201003 LAVATORIES General	D20 PLUMBING	D2010 PLUMBING FIXTURES	40 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 D201004 SINKS Kitchen Sink	D20 PLUMBING	D2010 PLUMBING FIXTURES	4 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D201004 SINKS Service Sink	D20 PLUMBING	D2010 PLUMBING FIXTURES	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D201006 DRINKING FOUNTAINS AND COOLERS Water	D20 PLUMBING	D2010 PLUMBING FIXTURES	4 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D201090 OTHER PLUMBING FIXTURES Emergency Eye	D20 PLUMBING	D2010 PLUMBING FIXTURES	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D201090 OTHER PLUMBING FIXTURES Emergency	D20 PLUMBING	D2010 PLUMBING FIXTURES	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D202001 PIPES & FITTINGS General	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	10,995 (LF)
Last Inspection Date: 01-Jan-1954 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? Inspection Source:	No InstallDate
1954 D202003 DOMESTIC WATER EQUIPMENT Water Heaters,	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	7 (EA)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: Condition Rating: G- Used Sampling? No Inspection Source: Inspection			
1954 D203001 WASTE PIPE & FITTINGS General	D20 PLUMBING	D2030 SANITARY WASTE	5,498 (LF)
Last Inspection Date: 01-Jan-1954 Inspector: Inspection Comments: Original Inspection Condition Rating: G+ Used Sampling? No Inspection Source: InstallDate			
1954 D203002 VENT PIPE & FITTINGS General	D20 PLUMBING	D2030 SANITARY WASTE	1,337 (EA)
Last Inspection Date: 01-Jan-1954 Inspector: Inspection Comments: Original Inspection Condition Rating: G+ Used Sampling? No Inspection Source: InstallDate			
1954 D203003 FLOOR DRAINS General	D20 PLUMBING	D2030 SANITARY WASTE	16 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: Condition Rating: A+ Used Sampling? No Inspection Source: Inspection			
1954 D301002 GAS SUPPLY SYSTEM Fuel Storage Tank - Fuel	D30 HVAC	D3010 ENERGY SUPPLY	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: Condition Rating: A Used Sampling? No Inspection Source: Inspection			
1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary	D30 HVAC	D3030 COOLING GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: The chiller is discolored and deteriorated. The cooling coils are damaged. Condition Rating: R Used Sampling? No Inspection Source: Inspection			
1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	1,085 (MBH)
Last Inspection Date: 01-Jan-1989 Inspector: Inspection Comments: Original Inspection Condition Rating: G+ Used Sampling? No Inspection Source: InstallDate			



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	3 (EA)
Last Inspection Date: 07-Jan-2020 Condition Rating: G- Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments:			
1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	108 (TON)
Last Inspection Date: 01-Jan-1996 Condition Rating: G+ Used Sampling? No Inspector: [REDACTED] Inspection Source: InstallDate Inspection Comments: Original Inspection			
1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	10 (EA)
Last Inspection Date: 07-Jan-2020 Condition Rating: R- Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments: The exhaust fans are heavily deteriorated and some units are covered in biological growth.			
1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	1 (EA)
Last Inspection Date: 07-Jan-2020 Condition Rating: R Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments: The make-up air unit is heavily rusted and the fiberglass portions of the enclosure are deteriorated and peeling.			
1954 D305002 UNIT HEATERS Hydronic - 200 MBH	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	8 (EA)
Last Inspection Date: 07-Jan-2020 Condition Rating: A Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments:			
1954 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	43 (EA)
Last Inspection Date: 07-Jan-2020 Condition Rating: G- Used Sampling? No Inspector: [REDACTED] Inspection Source: Inspection Inspection Comments:			
1954 D401001 FIRE ALARM DISTRIBUTION Other	D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION SY\$	43,386 (SF)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 01-Jan-2002 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? Inspection Source:	No InstallDate
1954 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 4"	D40 FIRE PROTECTION	D4030 STANDPIPE SYSTEMS	7 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D409004 HOOD & DUCT FIRE PROTECTION General	D40 FIRE PROTECTION	D4090 OTHER FIRE PROTECTION SYSTEI	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? Inspection Source:	No Inspection
1954 D501004 PANELBOARDS Main lugs, 400 amp	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBL	8 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: A+	Used Sampling? Inspection Source:	No Inspection
1954 D501004 PANELBOARDS Safety Switch, < 30 Amp	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBL	25 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D501006 MOTOR CONTROL CENTERS Motor Control	D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBL	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: XXXXXXXXXX Inspection Comments:	Condition Rating: G-	Used Sampling? Inspection Source:	No Inspection
1954 D502001 BRANCH WIRING General	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	43,386 (SF)
Last Inspection Date: 01-Jan-1989 Inspector: Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? Inspection Source:	No InstallDate



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 D502002 LIGHTING EQUIPMENT General	D50 ELECTRICAL	D5020 LIGHTING & BRANCH WIRING	43,386 (SF)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: This system was found to be partially operable during the time of assessment.	Condition Rating: R	Used Sampling? No Inspection Source: Inspection	
1954 D503003 INTERCOMMUNICATIONS SYSTEMS 25 stations	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 D503005 SECURITY SYSTEMS General	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 D503007 CLOCK & PROGRAM SYSTEMS General	D50 ELECTRICAL	D5030 COMMUNICATIONS & SECURITY	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: The clock system was malfunctioning at the time of assessment. Many clocks appear to be inoperable.	Condition Rating: R	Used Sampling? No Inspection Source: Inspection	
1954 D509003 GROUNDING SYSTEMS General	D50 ELECTRICAL	D5090 OTHER ELECTRICAL SERVICES	1 (EA)
Last Inspection Date: 01-Jan-2014 Inspector: [REDACTED] Inspection Comments: Original Inspection	Condition Rating: G+	Used Sampling? No Inspection Source: InstallDate	
1954 A B203001 SOLID DOORS Aluminum	B20 EXTERIOR ENCLOSURE	B2030 EXTERIOR DOORS	2 (EA)



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A+	Used Sampling? No Inspection Source: Inspection	
1954 A D305006 PACKAGE UNITS A/C Unit, Split Systems w/	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	4 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 B D305006 PACKAGE UNITS A/C Unit, Split Systems w/	D30 HVAC	D3050 TERMINAL & PACKAGE UNITS	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments: The split units are heavily discolored and corroded.	Condition Rating: R+	Used Sampling? No Inspection Source: Inspection	
1954 M101 D202003 DOMESTIC WATER EQUIPMENT Storage	D20 PLUMBING	D2020 DOMESTIC WATER DISTRIBUTION	1 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: A	Used Sampling? No Inspection Source: Inspection	
1954 M101 D302004 AUXILIARY EQUIPMENT Expansion Tank -	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	4 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 M101 D302004 AUXILIARY EQUIPMENT Expansion Tank -	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	2 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	
1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	6 (EA)
Last Inspection Date: 07-Jan-2020 Inspector: [REDACTED] Inspection Comments:	Condition Rating: G-	Used Sampling? No Inspection Source: Inspection	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

Section Description	System	Component	Quantity (UM)
1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	2 (EA)
Last Inspection Date: 07-Jan-2020	Condition Rating: G-	Used Sampling?	No
Inspector: [REDACTED]		Inspection Source:	Inspection
Inspection Comments:			
1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS	D30 HVAC	D3040 DISTRIBUTION SYSTEMS	2 (EA)
Last Inspection Date: 07-Jan-[REDACTED]	Condition Rating: A+	Used Sampling?	No
Inspector: [REDACTED]		Inspection Source:	Inspection
Inspection Comments:			
1954 M101 B1 D302001 BOILERS Gas, Hot Water - 650-900	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 07-Jan-2020	Condition Rating: G-	Used Sampling?	No
Inspector: [REDACTED]		Inspection Source:	Inspection
Inspection Comments:			
1954 M101 B2 D302001 BOILERS Gas, Hot Water - 650-900	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 07-Jan-2020	Condition Rating: G-	Used Sampling?	No
Inspector: [REDACTED]		Inspection Source:	Inspection
Inspection Comments:			
1954 M101 B3 D302001 BOILERS Gas, Hot Water - 650-900	D30 HVAC	D3020 HEAT GENERATING SYSTEMS	1 (EA)
Last Inspection Date: 07-Jan-2020	Condition Rating: G-	Used Sampling?	No
Inspector: [REDACTED]		Inspection Source:	Inspection
Inspection Comments:			

Appendix H

"identification only"

System Inventory Report



Camp Darby

200 - Livorno ES/MS Bldg 200

Livorno ES/MS (HE5408)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	2002 B201001 EXTERIOR CLOSURE CIP Concrete	400 (SF)	2002	2002
	B2010 EXTERIOR WALLS	2002 B201010 EXTERIOR JOINT SEALANT General	20 (LF)	2002	
	B2030 EXTERIOR DOORS	2002 B203001 SOLID DOORS Steel	1 (EA)	2002	
B30 ROOFING	B3010 ROOF COVERINGS	2002 B301002 LOW SLOPE ROOF SYSTEMS Built-Up	113 (SF)	2002	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Downspouts	9 (LF)	2002	
	B3010 ROOF COVERINGS	2002 B301005 GUTTERS & DOWNSPOUTS Gutters	12 (LF)	2002	



Camp Darby

201* - Livorno ES/MS Bldg 201*	Livorno ES/MS (HE5408)
--------------------------------	------------------------

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
B20 EXTERIOR ENCLOSURE	B2010 EXTERIOR WALLS	1954 B201001 EXTERIOR CLOSURE Cement Boards / Panels	1,334 (SF)	1980	2012
	B2010 EXTERIOR WALLS	1954 B201001 EXTERIOR CLOSURE E.I.F.S.	26,576 (SF)	1980	2007
	B2010 EXTERIOR WALLS	1954 B201001 EXTERIOR CLOSURE Wall Louver	248 (SF)	1980	2007
	B2010 EXTERIOR WALLS	1954 B201004 PARAPETS General	1,009 (LF)	2005	
	B2010 EXTERIOR WALLS	1954 B201006 BALCONY WALLS & HANDRAILS Ladder	23 (LF)	1989	
	B2010 EXTERIOR WALLS	1954 B201007 EXTERIOR SOFFITS General	11,435 (SF)	2007	2007
	B2010 EXTERIOR WALLS	1954 B201010 EXTERIOR JOINT SEALANT General	2,343 (LF)	1989	
	B2020 EXTERIOR WINDOWS	1954 B202001 WINDOWS Aluminum Windows	77 (EA)	1989	
	B2020 EXTERIOR WINDOWS	1954 B202002 STOREFRONTS General	432 (SF)	1999	
	B2020 EXTERIOR WINDOWS	1954 B202090 OTHER EXTERIOR WINDOWS General	71 (EA)	1989	
	B2030 EXTERIOR DOORS	1954 B203001 SOLID DOORS Aluminum	14 (EA)	1999	
	B2030 EXTERIOR DOORS	1954 B203001 SOLID DOORS Wood	2 (EA)	1999	
	B2030 EXTERIOR DOORS	1954 B203090 OTHER EXTERIOR SPECIALTY DOORS Emergency Egress Door	34 (EA)	1999	
	B2030 EXTERIOR DOORS	1954 A B203001 SOLID DOORS Aluminum	2 (EA)	2014	
B30 ROOFING	B3010 ROOF COVERINGS	1954 B301002 LOW SLOPE ROOF SYSTEMS Built-Up	45,386 (SF)	2005	
	B3010 ROOF COVERINGS	1954 B301003 ROOF INSULATION & FILL General	45,386 (SF)	2005	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Apron	1,147 (LF)	2005	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Base	1,147 (LF)	2005	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Cap	1,502 (LF)	2014	
	B3010 ROOF COVERINGS	1954 B301004 FLASHINGS & TRIM Flashings - Embedded Edge Metal	5,497 (LF)	2005	
	B3010 ROOF COVERINGS	1954 B301005 GUTTERS & DOWNSPOUTS Downspouts	671 (LF)	2005	
	B3010 ROOF COVERINGS	1954 B301005 GUTTERS & DOWNSPOUTS Gutters	2,101 (LF)	2005	
	B3010 ROOF COVERINGS	1954 B301006 ROOF OPENINGS AND SUPPORTS Gravity Ventilator - 6" Diameter	91 (EA)	1954	
	B3010 ROOF COVERINGS	1954 B301006 ROOF OPENINGS AND SUPPORTS Skylights	129 (SF)	2000	
	B3010 ROOF COVERINGS	1954 B301090 OTHER ROOFING General	8,136 (SF)	2005	
C10 INTERIOR	C1010 PARTITIONS	1954 C101001 FIXED PARTITIONS Wall - Concrete Block	59,000 (SF)	1954	2018
	C1010 PARTITIONS	1954 C101005 INTERIOR WINDOWS Interior Windows	1 (EA)	1990	
	C1010 PARTITIONS	1954 C101005 INTERIOR WINDOWS Metal Rollup / Coiling Grille	20 (SF)	1990	
	C1020 INTERIOR DOORS	1954 C102001 STANDARD INTERIOR DOORS Wood Door/Wood Frame	31 (EA)	1999	
	C1020 INTERIOR DOORS	1954 C102002 GLAZED INTERIOR DOORS General	26 (EA)	1999	
	C1030 SPECIALTIES	1954 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Toilet Partitions	16 (EA)	1990	
	C1030 SPECIALTIES	1954 C103001 COMPARTMENTS, CUBICLES & TOILET PARTITIONS Urinal Screen	1 (EA)	1990	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	C1030 SPECIALTIES	1954 C103002 TOILET & BATH ACCESSORIES General	65 (EA)	1993	
	C1030 SPECIALTIES	1954 C103003 MARKER BOARDS & TACK BOARDS General	100 (EA)	2008	
	C1030 SPECIALTIES	1954 C103008 COUNTERS Laminated Plastic	420 (LF)	1993	
	C1030 SPECIALTIES	1954 C103008 COUNTERS Stone	48 (LF)	2010	
	C1030 SPECIALTIES	1954 C103009 CABINETS Other	300 (LF)	1993	
C20 STAIRS	C2010 STAIR CONSTRUCTION	1954 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps	10 (EA)	1989	
	C2010 STAIR CONSTRUCTION	1954 C201001 INTERIOR AND EXTERIOR STAIRS Interior Steps - Concrete	5 (EA)	1989	
	C2010 STAIR CONSTRUCTION	1954 C201090 STAIR HANDRAILS, GUARDRAILS AND ACCESSORIES General	15 (LF)	1989	
C30 INTERIOR FINISHES	C3010 WALL FINISHES	1954 C301004 TILE & TERRAZZO WALL FINISHES Tile	6,500 (SF)	2007	
	C3010 WALL FINISHES	1954 C301005 WALL COVERINGS Other	3,200 (SF)	2007	
	C3020 FLOOR FINISHES	1954 C302001 TILE FLOOR FINISHES Ceramic Tile	24,000 (SF)	2018	
	C3020 FLOOR FINISHES	1954 C302003 WOOD FLOORING General	6,500 (SF)	1989	
	C3020 FLOOR FINISHES	1954 C302004 RESILIENT FLOOR FINISHES Composition Sheet	4,400 (SF)	1989	
	C3030 CEILING FINISHES	1954 C303001 ACOUSTICAL CEILING TILES & PANELS General	27,870 (SF)	1993	
	C3030 CEILING FINISHES	1954 C303003 PLASTER CEILING FINISHES General	3,500 (SF)	1993	2009
	C3030 CEILING FINISHES	1954 C303005 SUSPENSION SYSTEMS General	27,870 (SF)	1993	
	C3030 CEILING FINISHES	1954 C303006 METAL STRIP CEILINGS General	3,945 (SF)	1993	
D20 PLUMBING	D2010 PLUMBING FIXTURES	1954 D201001 WATERCLOSETS General	24 (EA)	1989	
	D2010 PLUMBING FIXTURES	1954 D201002 URINALS General	4 (EA)	1989	
	D2010 PLUMBING FIXTURES	1954 D201003 LAVATORIES General	40 (EA)	1989	
	D2010 PLUMBING FIXTURES	1954 D201004 SINKS Kitchen Sink	4 (EA)	1989	
	D2010 PLUMBING FIXTURES	1954 D201004 SINKS Service Sink	2 (EA)	1989	
	D2010 PLUMBING FIXTURES	1954 D201006 DRINKING FOUNTAINS AND COOLERS Water Cooler	4 (EA)	2017	
	D2010 PLUMBING FIXTURES	1954 D201090 OTHER PLUMBING FIXTURES Emergency Eye Wash	2 (EA)	1989	
	D2010 PLUMBING FIXTURES	1954 D201090 OTHER PLUMBING FIXTURES Emergency Shower	2 (EA)	1989	
	D2020 DOMESTIC WATER DISTRIBUTION	1954 D202001 PIPES & FITTINGS General	10,995 (LF)	1954	
	D2020 DOMESTIC WATER DISTRIBUTION	1954 D202003 DOMESTIC WATER EQUIPMENT Water Heaters, Residential, Electric	7 (EA)	2014	
	D2020 DOMESTIC WATER DISTRIBUTION	1954 M101 D202003 DOMESTIC WATER EQUIPMENT Storage Tank - Glass lined, PE, 80 gallon, 20" diameter, 64" L.O.A.	1 (EA)	2011	
	D2030 SANITARY WASTE	1954 D203001 WASTE PIPE & FITTINGS General	5,498 (LF)	1954	
	D2030 SANITARY WASTE	1954 D203002 VENT PIPE & FITTINGS General	1,337 (EA)	1954	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	D2030 SANITARY WASTE	1954 D203003 FLOOR DRAINS General	16 (EA)	1954	
D30 HVAC	D3010 ENERGY SUPPLY	1954 D301002 GAS SUPPLY SYSTEM Fuel Storage Tank - Fuel Storage Tank, 2500 GAL	1 (EA)	1954	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 D302004 AUXILIARY EQUIPMENT Expansion Tank - 30 gal	4 (EA)	2010	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 D302004 AUXILIARY EQUIPMENT Expansion Tank - 60 gal	2 (EA)	2010	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 B1 D302001 BOILERS Gas, Hot Water - 650-900 MBH	1 (EA)	2009	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 B2 D302001 BOILERS Gas, Hot Water - 650-900 MBH	1 (EA)	2009	
	D3020 HEAT GENERATING SYSTEMS	1954 M101 B3 D302001 BOILERS Gas, Hot Water - 650-900 MBH	1 (EA)	2009	
	D3030 COOLING GENERATING SYSTEMS	1954 D303001 CHILLED WATER SYSTEMS Chiller, Rotary Screw - 180 TN, Air Cooled Screw Liquid Chiller	1 (EA)	1996	
	D3040 DISTRIBUTION SYSTEMS	1954 D304003 HOT WATER DISTRIBUTION SYSTEMS General	1,085 (MBH)	1989	
	D3040 DISTRIBUTION SYSTEMS	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 3" size, 5 HP, to 225 GPM	3 (EA)	2010	
	D3040 DISTRIBUTION SYSTEMS	1954 D304006 CHILLED WATER DISTRIBUTION SYSTEMS General	108 (TON)	1996	
	D3040 DISTRIBUTION SYSTEMS	1954 D304007 EXHAUST SYSTEMS Fan System, Roof Exhaust - 800 CFM	10 (EA)	1980	
	D3040 DISTRIBUTION SYSTEMS	1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 3" size, 5 HP, to 225 GPM	6 (EA)	2010	
	D3040 DISTRIBUTION SYSTEMS	1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS Circulating Pump, End Suction - 4" size, 7-1/2 HP, to 350 GPM	2 (EA)	2009	
	D3040 DISTRIBUTION SYSTEMS	1954 M101 D304003 HOT WATER DISTRIBUTION SYSTEMS Heat Exchanger, Plate Type - 1200 GPM	2 (EA)	1996	
	D3050 TERMINAL & PACKAGE UNITS	1954 D305001 UNIT VENTILATORS Make-Up Air Unit - 14,000 CFM, 1180 MBH, includes standard controls	1 (EA)	1989	
	D3050 TERMINAL & PACKAGE UNITS	1954 D305002 UNIT HEATERS Hydronic - 200 MBH	8 (EA)	2000	
	D3050 TERMINAL & PACKAGE UNITS	1954 D305003 FAN COIL UNITS Cab Mount, Two Pipe - 1-1/2 ton	43 (EA)	1989	
	D3050 TERMINAL & PACKAGE UNITS	1954 A D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled Condenser - 2 TN	4 (EA)	2016	
	D3050 TERMINAL & PACKAGE UNITS	1954 B D305006 PACKAGE UNITS A/C Unit, Split Systems w/ Air Cooled Condenser - 2 TN	2 (EA)	2005	
D40 FIRE PROTECTION	D4010 FIRE ALARM AND DETECTION SYSTEMS	1954 D401001 FIRE ALARM DISTRIBUTION Other	43,386 (SF)	2002	
	D4030 STANDPIPE SYSTEMS	1954 D403001 STANDPIPE EQUIPMENT & PIPING Riser - 4" diam	7 (EA)	2014	
	D4090 OTHER FIRE PROTECTION SYSTEMS	1954 D409004 HOOD & DUCT FIRE PROTECTION General	2 (EA)	2004	



Camp Darby

201* - Livorno ES/MS Bldg 201*

Livorno ES/MS (HE5408)

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
D50 ELECTRICAL	D5010 ELECTRICAL SERVICE & DISTRIBUTION	1954 D501004 PANELBOARDS Main lugs, 400 amp	8 (EA)	2000	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	1954 D501004 PANELBOARDS Safety Switch, < 30 Amp	25 (EA)	1989	
	D5010 ELECTRICAL SERVICE & DISTRIBUTION	1954 D501006 MOTOR CONTROL CENTERS Motor Control Center - Size 3, 50 HP, 24" high	1 (EA)	1989	
	D5020 LIGHTING & BRANCH WIRING	1954 D502001 BRANCH WIRING General	43,386 (SF)	1989	
	D5020 LIGHTING & BRANCH WIRING	1954 D502002 LIGHTING EQUIPMENT General	43,386 (SF)	2009	
	D5030 COMMUNICATIONS & SECURITY	1954 D503002 PUBLIC ADDRESS SYSTEMS 30 outlets	1 (EA)	1995	
	D5030 COMMUNICATIONS & SECURITY	1954 D503003 INTERCOMMUNICATIONS SYSTEMS 25 stations	1 (EA)	1995	
	D5030 COMMUNICATIONS & SECURITY	1954 D503005 SECURITY SYSTEMS General	1 (EA)	2002	
	D5030 COMMUNICATIONS & SECURITY	1954 D503007 CLOCK & PROGRAM SYSTEMS General	1 (EA)	1995	
	D5090 OTHER ELECTRICAL SERVICES	1954 D509003 GROUNDING SYSTEMS General	1 (EA)	2014	
E10 EQUIPMENT	E1090 OTHER EQUIPMENT	*CONVECTION OVEN SINGLE A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2014	
	E1090 OTHER EQUIPMENT	*CONVECTION OVEN SINGLE B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*DEEP FRYER E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*DISH WASHER E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2014	
	E1090 OTHER EQUIPMENT	*RANGE GAS E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2014	
	E1090 OTHER EQUIPMENT	*REFRIGERATOR REACH IN 2 DOOR D E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2014	
	E1090 OTHER EQUIPMENT	*SERVING LINE COOLER E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2014	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN A E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN B E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	
	E1090 OTHER EQUIPMENT	*STEAM COUNTER ELECTRIC MULTI BASIN C E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	



201* - Livorno ES/MS Bldg 201*	Livorno ES/MS (HE5408)
--------------------------------	------------------------

System	Component	Section Description	Quantity (UM)	Yr. Installed	Yr Painted
	E1090 OTHER EQUIPMENT	*STEAMER 2 DOOR E109002 FOOD SERVICE EQUIPMENT General	1 (EA)	2009	