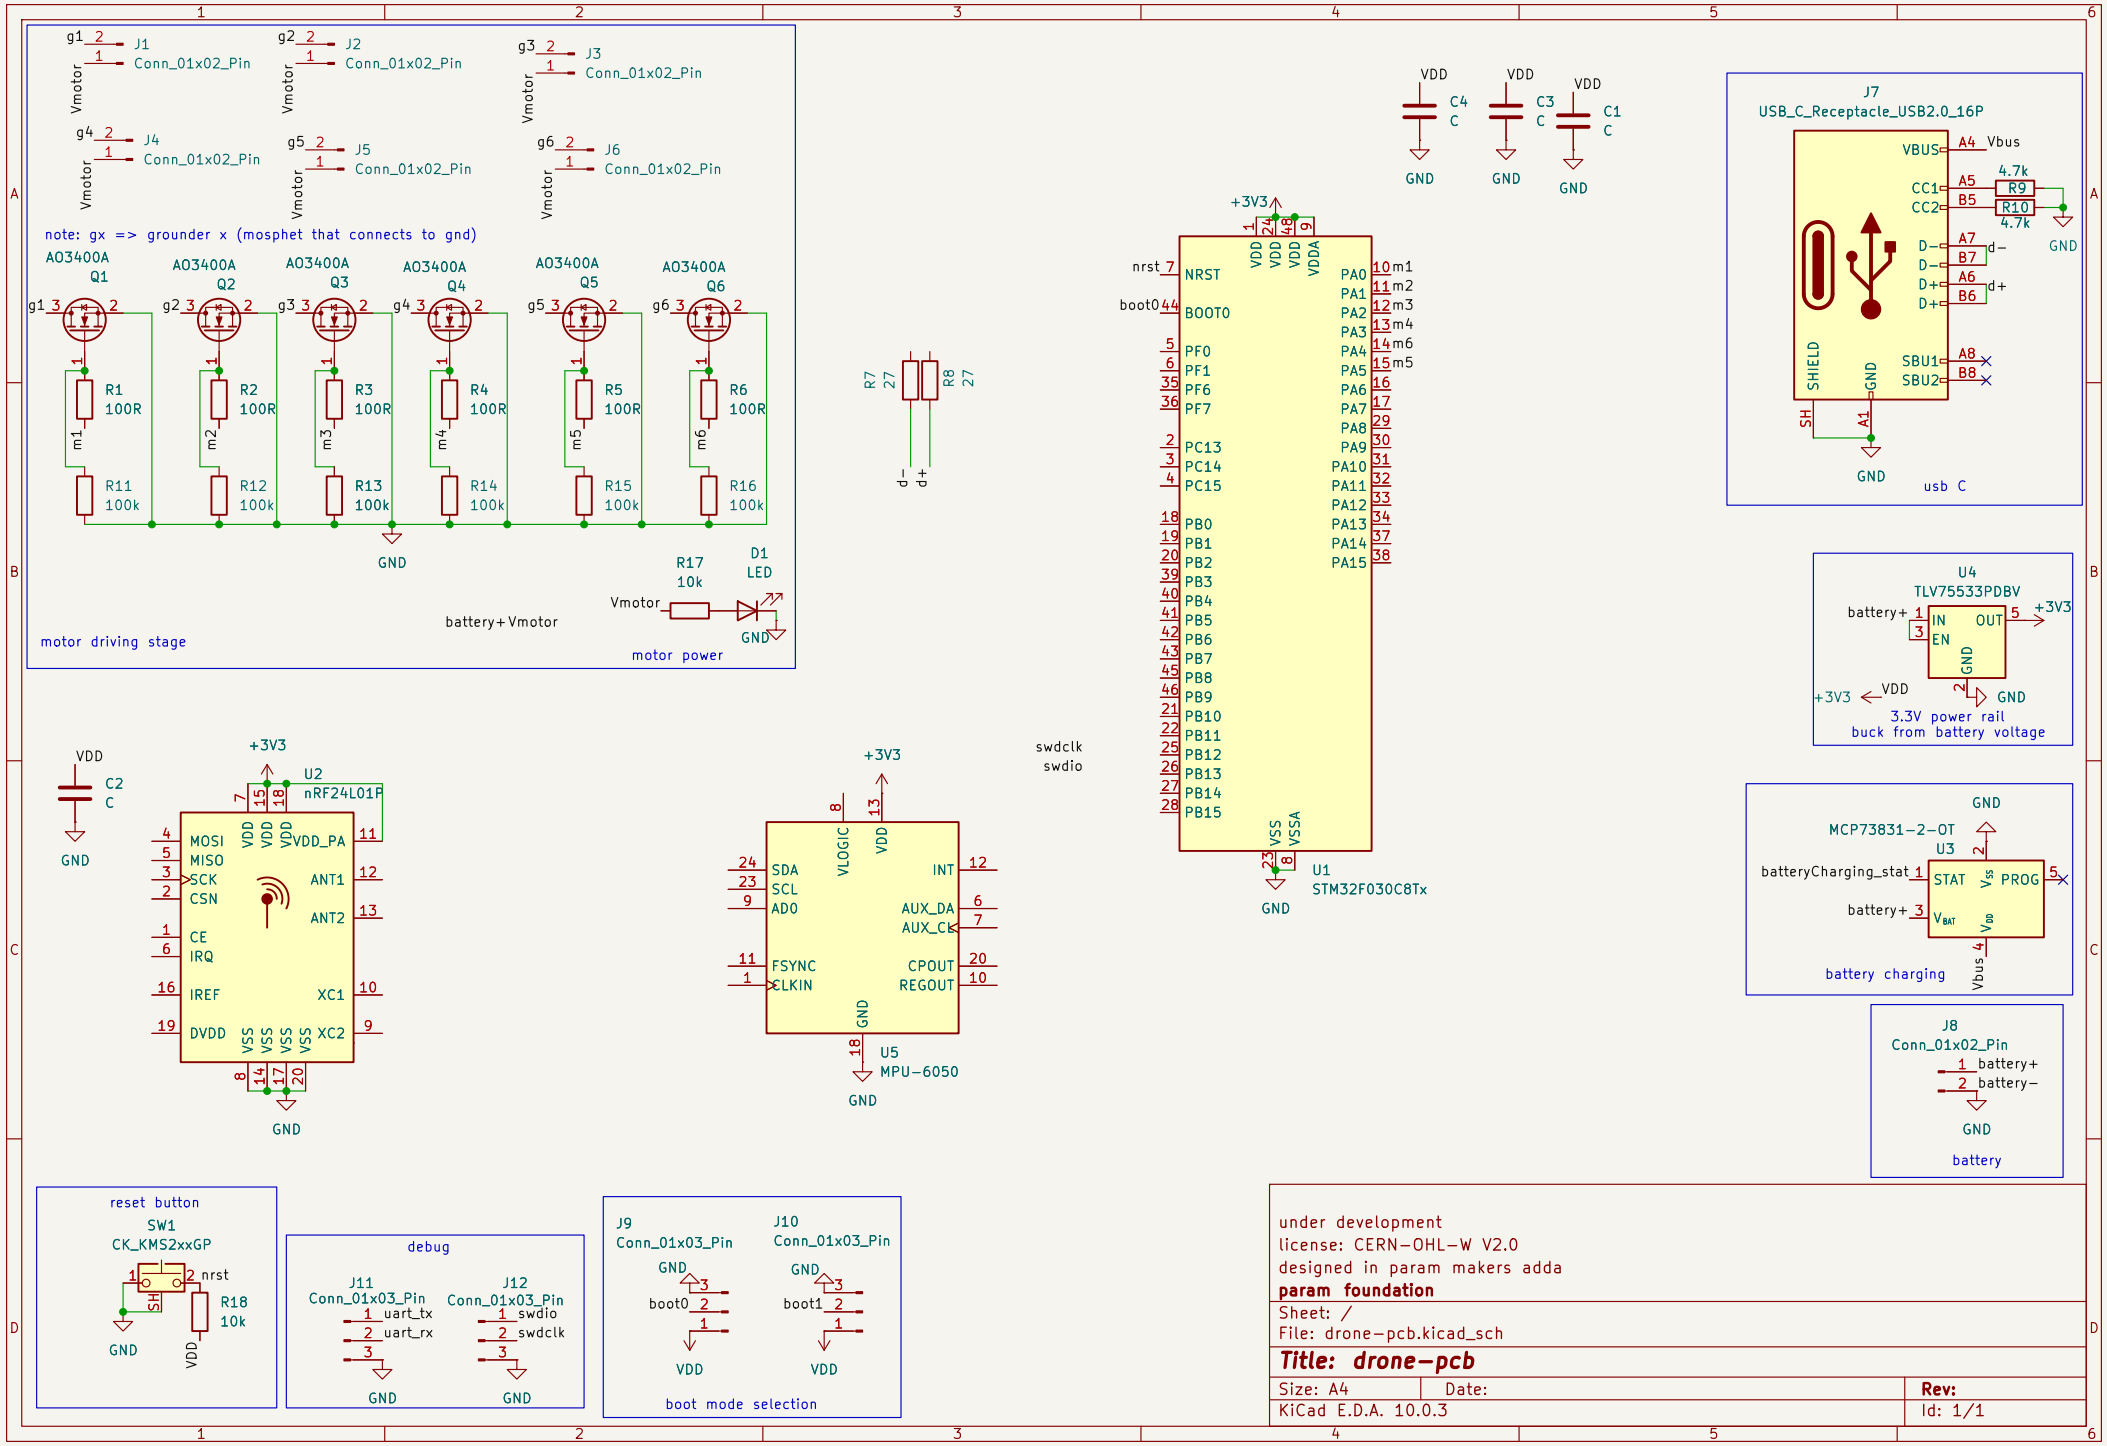

motor driving stage
note: gx => grounder x (mosphet that connects to gnd)
J1 Conn_01x02_Pin
J2 Conn_01x02_Pin
J3 Conn_01x02_Pin
J4 Conn_01x02_Pin
J5 Conn_01x02_Pin
J6 Conn_01x02_Pin
Vmotor
AO3400A
Q1
Q2
Q3
Q4
Q5
Q6
R1 100R
R2 100R
R3 100R
R4 100R
R5 100R
R6 100R
R11 100k
R12 100k
R13 100k
R14 100k
R15 100k
R16 100k
GND
R17 10k
D1 LED
battery+Vmotor
motor power
R7 27
R8 27
d−
d+
C4 C
C3 C
C1 C
+3V3
nrst
boot0
NRST
BOOT0
PF0
PF1
PF6
PF7
PC13
PC14
PC15
PB0
PB1
PB2
PB3
PB4
PB5
PB6
PB7
PB8
PB9
PB10
PB11
PB12
PB13
PB14
PB15
PA0 m1
PA1 m2
PA2 m3
PA3 m4
PA4 m6
PA5 m5
PA6
PA7
PA8
PA9
PA10
PA11
PA12
PA13
PA14
PA15
U1
STM32F030C8Tx
J7
USB_C_Receptacle_USB2.0_16P
VBUS
CC1
CC2
D−
D+
SHIELD
SBU1
SBU2
Vbus
4.7k
R9
R10
usb C
U4
TLV75533PDBV
battery+
IN
OUT
EN
3.3V power rail
buck from battery voltage
C2 C
U2
nRF24L01P
MOSI
MISO
SCK
CSN
CE
IRQ
IREF
DVDD
VDD_PA
ANT1
ANT2
XC1
XC2
swdclk
swdio
SDA
SCL
ADO
FSYNC
CLKIN
VLOGIC
AUX_DA
AUX_CK
CPOUT
REGOUT
INT
U5
MPU−6050
MCP73831−2−OT
U3
batteryCharging_stat
STAT
PROG
battery charging
J8
Conn_01x02_Pin
battery
reset button
SW1
CK_KMS2xxGP
R18 10k
debug
J11 Conn_01x03_Pin
J12 Conn_01x03_Pin
uart_tx
uart_rx
swdio
swdclk
J9 Conn_01x03_Pin
J10 Conn_01x03_Pin
boot0
boot1
boot mode selection
under development
license: CERN−OHL−W V2.0
designed in param makers adda
param foundation
Sheet: /
File: drone−pcb.kicad_sch
Title: drone−pcb
Size: A4
Date:
Rev:
KiCad E.D.A. 10.0.3
Id: 1/1