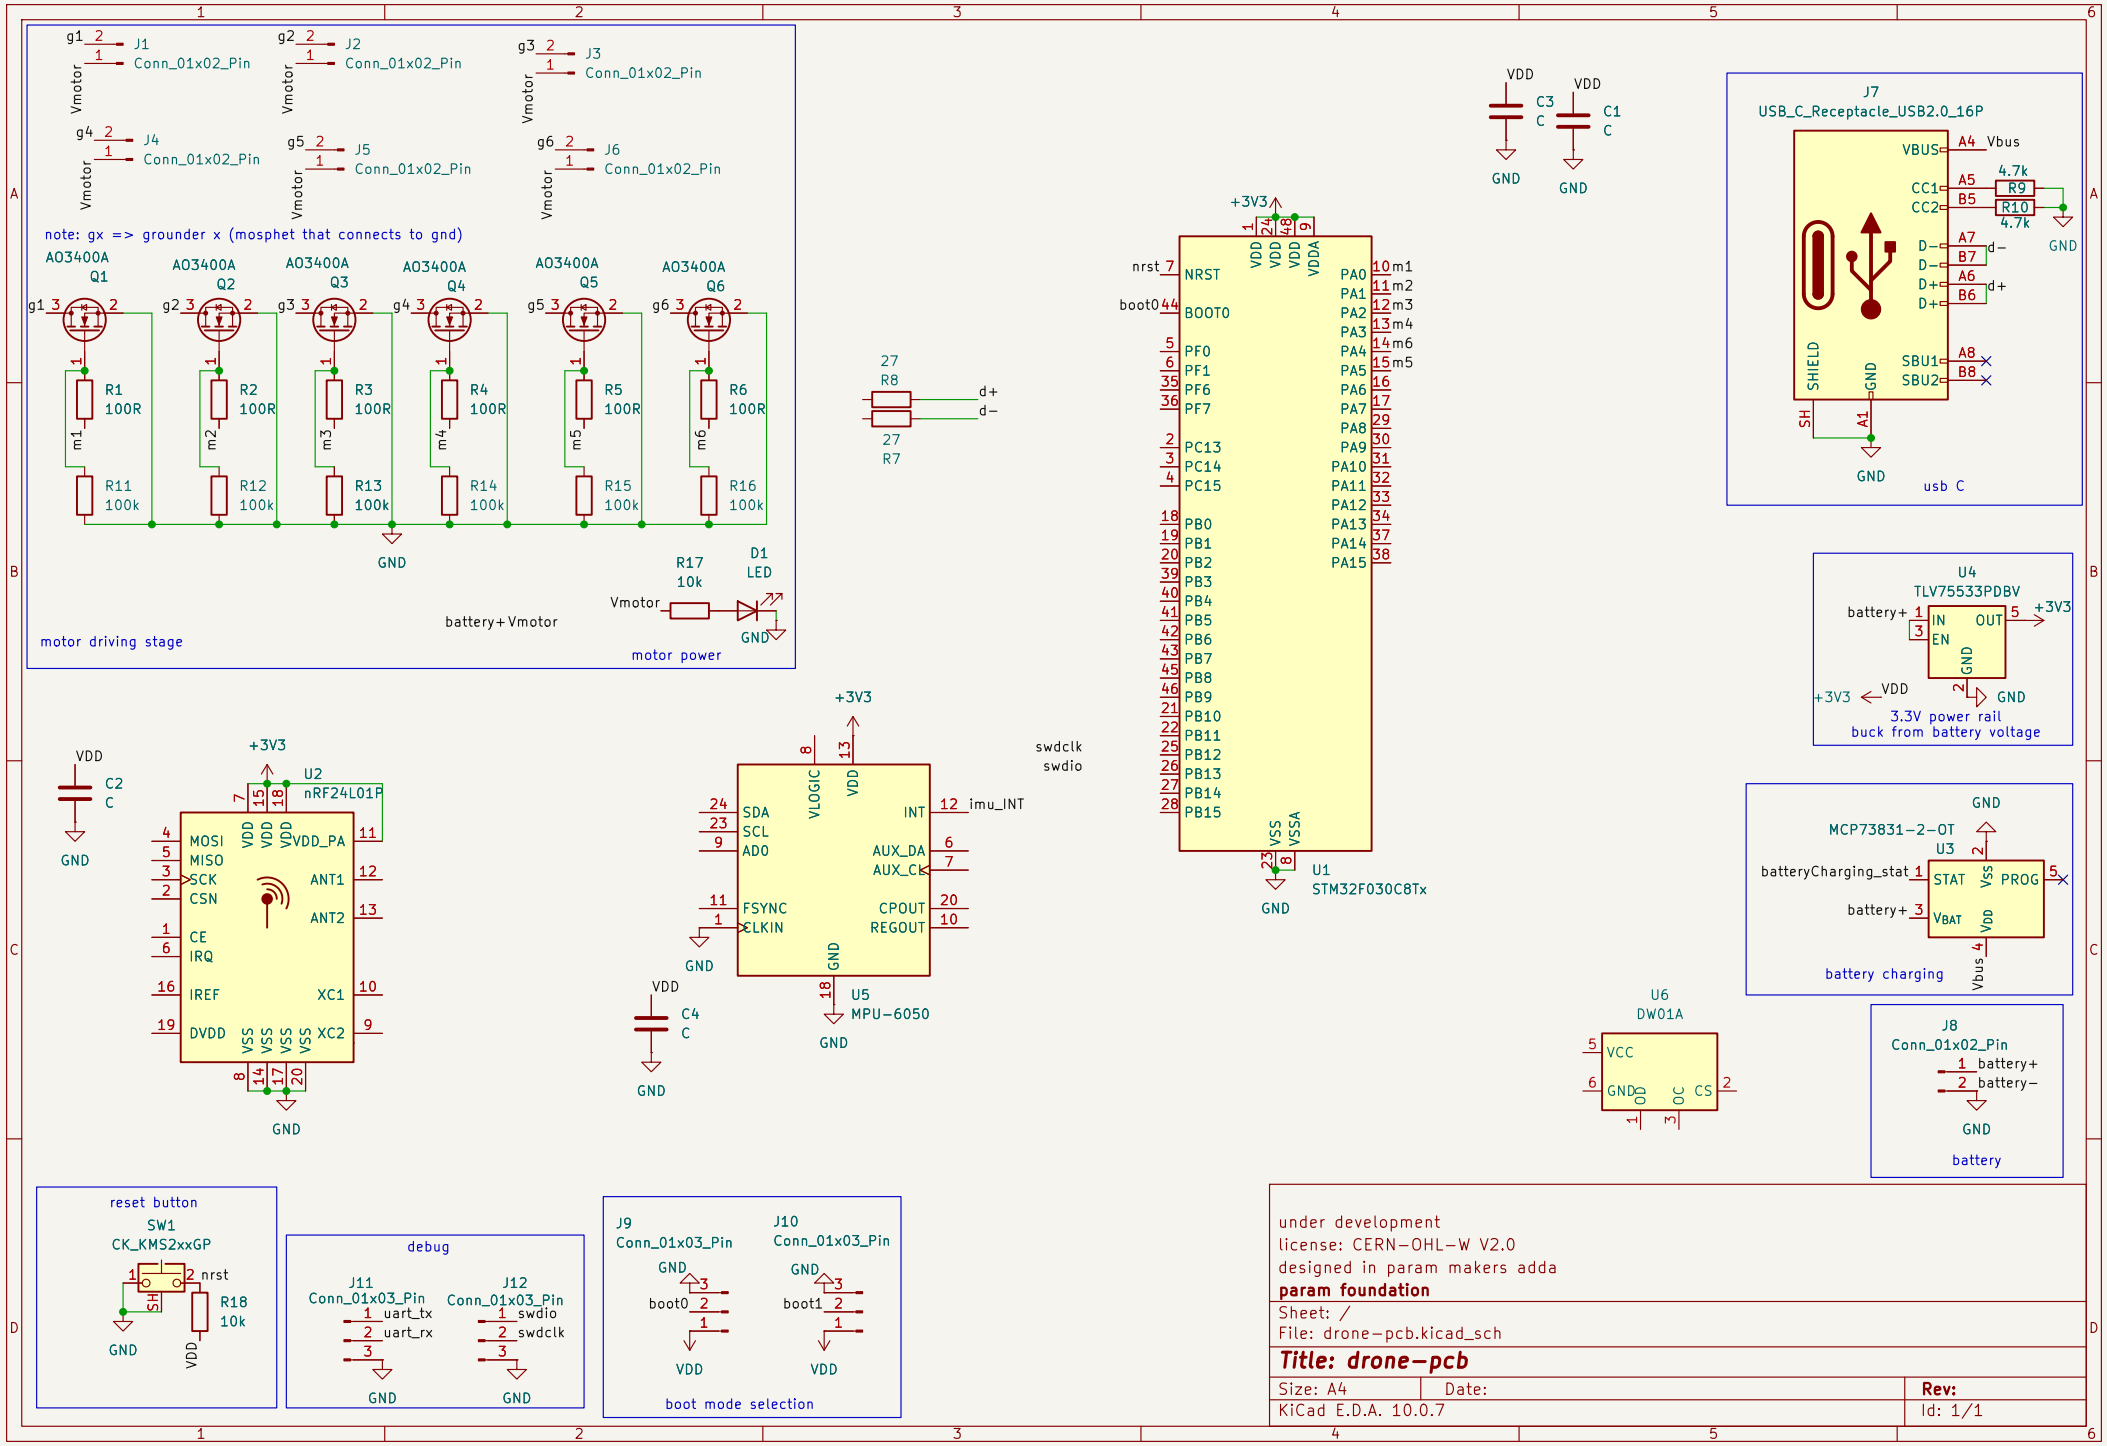

motor driving stage
note: gx => grounder x (mosphet that connects to gnd)
AO3400A
Q1
Q2
Q3
Q4
Q5
Q6
R1 100R
R2 100R
R3 100R
R4 100R
R5 100R
R6 100R
R11 100k
R12 100k
R13 100k
R14 100k
R15 100k
R16 100k
R17 10k
D1 LED
Vmotor
GND
battery+Vmotor
motor power
J1 Conn_01x02_Pin
J2 Conn_01x02_Pin
J3 Conn_01x02_Pin
J4 Conn_01x02_Pin
J5 Conn_01x02_Pin
J6 Conn_01x02_Pin
R8 27
R7 27
d+
d−
+3V3
VDD
C3 C
C1 C
C2 C
C4 C
U1
STM32F030C8Tx
U2
nRF24L01P
U5
MPU−6050
swdclk
swdio
imu_INT
J7
USB_C_Receptacle_USB2.0_16P
R9 4.7k
R10 4.7k
usb C
U4
TLV75533PDBV
3.3V power rail
buck from battery voltage
U3
MCP73831−2−OT
battery charging
U6
DW01A
J8
Conn_01x02_Pin
battery
reset button
SW1
CK_KMS2xxGP
R18 10k
nrst
debug
J11 Conn_01x03_Pin
J12 Conn_01x03_Pin
uart_tx
uart_rx
swdio
swdclk
J9 Conn_01x03_Pin
J10 Conn_01x03_Pin
boot0
boot1
boot mode selection
under development
license: CERN−OHL−W V2.0
designed in param makers adda
param foundation
Sheet: /
File: drone−pcb.kicad_sch
Title: drone−pcb
Size: A4
Date:
Rev:
Id: 1/1
KiCad E.D.A. 10.0.7