For the 2021-22 school year, Beverly Cleary (both Fernwood and Hollyrood combined) is forecast at 80%. Enrollment is expected to decline over the next several years, reaching 68% (for both Fernwood and Hollyrood combined) by 2030-31.

## FACILITY CONDITION SUMMARY

Beverly Cleary - Fernwood K-8 School is 110 years old, and in fair condition with a facility condition index (FCI) score of 0.1. As the average FCI score for K-8 schools in PPS is 0.16, the building is in comparatively better condition than most other K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The majority of plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was recently replaced and in excellent condition.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

» The building was observed to be fully sprinklered.
» An addressable fire alarm system headend (Silent Knight 5820) and associated detection and signal devices were installed (estimated) in 2014.

**Electrical**

» The site's main distribution switchboard was installed in 1978 and had exceeded its design life. The majority of the school's panel boards were installed in the same year and had exceeded their design lives. Three panel boards had been installed in 1998 as part of the technology upgrade and had no major deficiencies. One panel board was installed in 2005 for additional coverage of the kitchen and had no major deficiencies.
» An exterior lighting upgrade occurred in late 2019 to bring exterior light levels up to code.

**Arch/Struct/Site**

» The carpet floor finish in the main building was aged and had excessive wear in high traffic areas.
» The painted concrete floor finish in the main building was aged and had excessive wear and chipping.

## RECENT CAPITAL EXPENDITURES

» ADA Improvements in 2018
» Seismic Strengthened Roof in 2018
» Water Heater Replacement in 2018
» Plumbing Upgrades in 2019
» Fire Alarm Upgrades in 2020
» Drinking Fountain Fixture Replacements in 2020

## EDUCATIONAL SUITABILITY

» Science labs are undersized but in good overall condition.
» SPED classrooms are undersized (69% of size standard).
» Dedicated art and music rooms are present.
» The gym is adequately sized but with worn finishes.
» An auditorium is present.
» The entrance to the school is not controlled or supervised.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
» Create an outdoor learning area to support STEM instruction and project-based learning.
» Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# CESAR CHAVEZ K-8 SCHOOL

**ADDRESS**
5103 N WILLIS BLVD.

**CONSTRUCTION DATE**
1928 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
78,061 SF

**SITE AREA**
211,266 SF
4.85 ACRES

**CLASSROOMS COUNT**
32

**FUNCTIONAL CAPACITY**
589 STUDENTS

**CLUSTER**
ROOSEVELT

**MODULAR CLASSROOMS**
2

**ZONING**
R2 RESIDENTIAL 2,000 CU

## HISTORICAL SUMMARY

Situated in the primarily single family residential neighborhood of Portsmouth in North Portland, Cesar Chavez, formerly Clarendon-Portsmouth, School is a two-story school building with a ground floor basement. Built in 1928, the hybrid style building features Classical Revival detailing as well as Spanish Revival/Mediterranean Revival style tile roof. Cladding for the reinforced concrete structure consists of brick veneer with cast stone ornamentation. The building's irregularly shaped plan provides spaces for classrooms, a media center, an auditorium, a gymnasium, a cafeteria, and an administrative office.

Situated in the primarily single family, residential neighborhood of Portsmouth in North Portland, Cesar Chavez School, which faces North Willis Boulevard, is situated at the south side of the campus. The building is surrounded by asphalt covered parking lots and play areas. Grass covered play areas occupy the northeast portion of the campus.

While Portsmouth School is a notable historic resource that is representative of public school planning during the progressive era and the work of George Jones, it does not retain a level of historical integrity commensurate with other Portland Schools constructed during the same period; therefore, it is not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Chavez School has multiple attributes that place it in a high priority category for facility improvements that would advance the district's racial equity and social justice (RESJ) goals.

- For the 2021-22 school year, 77% of students are historically underserved, more than double the K-8 mean (29%).
- For the 2021-22 school year, 47% of students qualified for free or reduced lunch, more than double the K-8 mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Cesar Chavez K-8 School is forecast at 92% utilization. By the 2030-31 school year, utilization is projected to decrease to 80%.

## FACILITY CONDITION SUMMARY

Cesar Chavez K-8 School is 93 years old, and in poor condition with a facility condition index (FCI) score of 0.14. As the average FCI score for K-8 schools in PPS is 0.16, the building is in slightly better condition than many K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- The majority of the domestic water distribution equipment had been replaced in the past five years.
- Most of the air handling units had been replaced around 1990 and the condensate recovery equipment was replaced in 2017.
- The plumbing fixtures had no deficiencies observed. The domestic water piping and sanitary waste piping were not visible for assessment, but had no deficiencies reported.

### Fire Protection

- The building did not have a fire suppression system.
- The fire alarm control panel and alarm devices had no deficiencies observed.

### Electrical

- The electrical distribution equipment had no deficiencies observed.

### Arch/Struct/Site

- On the roof, the flashing around the parapet wall was heavily deteriorated. Significant ponding was occurring on the lower west roof.
- The skylight frames had moderate corrosion, tears and dents.
- The majority of the interior components were aged beyond typical design life.

## RECENT CAPITAL EXPENDITURES

- Select Flooring Replacements in 2018
- Refinished Gym Floor in 2019
- Exterior Fencing Extension in 2018
- Wireless Upgrades in 2018
- Installation of Restroom at Modular Classroom
- Drinking Fountain Fixture Replacements in 2020

## EDUCATIONAL SUITABILITY

- Classrooms are generally undersized (approximately 69% of size standards), particularly the kindergarten classrooms (60% of size standard). Some kindergarten classrooms lack a sink; others lack a dedicated restroom.
- One small science lab is present (71% of size standard) and lacks an emergency shower.
- The music room is located in the basement; an area with low ceilings and little natural light.
- The art classroom is very small (58% of size standard).
- The gym is only slightly undersized, but has poor acoustics. Locker rooms are dated.
- A large library media center is present; however, the layout is awkward to navigate.
- The main office retains active control of the main entry doors.
- The servery in the cafeteria is undersized, causing bottlenecks.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- Re-purpose space to create an art exhibition area.
- Security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory motor room.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
- Create an outdoor learning area to support STEM instruction and project-based learning.
- Renovate an existing space

to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
» Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications.

**Moderate Priority**

» Add an outdoor covered play structure or construct/re-purpose a structured movement room (2,000 SF) to support P.E. instruction.
» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entries of non-modernized schools to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.





# CLARK K-8 CREATIVE SCIENCE SCHOOL

**ADDRESS**
1231 SE 92ND AVE

**CONSTRUCTION DATE**
1955 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
50,227 SF

**SITE AREA**
300,564 SF
6.9 ACRES

**CLASSROOMS COUNT**
23

**FUNCTIONAL CAPACITY**
495 STUDENTS

**CLUSTER**
MCDANIEL

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

The former William Clark Elementary School is now known as Creative Science School. The school is a one-story brick veneer building designed in the International style. The campus consists of the 1955 single story brick-faced building that forms a modified H-shaped plan. The single-story brick wings that comprise the building are separated by a courtyard and form a variation on a finger plan type school. The building features International style elements such as a linear composition and an asymmetrical plan. In addition, bands of aluminum windows, flat roofs, overhangs, and a lack of ornamentation serves to reinforce the ideals of functionalism and minimalism.

The Creative Science School is situated in the Montavilla neighborhood of East Portland. The campus occupies a long, narrow parcel between SE 92nd Avenue on the east and SE 89th Avenue on the west. The school is located on the east end of the campus, and parking is to the north. Recreational facilities include play fields at the western end of the campus, and playgrounds at the south end of the campus. Berrydale Park is located immediately to the north of the school campus.

The school retains excellent integrity of location, design, setting, materials, workmanship, feeling, and association with its plan and exterior and interior finishes. The 1955 International style influenced school is recommended as eligible for the National Register of Historic Places (NRHP) for its association with the PPS program of post-war construction.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Creative Science School serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 17% of students are historically underserved, below the K-8

school mean (29%).
» For the 2021-22 school year, 14% of students qualified for free or reduced lunch, slightly below the K-8 mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Clark K-8 Creative Science School is forecast at 92% utilization. By the 2030-31 school year, utilization is projected to increase slightly to 93%.

## FACILITY CONDITION SUMMARY

Clark K-8 Creative Science School is 66 years old, and in poor condition with a facility condition index (FCI) score of 0.17. As the average FCI score for K-8 schools in PPS is 0.16, the building is in slightly worse condition than many K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The supply fan located in the gym fan room was not operating at the time of the assessment.
» Most of the domestic water equipment had been replaced in the past eight years and was observed to be in good condition.
» All the rooftop exhaust fans were replaced in 2015 and were in good condition. Most of the remaining HVAC equipment was original to the facility's construction.

**Fire Protection**

» There was a wet pipe sprinkler system that only served the stage area in the cafetorium.

**Electrical**

» The majority of the site's electrical system, including the service entrance equipment and distribution panel boards appeared to be original to the facility's construction and had exceeded typical design life.

**Arch/Struct/Site**

» The exterior brick wall was heavily weathered in spots, with some areas of minor to moderate cracking and patching. A major crack on the north wall of the gym had been patched but had since cracked through the repair.
» Most of the interior architectural assets were observed to be in average condition. The ceramic tile flooring in the restrooms had exceeded its design life.
» Many of the clerestory glass blocks in the north walls of the cafeteria and gym have been cracked or patched with unlike blocks.
» The exterior metal doors had exceeded their design lives. The exterior doors to the gym were heavily dented.
»

## RECENT CAPITAL EXPENDITURES

» ADA Upgrades in 2019-20
» Design for SRGP Grant in 2021
» Drinking Fountain Fixture Replacements in 2021

## EDUCATIONAL SUITABILITY

» Classrooms are generally appropriately sized.
» The school lacks purposely designed special education spaces.
» The science labs are partially-converted general classrooms with only one sink, no gas, and insufficient outlets.
» A separate music room is not provided; music instruction is held on the stage.
» A small art room is provided, as well as a kiln (not adjacent).
» The gym is significantly undersized (59% of size standard) and lacks acoustical treatments.
» The library media center is adequately sized and in good condition.
» The main office does not have active control of the main entry doors.
» A multipurpose cafeteria/auditorium is provided with a small kitchen.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.
» Incorporate recommendations of All Gender Task Force, including restrooms.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
» Create an outdoor learning area to support STEM instruction and project-based learning.
» Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
» Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications.

**Moderate Priority**

» Add an outdoor covered play structure or construct/re-purpose a structured movement room (2,000 SF) to support P.E. instruction.
» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# EAST SYLVAN K-8 SCHOOL

**ADDRESS**
1849 SW 58TH AVE

**CONSTRUCTION DATE**
1933 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
24,875 SF

**SITE AREA**
270,072 SF
6.2 ACRES

**CLASSROOMS COUNT**
11

**FUNCTIONAL CAPACITY**
174 STUDENTS

**CLUSTER**
LINCOLN

**MODULAR CLASSROOMS**
0

**ZONING**
R20 RESIDENTIAL 20,000 CU

## HISTORICAL SUMMARY

Situated near the residential neighborhood of Sylvan Hills in West Portland, the East Sylvan Middle School was built in 1933. The Colonial Revival style school building rests at the crest of a hill on a mostly grass-covered campus. The main wing of the school is located in the upper story with additional classrooms located in a daylight basement. On the lower level of the school, a single story attached wing projects to the north. The modified L-shaped mass of the building is covered with cross-hip roofs. Clad with red brick, the wood frame building sits on a poured concrete basement. The school facilities include classrooms, a gymnasium/ cafeteria, a library and computer lab, and an administrative office. The entry to the school is from the east on SW 58th Avenue. Recreational facilities on the campus consist of playfields that are situated to the west (rear) and north of the school. A driveway encircles the north and east sides of the school. An asphalt-covered parking area is located to the south of the school.

While the building is associated with a prominent architect and features some characteristic elements of schools designed in the early twentieth century, several alterations have diminished the building's integrity of materials, design, and feeling. Due to this loss of integrity, East Sylvan Middle School is not eligible under either NRHP Criteria A, B, or C.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities; East Sylvan has low poverty levels compared to the district average.

» For the 2021-22 school year, 10% of students are historically underserved, below the K-8 mean (29%)
» For the 2021-22 school year, 13% of students qualified for free or reduced lunch, below the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, East Sylvan is forecast at 140% utilization. By the 2030-31 school year, utilization is projected to increase slightly to 143%.

## FACILITY CONDITION SUMMARY

East Sylvan K-8 School is 88 years old, and in critical condition with a facility condition index (FCI) score of 0.32. As the average FCI score for K-8 schools in PPS is 0.16, the building is in significantly worse condition than most other K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

» The majority of the mechanical and plumbing system were aged and had exceeded their intended design lives. Signage was present throughout indicating pipe and equipment insulation contained asbestos. There were signs of an active leak in the domestic water distribution piping in Room 26B.

### Fire Protection

» The fire alarm control panel and devices were upgraded in 2018 and were in good condition with no deficiencies observed.
» The main facility had a wet-pipe sprinkler system typically covering the classrooms and corridors. No major deficiencies were observed or reported with the fire protection system at the time of assessment.

### Electrical

» Less than half of the distribution panel boards had exceeded design life. The 400-amp switchboard in the compressor room had exceeded design life.

### Arch/Struct/Site

» The wood window frames and trim have flaking paint and cracked sealant.
» There were a few cracked glass blocks on the west exterior.
» Minor cracking was observed on most concrete exterior walls.
» Stains on brick beneath windows indicate water may not be draining properly.
» Interior stair treads were heavily worn.

## RECENT CAPITAL EXPENDITURES

» Select Auditorium/Stage Upgrades in 2017
» Drinking Fountain Fixture Replacements in 2021

## EDUCATIONAL SUITABILITY

» The spatial configuration of some of the general classrooms does not align with the instructional program.
» The school lacks purposely designed special education spaces.
» A dedicated music room is not present.
» The school does not have a dedicated art classroom.
» A small cafegymatorium is present.
» The school site lacks appropriate fencing.
» The main office does not have remote control of the main entry doors.
» The library media center is located in a converted general classroom; it is undersized.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

» Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
» Create an outdoor learning area to support STEM instruction and project-based learning.
» Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.

- Facilities upgrades to provide a dedicated visual arts space configured and equipped per current Ed Specifications with a working, properly ventilated kiln.
- Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications.

**Moderate Priority**

- Add an outdoor covered play structure or construct/re-purpose a structured movement room (2,000 SF) to support P.E. instruction.
- Re-purpose an existing space into a wellness room.
- Allocate an area for a Reconnection Services office.
- Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
- Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

- Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

# FAUBION K-8 SCHOOL

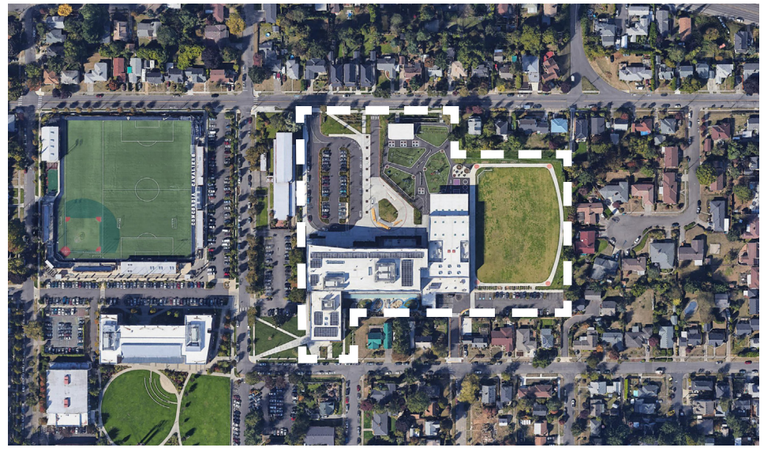

**ADDRESS**
3039 NE ROSA PARKS WAY

**CONSTRUCTION DATE**
2016 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
170,638 SF

**SITE AREA**
261,360 SF
6.0 ACRES

**CLASSROOMS COUNT**
44

**FUNCTIONAL CAPACITY**
710 STUDENTS

**CLUSTER**
JEFFERSON

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

The Faubion K-8 School has undergone a modernization program and is a new building.

Faubion K-8 School is situated in the Concordia neighborhood of Northeast Portland. The campus occupies portions of two city blocks between NE Portland Street on the south and NE Dekum Street on the north. The school is located on the west end of the campus. Parking is to the south, the playground is to the north, and play fields are to the east. The formal entrance to the building is from N.E. Dekum. However, the NE Rosa Parks Way entrances are used often since parking is located along this end of the building. Residential buildings provide a buffer between NE Rosa Parks Way and the school campus.

Faubion Elementary School is not eligible under either NRHP Criteria A, B, or C.

## RESJ CONSIDERATIONS

Faubion School has multiple attributes that place it in a high priority category for facility improvements that would advance the district's racial equity and social justice (RESJ) goals..

- For the 2021-22 school year, 72% of students are historically underserved, more than double the K-8 school mean (29%).
- For the 2021-22 school year, 44% of students qualified for free or reduced lunch, more than double the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Faubion K-8 School is forecast at 101% utilization. By the 2030-31 school year, utilization is projected to decrease to 98%.

## FACILITY CONDITION SUMMARY

Faubion K-8 School is five years old, and in good condition with a facility condition index (FCI) score of 0.0. As the average FCI score for K-8 schools in PPS is 0.16, the building is

in significantly better condition than other K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The HVAC and plumbing systems and equipment were renovated in 2016 and had no deficiencies observed.

**Fire Protection**

» Due to the 2016 full renovation, no major deficiencies were observed.

**Electrical**

» Due to the 2016 full renovation, no major deficiencies were observed.

**Arch/Struct/Site**

» Due to the 2016 full renovation, no major deficiencies were observed.

## RECENT CAPITAL EXPENDITURES

No recent projects, as Faubion was constructed in 2016.

## EDUCATIONAL SUITABILITY

» As a newer school building, Faubion was designed based on the district's Educational Specifications. As such, its educational suitability rating is very high.

## EDUCATIONAL PROGRAM

## FORECAST

**High Priority**

» Re-purpose space to create an art exhibition area.
» Security upgrades (as needed).
» Re-purpose an existing space into a sensory motor room.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
» Create an outdoor learning area to support STEM instruction and project-based learning.

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

TITLE **FUTURE SCHOOL**
ARTIST **ELY WALTERS**
GRADE **8**
SCHOOL **JACKSON**
TEACHER **JESSICA HICKEY**

# LAURELHURST K-8 SCHOOL

**ADDRESS**
840 NE 41ST AVE

**CONSTRUCTION DATE**
1923 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
59,239 SF

**SITE AREA**
126,760 SF
2.91 ACRES

**CLASSROOMS COUNT**
31

**FUNCTIONAL CAPACITY**
657 STUDENTS

**CLUSTER**
GRANT

**MODULAR CLASSROOMS**
8

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Situated in the Laurelhurst neighborhood of East Portland, the 1923 Laurelhurst K-8 School consists of a two-story, reinforced concrete with brick veneer building and a single story wood structure constructed in 1951 and added onto in 1968. Laurelhurst K-8 School is ornamented with quoins, decorative brickwork, and terra cotta belt courses and geometric details. Other details include a central entrance pavilion with terra cotta cartouche and entry surround. Bands of aluminum windows and arched multi-light windows with terra-cotta keystones provide the primary fenestration. The building is capped by a flat roof with a terra cotta capped parapet. Double loaded corridors provide access to the administrative offices, classrooms, and recreation spaces.

The neighborhood consists of a mix of single family residences built primarily between 1910 and 1950. The primary entrances to the school are from NE 41st Street. Play areas and open space occupy the eastern end of the campus. Located to the northeast of the primary building is a 1951 single story annex with flat roof and wood shingle and brick veneer siding. A two room portable with flat roof and plywood walls was added to the east end of the annex in 1968.

The school is neither an exemplar of the Colonial Revival style nor does it retain a level of historical integrity commensurate with other Portland Elementary Schools constructed during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Laurelhurst serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 14% of students are historically underserved; this is less than half the K-8 school mean (29%).
» For the 2021-22 school year, 6% of students qualified for free or reduced lunch, well below the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Laurelhurst is forecast at 106% utilization. By the 2030-31 school year, utilization is projected to decrease to 99%.

## FACILITY CONDITION SUMMARY

Laurelhurst K-8 School is 98 years old, and in poor condition with a facility condition index (FCI) score of 0.11. As the average FCI score for K-8 schools in PPS is 0.16, the building is in comparatively better condition than most other K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was recently replaced.
» The vast majority of the heating equipment, air handlers, exhaust fans, and associated equipment had exceeded their design lives.

**Fire Protection**

» The building did not have a sprinkler system.
» An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices had been installed within the last year.

**Electrical**

» The site's main distribution switchboard was original to the building and had exceeded its design life. In 1998, a new sub-distribution had been added that in turn serves the building's panel boards. The majority of these panel boards were observed to have exceeded their respective design lives, though several had been installed in the last 20 years (including two as part of the telecommunications upgrade in 1997). A generator had been installed in 2002.

**Arch/Struct/Site**

» The exterior wood windows were aged beyond typical design life.
» The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

» ADA Upgrades in 2019
» Fire Alarm Upgrades in 2020
» Drinking Fountain Fixture Replacements in 2020

## EDUCATIONAL SUITABILITY

» There are some open style classrooms which are used to supplement traditional instructional spaces.
» General classrooms average 80% of the size guideline.
» All Kindergarten classrooms are located in portables.
» The SPED classroom is undersized (68% of standard).
» The school has a small science lab (73% of size standard).
» The art room is undersized (61% of size standard).
» The school lacks a dedicated music room.
» The school has a small gym (61% of size standard) and a separate PE activity room that is approximately 1,286 SF.
» The school has a multipurpose cafetorium with dated finishes.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Re-purpose space to create an art exhibition area.
» Re-purpose an existing space into a sensory motor room.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
» Create an outdoor learning area to support STEM instruction and project-based learning.
» Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
» Re-purpose existing space to provide a dedicated music classroom configured and

equipped per current Ed Specifications.

**Moderate Priority**

» Add an outdoor covered play structure or construct/re-purpose a structured movement room (2,000 SF) to support P.E. instruction.
» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.





# SKYLINE K-8 SCHOOL

**ADDRESS**
11536 NW SKYLINE BLVD

**CONSTRUCTION DATE**
1939 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
38,327 SF

**SITE AREA**
254,390 SF
5.84 ACRES

**CLASSROOMS COUNT**
14

**FUNCTIONAL CAPACITY**
282 STUDENTS

**CLUSTER**
LINCOLN

**MODULAR CLASSROOMS**
0

**ZONING**
RES RURAL ZONING
EFU EXCLUSIVE FARM USE

## HISTORICAL SUMMARY

Situated on the rural fringes of Northwest Portland, Skyline School is located on NW Skyline Road. Built in 1939, the school building is situated on a mostly grass-covered campus. Additional structures on the parcel include a covered playshed located to the northwest of the main building and a garage building to the north. The school exhibits Minimal Traditional detailing. The modified U-shaped building is covered by a hipped roof and rests on a poured concrete foundation. The building is single story with a daylight basement. Cladding for the wood framing building consists of a mixture of brick veneer and vertical board siding. The school facilities include classrooms, a gymnasium, a library, and a cafeteria.

Development in the surrounding area is sparse with many large suburban residences set into the hills overlooking the Tualatin Valley. The building sits at the crest of a hill with playfields located on a terrace below the main level of the building. Additional grass covered play areas are located to the south and east of the school. An asphalt covered parking lot is situated on the east side of the school.

Skyline School is recommended as eligible for the National Register of Historic Places (NRHP) under Criterion A for its associations with the growth of the Portland Public School district in the rural fringes of the city by the mid twentieth century.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Skyline serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 12% of students are historically underserved; this is less than the K-8 school mean (29%).
» For the 2021-22 school year, 7% of students qualified for free or reduced lunch, well below the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Skyline K-8 School is forecast at 75% utilization. By the 2030-31 school year, utilization is projected to increase slightly to 76%.

## FACILITY CONDITION SUMMARY

Skyline K-8 School is 82 years old, and in poor condition with a facility condition index (FCI) score of 0.18. As the average FCI score for K-8 schools in PPS is 0.16, the building is in slightly worse condition than many K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The majority of the plumbing fixtures had exceeded typical design life.
- The domestic water piping and sanitary waste piping was assumed to be original and had assumed to have exceeded typical design life.
- Both of the water heaters and the boiler had exceeded typical design life.
- The air handling unit and supply/exhaust fans had exceeded typical design life.
- The classroom ventilators and heaters had exceeded typical design life.
- The pneumatic controls and associated air compressor had exceeded typical design life

**Fire Protection**

- The fire alarm control panel and alarm devices were in good condition and had no deficiencies observed.
- The fire suppression system had exceeded its design life.

**Electrical**

- The main distribution switchgear and eight of the distribution panels had exceeded typical design life.
- The interior lighting was approaching the end of typical design life.
- The natural gas generator and associated automatic transfer switch had exceeded typical design life.
- School custodian and Principal reported that the backup generator is insufficient. Power outages are common and the generator can only power lights. No heat is provided when the children are waiting to be picked up. There is also no potable water during power outages because the school is on a well.

**Arch/Struct/Site**

- The windows in classrooms 109 and 110 were damaged and no longer opened. The windows were part of the emergency egress plan for students.
- The exterior doors were aged beyond design life. They had areas of damage and were beginning to warp and not properly seal.
- The majority of interior architectural components had exceeded design life.
- The asphalt surfaces had large areas of alligator cracking.

## RECENT CAPITAL EXPENDITURES

- Radon Mitigation in 2018
- Select Flooring Replacements in 2018
- Stair Replacement in 2019
- Replacement of Damaged Ceiling Tiles in 2019

## EDUCATIONAL SUITABILITY

- The school has no designed spaces to accommodate differentiated learning or grouping patterns.
- The room finishes are worn/dated with old window blinds and cabinetry.
- Most general classrooms meet approximately 78% of the size standard.
- The school lacks purposely designed special education spaces.
- The music room is located in an inaccessible basement and only meets approximately 50% of the size standard.
- A science lab is present.
- The school lacks a dedicated art room.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Add or re-purpose space for a structured movement room (2,000 SF) to support P.E. instruction. If space for a structured movement area is unavailable, construct an additional covered play structure.
- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- Re-purpose space to create an art exhibition area.
- Security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory motor room.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
- Create an outdoor learning area to support STEM instruction and project-based learning.
- Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
- Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications. Music is currently held in a small basement area.
- Facilities upgrades to provide a dedicated visual arts space configured and equipped per current Ed Specifications with a working, properly ventilated kiln.

**Moderate Priority**

- Construct a new gymnasium.
- Re-purpose an existing space into a wellness room.
- Allocate an area for a Reconnection Services office.
- Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
- Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

- Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

# SUNNYSIDE K-8 SCHOOL

**ADDRESS**
3421 SE SALMON ST

**CONSTRUCTION DATE**
1925 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
56,245 SF

**SITE AREA**
135,036 SF
3.1 ACRES

**CLASSROOMS COUNT**
27

**FUNCTIONAL CAPACITY**
546 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR CLASSROOMS**
2

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

Sunnyside K-8 School is situated in the primarily single-family residential Sunnyside neighborhood of Southeast Portland. Built in 1925, the two-story school building with a ground floor basement has a reinforced concrete structure and is covered with brick veneer. The exterior is distinguished by its Classical Revival style cast stone and terra cotta ornamentation. The building's irregular shaped plan includes classrooms, an auditorium, a gymnasium, a cafeteria, a library, and an administrative office.

The school building faces SE Salmon Street, and is situated on a campus covered with a mixture of grass and asphalt. East of the school parcel is Sunnyside School Park, a City/School distinct joint-use property maintained by the City of Portland which contains playgrounds and play fields. An extensive garden is situated along the front elevation. The primary entrance to the building is on SE Salmon Street.

Due to the loss of integrity, Sunnyside K-8 School is not eligible under either NRHP Criteria A, B, or C.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Sunnyside serves a less diverse student population with relatively low poverty levels compared to the district average.

- For the 2021-22 school year, 21% of students are historically underserved; this is less than the K-8 school mean (29%).
- For the 2020-21 school year, 17% of students qualified for free or reduced lunch, slightly below the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Sunnyside K-8 School is forecast at 96% utilization. By the 2030-31 school year, utilization is projected to decrease significantly to 77%.

## FACILITY CONDITION SUMMARY

Sunnyside K-8 School is 96 years old, and in poor condition as with a facility condition index (FCI) score of 0.16. As the average FCI score for K-8 schools in PPS is 0.16, the building is typical of most K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The majority of the plumbing fixtures had exceeded their design lives.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, and associated equipment had exceeded their design lives.

**Fire Protection**

- The building was sprinkled in a single room. The piping was estimated to be original to the building and had exceeded its typical design life.
- The fire alarm control panel (Silent Knight 5207) and associated detection and signal devices were installed in 1997 and had exceeded its typical design life.
- The fire alarm control panel and alarm devices were in good condition and had no deficiencies observed.
- The fire suppression system had exceeded its design life.

**Electrical**

- The site's main distribution switchboard had been replaced in 1998. A majority of the panel boards in the building had also been either replaced or added within the last 20 years. Five panel boards, however, appeared to be original to the building and had exceeded their design lives. A generator had been installed at the school in 1998.

**Arch/Struct/Site**

- The roof coverings of the main building had areas of ponding, degranulating and debris buildup. Infrequent leaks were reported.
- The asphalt shingle roof at the portable had a section of damaged shingles at the roof peak.

## RECENT CAPITAL EXPENDITURES

- Exterior Fencing Extension in 2017-18
- Sink Hole Repairs in 2020
- Replacement of Auditorium Carpet in 2020
- Drinking Fountain Fixture Replacements in 2021

## EDUCATIONAL SUITABILITY

- Classroom sizes are smaller than the size standard.
- The school lacks purposely designed special education spaces.
- A general classroom is used as a science classroom.
- There is not a dedicated music room at this school.
- The art classroom is undersized (70% of standard) and poorly configured.
- The gym is greatly undersized (50% of space standard).
- The library media center is undersized with worn finishes.
- The site is not fenced. The main entrance is not easily supervised.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Re-purpose space to create an art exhibition area.
- Re-purpose an existing space into a sensory motor room.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
- Create an outdoor learning area to support STEM instruction and project-based learning.
- Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
- Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications.

**Moderate Priority**

- Add an outdoor covered play structure or construct/re-

purpose a structured movement room (2,000 SF) to support P.E. instruction.
» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.





# VERNON K-8 SCHOOL

**ADDRESS**
2044 NE KILLINGSWORTH ST

**CONSTRUCTION DATE**
1931 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
70,833 SF

**SITE AREA**
162,914 SF
3.74 ACRES

**CLASSROOMS COUNT**
25

**FUNCTIONAL CAPACITY**
579 STUDENTS

**CLUSTER**
JEFFERSON

**MODULAR CLASSROOMS**
4

**ZONING**
R2.5 RESIDENTIAL 2,500 CU

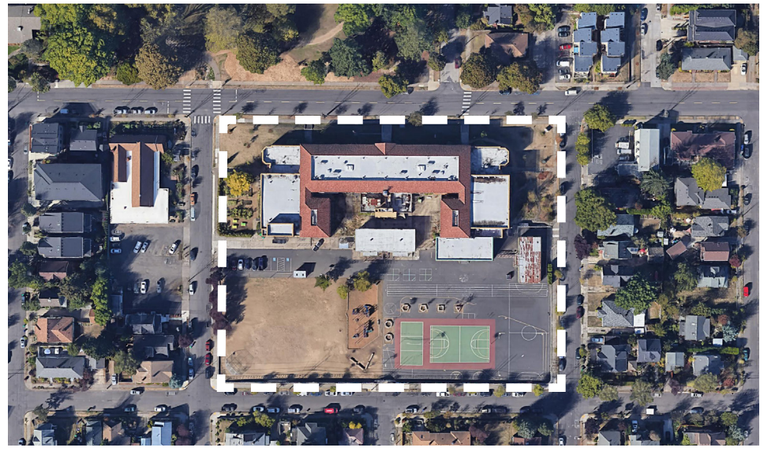

## HISTORICAL SUMMARY

Vernon K-8 School is located in Northeast Portland. Aligned on an east-west axis, the two story school building is situated at the north end of the campus. Wood frame "portables" located at the south and east side of the main building provide additional classroom space. The 1931 reinforced concrete structure, faced with variegated brick, rests on a poured concrete foundation. A hipped roof, clad with red pantiles, covers the central mass of U-shaped building. The remaining bays of the irregular shaped school facility are covered by flat roofs with a parapet. Designed in a modified Georgian style, cast stone is utilized to divide the elevations horizontally and to distinguish significant architectural spaces on the exterior elevations. Fenestration consists of a mixture of grouped metal frame and wood frame windows. The surrounding neighborhood consists primarily of single family residences. Much of the neighborhood had been developed by the 1920s, but the area continued to experience growth through the 1950s.

Vernon K-8 School does not retain a level of historical significance and integrity commensurate with other Portland Elementary Schools constructed of similar styles during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Vernon's student population is largely reflective of district-wide averages for K-8 schools:

» For the 2021-22 school year, 38% of students are historically underserved, more than the K-8 school mean (29%).
» For the 2020-21 school year, 25% of students qualified for free or reduced lunch, slightly above the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Vernon K-8 School is forecast at 106% utilization. By the 2030-31 school year, utilization is projected to

decrease to 97%.

## FACILITY CONDITION SUMMARY

Vernon K-8 School is 90 years old, and in poor condition with a facility condition index (FCI) score of 0.18. As the average FCI score for K-8 schools in PPS is 0.16, the building is in slightly worse condition than many K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of typical design life.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

- The building was partially sprinklered.
- An addressable fire alarm system headend (Silent Knight SK-5208) and associated detection and signal devices were installed (estimated) in 2005.
-

**Electrical**

- The site's main distribution switchboard was replaced in 1998 and had no major deficiencies. The majority of the school's panel boards, however, appeared to be installed in 1979 and had exceeded their design lives. The original main distribution switchboard appeared to be re-fed from the new main distribution panel board and had exceeded its design life. Three panel boards had been installed in 1997 as part of a technology upgrade and had no major deficiencies. A generator had been installed in 2000 and had no major deficiencies.

**Arch/Struct/Site**

- One skylight on the main building roof over the boiler room appeared to be original to the building and had corroded frames, broken glazing and deteriorated sealant.
- The carpet floor finish in the main building was aged and had excessive wear in high traffic areas.
- The painted concrete floor finish in the main building was aged and had excessive wear and chipping.
- The wood cabinet casework in Portable 1 was aged and had aged and damaged hardware.
- The suspended acoustic panel ceiling in Portable 2 was aged and had discolored frames and mismatched, damaged, and dirty panels.

## RECENT CAPITAL EXPENDITURES

- Installation of Climbing Wall in Gym in 2017
- Boiler Reinsulate in 2018
- Radon Mitigation in 2018
- HVAC Repairs in 2017-18
- Conversion of Courtyard to Outdoor Learning Center in 2020
- Asbestos Mitigation in 2020
- Fire Alarm Upgrades in 2020
- Drinking Fountain Fixture Replacements in 2020

## EDUCATIONAL SUITABILITY

- Classrooms are generally undersized. Kindergarten classrooms are open with a shared ex space between them causing significant noise interference.
- The SPED classroom is significantly undersized (54% of size standard) and lacks a restroom.
- One small science classroom is present.
- Music and art are each taught in portable buildings.
- One small gym is present (51% of size standard).
- The library media center is small and uninviting.
- The main office does not have remote control of the main entry doors.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Re-purpose space to create an art exhibition area.
- Re-purpose an existing space into a sensory motor room.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
- Create an outdoor learning area to support STEM instruction and project-based learning.
- Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
- Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications. Music is currently taught in a portable classroom.
- Facilities upgrades to provide a dedicated visual arts space configured and equipped per current Ed Specifications with a working, properly ventilated kiln. Art is currently taught in a portable classroom.

**Moderate Priority**

- Add an outdoor covered play structure or construct/re-purpose a structured movement room (2,000 SF) to support P.E. instruction.
- Re-purpose an existing space into a wellness room.
- Allocate an area for a Reconnection Services office.
- Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
- Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

- Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

# WINTERHAVEN K-8 SCHOOL

**ADDRESS**
3830 SE 14TH AVE

**CONSTRUCTION DATE**
1930 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
41,345 SF

**SITE AREA**
213,444 SF
4.9 ACRES

**CLASSROOMS COUNT**
15

**FUNCTIONAL CAPACITY**
261 STUDENTS

**CLUSTER**
CLEVELAND

**MODULAR CLASSROOMS**
1

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

Winterhaven School (formerly Brooklyn), is located in the Brooklyn neighborhood of Southeast Portland. The campus includes the L-shaped school building and a detached portable classroom.

Faced with variegated brick, the reinforced concrete building rests on a poured concrete foundation. Two bays project slightly from the west elevation to create a slight enclosure for the entry. The entry door is flanked by engaged pilasters and exhibits a wood window with a cast stone surrounded with bottom scrolls. Designed in the Mediterranean-Revival style, cast stone architectural details are located throughout the building and include cast stone coping, water table, and scroll work above the primary entry door. A brick chimney projects above the east elevation. Fenestration consists primarily of six-over-six, wood frame windows.

Asphalt covered play areas on the east side of the school connect to the larger open spaces of Brooklyn School Park. Development in the surrounding neighborhood consists primarily of single family residences built between 1928- 1950.

Winterhaven K-8 School retains a high degree of integrity and is therefore eligible for the National Register of Historic Places.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Winterhaven serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 8% of students are historically underserved; this is less than the K-8 school mean (29%).
» For the 2021-22 school year, 8% of students qualified for free or reduced lunch, significantly below the K-8 school mean (19%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Winterhaven K-8 School is forecast at 112% utilization. By the 2030-31 school year, utilization is projected to decrease to 108%.

## FACILITY CONDITION SUMMARY

Winterhaven K-8 School is 91 years old, and in poor condition with a facility condition index (FCI) score of 0.19. As the average FCI score for K-8 schools in PPS is 0.16, the building is in slightly worse condition than many K-8 schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The majority of the plumbing fixtures had exceeded their design lives.
» The domestic water distribution equipment was recently replaced and is in good condition.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

» A fire sprinkler system was not observed in the building.
» The fire alarm control panel (Silent Knight 5207) and associated detection and signal devices were installed in 2005.

**Electrical**

» The site's main distribution switchboard was installed in 1989 which puts it at the very end of its design life.
» Three panel boards had exceeded their design lives, while two (B1 and B2) had been replaced more recently, and panel boards IT1 and IT2 had been added with the telecommunications upgrade in 1997.

**Arch/Struct/Site**

» The wood window frames were deteriorated on the main building and north addition.
» The built-up roof was cracked and blistered.
» The roof hatch had worn springs, missing seals, and aged hardware.
» The majority of interior architectural components were nearing the end of design life.
» There were roof leaks in the north addition in the corridor below roof drains and in room 10. There were also stained ceiling tiles in these areas.

## RECENT CAPITAL EXPENDITURES

» Sidewalk/Curb Replacement in 2018
» Refinished Gym Floor in 2018
» Lead Paint Abatement in 2018
» Select Auditorium Upgrades in 2019
» Drinking Fountain Fixture Replacements in 2021

## EDUCATIONAL SUITABILITY

» While the facility is dated there are updated instructional spaces that provide for flexibility.
» Classrooms in the original building range from meeting 70 - 90% of the size standard. Those in the north addition meet the standard.
» Kindergarten classrooms do not have adjacent dedicated restrooms.
» The school lacks purposely designed special education spaces.
» The science room has perimeter lab stations and good cabinetry.
» Art is located in a portable classroom.
» There is not a dedicated music room at this facility.
» A cafegymatorium is present, limiting scheduling and use of the space.
» Minimal fencing is present.
» The main office is not able to effectively supervise the main entry and does not have remote control of the doors.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Add or re-purpose space for a structured movement room (2,000 SF) to support P.E. instruction. If space for a structured movement area is unavailable, construct an additional covered play structure.
» Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and

improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Provide new flexible classroom furnishings and student seating options to allow teachers to easily reconfigure spaces to accommodate a variety of activities.
» Create an outdoor learning area to support STEM instruction and project-based learning.
» Renovate an existing space to provide a minimum of one (1) multipurpose SPED focus classroom, equipped with and an accessible restroom per the district's Educational Specifications.
» Re-purpose existing space to provide a dedicated music classroom configured and equipped per current Ed Specifications.
» Facilities upgrades to provide a dedicated visual arts space configured and equipped per current Ed Specifications with a working, properly ventilated kiln. Art is currently taught in a portable classroom.

**Moderate Priority**

» Construct a new gymnasium.
» Re-purpose an existing space into a wellness room.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with the district's Educational Specifications. This may require renovation and/or relocation of the main office to provide direct visual supervision of the main entry.
» Invest in facilities upgrades to support project-based learning activities.

**Lower Priority**

» Modernize school to support new approaches to teaching and learning, emphasizing project-based learning, differentiated instruction, collaboration, and team teaching.
» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

| | |
|---|---|
| TITLE | **FUTURE SCHOOL** |
| ARTIST | **ELISSA PELLETIER** |
| GRADE | **8** |
| SCHOOL | **JACKSON** |
| TEACHER | **JESSICA HICKEY** |

# MIDDLE SCHOOLS

# BEAUMONT MIDDLE SCHOOL

**ADDRESS**
4043 NE FREMONT ST

**CONSTRUCTION DATE**
1926 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
91,294 SF

**SITE AREA**
249,163 SF
5.72 ACRES

**CLASSROOM COUNT**
34

**FUNCTIONAL CAPACITY**
701 STUDENTS

**CLUSTER**
GRANT

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Situated in the Beaumont-Wilshire neighborhood of East Portland, the Beaumont Middle School campus consists of a 1926 U-shaped building with two detached additions that house classrooms and recreation space. The primary two-story Classical Revival building is constructed of concrete with brick veneer and ornamented by a cast-stone façade with shield motif. Double loaded corridors provide access to the administrative offices, classrooms, and recreation spaces.

The neighborhood consists of a mix of commercial and single family residences built primarily between 1920 and 1950. Play areas and open space occupy the western end of the campus.

To the west of the main building is a single-story brick veneer building (1989) that houses a gym/auditorium, cafeteria, and art room; the two buildings—the 1929 primary building and the 1989 gymnasium/cafeteria building—are connected by a covered walkway.

Beaumont Middle School does not retain a level of historical integrity commensurate with other Portland schools constructed during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Facility improvements to Beaumont would be somewhat impactful underserved communities as RESJ indicators are similar to district averages.

- For the 2021-22 school year, 40% of Beaumont's students are historically underserved, slightly below the middle school mean (37%).
- For the 2021-22 school year, 19% of Beaumont students qualified for free or reduced lunch, below the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Beaumont is forecast at 75% utilization. By the 2030-31 school year, enrollment is projected to decline to 61%. Given this anticipated enrollment pattern, the district should plan for program consolidation or co-location with other programs.

## FACILITY CONDITION SUMMARY

Beaumont is nearly a century old and in poor condition with a facility condition index (FCI) score of 0.12. As the mean FCI score for non-modernized middle schools in PPS is 0.12, the Beaumont building is in typical condition to many of the middle schools in the district.

Facility condition assessment conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- The majority of the plumbing fixtures had exceeded their typical design lives. A portion of the domestic water distribution was replaced; however, many of the existing plumbing fixtures were noted to have lead present in the system and the water is not safe for consumption.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, and associated equipment had exceeded their typical design lives. Many of the perimeter steam heating units in classrooms were not functioning due to age.

### Fire Protection

- The building was observed to have a wet-pipe sprinkler system providing coverage of approximately 50% of the overall building. The piping and sprinkler heads were estimated to be original to the building and had exceeded their typical design life.
- A new addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices were installed in 2019.

### Electrical

- The majority of the site's electrical distribution system had exceeded its typical design life. The building's main distribution switchboard was upgraded in 1997. The original switchboard, however, had been installed in 1950 was still in service – having been back-fed from the new switchboard.

### Arch/Struct/Site

- The roof over the gymnasium in the main building had concrete faced insulated panel roofing over a built-up roof covering. There were many broken and displaced insulated panels and organic growth throughout this section of roof.
- The built-up roof covering of the Industrial Arts building had wrinkling and blistering throughout, top coat cracking throughout, and several areas that had been patched.
- The remaining exterior architectural components are planned for future assessment.
- The aged vinyl composition tile had worn surfaces and was cracked and chipped in several locations.
- The painted and sealed concrete finishes had excessive wear and chipping especially in the boiler room.
- The carpet floor finish had excessive wear and staining throughout, and torn carpet seams in the library had been patched with duct tape.

## RECENT CAPITAL EXPENDITURES

- Parking lot re-striping in 2019
- Fire alarm upgrades in 2020
- Drinking fountain fixture replacements in 2020
- Re-roofed modular building in 2020
- Library carpet replacement in 2020
- Electrical improvements in one room in 2020
- ADA upgrades (cafeteria door) in 2020
- Asbestos abatement in 2021

## EDUCATIONAL SUITABILITY

- Beaumont's classrooms are undersized; most general classrooms are 70% of the size standard..
- Some of the science labs are also undersized with insufficient sinks.
- Band is held in a modular classroom.
- SPED classrooms lack adjacent, dedicated accessible restrooms.
- The administrative offices are not located near the main entry, creating supervision and access control challenges.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- Addition of accessible and age-

appropriate play equipment and a covered play structure.
» Add flexible furnishings to support student collaboration.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms.
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Renovate main entry to align with district's updated Ed Specs.
» Relocate main office so that it is adjacent to the main entry.
» Re-purpose space to provide a dedicated security office.
» Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
» Add or re-purpose space for separate band and choir rooms with shared ensemble/practice rooms, music office, and music library. (Note: school currently only has one music room and it is located in a modular building)
» Upgrades to existing stage and/or small drama classroom to create a flexible performance area.
» Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.
» Athletic upgrades including the addition of new turf field with a track. (Note: aux gym is present)





# DA VINCI MIDDLE SCHOOL

**ADDRESS**
2508 NE EVERETT ST

**CONSTRUCTION DATE**
1928 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
88,659 SF

**SITE AREA**
435,600 SF
10.0 ACRES

**CLASSROOM COUNT**
25

**FUNCTIONAL CAPACITY**
714 STUDENTS

**CLUSTER**
GRANT

**MODULAR CLASSROOMS**
6

**ZONING**
R2.5 RESIDENTIAL 2,500 CU

## HISTORICAL SUMMARY

The Girl's Polytechnic High School (now known as da Vinci Arts Middle School) is a multi-story reinforced concrete structure with brick cladding designed in the Classical Revival style. The building is covered by a flat roof. The campus consists of a T-shaped building and four portable classroom buildings. Constructed in 1927, the school exhibits extensive use of cast-stone ornamentation to express its Classical Revival style.

The school features one and two-story projecting bays, as well as single and paired six-over-six double hung wood sash windows that are arranged symmetrically. The middle bay of the front façade, trimmed with recessed cast-stone balustrades and decorative panels, extrudes slightly from the rest of the building. The main portal protrudes off its face and is accented with Tuscan columns and a portico topped by an entablature.

Da Vinci Arts School is located in the Kerns neighborhood of Northeast Portland. The neighborhood consists of a mix of single family residences, multi-story apartments, and commercial and industrial buildings built primarily between 1920 and 1950. The da Vinci Arts campus occupies two-and-one-half city blocks and part of the NE 26th Avenue right-of-way. The school is located on the northwest end of the campus and play areas and open space are on the southwest and east end of the campus. Parking is provided along the west (side) and south (rear) elevations of the school building. Four portable buildings are located to the south of the primary building.

The 1927 Classical Revival school is recommended as eligible for the National Register of Historic Places (NRHP) for its association with progressive era public school, particularly trade school, construction in Portland (Criterion A).

## RESJ CONSIDERATIONS

Facility improvements to da Vinci would be less impactful to

underserved communities.

- For the 2021-22 school year, 28% of da Vinci's students are historically underserved, well below the middle school mean (37%).
- For the 2021-22 school year, 15% of da Vinci students qualified for free or reduced lunch; this is below the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, da Vinci is forecast at 63% utilization. Stable enrollment levels are forecasted over the next decade, with a utilization rate of 64% projected by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

da Vinci Middle School is 93 years old and in poor condition with a facility condition index (FCI) score of 0.11. As the average FCI score for non-modernized middle schools in PPS is 0.12, the building is in similar condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The majority of the plumbing fixtures had exceeded their design lives.
- The domestic water distribution equipment was in good condition.
- The vast majority of the heating and cooling equipment, exhaust fans, and associated equipment had exceeded their design lives.

**Fire Protection**

- A fire sprinkler system was not observed in the building.
- A new addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices were installed in 2019.

**Electrical**

- The site's electrical distribution system (including main switchboard and panel boards) had exceeded its intended design life.
- The panel boards in the portable/industrial art buildings have also exceeded their design lives.

**Arch/Struct/Site**

- A portion of the parapet flashing on the roof was loose and had torn off.
- The exterior stairs were observed with moderate cracking.
- The sheet vinyl flooring was observed with excessive wear and with chipped pieces.
- The carpet in the main office was observed with excessive wear.
- The exterior wall panels of Portable A had moderate denting.
- The wood exterior walls of Portable B were deteriorated.
- The wood frames and sealant of Portable E were heavily degraded. The roof was observed with missing tiles and organic growth.
- The majority of architectural components were nearing or had exceeded the end of design life.

## RECENT CAPITAL EXPENDITURES

- Asbestos abatement in stairwell (floor tiles) in 2018
- Sewer work in 2019
- Added foundation to modular building in 2020
- Drinking fountain fixture replacements in 2021

## EDUCATIONAL SUITABILITY

- Music is held in a small general classroom.
- Art class is held in a modular building.
- The gym is undersized.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- Addition of accessible and age-appropriate play equipment.
- Add flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

- Re-purpose an existing space into a wellness room.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Allocate an area for a Reconnection Services office.
- Renovate main entry to align with district's updated Ed Specs. This may require renovating main office to improve visual and/or physical connection to the main entry.
- Re-purpose space to provide a dedicated security office.
- Re-purpose space to create two (2) visual arts classrooms, providing separate teaching stations for 2D and 3D visual arts instruction. (Note: art is currently taught in a modular building)
- Add or re-purpose space to create two separate band and choir rooms with shared ensemble/practice rooms, music office, and music library. (Note: music is currently taught in a general classroom)
- Upgrades to existing stage / auditorium (as needed) to support performing arts instruction.
- Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

# GEORGE MIDDLE SCHOOL

**ADDRESS**
10000 N BURR AVE

**CONSTRUCTION DATE**
1950 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
76,142 SF

**SITE AREA**
315,810 SF
7.25 ACRES

**CLASSROOM COUNT**
31

**FUNCTIONAL CAPACITY**
617 STUDENTS

**CLUSTER**
ROOSEVELT

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Built in 1950, the Northwest Regional style George Middle School building is situated on a grass and asphalt-covered campus. The single story wood frame building is clad with brick veneer. The irregular shape plan building provides facilities for classrooms, a gymnasium, an auditorium, a media center, a cafeteria and an administrative office. Situated in a primarily residential area adjacent to the St. Johns neighborhood of North Portland the George Middle School, which faces North Burr Avenue, is built in the style of many post-World War II schools, with projecting "fingers" and courtyard. The asphalt-covered playground and playfields are located directly east and southeast of the school. An asphalt-covered half-circular driveway provides access to the front (west) elevation and the parking area is situated on the northwest corner of the school property near the front entrance.

George Middle School is a good example of the finger plan type school in the Northwest Regional style that exhibits a high degree of integrity with its floor plan, roof forms, cladding, and intact interior finishes. The school is recommended as eligible for the NRHP. The school was built in response to the residential development in North Portland during PPS program of post-war construction and is eligible for the NRHP under Criterion A.

## RESJ CONSIDERATIONS

George Middle School has two attributes that place it in a high priority category for facility improvements to advance the district's racial equity and social justice (RESJ) goals.

» For the 2021-22 school year, eighty-two percent (78%) of George's students are historically underserved; significantly above the middle school mean (37%).
» For the 2021-22 school year, 56% of George students qualified for free or reduced lunch; significantly above the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, George is forecast at 70% utilization. Over the next several years, enrollment is projected to decline, reaching 57% by the 2030-31 school year. Given this anticipated enrollment pattern, the district should plan for program consolidation or co-location with other programs.

## FACILITY CONDITION SUMMARY

George Middle School is 71 years old and in poor condition with a facility condition index (FCI) score of 0.13. As the average FCI score for non-modernized middle schools in PPS is 0.12, George's building is in slightly worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

» The majority of the plumbing fixtures had exceeded their typical design lives. The domestic water distribution equipment was recently replaced.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, controls and associated equipment had exceeded their typical design lives.

### Fire Protection

» An addressable fire alarm system headend (Silent Knight 5895XL) and associated detection and signal devices were installed in 2014.
» The building did not have a fire suppression system.

### Electrical

» The building's main electrical switchboard had exceeded their typical design life. Most of the panel boards had also exceeded their typical design life. A sub-distribution panel board (SDP1) had been added more recently (1998), along with two subfed panel boards (IT1 and IT2) as part of a telecommunications upgrade in 1998.

### Arch/Struct/Site

» The athletic lockers in the main building gymnasium had moderate damage throughout including bent doors and dents.
» The carpet floor finish in the main building had excessive wear and staining in high traffic areas.
» The wood floor in the main building gymnasium had exceeded typical design life. The whole floor was rippled with curling plank edges and there were areas of water damage from previous roof leaks.

## RECENT CAPITAL EXPENDITURES

» Drinking fountain fixture replacements in 2020

## EDUCATIONAL SUITABILITY

» Only two (2) science labs are present.
» Five (5) SPED rooms are provided, though none have access to a dedicated, adjacent accessible restroom.
» Music is held in a small general classroom.
» The administrative offices are located across the corridor from the main entry, creating supervision and access control challenges.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

» Addition of accessible and age-appropriate play equipment and a covered play structure.
» Add flexible furnishings to support student collaboration.
» Incorporate recommendations of All Gender Task Force, including restrooms and locker rooms (once finalized).
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.

### Moderate Priority

» George MS is among several middle schools identified for athletic upgrades. This would include construction of an auxiliary gym and the addition of new turf field with a track. The aux gym should be constructed to a seismic performance level of immediate occupancy, serving as a potential community shelter in the event of a natural disaster.
» Re-purpose an existing space into a wellness room.
» Re-purpose existing space

to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Renovate main entry to align with district's updated Ed Specs. This may require renovating main office to improve visual and/or physical connection to the main entry.
» Re-purpose space to provide a dedicated security office.
» Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
» Add or re-purpose space for separate band and choir rooms with shared ensemble/practice rooms, music office, and music library. (Note: school currently uses one general classroom for band instruction)
» Upgrades to existing stage / auditorium (as needed) to support performing arts instruction.
» Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# GRAY MIDDLE SCHOOL

**ADDRESS**
5505 SW 23RD AVE

**CONSTRUCTION DATE**
1952 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
74,614 SF

**SITE AREA**
576,299 SF
13.23 ACRES

**CLASSROOM COUNT**
26

**FUNCTIONAL CAPACITY**
622 STUDENTS

**CLUSTER**
WELLS-BARNETT

**MODULAR CLASSROOMS**
0

**ZONING**
R7 RESIDENTIAL 7,000 CU

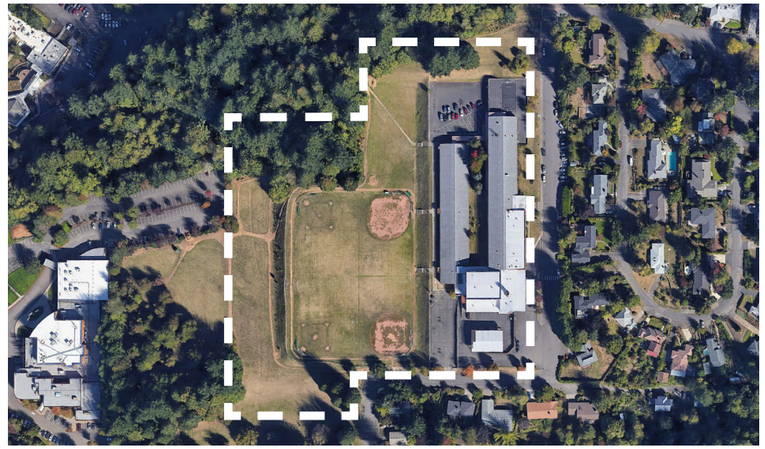

## HISTORICAL SUMMARY

The Gray Middle School site includes the primary school building and a covered playshed. The finger type plan school building exhibits some characteristics of the International style. The wings that comprise the U-shaped building are covered by a mixture of moderately pitched gable and flat roofs. The school is set into the crest of a hill with an upper rectangular wing that faces SW 23rd Avenue.

The basement level consists of two rectangular wings joined by a crawl space. Cladding for the wood frame structure consists of a mixture of brick veneer, concrete, and horizontal board siding. The school facilities include classrooms, a gymnasium, a cafeteria, media center/library, home economics, music room, and an administrative office. Gray is situated in the Hillsdale neighborhood of Southwest Portland. Development in the surrounding neighborhood consists primarily of large residential lots set amidst the hills of Southwest Portland. Grass covered playfields are located to the north and west of the school. An asphalt-covered play area is located to the south of the school building.

Robert Gray is associated with the expansion of Portland's southwest neighborhoods in the early 1950s and the emerging educational philosophies and planning of the period, and is therefore eligible under NRHP Criterion A.

## RESJ CONSIDERATIONS

Facility improvements to Gray would be less impactful to underserved communities.

» For the 2021-22 school year, 18% of Gray's students identify as BIPOC, well below the middle school mean (37%).
» For the 2021-22 school year, 9% of Gray's students qualified for free or reduced lunch, well below the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Gray is forecast at 88% utilization. Over the next several years, enrollment is projected to decline, reaching 73% by the 2030-31 school year,

## FACILITY CONDITION SUMMARY

Gray is 69 years old and in poor condition with a facility condition index (FCI) score of 0.15. As the average FCI score for non-modernized middle schools in PPS is 0.12, the Gray building is in worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

- The building was not observed to be sprinklered.
- An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices had been installed within the last year.

**Electrical**

- The site's main distribution switchboard was replaced in 1998 and was observed to be in good condition. The majority of the school's panel boards, however, were original to the building and had exceeded their design lives. Another group had been added during the mechanical systems upgrade in the basement in 1985, and while these two had exceeded their design lives, they were observed to have been well maintained. Two panel boards had been installed in 1997 as part of the technology upgrade.

**Arch/Struct/Site**

- Consider structural assessment based on signs of potential structural movement and water infiltration at the north end of the building. Grading and drainage repairs had been made to remedy water intrusion but there was damage to concrete walls and stairs.
- The wood framed windows were beyond typical design life. The frames had significant degradation on the interior and exterior. Staff commented that the window frames had lead paint. Previous repairs included adding exterior metal flashing on top of the wood frames with the most damage.
- The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

- Mold remediation in 2018
- Boiler repair and abatement in 2019
- Fire alarm upgrades in 2020
- Fire suppression back flow in 2020
- Drinking fountain fixture upgrades in 2021

## EDUCATIONAL SUITABILITY

- Gray has only one small gymnasium.
- Administrative offices are undersized; the principal does not have a dedicated office.
- The administrative offices do not have sight lines to the main entry creating supervision and access control challenges.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- Addition of accessible and age-appropriate play equipment.
- Add flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

- As a multi-level building without an elevator, Gray has been identified as a candidate for modernization under a future bond. Extensive accessibility upgrades to the building and site are needed.
- Re-purpose an existing space into a wellness room.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Allocate an area for a Reconnection Services office.
- Renovate main entry to align with district's updated Ed Specs. This may require renovating the main office to improve visual and/or physical connection to the main entry.
- Re-purpose space to provide a dedicated security office.
- Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- Add or re-purpose space for a 2nd music room with shared ensemble/practice rooms, music office, and music library.
- Create a flexible performance area by upgrading existing stage and/or repurposing space.
- Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

# HARRIET TUBMAN MIDDLE SCHOOL

**ADDRESS**
2231 N FLINT AVE

**CONSTRUCTION DATE**
1952 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
87,610 SF

**SITE AREA**
132,858 SF
3.05 ACRES

**CLASSROOM COUNT**
33

**FUNCTIONAL CAPACITY**
732 STUDENTS

**CLUSTER**
JEFFERSON

**MODULAR CLASSROOMS**
0

**ZONING**
CM3 COMMERCIAL MIXED USE 3

## HISTORICAL SUMMARY

The Harriet Tubman (originally Eliot Elementary School) is a two story brick veneer building designed in the International style. The campus consists of the original L-shaped building built in 1952 and 1983 ribbed concrete additions that are located along the east (front) and west (rear) elevations of the building. The Brutalist styled addition is connected to the original building creating a modified rectangular plan. A rectangular concrete building is located to the north of the primary facility, and the two facilities are connected via a covered breezeway.

Harriet Tubman school is situated in the Eliot neighborhood of East Portland. The neighborhood consists of a mix of commercial, industrial, and single and multi family residences. The campus occupies an irregular shaped parcel that is bound on the north by Lillis Albina Park, on the east by N. Flint Avenue, on the south by commercial buildings, and on the west by Interstate 5. The school is located on the south end of the campus and an industrial arts building is located to the north. Parking is provided along the south, west, and north sides of the building and play areas are provided in Lillis Albina Park to the north.

While Tubman is a notable historic building, it does not retain a level of historical integrity commensurate with other Portland schools constructed during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

As of this writing, Harriet Tubman Middle School is under consideration for relocation. Student population data is presented below.

» For the 2021-22 school year, 62% of Tubman's students are historically underserved; this is significantly higher than the middle school mean (37%).
» For the 2021-22 school year, 35% of Tubman students qualified for free or reduced lunch; this is above the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Tubman is forecast at 60% utilization. Over the next several years, enrollment is projected to decline slightly to 57% by the 2030-31 school year, Given this anticipated enrollment pattern, the district should plan for program consolidation or co-location with other programs.

## FACILITY CONDITION SUMMARY

Harriet Tubman Middle School is 69 years old, but in good condition as with a facility condition index (FCI) score of 0.05. The district invested significant funds to renovate Tubman in 2018, addressing facilities deficiencies as well as abatement of hazardous substances. As the average FCI score for non-modernized middle schools in PPS is 0.12; Tubman's FCI score indicates that its building is in better condition than all other non-modernized middle schools.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

» The building had several plumbing fixtures that appeared to date from original construction, but the majority of plumbing fixtures appeared to have been replaced at the time of the South Addition project in 1986. The plumbing system was observed to be in good condition with no major deficiencies.
» A majority of the HVAC system was upgraded in 2018 and is in excellent condition. Existing HVAC equipment serving the South Addition had not been replaced as part of the upgrade but appeared to be in good working condition.

### Fire Protection

» The building was observed to have a wet-pipe sprinkler system. The piping and sprinkler heads were estimated to have been installed as part of the South Addition and renovation project in 1986 and were observed to be in average condition with no major deficiencies.
» An addressable fire alarm system headend (Silent Knight 5820XL) and associated detection and signal devices were installed in 2014.

### Electrical

» As part of the upgrade of the overall HVAC system in 2018, a 480Y/277V electrical service was added to the building. This new service is in excellent condition and is dedicated to the new HVAC systems. However, the majority of the building is served by a 208Y/120V service that was installed with the South Addition and renovation project in 1986. The main 208Y/120V electrical switchboard and its associated panel boards had exceeded their typical design lives. The original 208Y/120V switchboard had been backfed from the main switchboard and was still in use, serving panels also dating back to original construction. These had all exceeded their typical design lives and should be replaced. A new sub-distribution board and associated panel board had been added in 1996 as part of a telecommunications upgrade.

### Arch/Struct/Site

» The lockers in the locker rooms had exceeded typical design life and had excessive wear and denting throughout.
» The aluminum south facing exterior windows of the Industrial Arts building had deteriorated frames and sealant. (The building function is now a dance room.)
» The exterior architectural components are planned for future assessment.

## RECENT CAPITAL EXPENDITURES

» Significant building system upgrades were completed in 2018 including a new mechanical system
» Drinking fountain fixture replacements in 2021

## EDUCATIONAL SUITABILITY

» Some classrooms lack windows.
» The school's SPED classroom is undersized.
» The cafeauditorum shares walls with classrooms, causing noise transference between spaces.
» The health room lacks space for a cot.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Addition of accessible and age-appropriate play equipment and a covered play structure.
- Add flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Complete 2020 bond-funded security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory room.
- Conduct inventory and assessment of SPED classrooms and support spaces to determine alignment with SPED programmatic goals.

**Moderate Priority**

- Re-purpose an existing space into a wellness room.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Allocate an area for a Reconnection Services office.
- Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- Add or re-purpose space for a 2nd music room with shared ensemble/practice rooms, music office, and music library.
- Upgrades to existing stage / auditorium (as needed) to support performing arts instruction.
- Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

| | |
|---|---|
| TITLE | **FUTURE SCHOOL** |
| ARTIST | **DELPHINA SEEGER** |
| GRADE | **8** |
| SCHOOL | **JACKSON** |
| TEACHER | **JESSICA HICKEY** |

# HARRISON PARK MIDDLE SCHOOL (ANTICIPATED)

**ADDRESS**
2225 SE 87TH AVE

**CONSTRUCTION DATE**
1949 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
110,775 SF

**SITE AREA**
235,224 SF
5.4 ACRES

**CLASSROOMS COUNT**
39

**FUNCTIONAL CAPACITY**
890 STUDENTS

**CLUSTER**
MCDANIEL

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

The Harrison Park School (originally Binnsmead Elementary) is situated in the Montavilla neighborhood of East Portland. The School is a single-story building with variegated brick veneer exhibiting limited elements of the International style.

Construction began on the campus in 1949, and today includes the main building, several additions made in 1975, and another addition built in 1987. The building features a linear composition and asymmetrical plan. These International style elements, in addition to bands of aluminum windows, flat roofs, overhangs, and lack of ornamentation, serve to reinforce the ideals of functionalism and minimalism.

The Montavilla neighborhood consists of single family homes and industrial and commercial buildings. The Harrison Park campus occupies a long rectangular shaped parcel that is bound on the north by Harrison Park, on the east by SE 87th Avenue, on the south by industrial buildings, and on the west by SE 85th Avenue.

The school is located in the middle of the campus with parking provided to the east and south of the building, a playground to the west, and play fields to the north.

While Harrison Park School is a notable historic building, it does not retain a level of historical integrity commensurate with other Portland schools constructed during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

At the time of this report, PPS is in the process of transitioning Harrison Park to a middle school configuration and changing the school's attendance boundaries. As such, future RESJ indicators are to be determined at this school.

## ENROLLMENT & UTILIZATION

Due to Harrison Park's impending transition to a middle school with resultant school boundary changes, enrollment projections for this school are not indicative of future numbers. The school's transition to a middle school will also impact its functional capacity and utilization numbers. As such, this section should be updated following Phase II of the Enrollment and Program Balancing process in spring 2022.

## FACILITY CONDITION SUMMARY

Harrison Park is 72 old and in critical condition with a facility condition index (FCI) score of 0.35. As the average FCI score for non-modernized middle schools in PPS is 0.12, Harrison Park's building is in much worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The pumps on the condensate recovery system were observed to be corroded and reportedly have functionality issues.
- Most of the domestic water equipment had been replaced in the past seven years and was observed to be in good condition.
- The roof drains were missing covers and were blocked by debris build-up.
- The boilers were original to the facility but had been retrofitted with gas burners.

**Fire Protection**

- The building did not have a fire suppression system.

**Electrical**

- The site's service entrance equipment and a portion of the electrical system's interior distribution was replaced in 2003. However, a portion of the system including distribution panels, the automatic transfer switch, and the lighting throughout the facility had exceeded their typical design lives.

**Arch/Struct/Site**

- There was a significant amount of standing water beneath the insulated roof panels, with some panels having been torn up and not replaced. Vegetation was growing throughout the inverted panel roof. There was evidence of roof leaks on the interior of the building.
- Multiple exterior windows were observed to be cracked or broken from vandalism.
- The exterior brick walls were weathered with minor to moderate cracking observed.
- The majority of the interior finishes were observed to be aged beyond their design lives, with patched VCT flooring and worn carpet throughout. The wall tiles in the corridors were cracked in many areas.
- Most of the wood interior doors had exceeded their typical design life.
- The wood cabinets and casework in the classrooms had excessive surface wear, typical in most classrooms.

## RECENT CAPITAL EXPENDITURES

- Fire alarm upgrades in 2020
- Drinking fountain fixture replacements in 2020
- Partial roof replacement in 2021

## EDUCATIONAL SUITABILITY

- General classrooms are undersized (72% of size standard on average).
- The school has a few purposely designed areas to accommodate flexible instruction.
- The school has two (2) science labs, a purposely designed music room, and an art room. A kiln is also present.
- The school has two (2) gyms and a dance room.
- The school has a small auditorium.
- The cafeteria is undersized for the current student enrollment.

## EDUCATIONAL PROGRAM FORECAST

- Harrison Park's educational program forecast is dependent upon the results of Phase II of the PPS Enrollment and Program Balancing initiative that was in process at the time of this document.

# HOSFORD MIDDLE SCHOOL

**ADDRESS**
2303 SE 28TH PL

**CONSTRUCTION DATE**
1925 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
88,532 SF

**SITE AREA**
293,159 SF
6.73 ACRES

**CLASSROOM COUNT**
32

**FUNCTIONAL CAPACITY**
696 STUDENTS

**CLUSTER**
CLEVELAND

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU
R2.5 RESIDENTIAL 2,500 CU

## HISTORICAL SUMMARY

The Hosford Middle School is located on a campus that consists of a multi-story school building and north wing additions. Situated in the primarily single family residential neighborhood of Southeast Portland, the school was built in 1925 in the Classical Revival style.

The building is a reinforced concrete structure with brick veneer cladding. The elevations feature cast stone and terra cottage ornamentation. The irregular shaped plan includes classrooms, an auditorium, a gymnasium, a cafeteria, and an administrative office. The building, which faces SE 28th Place, is situated on a grass-covered and asphalt campus with play fields west of the school. There are asphalt-covered playgrounds located to the west and south of the school. Two rectangular wings are connected to the north and northwest sides of the main building.

Due to the loss of integrity, Hosford School is not eligible under NRHP Criteria A, B, or C.

## RESJ CONSIDERATIONS

Facility improvements to Hosford would be less impactful to underserved communities.

- For the 2021-22 school year, approximately 20% of Hosford's students are historically underserved, less than the middle school mean (37%).
- For the 2021-22 school year, 20% of Hosford's students qualified for free or reduced lunch; this is less than the middle school mean (26%).
- Hosford would benefit from an additional elevator; the existing elevator does not serve all program areas.

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Hosford is forecast at 98% utilization. Over the next several years, enrollment is projected to decline, reaching 80% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

Hosford is 96 old and in fair condition with a facility condition index (FCI) score of 0.08. As the average FCI score for non-modernized middle schools in PPS is 0.12, Hosford's building is in better condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

- The building was not observed to be sprinklered.
- An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices had been installed within the last year.

**Electrical**

- The site's main distribution switchboard was replaced in 1998 and was observed to be in good condition. The majority of the school's panel boards, however, were original to the building and had exceeded their design lives. Another group had been added during the mechanical systems upgrade in the basement in 1985, and while these two had exceeded their design lives, they were observed to have been well maintained. Two panel boards had been installed in 1997 as part of the technology upgrade.

**Arch/Struct/Site**

- Consider structural assessment based on signs of potential structural movement and water infiltration at the north end of the building. Grading and drainage repairs had been made to remedy water intrusion but there was damage to concrete walls and stairs.
- The wood framed windows were beyond typical design life. The frames had significant degradation on the interior and exterior. Staff commented that the window frames had lead paint. Previous repairs included adding exterior metal flashing on top of the wood frames with the most damage.
- The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

- Asbestos mitigation (wood shop flooring) in 2018
- Playground equipment upgrades in 2018
- Repaving of walkway in 2019
- Asbestos abatement in 2020
- Drinking fountain fixture replacements in 2021

## EDUCATIONAL SUITABILITY

- General classrooms are greatly undersized (58% of size standard on average).
- The school lacks designated music rooms; the auditorium is used for this purpose.
- Art classes are held in the basement in an area not designed for this purpose.
- Only one small gym is present.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- Addition of accessible and age-appropriate play equipment and a covered play structure.
- Add flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Complete 2020 bond-funded security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory room.
- Conduct inventory and assessment of SPED classrooms and support spaces to determine alignment with SPED programmatic goals.

**Moderate Priority**

- Re-purpose an existing space into a wellness room.

- » Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- » Allocate an area for a Reconnection Services office.
- » Renovate main entry to align with district's updated Ed Specs. This may require renovating the main office to improve visual and/or physical connection to the main entry.
- » Re-purpose space to provide a dedicated security office.
- » Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- » Add or re-purpose space for separate band and choir rooms with shared ensemble/practice rooms, music office, and music library. (Note: music is currently taught in the auditorium)
- » Upgrades to existing stage / auditorium (as needed) to support performing arts instruction.
- » Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- » Expand P.E. storage by repurposing space and/or adding casework.
- » Allocate instructional, office, and meeting space for Virtual Scholars.
- » Athletic upgrades including construction of an auxiliary gym and the addition of new turf field with a track. The aux gym should be constructed to a seismic performance level of immediate occupancy, serving as a potential community shelter in the event of a natural disaster.

# JACKSON MIDDLE SCHOOL

**ADDRESS**
10625 SW 35TH AVE

**CONSTRUCTION DATE**
1966 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
219,281 SF

**SITE AREA**
1,586,891 SF
36.43 ACRES

**CLASSROOM COUNT**
40

**FUNCTIONAL CAPACITY**
908 STUDENTS

**CLUSTER**
WELLS-BARNETT

**MODULAR CLASSROOMS**
0

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

Jackson Middle School is located in the West Portland Park neighborhood of Southwest Portland. The sprawling, interconnected campus encompasses the main school building, which consists of an office, auditorium wing, cafeteria, gymnasium, library, two "resource centers" (classrooms that encircle an open middle space), and a detached 1970 autoshop. Originally constructed as a high school, this "unit" plan school is indicative of trends in modernist architectural movements of the mid-1960s.

Constructed of precast concrete slabs with polished gravel exterior surfaces, the building's various functions are communicated by the different heights, massing, and fenestration patterns for each section of the building. The building also reflects the influences of the more suburban context as it is situated off the main road, approached via a U-shaped drive, and set within an expansive property.

The campus occupies a roughly square shaped parcel that is bounded to the north by SW Alfred St., to the east by SW 35th Ave., to the west by SW 40th Ave. and to the south by residential development. The school building is approached via a U-shaped driveway that extends west of 35th Ave. to allow for easy drop off to a concrete column lined shelter on the front (east) side of the school. Development in the surrounding area consists primarily of single family residences built between 1930 and 2000.

The Jackson School retains its integrity with its floor plan, and many of the exterior and interior finishes remain intact. Therefore it is recommended as eligible for the NRHP. The school, as PPS's only example of a unit plan design, is further eligible for the NRHP under Criterion C.

## RESJ CONSIDERATIONS

Facility improvements to Jackson would be less impactful to underserved communities.

- For the 2021-22 school year, 24% of Jackson's students are historically underserved, below the middle school mean (37%).
- For the 2020-21 school year, 15% of Jackson students qualified for free or reduced lunch, well below the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Jackson is forecast at 91% utilization. Over the next several years, enrollment is projected to decline, reaching 80% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

Jackson Middle School is 55 years old and in fair condition with a facility condition index (FCI) score of 0.09. As the average FCI score for non-modernized middle schools is 0.12, Jackson's building is in better condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

### Fire Protection

- The building was not observed to be sprinklered.
- An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices had been installed within the last year.

### Electrical

- The site's main distribution switchboard was replaced in 1998 and was observed to be in good condition. The majority of the school's panel boards, however, were original to the building and had exceeded their design lives. Another group had been added during the mechanical systems upgrade in the basement in 1985, and while these two had exceeded their design lives, they were observed to have been well maintained. Two panel boards had been installed in 1997 as part of the technology upgrade.

### Arch/Struct/Site

- Consider structural assessment based on signs of potential structural movement and water infiltration at the north end of the building. Grading and drainage repairs had been made to remedy water intrusion but there was damage to concrete walls and stairs.
- The wood framed windows were beyond typical design life. The frames had significant degradation on the interior and exterior. Staff commented that the window frames had lead paint. Previous repairs included adding exterior metal flashing on top of the wood frames with the most damage.
- The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

- Roof replacement and seismic upgrades in 2021.
- Drinking fountain fixture upgrades in 2021.

## EDUCATIONAL SUITABILITY

- The SPED classrooms do not have a dedicated, adjacent accessible restroom. Four (4) of the school's science labs lack sinks.
- Although there is an auditorium present, it is in poor condition with missing and damaged seats.
- The fixed bleachers in the gymnasium are in disrepair and unusable.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- Develop the Jackson campus as a regional athletics hub serving the district. At minimum, provide double-wide football/soccer fields (side-by-side) with artificial turf and field lighting. May also include additional interior and exterior athletic upgrades.
- Addition of accessible and age-appropriate play equipment and a covered play structure.
- Add flexible furnishings to

support student collaboration.
» Incorporate recommendations of All Gender Task Force, including restrooms and locker rooms (once finalized).
» Re-purpose space to create an art exhibition area.
» Complete 2020 bond-funded security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory room.
» Conduct inventory and assessment of SPED classrooms and support spaces to determine alignment with SPED programmatic goals.

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
» Add or re-purpose space for a 2nd music room with shared ensemble/practice rooms, music office, and music library.
» Upgrades to existing stage / auditorium (as needed) to support performing arts instruction.
» Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# JACKSON MS SITE STUDY

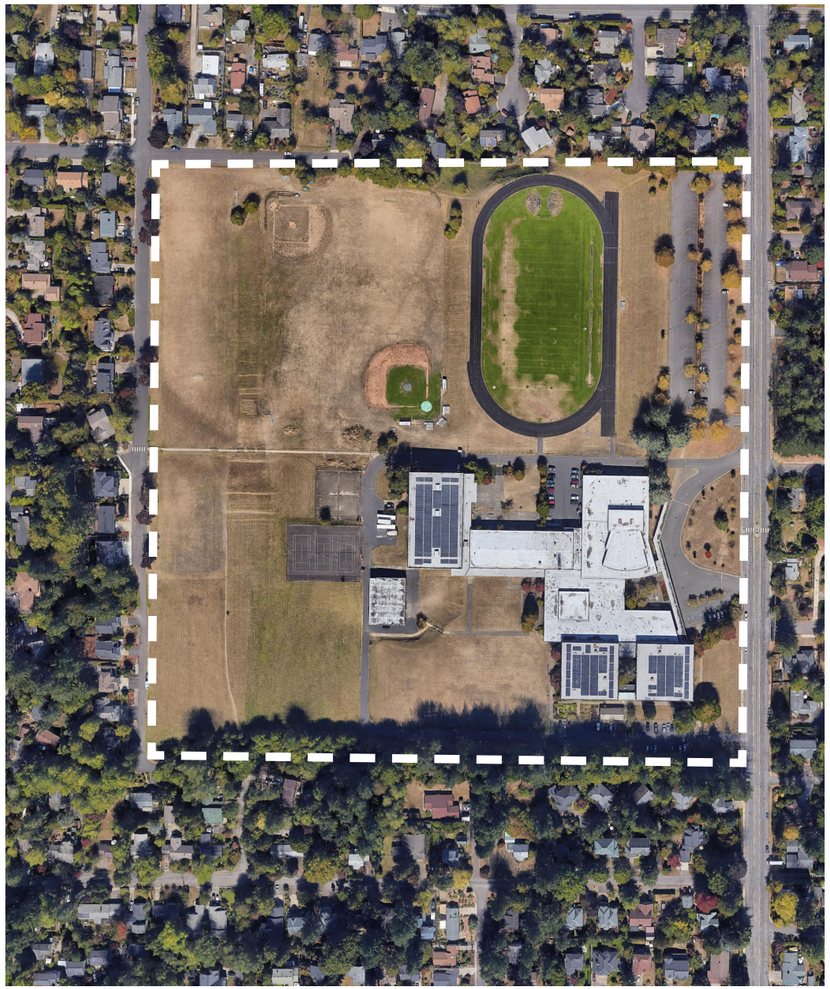

**Existing Site**

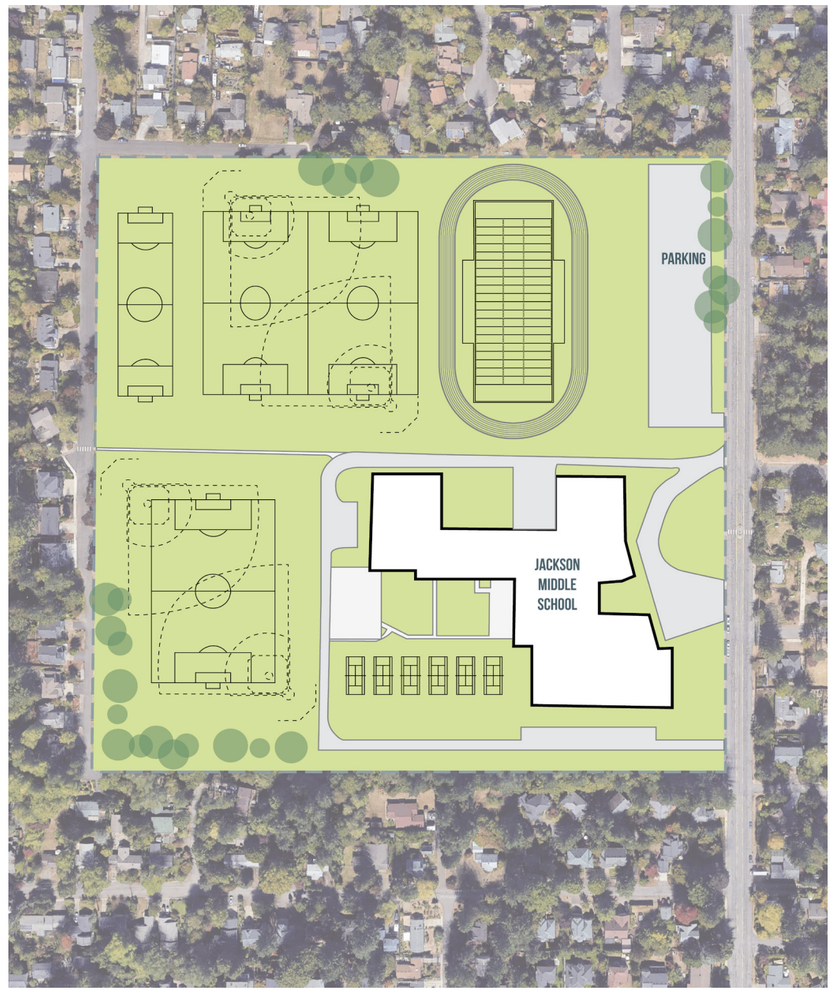


**Proposed Athletics Programming**

# KELLOGG MIDDLE SCHOOL

**ADDRESS**
3300 SE 69TH AVE

**CONSTRUCTION DATE**
2021

**LEVELS**
3

**BLDG AREA**
108,110 SF

**SITE AREA**
252,648 SF
5.8 ACRES

**CLASSROOMS COUNT**
33

**FUNCTIONAL CAPACITY**
803 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR CLASSROOMS**
0

**ZONING**
R5 - RESIDENTIAL 5,000
RM1 - RESIDENTIAL MULTI-DWELLING 1
RM2 - RESIDENTIAL MULTI-DWELLING 2

## HISTORICAL SUMMARY

Kellogg Middle School was rebuilt in 2021.

# LANE MIDDLE SCHOOL

**ADDRESS**
7200 SE 60TH AVE

**CONSTRUCTION DATE**
1927 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
94,753 SF

**SITE AREA**
395,960 SF
9.09 ACRES

**CLASSROOM COUNT**
39

**FUNCTIONAL CAPACITY**
770 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Lane Middle School is situated in the Brentwood Darlington neighborhood of southeast Portland. The two-story building rests on a poured concrete foundation. Constructed from reinforced concrete with a cladding of variegated light red brick, the Classical Revival style building features cast stone cartouches, arched window and door openings, and coping at the parapet. Later additions to the school are also clad in variegated brick but with minimal architectural ornamentation. Development in the neighborhood consists of primarily single family residences constructed between 1925 and 1950. The school campus retains a pastoral quality due to its location immediately to the south of Brentwood Park. Tennis courts, ball fields, and playgrounds occupy the east side of campus. The primary entrance to the campus is from 60th Avenue. Secondary entrances are located adjacent to the asphalt covered parking areas that occupy the north and south ends of the building.

Lane does not retain a level of historical integrity commensurate with other Portland Middle Schools constructed of similar styles during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Lane Middle School has multiple attributes that place it in a high priority category for facility improvements to advance the district's racial equity and social justice (RESJ) goals.

- For the 2021-22 school year, 43% of Lane's students are historically underserved; above the middle school mean (37%).
- For the 2021-22 school year, 44% of Lane students qualified for free or reduced lunch; above the middle school mean (26%).
- Lane Middle School is a two-story building without an elevator preventing students with mobility challenges or physical disabilities from accessing spaces on the 2nd level.

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Lane is forecast at 53% utilization. Over the next several years, enrollment is projected to decline, reaching 41% by the 2030-31 school year. Given this anticipated enrollment pattern, the district should plan for program consolidation or co-location with other programs.

It is important to note that PPS is currently considering enrollment and program redistribution scenarios between Lane and Harrison Park as part of the conversion of Harrison Park into a middle school. As such, Lane's enrollment will likely differ significantly from the current forecast.

## FACILITY CONDITION SUMMARY

Lane is nearly a century old and in poor condition with a facility condition index (FCI) score of 0.13. As the average FCI score for non-modernized middle schools in PPS is 0.12, Lane's building is in slightly worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- The majority of the plumbing fixtures had exceeded their design lives.
- The domestic water distribution equipment was recently replaced and was in good condition.
- The vast majority of the heating and cooling equipment, exhaust fans, and associated equipment had exceeded their design lives.

Fire Protection

- The building contained a partial fire sprinkler system. The related piping was estimated to be original to the building and had exceeded its intended useful design life.
- An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices were installed in 2018. Some horn notification devices appeared to have been installed prior to this and were reused.

### Electrical

- The majority of the site's electrical distribution system had exceeded its intended design life.
- The main distribution switchboard was installed in 1987 (as were most of the building's panel boards); however, the original switchboard (installed in 1960) was still in service and had been back-fed from the new service.

### Arch/Struct/Site

- The large roof hatch had weak springs and broken latch hardware. The small roof hatch had missing hardware.
- The cabinets and countertops were observed with excessive wear.
- There were damaged, cracked, and missing vinyl composition tile flooring throughout.
- The carpeting in high traffic areas was observed with excessive wear.
- There were missing glue-on acoustic ceiling tiles.
- The windows, doors, and lockers were nearing the end of typical design life.

## RECENT CAPITAL EXPENDITURES

- Asbestos abatement (boiler) in 2017.
- Reader board repair in 2018.
- Flooring replacement / asbestos abatement in one room in 2019.
- Radon mitigation in 2019.
- Kiln replacement in 2019.
- Drinking fountain fixture replacements in 2021.
- Hazardous substances mitigation (asbestos and lead painting) in 2021.

## EDUCATIONAL SUITABILITY

- Interiors are dated in appearance.
- Science labs are undersized and lack appropriate equipment.
- Only one music room is present.
- The school lacks an auxiliary gym.
- The SPED classroom is undersized and lacks a dedicated, adjacent accessible restroom.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- As a multi-level building without an elevator, Lane is a strong candidate for modernization under a future bond. Extensive accessibility upgrades to the building and site are needed.

- Addition of accessible and age-appropriate play equipment and a covered play structure.
- Flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force (once finalized).
- Re-purpose space to create an art exhibition area.
- Security projects, including new classroom door locks and improvements to the security / alarm system.
- Add a sensory room.

**Moderate Priority**

- Lane is among several middle schools identified for athletic upgrades. This would include construction of an auxiliary gym and the addition.
- Re-purpose an existing space into a wellness room.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Allocate an area for a Reconnection Services office.
- Re-purpose space to provide a dedicated security office.
- Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- Add or re-purpose space for a 2nd music room with shared ensemble/practice rooms, music office, and music library.
- Create a flexible performance area by upgrading existing stage and/or repurposing space.
- Upgrades existing stage / drama area (as needed) to support performing arts instruction.
- Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.



# MT. TABOR MIDDLE SCHOOL

**ADDRESS**
5800 SE ASH ST

**CONSTRUCTION DATE**
1952 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
79,477 SF

**SITE AREA**
323,215 SF
7.42 ACRES

**CLASSROOMS COUNT**
31

**FUNCTIONAL CAPACITY**
682 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR CLASSROOMS**
0

**ZONING**
R2.5 RESIDENTIAL 2,500 CU

## HISTORICAL SUMMARY

The Mount Tabor Middle School (originally Mount Tabor School) is a one story brick veneer building designed in the International style. The campus consists of the 1952 Mount Tabor Middle School, which features a modified L-shaped plan, and a series of additions have been added to the south elevation of the building. These additions have enclosed the original L-shaped plan and formed a central courtyard. The building features a linear composition and asymmetrical plan. These International style elements, in addition to bands of aluminum windows, low sloped roofs, overhangs, and lack of ornamentation serve to reinforce the ideals of functionalism and minimalism. Mount Tabor Middle School has been extensively modified over time to meet the evolving needs of the Portland Public Schools.

The building has been expanded five times since its original construction. Additions (1958, 1968, 1976, 1987, and 1991) were constructed along the south and east elevations of the main facility.

The neighborhood consists of a mix of commercial and single and multi family residences built primarily between 1920 and 1950. The Mount Tabor campus occupies a rectangular shaped parcel that is bound on the north by SE Ash, on the east by SE 60th Avenue, on the south by residential buildings, and on the east by SE 57th Avenue. The school is located on the west end of the campus and play fields are located on the east side of the campus. Parking is provided to the south and playgrounds are to the southeast of the facility.

Mount Tabor Middle School does not retain a level of historical integrity and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Improvements to Mt. Tabor Middle School would moderately advance the district's racial equity and social justice (RESJ) goals.

» For the 2021-22 school year, 18% of Mt. Tabor's students are historically underserved; this is below the middle school mean (37%).
» For the 2020-21 school year, 9% of Mt Tabor students qualified for free or reduced lunch, significantly below the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Mt. Tabor is forecast at 101% utilization. Over the next several years, enrollment is projected to decline, reaching 90% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

Mt. Tabor Middle School is 69 years old and in poor condition with a facility condition index (FCI) score of 0.15. As the average FCI score for non-modernized middle schools in PPS is 0.12, Mt. Tabor building is in worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

» The building was not observed to be sprinklered.
» An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices had been installed within the last year.

**Electrical**

» The site's main distribution switchboard was replaced in 1998 and was observed to be in good condition. The majority of the school's panel boards, however, were original to the building and had exceeded their design lives. Another group had been added during the mechanical systems upgrade in the basement in 1985, and while these two had exceeded their design lives, they were observed to have been well maintained. Two panel boards had been installed in 1997 as part of the technology upgrade.

**Arch/Struct/Site**

» Consider structural assessment based on signs of potential structural movement and water infiltration at the north end of the building. Grading and drainage repairs had been made to remedy water intrusion but there was damage to concrete walls and stairs.
» The wood framed windows were beyond typical design life. The frames had significant degradation on the interior and exterior. Staff commented that the window frames had lead paint. Previous repairs included adding exterior metal flashing on top of the wood frames with the most damage.
» The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

» Drinking fountain fixture upgrades in 2021.
» Partial roof replacement in 2021.

## EDUCATIONAL SUITABILITY

» Three (3) of the school's science labs are converted general classrooms; all are undersized with inadequate sinks and electrical outlets.
» The SPED classroom is undersized and lacks an a dedicated, adjacent ADA restroom.
» Although both a main and aux gym are present, they are both undersized.
» Administrative offices are not adjacent to the main entry creating supervision and access control challenges.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Addition of accessible and age-appropriate play equipment and a covered play structure.
» Add flexible furnishings to support student collaboration.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
» Re-purpose space to create an art exhibition area.
» Security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
» Add or re-purpose space for a 2nd music room with shared ensemble/practice rooms, music office, and music library.
» Create a flexible performance area by upgrading existing stage and/or repurposing space.
» Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# OCKLEY GREEN MIDDLE SCHOOL

**ADDRESS**
6031 N MONTANA AVE

**CONSTRUCTION DATE**
1925 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
74,018 SF

**SITE AREA**
226,512 SF
5.2 ACRES

**CLASSROOM COUNT**
31

**FUNCTIONAL CAPACITY**
689 STUDENTS

**CLUSTER**
JEFFERSON

**MODULAR CLASSROOMS**
3

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

Ockley Green Middle School is situated in the Arbor Lodge neighborhood of north Portland. Aligned on a north south axis, the two story school building is situated at the east side of the campus. In addition to the main school building, the campus has two portables located at its northwest corner and an attached gymnasium annex at the northeast corner of the campus. The reinforced concrete structure, faced with a variegated brick, rests on a poured concrete foundation. A flat roof with a parapet covers the rectangular building. Designed in the Collegiate Gothic style, cast stone architectural details highlight the windows doors and other significant elements of the exterior elevations. Variations in the brickwork below the parapet provide additional visual relief in the long elevations.

Development in the surrounding neighborhood consists primarily of single family residences built primarily between 1925-1950. Play fields are located at the west side of the campus.

Due to the loss of integrity, Ockley Green Elementary School is not eligible under either NRHP Criteria A, B, or C.

## RESJ CONSIDERATIONS

Ockley Green Middle School has multiple attributes that place it in a high priority category for facility improvements to advance the district's racial equity and social justice (RESJ) goals.

- For the 2019-20 school year, 56% of Ockley Green's students are historically underserved, above the middle school mean (37%).
- For the 2020-21 school year, 30% of Ockley Green students qualified for free or reduced lunch, exceeding the middle school mean (26%).
- Ockley Green Middle School is a two-story building without an elevator, restricting students with mobility challenges or physical disabilities from accessing any spaces on the 2nd level.

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Ockley Green is forecast at 72% utilization. Over the several years, enrollment is projected to decline, reaching 66% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

Ockley Green is 96 years old and in poor condition with a facility condition index (FCI) score of 0.15. As the average FCI score for non-modernized middle schools in PPS is 0.12, Ockley Green's building is in worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

### Fire Protection

- The building was not observed to be sprinklered.
- An addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices had been installed within the last year.

### Electrical

- The site's main distribution switchboard was replaced in 1998 and was observed to be in good condition. The majority of the school's panel boards, however, were original to the building and had exceeded their design lives. Another group had been added during the mechanical systems upgrade in the basement in 1985, and while these two had exceeded their design lives, they were observed to have been well maintained. Two panel boards had been installed in 1997 as part of the technology upgrade.

### Arch/Struct/Site

- Consider structural assessment based on signs of potential structural movement and water infiltration at the north end of the building. Grading and drainage repairs had been made to remedy water intrusion but there was damage to concrete walls and stairs.
- The wood framed windows were beyond typical design life. The frames had significant degradation on the interior and exterior. Staff commented that the window frames had lead paint. Previous repairs included adding exterior metal flashing on top of the wood frames with the most damage.
- The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

- Exterior masonry repair in 2018.
- Wireless technology upgrades in 2019.
- Drinking fountain fixture replacements in 2020.
- Partial roof replacement in 2021.

## EDUCATIONAL SUITABILITY

- General classrooms, science labs, and SPED rooms are undersized.
- One small gym is present.
- A performing arts space is present, but the stage lacks lighting or sound systems.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- As a multi-level building without an elevator, Ockley Green is a strong candidate for modernization under a future bond. Extensive accessibility upgrades to the building and site are needed.
- Addition of accessible and age-appropriate play equipment and a covered play structure.
- Add flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Security projects, including new classroom door locks and improvements to the security / alarm system.

- » Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

- » Ockley Green is among several middle schools identified for athletic upgrades. This would include construction of an auxiliary gym and the addition of new turf field with a track. The aux gym should be constructed to a seismic performance level of immediate occupancy, serving as a potential community shelter in the event of a natural disaster.
- » Re-purpose an existing space into a wellness room.
- » Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- » Allocate an area for a Reconnection Services office.
- » Renovate main entry to align with district's updated Ed Specs. This may require renovating main office to improve visual and/or physical connection to the main entry.
- » Re-purpose space to provide a dedicated security office.
- » Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- » Add or re-purpose space for a 2nd music room with shared ensemble/practice rooms, music office, and music library.
- » Upgrade existing stage / auditorium (as needed) to support performing arts instruction.
- » Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- » Expand P.E. storage by repurposing space and/or adding casework.
- » Allocate instructional, office, and meeting space for Virtual Scholars.

# ROSEWAY HEIGHTS MIDDLE SCHOOL

**ADDRESS**
7334 NE SISKIYOU ST

**CONSTRUCTION DATE**
1923 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
103,610 SF

**SITE AREA**
371,567 SF
8.53 ACRES

**CLASSROOM COUNT**
39

**FUNCTIONAL CAPACITY**
803 STUDENTS

**CLUSTER**
MCDANIEL

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Roseway Heights Middle School is situated in northeast Portland. The two-story school building rests on a poured concrete foundation. The primary construction system is reinforced concrete. Parapets located on the flat roof mask the skylights and mechanical systems. The school features a variety of architectural styles including Collegiate Gothic embellishments on the central bay of the east elevation, Mediterranean embellishments on the north and south bays of the east elevation, and a contemporary hybrid of the Mediterranean and Modern styles on the west elevations.

The neighborhood consists primarily of single family residence built between 1920 and 1950. Oriented on a east-west axis, the school building is located at the northeast portion of a rectangular parcel. Playgrounds and playfields occupy the south portion of the campus. Asphalt covered parking lots are located on the south and west sides of the campus. The primary entrance to the campus is from the north on Siskiyou Street. The path to the secondary entrance on the west elevation from the parking lot is flanked with columns.

Although designed by a noted Portland architect and associated with several events related to the growth of the Portland school district, Roseway Heights School does not retain a level of historical significance and integrity and is therefore not eligible for the National Register of Historic Places.

## RESJ CONSIDERATIONS

Roseway Heights Middle School has multiple attributes that place it in a high priority category for facility improvements to advance the district's racial equity and social justice (RESJ) goals.

- » For the 2021-22 school year, 46% of Roseway Heights students are historically underserved; above the middle school mean (37%).
- » For the 2021-22 school year, 36% of Roseway Heights students

qualified for free or reduced lunch, exceeding the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Roseway Heights is forecast at 78% utilization. Over the next several years, enrollment is projected to decline, reaching 72% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

Roseway Heights is 98 years old and in fair condition with a facility condition index (FCI) score of 0.09. As the average FCI score for non-modernized middle schools in PPS is 0.12, Roseway Heights' building is in slightly better condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- Plumbing fixtures were aged, but operational. The majority of the water closet flush valves had been updated with dual-flush handles.
- Thirteen air handling units were observed inside the facility, as well as two rooftop units. There were also 31 fan coil units located above the ceiling tiles throughout the facility. Many of the fan coil units made excessive noise and all units had exceeded their typical design lives.
- Both of the facility's boilers were replaced in 2002.

### Fire Protection

- The fire alarm control panel was installed around 2010 and fire alarm devices had been recently replaced.
- There was a wet pipe sprinkler system observed throughout the basement level. No deficiencies were observed or reported with the system.

### Electrical

- Four panels were added in 1996 to support IT equipment, but the remaining electrical distribution equipment was original to building construction in 1989 and had exceeded its typical design life.
- The parking lot lighting was reported have had unidentified issues that require further investigation. These fixtures were also original to the 1989 construction and were in need of replacement.

### Arch/Struct/Site

- The exterior wall expansion joints were degraded, and areas of the exterior wall were cracked.
- There were signs of water intrusion and deteriorating walls at the boiler room exterior doors.
- The majority of interior architectural components had exceeded design life.
- The exterior steps around the site were deteriorated.

## RECENT CAPITAL EXPENDITURES

- Ceiling piping system improvements in 2018.
- Drinking fountain fixture replacements in 2020.
- Wooden loft removal in 2020.

## EDUCATIONAL SUITABILITY

- The school has four (4) undersized science labs.
- Two music rooms are provided with a shared music library and storage rooms.
- The aux gym is significantly undersized (36% of size standard).
- The school has an assortment of performing arts spaces, including an auditorium, drama classrooms, and a dance room.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
- Addition of accessible and age-appropriate play equipment and a covered play structure.
- Add flexible furnishings to support student collaboration.
- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Complete 2020 bond-funded security projects, including new classroom door locks and improvements to the security / alarm system.
- Re-purpose an existing space into a sensory room.
- Conduct inventory and assessment of SPED classrooms and support spaces to determine alignment with SPED programmatic goals.

### Moderate Priority

- Re-purpose an existing space into a wellness room.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Allocate an area for a Reconnection Services office.
- Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- Music room upgrades which may include increasing the size of the two (2) existing small music rooms and creation of shared ensemble/practice rooms, music office, and music library.
- Upgrades existing stage / auditorium (as needed) to support performing arts instruction.
- Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

### Lower Priority

- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.
- Athletic upgrades including construction of an auxiliary gym and the addition of new turf field with a track. The new aux gym should be constructed to a seismic performance level of immediate occupancy, serving as a potential community shelter in the event of a natural disaster. (Note: existing aux gym is present, but is greatly undersized at only 36% of Ed Spec requirements)

# SELLWOOD MIDDLE SCHOOL

**ADDRESS**
8300 SE 15TH AVE

**CONSTRUCTION DATE**
1914 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
87,364 SF

**SITE AREA**
206,910 SF
4.75 ACRES

**CLASSROOM COUNT**
30

**FUNCTIONAL CAPACITY**
683 STUDENTS

**CLUSTER**
CLEVELAND

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Sellwood Middle School is located in the Sellwood neighborhood of southeast Portland. The campus includes a primary building and a connected annex surrounded by asphalt covered parking and play areas. The reinforced concrete structure, covered in white stucco, rests on a poured concrete foundation. A flat roof covers the irregular shaped mass of the building. The fenestration consists of a mixture of original multi-light wood frame and grouped metal frame windows.

Designed in the Art Deco style, the poured concrete is molded to create a water table, belt course, and parapet cap. The concrete also forms the pilasters, capped by gilded figures of eagles, which flank the entries to the building. Below the belt courses, bands of floral inscribed squares outlined in projecting concrete ribbons provide additional horizontal divisions to the multi-story structure. The single story gymnasium annex to the east was constructed in 1987.

Development in the surrounding area consists primarily of single family residences built between 1900 and 1950. The school building is situated at the north portion of a rectangular parcel. An asphalt covered parking area is located at the southwest side of the campus. Recreational facilities consist of two grass covered playfields on the southeast side of the parcel.

Sellwood School does not retain a level of historical integrity commensurate with other Portland schools constructed of similar styles during the same period, and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Sellwood's student body is less diverse than other district middle schools and has one of the lowest counts for students who qualify for free and reduced lunch.

» For the 2021-22 school year, 14% of Sellwood students are historically underserved, significantly below the middle school mean (37%).
» For the 2021-22 school year, 9% of Sellwood students qualified for free or reduced lunch, significantly below the middle school mean (26%).
» Sellwood Middle School is a two-story building without an elevator preventing students with mobility challenges or physical disabilities from accessing spaces on the 2nd level.

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Sellwood is forecast at 83% utilization. Over the next several years, enrollment is projected to decline, reaching 72% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

Sellwood is 107 years old and in poor condition with a facility condition index (FCI) score of 0.17. As the average FCI score for non-modernized middle schools in PPS is 0.12, Sellwood's building is in worse condition than most middle schools in the district.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, fan coil units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

» The building was not observed to be sprinklered.

**Electrical**

» The site's main distribution switchboard was replaced in 1998 and was observed to be in good condition. The majority of the school's panel boards, however, were original to the building and had exceeded their design lives. Another group had been added during the mechanical systems upgrade in the basement in 1985, and while these two had exceeded their design lives, they were observed to have been well maintained. Two panel boards had been installed in 1997 as part of the technology upgrade.

**Arch/Struct/Site**

» The wood framed windows were beyond typical design life. The frames had significant degradation on the interior and exterior. Staff commented that the window frames had lead paint. Previous repairs included adding exterior metal flashing on top of the wood frames with the most damage.
» The majority of interior architectural components had exceeded design life.

## RECENT CAPITAL EXPENDITURES

» Parking lot improvements in 2018 (signs and re-striping).
» Drinking fountain fixture replacements in 2021.

## EDUCATIONAL SUITABILITY

» The school's aux gym is being used as an extension of the cafeteria and is not available for P.E. activities.
» The school lacks purposely-designed music rooms; music is taught in a former shop area in the basement.
» The administrative offices do not have direct visual access to the main entry creating supervision and access control challenges.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
» As a multi-level building without an elevator, Sellwood is a strong candidate for modernization under a future bond. Extensive accessibility upgrades to the building and site are needed.
» Addition of accessible and age-appropriate play equipment and a covered play structure.
» Add flexible furnishings to support student collaboration.
» Incorporate recommendations of All Gender Task Force, including restrooms and locker rooms (once finalized).

- » Re-purpose space to create an art exhibition area.
- » Security projects, including new classroom door locks and improvements to the security / alarm system.
- » Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

- » Re-purpose an existing space into a wellness room.
- » Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- » Allocate an area for a Reconnection Services office.
- » Renovate main entry to align with district's updated Ed Specs. This may require renovating main office to improve visual and/or physical connection to the main entry.
- » Re-purpose space to provide a dedicated security office.
- » Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
- » Add or re-purpose space for separate band and choir rooms with shared ensemble/practice rooms, music office, and music library. (Note: music is currently taught in a former shop area in the basement)
- » Create a flexible performance area by upgrading existing stage and/or repurposing space.
- » Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

- » Expand P.E. storage by repurposing space and/or adding casework.
- » Allocate instructional, office, and meeting space for Virtual Scholars.



# WEST SYLVAN MIDDLE SCHOOL

**ADDRESS**
8111 SW WEST SLOPE DR

**CONSTRUCTION DATE**
1954 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
108,187 SF

**SITE AREA**
593,287 SF
13.62 ACRES

**CLASSROOM COUNT**
40

**FUNCTIONAL CAPACITY**
987 STUDENTS

**CLUSTER**
LINCOLN

**MODULAR CLASSROOMS**
0

**ZONING**
R7 CITY OF BEAVERTON

## HISTORICAL SUMMARY

The West Sylvan Middle School is situated near the residential neighborhood of West Slope in East Beaverton. Built in 1954, the school building is situated on a mostly grass-covered campus. The modern period building exhibits some characteristics of the Northwest Regional style. A flat roof covers the irregularly shaped building. The modified finger plan building is a single story and rests on a poured concrete foundation. A two-story attached wing is located to the west of the main building. Cladding for the wood framing building consists of a mixture of brick veneer, concrete, and corrugated metal siding. The school facilities include classrooms, two gymnasiums (including an auditorium and cafeteria), media center/library, industrial shop, home economics, choir and band rooms, two courtyards, and an administrative office.

The West Sylvan School is situated on a suburban-style campus typical of post-World War II schools. Grass covered playfields are located to the south and west of the school. An asphalt-covered driveway lies adjacent to the southeast of the school building and several parking areas are located to the southeast and east. A courtyard, with mixed deciduous growth, serves as the primary organizing element for the building. A smaller courtyard is located between the west wing and the main section of the school. West Sylvan School does not retain a level of historical integrity commensurate with other Middle Schools constructed of similar styles during the same period and is therefore not eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Facility improvements to West Sylvan would be less meaningful to the district's racial equity and social justice goals than improvements at other middle schools.

- » For the 2021-22 school year, 16% of West Sylvan students are historically underserved, below

the middle school mean (37%).
» For the 2021-22 school year, 7% of West Sylvan students qualified for free or reduced lunch, significantly below the middle school mean (26%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, West Sylvan is forecast at 83% utilization. Over the next 15 years, enrollment is projected to decline, reaching 73% by the 2030-31 school year.

## FACILITY CONDITION SUMMARY

West Sylvan is 67 years old and in poor condition with a facility condition index (FCI) score of .14. As the average FCI score for non-modernized middle schools in PPS is 0.12, West Sylvan's building is in somewhat worse condition than most middle schools in the district.

Facility condition assessments conducted in 2018 -19 revealed the following deficiencies:

**Mechanical & Plumbing**

» The majority of the plumbing fixtures had exceeded their design lives. The domestic water distribution equipment was nearing the end of its typical design life.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, controls and associated equipment had exceeded their design lives.

**Fire Protection**

» The building was sprinklered throughout. The system is estimated to be in good working condition.
» An addressable fire alarm system headend (Silent Knight 5820XL) and associated detection and signal devices were installed (estimated) in 2014. Legacy smoke detection devices, however, were observed in the east addition and had not yet been upgraded.

**Electrical**

» There were two 208Y/120V services at the school – one 1200A main distribution board was installed adjacent to the kitchen in 1988, and one 600A main distribution board was installed as part of the West Addition in 1990. The majority of panel boards in the facility had exceeded or were approaching the end of their design life, but had been well maintained. Those original to the main building were most in need of replacement, those installed with the west and north additions in 1985 and 1990, respectively, were a lower priority. Several panels installed with the technology upgrade in 1997 were newer. A generator had been installed as part of the west addition and had exceeded its design life.

**Arch/Struct/Site**

» Consider emergency egress options for classrooms surrounding the interior courtyard areas. Staff reported that the windows which open to the interior courtyards are difficult to operate. Emergency plan includes opening windows, exiting to the courtyard and then entering the school through windows on the other side of the courtyard.
» The roof covering was observed with widespread areas of alligator cracking, soft spots, ponding, debris buildup and organic growth. There was evidence of leaks on the interior and staff reported leaks.
» The windows were beyond typical design life and the frames had areas of damage.
» The majority of interior architectural components had exceeded design life.
» The asphalt had large areas of alligator cracking.

## RECENT CAPITAL EXPENDITURES

» Athletic field improvements in 2018.
» Drainage improvements in 2018.
» Water line repair in 2019.
» Drinking fountain fixture replacements in 2021.

## EDUCATIONAL SUITABILITY

» West Sylvan is one of few middle schools in the district that has separate, purposely-designed band and choir rooms.
» The cafeteria and kitchen are both undersized.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Accessibility upgrades to allow all students to enter the building via the main entry and navigate all essential programming within the building.
» Addition of accessible and age-appropriate play equipment and a covered play structure.
» Add flexible furnishings to support student collaboration.
» Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
» Re-purpose space to create an art exhibition area.
» Complete 2020 bond-funded security projects, including new classroom door locks and improvements to the security / alarm system.
» Re-purpose an existing space into a sensory motor room.

**Moderate Priority**

» West Sylvan is among several middle schools identified for athletic upgrades. This would include the addition of new turf field with a track. (Note: an aux gym is present)
» Re-purpose an existing space into a wellness room.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Renovate the main entry to align with district's updated Ed Specs. This may require renovating main office to improve visual and/or physical connection to the main entry.
» Re-purpose space to provide a dedicated security office.
» Re-purpose space for a 2nd visual arts classroom, providing separate teaching stations for 2D and 3D visual arts instruction.
» Provide shared practice / ensemble rooms for existing band and choir rooms.
» Create a flexible performance area by upgrading existing stage and/or repurposing space.
» Add a makerspace to support STEAM activities in alignment with CTE pathways at the high school level.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# HIGH SCHOOLS

# BENSON HIGH SCHOOL

**ADDRESS**
546 NE 12TH AVE

**CONSTRUCTION DATE**
2024 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
371,189 SF

**SITE AREA**
378,972 SF
8.7 ACRES

**CLASSROOMS COUNT**
86

**FUNCTIONAL CAPACITY**
2,203

**CLUSTER**
CLEVELAND

**MODULAR CLASSROOMS**
0

**ZONING**
EX - CENTRAL EMPLOYMENT

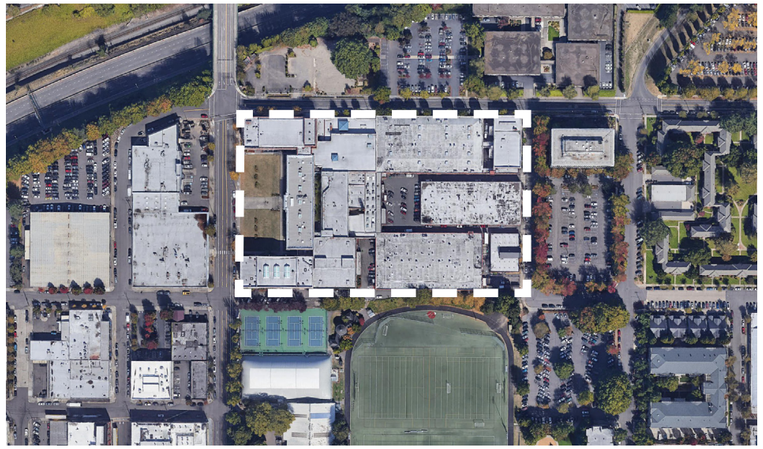

## HISTORICAL SUMMARY

As of the writing Benson High School is being modernized

# CLEVELAND HIGH SCHOOL

**ADDRESS**
3400 SE 26TH AVE

**CONSTRUCTION DATE**
1929 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
256,984 SF

**SITE AREA**
493,535 SF
11.33 ACRES

**CLASSROOMS COUNT**
75

**FUNCTIONAL CAPACITY**
1,859 STUDENTS

**CLUSTER**
CLEVELAND

**MODULAR CLASSROOMS**
2

**ZONING**
R2.5 RESIDENTIAL 2,500 CU

## HISTORIC SUMMARY

Cleveland High School consists of two separate properties. The main school campus is located in the Hosford-Abernethy neighborhood, while the Cleveland Field is located at 3100 SE Powell Blvd in the Richmond neighborhood in southeast Portland. Designed in the Classical Revival style, the three story main school building exhibits an extensive use of terra cotta panels to emphasize the main entrance, ancillary entrances, windows, corners, cornice, and parapet. The interior of the original building features a square corridor plan with several additions situated to the east. These additions include a gymnasium, shop wing, classroom addition, as well as a detached portable. The Cleveland Field property lies to the east of the main school property and features a restrooms building as well as grandstands, a track, and an athletic field.

Development in the surrounding area consists of commercial as well as single and multi-family residential built between 1890 and 1950. Much of the commercial development is centered on Powell Blvd. that borders both properties to the south.

With all of the additions placed on the east side of the school and in spite of the replacement of its original windows, Grover Cleveland High School remains eligible for the National Register of Historic Places (NRHP) as it retains much of its historical integrity.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Cleveland serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 17% of students are historically underserved, well below the high school mean (37%).
» For the 2021-22 school year, 20% of students qualified for free or reduced lunch, less than the high school mean (20%).







## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Cleveland High School is forecast at 86% utilization. By the 2030-31 school year, utilization is projected to decrease to 80%.

## FACILITY CONDITION SUMMARY

Cleveland High School is 92 years old, and in poor condition with a facility condition index (FCI) score of 0.29. The average FCI score for non-modernized high schools in PPS is 0.24.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» Main: steam boilers have considerable remaining useful life due to upgrades/repairs.
» Piping and ducting (general): aged beyond useful design life.
» Gym Addition: majority of water coolers not functional.
» Plumbing fixtures: aged beyond useful design life and becoming erratic.

**Fire Protection**

» Main: coverage in corridors, entry/exit doors into classrooms.
» Gymnasium: coverage in weight room/mat room.
» East and South Additions: coverage in corridors and classrooms.

**Electrical**

» Electrical distribution: significant portion is aged despite upgrades in 1997.
» Electrical capacity of the building is a concern in general.
» Security/alarm system: generally insufficient coverage.
» Exterior lighting: generally insufficient coverage (security concerns).

**Arch/Struct/Site**

» Interior finishes: all are aged beyond design life and deteriorated.
» Auditorium: cracking in plaster wall finish/wall near balcony.
» Parking areas: resurface and fill cracks.
» Landscaping: clean up and thin out at all elevations.
» ADA: handrails not compliant, door hardware not consistent.
» Stadium: metal seating and stairs at the stadium is aged and deteriorated.

## RECENT CAPITAL EXPENDITURES

» Football Field Turf Replacement in 2017
» Select Flooring Replacements in 2018
» ADA Improvements in 2018-19
» Dust Collection System Replacement in 2019
» Drinking Fountain Fixture Replacements in 2021
» Planning and Design for Future Modernization in 2021

## EDUCATIONAL SUITABILITY

» While the age of the facility limits the availability of modern learning style spaces, the numerous wings and additions have provided a degree of flexibility.
» General classrooms range in size from approximately 575 to over 1,000 square feet. On average classrooms meet approximately 70% of the size standard.
» The special education space meets less than 50% of the size standard.
» A number of the science classrooms have outdated physical environments that lack the necessary spatial components to allow for small group interaction.
» Separate band and choir rooms are provided.
» 3D and 2D art rooms are somewhat small (approximately 80% of size standard).
» CTE spaces are dated and undersized.
» While adequate gym space is provided the wrestling room and P.E. support areas are undersized.
» The auditorium is sufficiently sized, but the stage is small per the district's space standards.
» The kitchen is not utilized; equipment is not functional.
» The campus lacks fencing. The building has numerous entrances that are difficult to monitor.

## EDUCATIONAL PROGRAM FORECAST

The district has started the process to fully modernize Cleveland High School. Planning and design work to modernize Cleveland High School is funded through the 2020 Bond. Construction costs are expected to be financed by future bonds.

# FRANKLIN HIGH SCHOOL

**ADDRESS**
5405 SE WOODWARD ST

**CONSTRUCTION DATE**
2017 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
296,719 SF

**SITE AREA**
797,148 SF
18.3 ACRES

**CLASSROOMS COUNT**
74

**FUNCTIONAL CAPACITY**
1,744 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR CLASSROOMS**
0

**ZONING**
IR INSTITUTIONAL RESIDENTIAL LCU

## HISTORICAL SUMMARY

Franklin High School is located in the South Tabor neighborhood of Southeast Portland. The large campus includes the original Colonial Revival style central building integrated into an entirely modernized building in 2017. Modernization includes a fully modernized gymnasium to east and a modernized stadium and athletic field.

The campus occupies an expansive rectangular shaped parcel that is positioned between SE Woodward St. to the south and Division St. to the north. Development in the surrounding area consists primarily of single family residences built between 1900-1950. Some multi-family housing and institutional buildings are situated in close proximity to the school, but they are not predominant. The property also includes expansive playing fields that include a football field and baseball field. Just to the east of the school are playing fields and tennis courts that are part of Clinton Park and Atkinson School. They are situated to the northeast of the high school property. The grounds immediately in front (north) of the school are divided into two equal quadrants, while the rear (south) area features an oval shaped road and paths that lead to the rear entrance.

## RESJ CONSIDERATIONS

Franklin's student population is largely reflective of district-wide averages for high schools:

» For the 2021-22 school year, 31% of students are historically underserved, near the high school mean (37%).
» For the 2020-21 school year, 22% of students qualified for free or reduced lunch, slightly above the high school mean (20%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Franklin High School is forecast at 118% utilization. By the 2030-31 school year, utilization is projected to decrease to 110%.





## FACILITY CONDITION SUMMARY

Franklin High School is four years old, and in good condition as with a facility condition index (FCI) score of 0.0.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The HVAC equipment, water distribution equipment, and plumbing fixtures had all been replaced during a 2017 renovation and were observed to be in good condition with no major deficiencies.

**Fire Protection**

» The fire protection equipment and fire alarm devices were all replaced during a 2017 renovation and was observed to be in good condition with no major deficiencies

**Electrical**

» The majority of the electrical distribution equipment and lighting was fully renovated in 2017, however, the natural gas generator and corresponding transfer switch in the second-floor boiler room had exceeded their design lives.

**Arch/Struct/Site**

» The interior walls throughout the library (SS-117) and other areas of the east wing were observed to be degraded from moisture and water infiltration.
» The concrete floor was observed to be cracked throughout the café (SS-104).
» The roof wall covering was observed to be loose/detached at the roof mechanical area of the auditorium wing.

## RECENT CAPITAL EXPENDITURES

» Sidewalk/Curb Replacement in 2018
» Assorted Repairs Following Modernization in 2019
» Security Upgrades in 2020

## EDUCATIONAL SUITABILITY

» There are two rooms for students supported through special education. The rooms are located near their bus loading area, but isolated from other instructional areas in the lower level and in a separate wing.
» Science classrooms range from 78% to 89% of the size standard.
» The metal shop and the robotics space have issues with adequate and appropriate electrical service.
» There is no security vestibule present. The main office does not have remote control of the main entry doors. The campus layout makes supervision challenging. .

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
» Re-purpose space to create an art exhibition area.
» Re-purpose an existing space into a sensory motor room.
» Evaluate whether SPED focus classroom renovations are needed to support an inclusive instructional model and align with the updated district Educational Specifications.
» Expand dedicated space(s) for community programs.
» Re-purpose existing space(s) to provide dedicated supports for social emotional health (e.g. calming room).

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Add/re-purpose a smaller dedicated activity space for Adapted P.E.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# GRANT HIGH SCHOOL

**ADDRESS**
2245 NE 36TH AVE

**CONSTRUCTION DATE**
2019 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
303,271 SF

**SITE AREA**
444,312 SF
10.2 ACRES

**CLASSROOMS COUNT**
74

**FUNCTIONAL CAPACITY**
1,686 STUDENTS

**CLUSTER**
GRANT

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Grant High School is located in the Grant Park neighborhood of Northeast Portland. The ten acre campus includes an extensive collection of educational buildings constructed between 1923 and 1970 including the main original building. The majority of the school, including gymnasium, was rebuilt in 2019. Set within a flat, pastoral setting of trees and parkland, the front exterior of the building constructed in the 1920s at Grant High School. This portion exhibits a variety of character defining features including a bilaterally symmetrical U-shaped plan, a bold portico supported by fluted Ionic columns with a broad terra cotta frieze, ancillary entries with terra cotta Ionic columns or pilasters and classical entablatures, a concrete watertable, terra cotta stringcourse, terra cotta cornice and coping.

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Grant serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 19% of students are historically underserved, well below the high school mean (37%).
» For the 2020-21 school year, 11% of students qualified for free or reduced lunch, significantly less than the high school mean (20%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Grant High School is forecast at 122% utilization. By the 2030-31 school year, utilization is projected to decrease to 111%.

## FACILITY CONDITION SUMMARY

Grant High School is two years old, and in good condition with a facility condition index (FCI) score of 0.0.





## RECENT CAPITAL EXPENDITURES

» Full Modernization in 2019
» Gym Lighting Improvements in 2020
» Grant Bowl Improvements in 2021

## EDUCATIONAL SUITABILITY

» Educational suitability data was not available. Facility was constructed in 2019. The design aligned with the district's Educational Specifications.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

» Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
» Re-purpose space to create an art exhibition area.
» Re-purpose an existing space into a sensory motor room.
» Evaluate whether SPED focus classroom renovations are needed to support an inclusive instructional model and align with the updated district Educational Specifications.
» Expand dedicated space(s) for community programs.
» Re-purpose existing space(s) to provide dedicated supports for social emotional health (e.g., calming room).

**Moderate Priority**

» Re-purpose an existing space into a wellness room.
» Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
» Allocate an area for a Reconnection Services office.
» Add/re-purpose a smaller dedicated activity space for Adapted P.E.

**Lower Priority**

» Expand P.E. storage by repurposing space and/or adding casework.
» Allocate instructional, office, and meeting space for Virtual Scholars.

# JEFFERSON HIGH SCHOOL

**ADDRESS**
5210 N KERBY AVE

**CONSTRUCTION DATE**
1909 (PRIMARY)

**LEVELS**
4

**BLDG AREA**
318,790 SF

**SITE AREA**
610,711 SF
14.02 ACRES

**CLASSROOMS COUNT**
74

**FUNCTIONAL CAPACITY**
1,817 STUDENTS

**CLUSTER**
JEFFERSON

**MODULAR CLASSROOMS**
0

**ZONING**
IR INSTITUTIONAL RESIDENTIAL LCU

## HISTORICAL SUMMARY

Jefferson High School is located in the Humboldt neighborhood of North Portland. The campus includes the original 1909 school building (with several subsequent additions), an auto shop, and a gymnasium. The high school building currently exhibits limited evidence of its former architectural style that once revealed the tensions between the Arts and Crafts and Classical Revival Movements. Several subsequent additions and exterior alterations, however, have diminished the building's architectural integrity.

The campus stretches from north to south between N. Kirby Ave. and N. Commercial Ave. and bisected by N. Alberta Ave. Development in the surrounding area consists primarily of single family residences built between 1890 and 1950 along N. Killingsworth Ave., which forms the northern boundary of the property, as well as mixed commercial and residential uses. The Jefferson High School campus consists of the original main building, gymnasium addition, auditorium addition, girl's gymnasium, free-standing gymnasium, and an auto shop. Most of the buildings are clustered in the center of the property with a football field located to the north and a baseball field situated to the south.

Jefferson High School does not retain sufficient architectural integrity to be eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Jefferson High School has multiple attributes that place it in a high priority category for facility improvements that would advance the district's racial equity and social justice (RESJ) goals.

- For the 2021-22 school year, 67% of students are historically underserved, significantly greater than the high school mean (48%).
- For the 2021-22 school year, 35% of students qualified for free or reduced lunch, exceeding the high school mean (20%).







## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Jefferson High School is forecast at 34% utilization. By the 2030-31 school year, utilization is projected to increase slightly to 35%.

## FACILITY CONDITION SUMMARY

Jefferson High School is 112 years old, and in poor condition with a facility condition index (FCI) score of 0.21. The average FCI score for non-modernized high schools in PPS is 0.24.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

- The hydraulic elevator Is nearing the end of its design life.
- The majority of the plumbing fixtures and domestic water distribution equipment had exceeded their design lives.
- The vast majority of the heating hot water equipment, exhaust fans, air handling units, fan coil units, and associated equipment had exceeded their design lives.

**Fire Protection**

- The fire riser, fire backflow preventer, and sprinkler system in the auditorium as well as the fire riser in the Boy's Gym had exceeded their design lives.

**Electrical**

- The majority of the site's electrical distribution system had exceeded its intended design life. In addition, there was a Federal Pacific panel in Room TV03 which poses a safety concern. Federal pacific panels contain breakers that may fail to trip resulting in overheating and potential fires.

**Arch/Struct/Site**

- The roof coverings, roof hatches, and skylights throughout all buildings were observed to be aged, cracked and dried, and had loose flashing at parapets. The roof hatches were difficult to operate and dangerous due to counterweights placed on the exterior.
- The exterior metal fire escape structures (all locations) were observed to be extremely corroded, degraded and aged.
- The exterior windows (TV Wing, Auditorium, Boys Gym) were observed to be aged, had broken glazing panes, degraded.
- The interior finishes (TV Wing) were all were observed to be predominantly aged and degraded.
- The wood gymnasium flooring (Boy's Gym) was observed to have some cracks and previous repairs; it may need replacement in the near future.
- The stadium concrete structure was observed to be crumbling in various areas and the press box was observed to be degraded (all interior/exterior systems).

## RECENT CAPITAL EXPENDITURES

- Boiler Repairs in 2017
- Security Upgrades in 2017
- Radon Mitigation in 2018
- Fire Sprinkler Upgrades in 2019
- Mold and Asbestos Abatement in 2020
- Drinking Fountain Fixture Replacements in 2020
- Pre-Bond Planning for Modernization

## EDUCATIONAL SUITABILITY

- There are very few spaces that support multiple teaching and learning styles.
- Most classrooms are appropriately sized with some falling below the district's size standard.
- The school lacks purposely designed special education spaces.
- Finishes are worn and dated.
- The science rooms range from 58% to 78% of the room size standard. There are insufficient outlets to meet educational needs. The labs lack emergency showers.
- Only one music room is present (band).
- The art rooms range from 70% to 75% of the size standard.
- The school's only career program is television/video production. Those spaces are inviting and stimulating. There are three unused CTE spaces that used to house wood and metals shops in the main building and an auto shop in an annex building. Those spaces now are used for storage or for the wrestling program.
- The gym is 80% of the size standard. There is not enough seating for the entire student body.
- A large theater is present, but the stage is undersized. The

school does not have a black box theater or drama classroom. A couple dance rooms with sprung floors are present.
» The library media center is greatly undersized (51% of size standard) and uninviting with little natural light.
» The cafeteria has large columns that limit flexible seating options.
» This school has no locked doors, no security vestibule, no buzzer entry system, and is open on all sides to student traffic. The main office does not have visual supervision of any doors.

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

Planning will commence in 2022 for the complete modernization of this facility. Construction will be complete in March 2027. The school will be designed per the district's Educational Specifications.

In the interim, provide CTE upgrades to increase the usability of career technical spaces until the facility can be fully modernized.

# LINCOLN HIGH SCHOOL

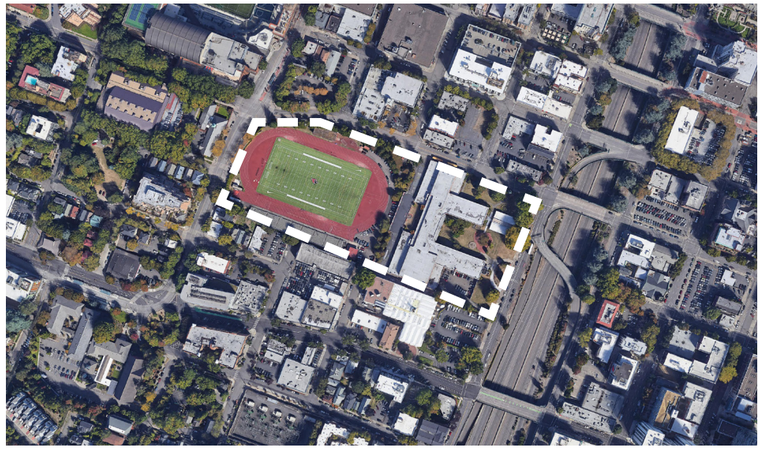

**ADDRESS**
1600 SW SALMON ST

**CONSTRUCTION DATE**
2022 (PRIMARY)

**LEVELS**
6

**BLDG AREA**
292,000 SF

**SITE AREA**
477,418 SF
11.0 ACRES

**CLASSROOMS COUNT**
76

**FUNCTIONAL CAPACITY**
1,867

**CLUSTER**
LINCOLN

**MODULAR CLASSROOMS**
0

**ZONING**
CX - CENTRAL COMMERCIAL

## HISTORICAL SUMMARY

» As of this writing, Lincoln High School is being rebuilt.







# MCDANIEL HIGH SCHOOL

**ADDRESS**
2735 NE 82ND AVE

**CONSTRUCTION DATE**
2021 (PRIMARY)

**LEVELS**
4

**BLDG AREA**
273,646 SF

**SITE AREA**
1,053,281 SF
24.18 ACRES

**CLASSROOMS COUNT**
77

**FUNCTIONAL CAPACITY**
1,739 STUDENTS

**CLUSTER**
MCDANIEL

**MODULAR CLASSROOMS**
0

**ZONING**
IR INSTITUTIONAL RESIDENTIAL LCU

## HISTORICAL SUMMARY

» McDaniel High School was modernized and reopened in fall 2021

# ROOSEVELT HIGH SCHOOL

**ADDRESS**
6941 N CENTRAL ST

**CONSTRUCTION DATE**
2017 (PRIMARY)

**LEVELS**
4

**BLDG AREA**
NO DATA

**SITE AREA**
744,876 SF
17.1 ACRES

**CLASSROOMS COUNT**
61

**FUNCTIONAL CAPACITY**
1,320 STUDENTS

**CLUSTER**
ROOSEVELT

**MODULAR CLASSROOMS**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Roosevelt High School is located in the St. Johns neighborhood of North Portland. The campus retained the face of the original school building (1921) which has gone through a modernization in 2017. The main building was designed in the Colonial Revival style and the front facade has been preserved.

The campus occupies a 17 acre, roughly square parcel bounded by N. Smith St. to the north, N. Ida St. to the east, N. Burr St. to the west, and Central Ave. to the south. The school occupies the southeast quadrant of the property with playing fields to the west, track and football field to the northwest, and tennis courts to the north.

Development in the surrounding area consists primarily of single family residences built between 1920 and 1950.

## RESJ CONSIDERATIONS

Roosevelt High School has multiple attributes that place it in a high priority category for facility improvements that would advance the district's racial equity and social justice (RESJ) goals.

- For the 2021-22 school year, 63% of students are historically underserved, significantly greater than the high school mean (37%).
- For the 2020-21 school year, 35% of students qualified for free or reduced lunch, exceeding the high school mean (20%).

## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Roosevelt High School is forecast at 103% utilization. Utilization is expected to remain steady over the next decade; after a period of increase over the next 6-7 years, enrollment will then enter a period of decline, settling back at 103% enrollment by 2030-31.

## FACILITY CONDITION SUMMARY

Roosevelt High School is four years old, and in good condition with a facility condition index (FCI) score of 0.0.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

### Mechanical & Plumbing

- Most of the roof drains were observed to be blocked by debris build-up and as a result, several areas of ponding water were observed on the roof.
- All mechanical and plumbing equipment was replaced during the 2017 renovation and was observed to be in good condition with no major deficiencies noted.

### Fire Protection

- All fire protection equipment and fire alarm devices were replaced during the 2017 renovation and were observed to be in good condition with no major deficiencies noted.

### Electrical

- The electrical distribution equipment and lighting was fully renovated in 2017 and had no major deficiencies observed.

### Arch/Struct/Site

- The wood soffit and areas of the exterior historic architectural features were observed to be deteriorated.
- Broken windows (2) across from the baseball field were observed.
- Previous repairs to the exterior brick wall at the roof elevation of the library were observed to be cracked.

## RECENT CAPITAL EXPENDITURES

- Initiated Phase IV and V Modernization Scoping in 2019 (ongoing)
- Dust Collector Replacement in 2019
- Historic Window Restorations in 2020

## EDUCATIONAL SUITABILITY

- Roosevelt is a recently modernized school, designed to align with the district's Educational Specifications. As such, the school received a high educational suitability rating.
- The CTE spaces meet an average of 75% of the size standard guidelines.

## EDUCATIONAL PROGRAM FORECAST

### High Priority

- Incorporate recommendations of PPS' All Gender Task Force, including restrooms and locker rooms (once finalized).
- Re-purpose space to create an art exhibition area.
- Re-purpose an existing space into a sensory motor room.
- Evaluate whether SPED focus classroom renovations are needed to support an inclusive instructional model and align with the updated district Educational Specifications.
- Expand dedicated space(s) for community programs.
- Re-purpose existing space(s) to provide dedicated supports for social emotional health (e.g. calming room).

### Moderate Priority

- Re-purpose an existing space into a wellness room.
- Re-purpose existing space to provide a Family Resource Center with kitchen equipment.
- Allocate an area for a Reconnection Services office.
- Add/re-purpose a smaller dedicated activity space for Adapted P.E.

### Lower Priority

- Expand P.E. storage by repurposing space and/or adding casework.
- Allocate instructional, office, and meeting space for Virtual Scholars.

# IDA B WELLS-BARNETT HIGH SCHOOL

**ADDRESS**
1151 SW VERMONT ST

**CONSTRUCTION DATE**
1954 (PRIMARY)

**LEVELS**
4

**BLDG AREA**
290,246 SF

**SITE AREA**
990,990 SF
22.75 ACRES

**CLASSROOMS COUNT**
76

**FUNCTIONAL CAPACITY**
1,872 STUDENTS

**CLUSTER**
WELLS-BARNETT

**MODULAR CLASSROOMS**
0

**ZONING**
IR INSTITUTIONAL RESIDENTIAL
LCU MIT PLAN

## HISTORICAL SUMMARY

Ida B Wells (formerly Woodrow Wilson) High School is located in the Hillsdale Neighborhood of Southwest Portland. The campus includes the original high school building (1953). The multi-story, International Style school building is a U-shaped finger plan with the gymnasium, auditorium, and music wing all differentiated from the main classroom sections of the school by different massing, building materials, heights, and overall shapes. The classroom sections of the building were constructed of "lifted" concrete slabs and the auditorium, gymnasium, and music wing were constructed using the more conventional tilt slab concrete. Most of the main classrooms lie behind a glazed curtain wall and the second floor library is cantilevered over the first floor.

The campus occupies an expansive rectangular shaped parcel that is positioned between SW Vermont Street to the south, SW Capitol Highway and SW Burlingame Avenue to the north, Mary Rieke School to the west, and a residential development to the east. Development in the surrounding area consists primarily of single family residences built between 1950 and 1990. Playing fields as well as a football field and track are located to the west of the high school. A fence-enclosed outdoor pool is also situated to the west of the gymnasium. The pool is owned by Portland Parks and Recreation.

Given the high level of integrity and the school's unique method of construction, Ida B Wells-Barnett High School is eligible for the National Register of Historic Places (NRHP).

## RESJ CONSIDERATIONS

Facility improvements would not be significantly impactful to underserved communities, as Ida B. Wells-Barnett High School serves a less diverse student population with relatively low poverty levels compared to the district average.

» For the 2021-22 school year, 19% of students are historically underserved, below the high school mean (37%).
» For the 2020-21 school year, 10% of students qualified for free or reduced lunch, approximately half of the high school mean (20%).





## ENROLLMENT & UTILIZATION

For the 2021-22 school year, Ida B. Wells-Barnett High School is forecast at 88% utilization. By the 2030-31 school year, utilization is projected to increase to 90%.

## FACILITY CONDITION SUMMARY

Ida B. Wells High School is 67 years old, and in poor condition with a facility condition index (FCI) score of 0.24. The average FCI score for non-modernized high schools in PPS is 0.24.

Facility condition assessments conducted in 2019-20 revealed the following deficiencies:

**Mechanical & Plumbing**

» The remaining equipment was original to facility construction.
» The plumbing fixtures had no deficiencies observed. The domestic water piping and sanitary waste piping were not visible for assessment, but had no deficiencies reported..

**Fire Protection**

» The school had a wet pipe sprinkler system that served the entire building.
» The fire alarm control panel and alarm devices had no deficiencies observed.

**Electrical**

» The electrical distribution equipment had no deficiencies observed. Distribution branch wiring and grounding systems were not visible for assessment, but had no deficiencies reported.

**Arch/Struct/Site**

» Moderate cracking was occurring in the south exterior concrete wall.
» One roof hatch was tearing at its hinge. Moderate surface corrosion was present on both roof hatches.
» Multiple concrete exterior stairs had cracks or were crumbling or broken.
» The VCT in the cafeteria was coming loose in spots, with stress cracking in many of the tiles.
» The wood floor was delaminating throughout the cafeteria and gymnasiums.
» There was a major crack in the southwest retaining wall.
» Spaces are not flexible to allow for differentiated instruction.
» The school lacks an auxiliary gym.
» Finishes are worn and dated.
» There is a lack of controlled entrances at this site.

## RECENT CAPITAL EXPENDITURES

» Library Media Center Upgrades in 2017
» College Career Center Upgrades in 2017
» Exterior Brick Wall Repairs in 2020
» Drinking Fountain Fixture Repairs in 2021
» Pre-Bond Planning for Modernization

## EDUCATIONAL SUITABILITY

## EDUCATIONAL PROGRAM FORECAST

**High Priority**

Planning and design work to modernized Ida B. Wells High School is funded through the 2020 Bond. Construction costs are expected to be financed by future Bonds.

# ALTERNATIVE SCHOOLS

# GREEN THUMB COMMUNITY TRANSITION PROGRAM

**ADDRESS**
6801 SE 60TH AVE

**CONSTRUCTION DATE**
1974 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
31,907 SF

**SITE AREA**
569,633 SF
13.05 ACRES

**CLASSROOMS COUNT**
6

**FUNCTIONAL CAPACITY**
130 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR BLDG**
0

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

The Green Thumb Facility is situated in the Brentwood Darlington neighborhood of southeast Portland. The large open campus consists of a residential style office/caretaker building, a classroom building, a rectangular portable, three greenhouses, a rectangular workshop building, a vehicle storage structure, and several small sheds. The collection of buildings is surrounded by large fields, several smaller planting areas, and multiple clusters of trees.

Development in the neighborhood consists of primarily single family residences constructed between 1925 and 1950. The campus retains a pastoral quality due to its location immediately to the west of Lane Middle School and Brentwood Park. Fields, planting areas, and fruit trees occupy the south and north portions of the campus. The primary entrance to the facility is from SE 60th Avenue. The principal structures on the campus are three greenhouses. Although representative of an innovative program designed to assist students in developing job skills, the Green Thumb Facility does not appear to be eligible for the NRHP under Criterion A.

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

- The majority of the plumbing fixtures and domestic water distribution equipment had exceeded typical design life.
- The vast majority of the heating and cooling equipment, exhaust fans, and associated equipment had exceeded typical design life.

### Fire Protection

- There was no sprinkler system in any of the buildings at Green Thumb.
- A new addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices were installed in 2019.

### Electrical

- The panelboards in the house, green house, and utility buildings had exceeded typical design life.

### Arch/Struct/Site

- The exterior windows of the house had exceeded typical design life and had broken glazing seals and condensation between their panes.
- The carpet floor finish of the house had exceeded typical design life and had heavy wear and staining throughout.
- The wood siding of the house had exceeded typical design life. The wood siding on the east face of the building had excessive surface weathering and the boards were warped and curled.
- The exterior corrugated fiberglass panel walls of the greenhouse had exceeded typical design life. The exterior surface of the fiberglass panels had heavy UV deterioration with peeling and missing top gelcoat and loose fibers.
- The exterior doors of the greenhouse had exceeded typical design life. The doors had surface damage, were sagging and difficult to open or close, and had aged hardware.
- The interior doors of the greenhouse had exceeded typical design life. The doors had surface damage, were sagging and difficult to open or close, and had aged hardware.
- Several holes were observed in the wood cladding of the north classroom building. The interior acoustical ceiling tile in the classrooms was observed to be stained from water/moisture damage in a few areas.
- The exterior metal doors (personnel doors) of the utility building were observed to be aged and showing signs of corrosion. It appeared that the mechanical parts of the rolling overhead doors has been recently replaced extending the useful life of those doors.
- The interior of the building was largely unfinished with a concrete floor slab throughout and minimal ceiling/wall finishes observed.

# MLC
# K-12

**ADDRESS**
2033 NW GLISAN ST

**CONSTRUCTION DATE**
1914 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
70,349 SF

**SITE AREA**
164,657 SF
3.78 ACRES

**CLASSROOMS COUNT**
22

**FUNCTIONAL CAPACITY**
464 STUDENTS

**CLUSTER**
LINCOLN

**MODULAR BLDG**
0

**ZONING**
RH HIGH DENSITY RESIDENTIAL CU

## HISTORICAL SUMMARY

The Metropolitan Learning Center is situated in a residential and commercial neighborhood in northwest Portland and was formerly designated the Couch Elementary School. The building faces an asphalt-covered playground, with a city park to the east and a school parking lot to the west. Hoyt and Glisan Streets border the school to the north and south respectively. The three story building is covered by a flat roof. The rectangular mass of the reinforced concrete structure is covered with brick veneer. Built in 1914, the Tudor Revival style building features glazed terra cotta decorative elements. The facilities include classrooms, a gymnasium, an auditorium, and an indoor pool.

The Metropolitan Learning Center/ Couch Elementary School retains its integrity with moderate alterations to its plan and exterior and interior finishes. The 1914 Tudor Revival style school is recommended as eligible for the National Register of Historic Places (NRHP) for its association with progressive era public school construction in Portland (Criterion A).

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

» The majority of the plumbing fixtures and domestic water distribution equipment had exceeded typical design life.
» The vast majority of the steam heating equipment, exhaust fans, air handling units, and associated equipment had exceeded typical design life.
» Fire Protection
» The fire suppression system was observed only in the mechanical/ boiler room.
» An addressable fire alarm system headend (Silent Knight 5820XL) and associated detection and signal devices were installed in 2014.

### Electrical

» The majority of the site's electrical distribution system (including the main switchboard and panelboards) had exceeded typical design life. This excludes the UPS and its associated panelboards (i.e. IT1 & IT2) added in the more recent IT upgrade project at the facility. Panelboard 'BP' in the pool area was water damaged and rusting. It was believed that the panelboard was no longer in use.

### Arch/Struct/Site

» The built-up roofs with metallic top coating had exceeded typical design life. The roof covering was blistered throughout, and the topcoat had moderate cracking.
» The interior doors had exceeded typical design life. Most of the classroom doors had excessive wear and two wood barn doors in the cafeteria were fixed in the open position due to a steel angle that had been welded to their tracks to keep them permanently open.
» The casework had exceeded typical design life. Approximately 80 percent of the casework appeared to be original and was in poor condition with heavy wear and tear and chipped paint.
» The wall finishes had exceeded typical design life. The glue-on acoustic tiles on the auditorium walls were heavily damaged with gouges throughout and missing and mismatched tiles were observed.
» The carpet had exceeded typical design life.
» The painted and sealed concrete floor finishes had exceeded typical design life. Excessive wear including chips and scratches was observed throughout the facility.
» The ceiling finishes had exceeded typical design life. The gypsum ceiling finish backstage in the auditorium had excessive water damage.
» The original metal frame skylight above the connecting corridor between the main building and the gymnasium had exceeded typical design life and had corroded metal frame components, cracked single pane wired glazing and deteriorated sealant.
» The wood storage cabinets in the corridor between the main building and the gymnasium had had exceeded typical design life. The cabinets had scratched surfaces and damaged and missing hardware.
» The wood gym floor in the gym addition had exceeded typical design life. Facility staff reported that the floor had many dead spots where balls do not bounce well.
» The wood windows of the main building and gym addition were observed to be aged, splintered, and had chipped/cracked painted finish exposing the wood to further deterioration.
» Some of the exterior concrete steps were observed to be in poor condition with cracked treads, nosing and concrete balustrade.
» The playground equipment was determined to be installed/ funded (in the summer of 2019) and maintained by Portland Parks and Recreation.

# TERWILLIGER

**ADDRESS**
6318 SW CORBETT ST

**CONSTRUCTION DATE**
1916 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
26,393 SF

**SITE AREA**
144,184 SF
3.31 ACRES

**CLASSROOMS COUNT**
11

**FUNCTIONAL CAPACITY**
N/A

**CLUSTER**
WELLS-BARNETT

**MODULAR BLDG**
2

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORIC SUMMARY

Terwilliger School is a one story brick veneer building designed in the Colonial Revival style. The school is situated in the Lair Hill neighborhood of Southwest Portland. Terwilliger School is a one story brick veneer building designed in the Colonial Revival style.

The campus consists of a U-shaped building and a portable. Constructed in 1916, the school features boxed cornices, brick soldier courses, and eyelid dormer vents along the roofline. Symmetrically arranged aluminum and multi pane casement windows provide the fenestration. The front façade features a central portico with entablature supported by square columns. The cornice of the entablature is ornamented with modillions. Along the roof line is an octagonal cupola with domical roof and weather vane. These Colonial Revival elements, in addition to the building's symmetrical plan and fenestration, serve to reinforce the ideals of order, balance, and formality.

The neighborhood consists of single family residences built primarily between 1920 and 1950. The campus occupies a long, narrow parcel that is located between SW Carolina and SW Dakota.

The school is located roughly in the center of the parcel, with open space located to the west (front) and play areas located to the east (rear) of the building. A linear walkway extends from SW Corbett to the building entrance. A 1948 portable building is located to the northeast of the primary building.

Terwilliger School is recommended as eligible for the National Register of Historic Places (NRHP).

## FACILITY CONDITION SUMMARY

**Mechanical & Plumbing**

» The majority of the mechanical and plumbing system were aged and had exceeded their intended design lives. The boiler's flue and associated piping were corroded and degraded. The backflow preventer had a constant discharge piddling on the floor adjacent to an electrical junction box.

**Fire Protection**

» The fire alarm control panel and fire alarm devices were all in good condition with no deficiencies observed.
» No fire suppression systems were observed at the site.

**Electrical**

» The electrical distribution equipment in the main building was approaching the end of design life.

**Arch/Struct/Site**

» The ACT was water stained in various areas throughout and some ceiling tiles were loose or had fallen off.
» The carpet was heavily worn in corridors.
» The paint on the floor in the mech room was heavily scraped and scuffed.
» Many water stains on interior ceilings and walls indicated roof leaks. The shingled and flat, coated roof coverings were heavily deteriorated.
» The interior wood doors were moderately worn with some chipping paint.
» The engineered wood siding on the exterior had peeling paint and water stains.
» The wood framing on the exterior windows had flaking paint and water damage at exposed wood.
» The concrete foundation wall had minor cracking around the perimeter, with major cracking in the northeast corner.
» The foundation wall of Portable 1 had moderate cracking on the east end.
» There was cracking and flaking engineered wood siding on the east exterior of Portable 1.
» The exterior stairs/stoops of Portable 1 were heavily weathered and cracking.
» The pavement at the north entrance had significant cracking and deterioration.
» The two sets of steps on west side of property did not have handrail, were cracked and beyond their typical design life.
» The sidewalk near the west entrance had major cracking near the storm drain.
» Sections of the perimeter fence was aged and corroded.

# PIONEER PROGRAM - HOLLADAY CENTER

**ADDRESS**
2600 SE 71ST AVE

**CONSTRUCTION DATE**
1972 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
30,568 SF

**SITE AREA**
409,464 SF
9.4 ACRES

**CLASSROOMS COUNT**
9

**FUNCTIONAL CAPACITY**
207 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR BLDG**
0

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

The Youngson-Holladay Campus for special needs children is situated in the South Tabor neighborhood of East Portland. The irregular shaped campus, which consists of three school facilities, is bound on the north by SE Division Street, the east by residences and SE 73rd Avenue, the south by residences, and the west by SE 71st Avenue. In the center of the campus is the 1972 Holladay Center. Each facility features its own parking and driveway.

The Holladay Center and Youngson School are attached via an enclosed walkway. The Holladay Center is a minimalistic square-shaped concrete building that exhibits a hybrid of architectural elements with no consistent style. The building features an open interior plan with classrooms lining the exterior walls. Exterior walls are punctuated by geometric shaped windows. The Holladay Center, known originally as the Holladay Center for the Handicapped, was designed for children with physical disabilities. The minimalistic building reflects some principles of Modern architecture, while the interior spatial composition reflects the educations philosophies of the 1970s. The minimalistic building with its character defining plan and interior details reflects the architectural principles of the later twentieth century and school design for disabled children. The Holladay Center is, therefore, eligible for listing in the NRHP under Criterion A and C.

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

- The majority of the plumbing fixtures and domestic water distribution equipment had exceeded their design life.
- The vast majority of the steam heating equipment, exhaust fans, air handling units, and associated equipment had exceeded typical design life.

### Fire Protection

- The building was not sprinklered.
- An addressable fire alarm system headend (Silent Knight 5820XL) and associated detection and signal devices were installed in 2014.

### Electrical

- The majority of the site's electrical distribution system (including the main switchboard and panelboards) had exceeded typical design life.

### Arch/Struct/Site

- The glazed exterior doors in the connecting enclosed walkway with Youngson Main had exceeded typical design life and had aged and mismatched hardware.
- The roof hatch had exceeded typical design life. The roof hatch had a degraded surface finish, weak springs and damaged and missing hardware.
- The sheet vinyl floor finish had exceeded typical design life and had dents, chips and excessive surface wear throughout.
- The main asphalt surface parking lot at the building was observed to have potholes and crumbling/ deteriorating asphalt.
- Several of the concrete sidewalks adjacent to the main parking lot were observed to be cracked with uneven/unlevel surfaces or grass growing in the cracks causing a possible tripping hazard.

# PIONEER PROGRAM - YOUNGSON

**ADDRESS**
2704 SE 71ST AVE

**CONSTRUCTION DATE**
1955 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
31,781 SF

**SITE AREA**
233,046 SF
5.35 ACRES

**CLASSROOMS COUNT**
12

**FUNCTIONAL CAPACITY**
295 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR BLDG**
0

**ZONING**
OS OPEN SPACE CU

## HISTORICAL SUMMARY

The Youngson-Holladay Campus for special needs children is situated in the South Tabor neighborhood of East Portland. The irregular shaped campus, which consists of three school facilities, is bound on the north by SE Division Street, the east by residences and SE 73rd Avenue, the south by residences, and the west by SE 71st Avenue. At the south end of the campus is the 1955 Youngson School. Each facility features its own parking and driveway. For Youngson School parking is provided along the entire west side of the building, which is accessible via a short driveway off SE 71st Avenue. The only play area/ open space is located at the south end of the campus. The design of Youngson School is influenced by the International style. The single story building that comprises the facility features linear wings that form exterior courtyard space. The horizontal massing of the building is emphasized by low sloping gable roofs and, in the case of Youngson School, bands of aluminum hopper windows. Elements such as a linear composition, bands of metal sash windows, low gable roofs, and lack of ornamentation serve to reinforce the ideals of functionalism and minimalism. The Youngson School and Holladay Center are attached via an enclosed walkway.
Due to loss of integrity and the lack of notable post war design principles, the Youngson School is not eligible for listing in the National Register of Historic Places (NRHP).

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

» The majority of the plumbing fixtures and domestic water distribution equipment had exceeded typical design life.
» The vast majority of the heating equipment, air handlers, exhaust fans, and associated equipment had exceeded typical design life.

### Fire Protection

» The building was not sprinklered.
» A new addressable fire alarm system headend (Potter PFC-6800) and associated detection and signal devices were installed in 2019.

### Electrical

» The site's electrical distribution system (including main switchboard and panelboards) had exceeded typical design life. This excludes the UPS and its associated panelboard (IT1) added in the more recent IT upgrade project at the facility. The existing generator (which feeds the automatic transfer switch in the Holladay Center) had also exceeded typical design life.

### Arch/Struct/Site

» The standing seam roof was not accessible for assessment. During a rain event, water was observed pouring over gutters indicating a possible downspout clog, and pouring through holes caused by corrosion in the bottom of the gutter at downspout connection points.
» The interior doors, casework, toilet partitions, and floor finishes were approaching the end of design life or had exceeded design life.
» The acoustic ceiling tiles had exceeded typical design life and some were missing or damaged.
» Several of the concrete sidewalks adjacent to the main parking lot were observed to be cracked with uneven/unlevel surfaces or grass growing in the cracks causing a possible tripping hazard.
» The asphalt parking lot was observed to be cracked throughout the surface.

# SWING & VACANT SITES

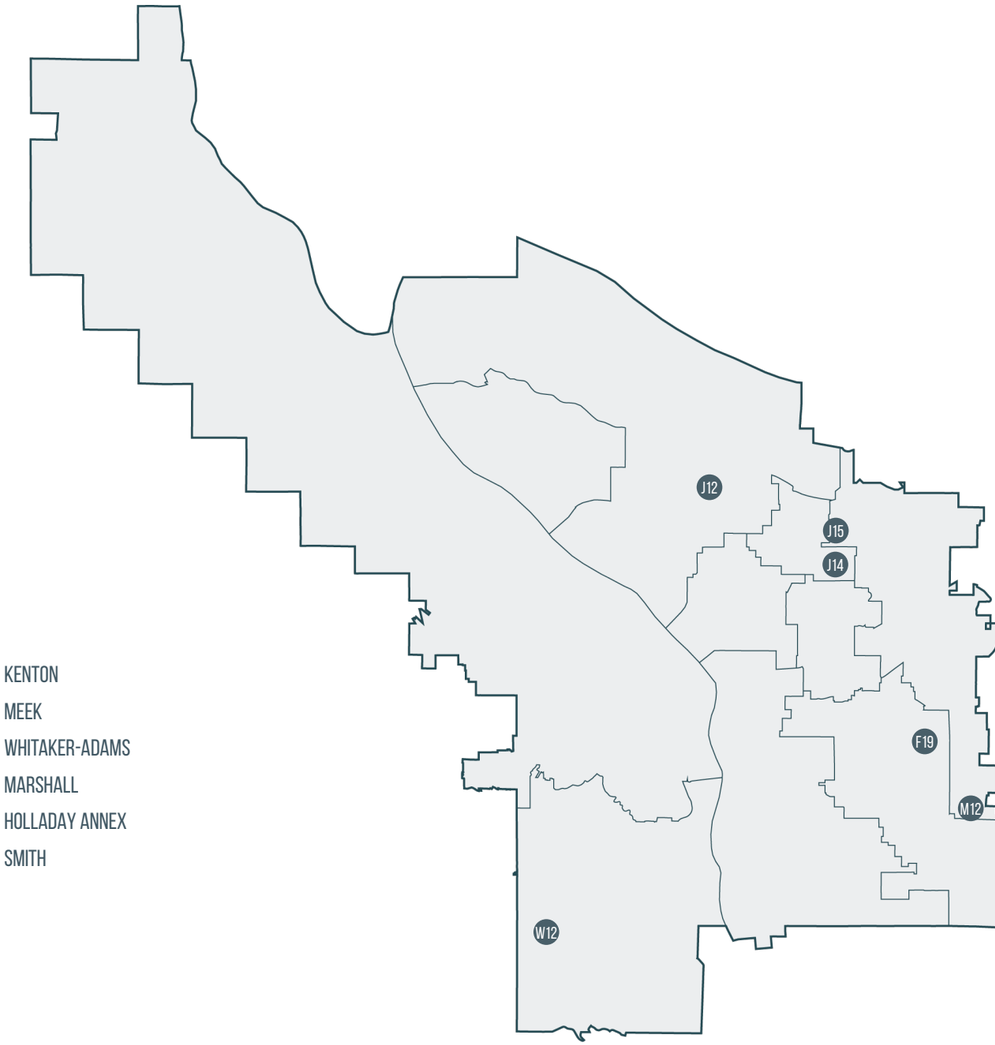


- J12 KENTON
- J14 MEEK
- J15 WHITAKER-ADAMS
- M12 MARSHALL
- F19 HOLLADAY ANNEX
- W12 SMITH

## CAPITAL FORECAST

Kenton and Marshall serve as the district's swing sites. Marshall is a former high school and comfortably supports a high school student body. Kenton is closer in square footage and classroom count to an elementary school. Both sites currently support the programs to be sited on the Benson campus in 2024.

The district owns two vacant sites: Smith and Whitaker-Adams. Smith is a former elementary school, closed in 2005. The building is now derelict. Significant investments would be necessary before the structure could be operational. However, enrollment forecasts in the Southwest do not support reopening Smith.

District leadership identified Whitaker-Adams for future development as an athletics hub as part of the development of this plan.

# SMITH K-5 SCHOOL

**ADDRESS**
8935 SW 52ND AVE

**CONSTRUCTION DATE**
1958 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
37,927 SF

**SITE AREA**
439,085 SF
10.08 ACRES

**CLASSROOMS COUNT**
18

**FUNCTIONAL CAPACITY**
184 STUDENTS

**CLUSTER**
WELLS-BARNETT

**MODULAR BLDG**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

## HISTORICAL SUMMARY

Smith Elementary School is situated in southwest Portland on a 10.08-acre school campus. The primary school building is a wood frame structure that rests on a poured concrete foundation. The cladding consists of a mixture of red brick, plywood panels, and T-1-11 siding. Gable roofs cover the two wings of the single-story building. The building features elements of the Northwest Regional style, including broad roof overhangs, plywood siding, and fixed windows with louvers.

Although designed to be extensible, Smith Elementary School lacks integrity due to the additions, alterations, and resulting lack of coherent building vocabulary. The school was built during the PPS program of post-war construction, but archival research does not indicate that it influenced the design of other schools buildings, the curriculum, or future planning for the schools. Therefore, it is not eligible for the NRHP under Criterion A. The architects Payne & Scott and John Storrs both had significant ties to the development of the Northwest Regional style; however this building is not a strong example of the style or of these architects' work. The alterations to the wing designed by John Storrs have significantly altered the original character of the school. Although the school exhibits characteristic features of twentieth century school design in the Northwest Regional style, due to the lack of integrity in comparison with other schools of this period in Portland, Smith Elementary School is not eligible for the NRHP under Criterion C.

## DEMOGRAPHIC CONTEXT

The Smith site is located in Census Tract 65.01, bordered by seven adjacent census tracts. PPS's attendance boundary runs to the west of the census tract that Smith falls within. In this area of the district, enrollment is projected to fall by 3% over the next 15 years.

Of the population of the Smith site census tract, up to 15% identify as BIPOC, up to 25% of households are cost-burdened, and up to 3% of children are experiencing poverty. The census tracts surrounding the site's census tract are more racially diverse (between 25% and 35% of the population identifying as BIPOC), and include a higher percentage of households experiencing cost burden (between 35% and 45%) and childhood poverty (between 7% and 15%).

**Credit**
U.S. Census Bureau's American Community Survey (ACS) 2014-2018 5-year estimates, December 2019 Release.

# SMITH SITE PHYSICAL CONTEXT

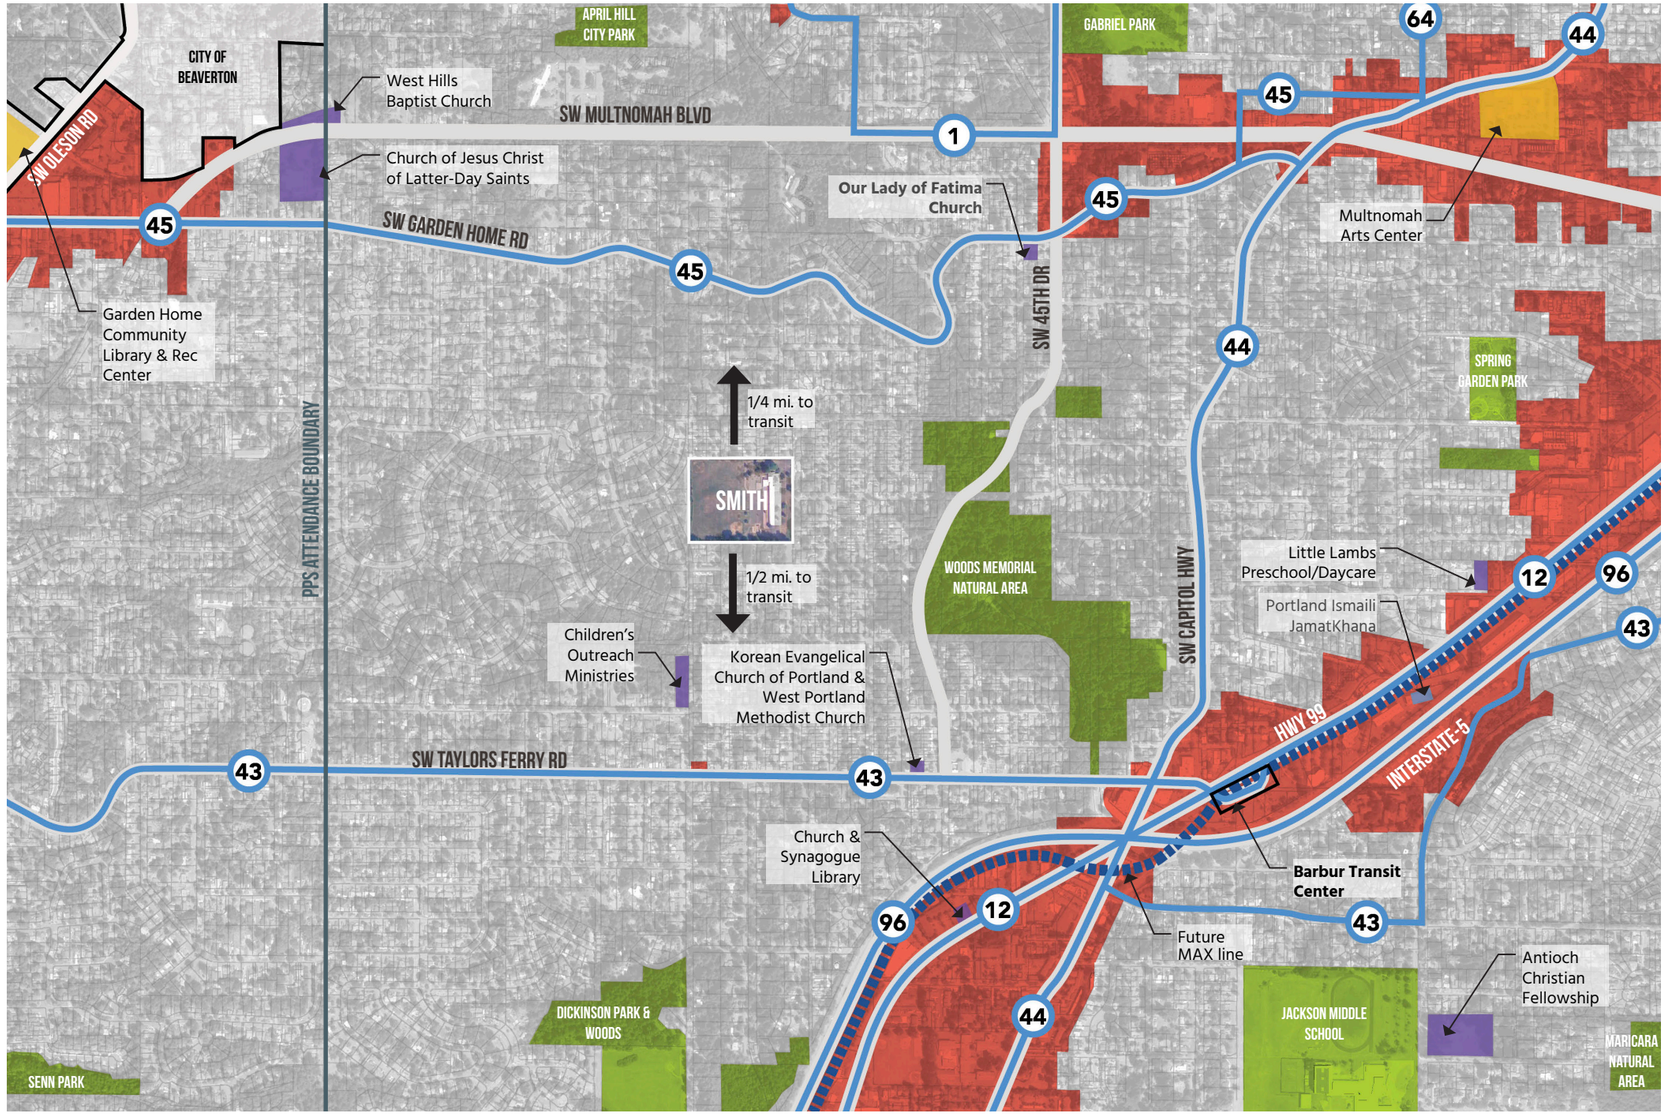


## TRANSPORTATION ACCESS

The Smith site is located in the Ashcreek neighborhood of Southwest Portland. SW Taylors Ferry Rd and SW Garden Home Rd / SW Multnomah Blvd are the primary east-west road corridors. I-5 and Hwy 99 are about a mile from the site, along with the Barbur Transit Center park and ride. The Southwest Corridor MAX light rail is planned along I-5 and would provide more convenient access to central Portland in the future. After voters declined to fund the new MAX line in 2020, the project was put on hold until funding can be identified. Major bus transit corridors are located north and south of the site.

## DISTRICT CONTEXT

The site is adjacent to PPS's attendance boundary to the west. Jackson Middle School, site of a future athletic hub, is located across I-5 to the southeast. Several city parks are located to the west of the site, and Smith is located 1.5 miles from Portland Parks and Recreation's Multnomah Arts Center to the east. Tualatin Hills Park and Recreation District's Garden Home Recreation Center is located to the west, outside the PPS attendance boundary. There are no PPS Early Childhood Education locations near the site or on the west side of the Willamette River.

## ADJACENT USES

The Smith site is surrounded by residential neighborhoods. Commercial areas, services, and community uses are located closer to major roads like the I-5 corridor and Multnomah Blvd.

LEGEND

- BUS LINE
- MAJOR ROAD
- FUTURE MAX LINE
- PARKS & SCHOOLS
- MIXED USE/ COMMERCIAL
- PLACE OF WORSHIP
- COMMUNITY USE

N 0 200' 400' 800'

# SMITH SITE ANALYSIS

## SITE ANALYSIS

The Smith site is surrounded by residential zoning (R5, R7, and R10). Dwellings were built primarily between the 1950s and 1980s, with some more recent construction. Of the surrounding roads, only SW 52nd Ave has a sidewalk, and pedestrian access points to the site are limited. The existing school building is in poor condition and has a footprint of around 43,000 gsf. A 27,000 sf paved school yard lies to the west of the existing building, and existing vehicular access enters a small parking lot at the northeast corner of the site. The site slopes about 35 feet down from southeast to northwest. A grove of mature trees borders the site to the southwest.

## POTENTIAL SITE SUITABILITY

Based on the district context, transportation access, and site conditions, the Smith site could be a candidate for Early Childhood Education (to add service to the west side of the district) or potentially for an athletic spillover use connected to the future Jackson Middle School athletic hub. The site could accommodate VAPA or CTE programs depending on geographic need.

SITE ANALYSIS LEGEND

- BUS LINE
- NEIGHBORHOOD COLLECTOR
- BUS STOP
- SIDEWALK
- FENCE
- VEHICULAR ACCESS
- PEDESTRIAN SITE ACCESS

0 50' 100' 200'

# MARSHALL HIGH SCHOOL

**ADDRESS**
3905 SE 91ST AVE

**CONSTRUCTION DATE**
1960 (PRIMARY)

**LEVELS**
4

**BLDG AREA**
273,646 SF

**SITE AREA**
1,039,342 SF
23.86 ACRES

**CLASSROOMS COUNT**
74

**FUNCTIONAL CAPACITY**
1,781 STUDENTS

**CLUSTER**
MCDANIEL

**MODULAR BLDG**
0

**ZONING**
IR INSTITUTIONAL RESIDENTIAL LCU

## HISTORICAL SUMMARY

Marshall High School is located in the Lents neighborhood of southeast Portland. The campus includes only the main school building The three story building is largely devoid of architectural embellishments, but the internal functions of the school, such as the stair Wells-Barnett, hallways, library, auditorium, and gymnasium are clearly communicated by the building's fenestration patterns, overall massing, and varying building heights. The building mixes an external skin of variegated tan-colored brick with expansive banks of plate glass windows that form the building's curtain walls. Cantilevered overhangs shade the windows on each floor on the west and south sides, while no eaves are present on the north and east sides. The interior follows a square shaped corridor plan that provides access to all classrooms, the auditorium, cafeteria, and the gymnasium.

The square-shaped property extends northward to gain access to SE 91st Avenue. Development in the surrounding area consists primarily of single family residences built between 1945 and 1970 as well as large scale retail with the presence of large "big box" stores situated to the west at Eastport Plaza.

Despite the retention of its historical integrity, Marshall High School does not appear to be eligible for the National Register of Historic Places.

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

» This facility utilized several air handling units, supply fans, and exhaust fans for heating and ventilation; most of which were original to building construction in 1960. All fans and their associated ductwork were observed to have exceeded their design life.
» While the boilers were observed to have updated controls and burners, their storage tanks and the remainder of the heating hot water system (expansion tanks, backflow preventers, piping, etc.) had exceeded its design life.
» Many water coolers throughout the facility had not been approved for water consumption due to potential lead hazards.
» All plumbing fixtures and domestic water distribution equipment was observed to have exceeded their design lives.

### Fire Protection

» The fire riser located in room B-65 and its associated sprinklers appeared to be original to building construction in 1960 and had exceeded their design life.

### Electrical

» Seventy-one of the 89 panels identified on site as well as two switchgears and six interior distribution transformers were observed to have all exceeded their intend design lives.
» All lighting throughout the facility was observed to have exceeded its intended design life.

### Arch/Struct/Site

» The exterior enclosure (section of glazed curtain wall, aluminum windows and exterior doors) were observed to be aged and degraded.
» The roof access hatch was observed to be aged and degraded.
» The interior floor finishes (including wood stage floor in auditorium), toilet partitions, lockers, and auditorium seating observed to be aged and degraded.

## DEMOGRAPHIC CONTEXT

The Marshall site is located in Census Tract 83.01, bordered by six other census tracts and located at the eastern edge of the PPS attendance boundary. In this area of the district, enrollment is projected to fall by 10% over the next 15 years, making it an area with one of the largest projected reductions in enrollment.

The Marshall site is located in an area with the highest concentration of BIPOC populations of all the alternative use sites studied; between 45% and 75% of residents in the Marshall site census tract and the tract to the east identify as BIPOC. Just to west of the site, more than 45% of residents are cost burdened, and other surrounding residents are between 30% and 45% cost burdened.

Child poverty is also high in the immediate vicinity of the site--between 30% and 74% of children are living below the poverty level in the site census tract. The demographics of this area are consistent with patterns of displacement from rapidly gentrifying neighborhoods to the west, where more diverse populations have lost a foothold, with some seeking affordability further east.

### Credit

U.S. Census Bureau's American Community Survey (ACS) 2014-2018 5-year estimates, December 2019 Release.

# MARSHALL SITE STUDY

**Existing Site**

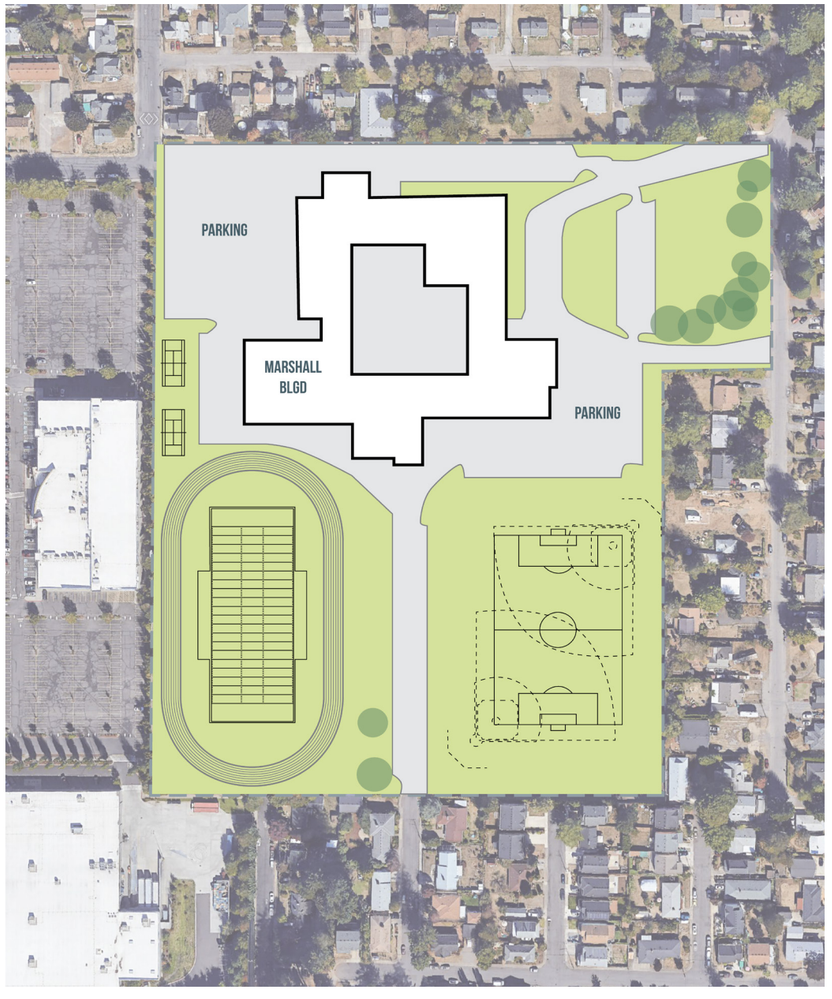


**Proposed Athletics Programming**

# MARSHALL SITE PHYSICAL CONTEXT

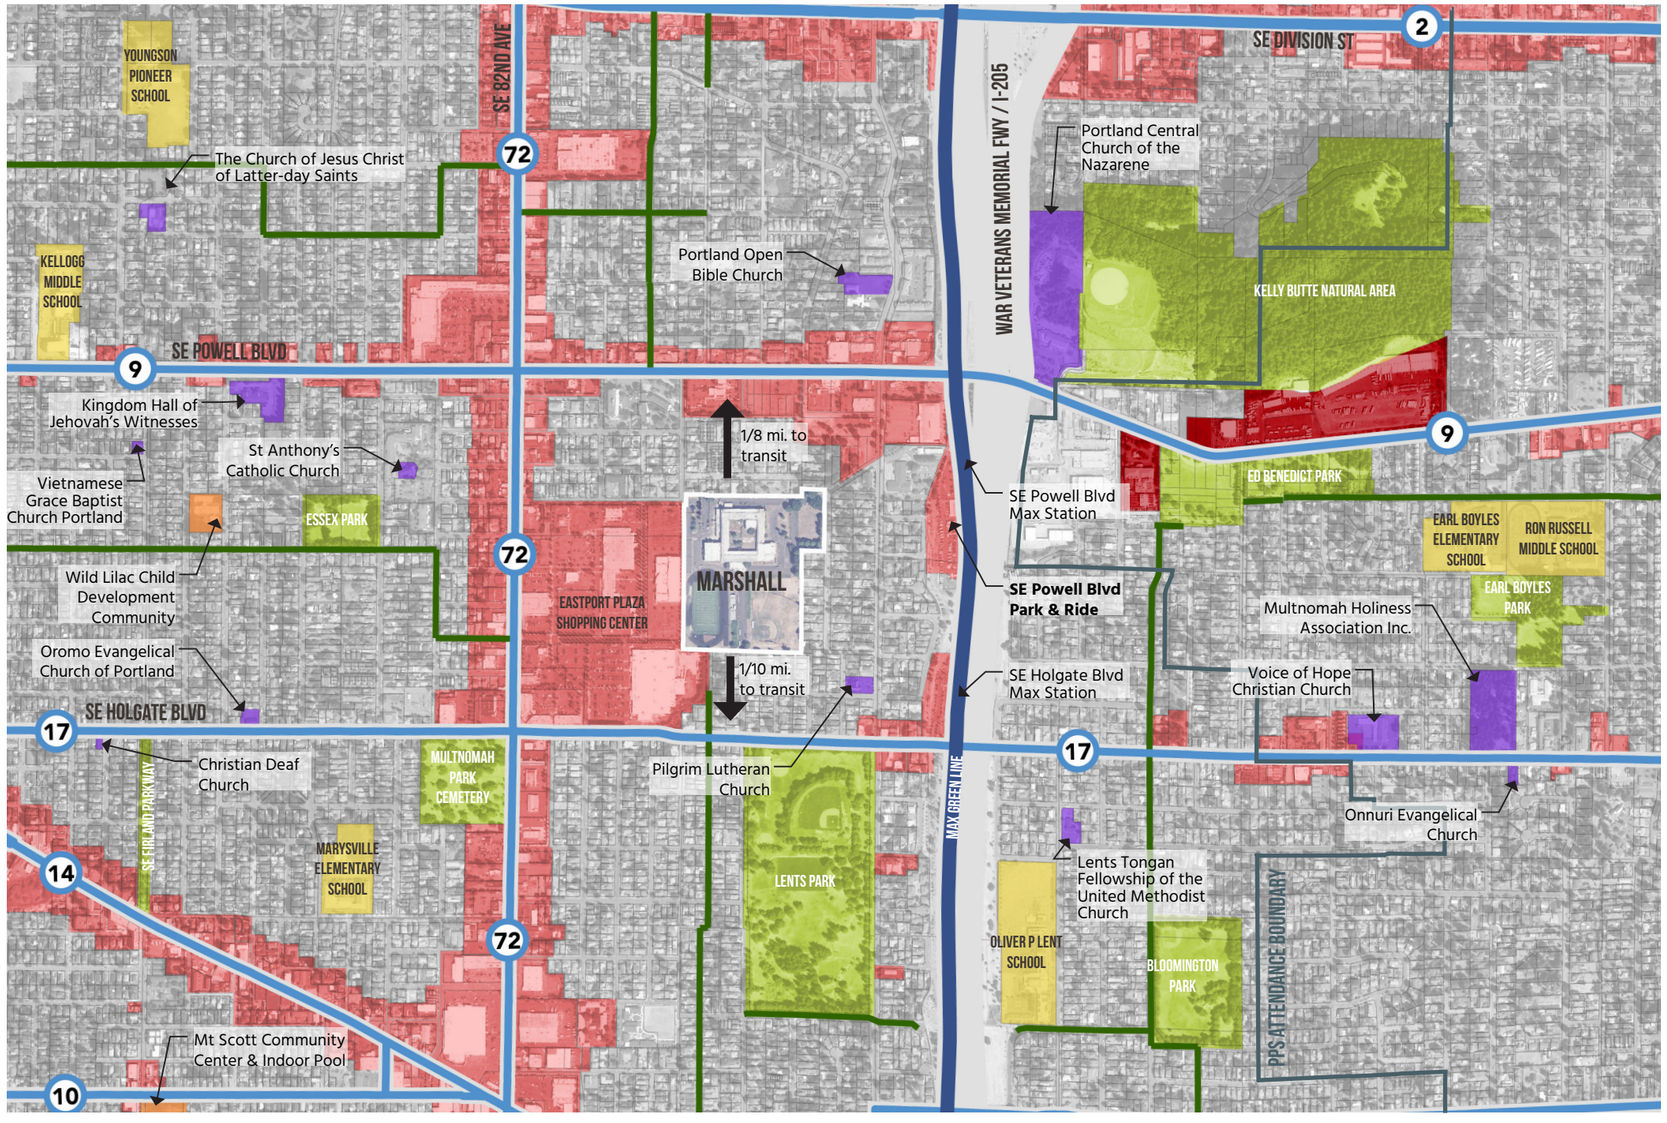


## TRANSPORTATION ACCESS

The Marshall site is located in the Lents neighborhood of Southeast Portland. The site sits between SE Powell Blvd (a Major City Traffic Street) and SE Holgate Blvd (Neighborhood Collector) as primary east-west road corridors and I-205 and SE 82nd Avenue as major north-south travel corridors. The MAX Green Line light rail runs adjacent to I-205, with two stops within a 5-minute walk of the site, at SE Powell and SE Holgate, providing convenient access to central Portland and other East Portland neighborhoods. Major bus transit corridors are located along SE Powell and SE Holgate with stops within a quarter mile walk of the site.

## DISTRICT CONTEXT

The PPS attendance boundary runs to the east of I-205, where David Douglas School District is adjacent. Two Title I schools, Marysville and Lent (which is also an Early Childhood facility), are located to the south, and Kellogg and Youngson Pioneer School are located to the northwest. Marshall is located within a 5-minute walk from Lents Park with its baseball stadium and soccer field. Three parks east of I-205: Kelly Butte, Ed Benedict and Bloomington parks.

## ADJACENT USES

The Marshall site is surrounded by residential neighborhoods to the north and south east with a mix of housing types. The large Eastport Plaza retail center adjoins the site to the west and smaller commercial pockets are located along SE Powell Blvd.

LEGEND

- BUS LINE
- NEIGHBORHOOD GREENWAY
- MAJOR ROAD
- EXISTING MAX LINE
- PARKS
- EMPLOYMENT
- MIXED USE/ COMMERCIAL
- PLACE OF WORSHIP
- COMMUNITY USE
- SCHOOLS

0 200' 400' 800'

# MARSHALL SITE ANALYSIS

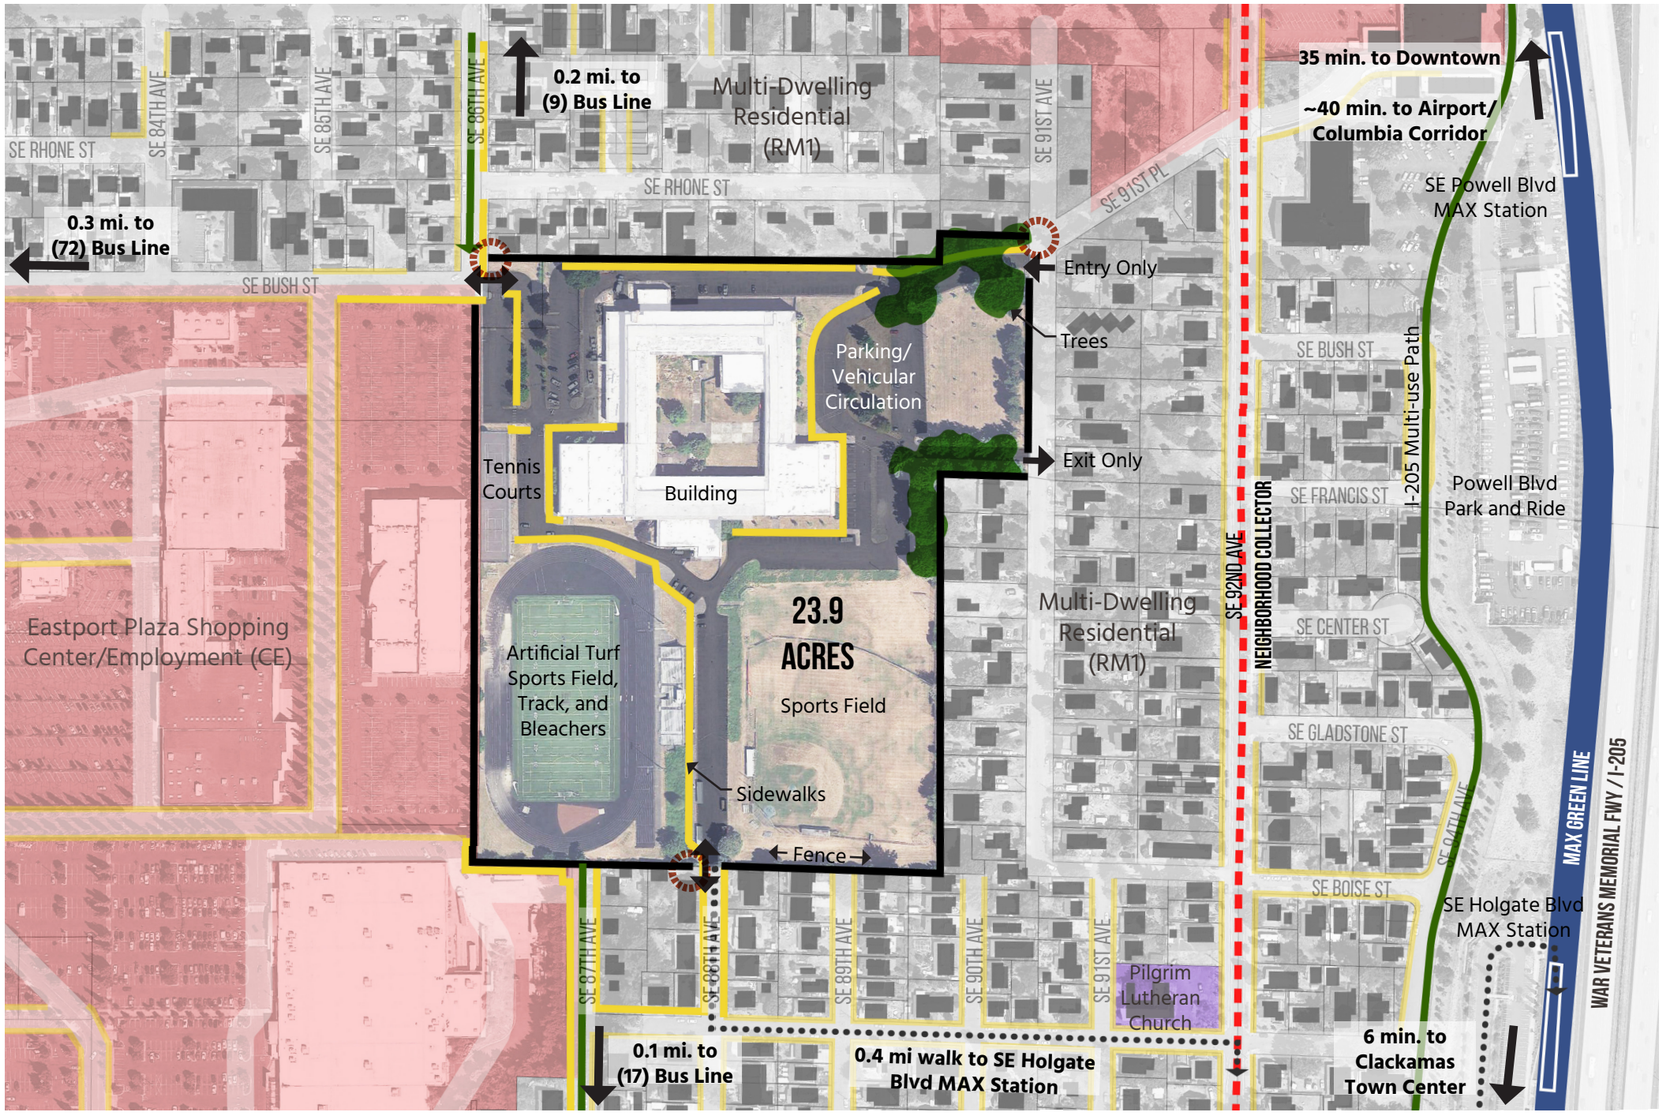


## SITE ANALYSIS

The Marshall site is surrounded by multi-dwelling zoning (RM1) to the east, north and south and commercial zoning on the Eastport Plaza center to the west. The existing 220,000 gsf building is in fair condition. The building is ringed by 4 acres of surface parking lots, and sports fields are located south of the building, flanking the main entry drive extending north from SE 88th Ave. Existing vehicular access enters on this main drive as well as into parking lots at the northeast and northwest corners of the site. Most surrounding roads have sidewalks, except for SE 91st Avenue. There are three main pedestrian access points to the site. A City Bikeway traverses the site north-south, and the I-205 multi-use path is located 2 blocks west. The site is flat. Some mature trees are located east of the building.

## POTENTIAL SITE SUITABILITY

Program capital forecasts identified the need for district-wide athletic and CTE hubs at this location. The site's topography, existing fields, and building capacity support these uses, and its robust transit access makes it a logical location for a district hub.

LEGEND

- BUS LINE
- NEIGHBORHOOD COLLECTOR
- CITY BIKEWAY
- SIDEWALK
- FENCE
- VEHICULAR ACCESS
- PEDESTRIAN SITE ACCESS

0 50' 100' 200'

# KENTON SCHOOL

**ADDRESS**
7528 N FENWICK AVE

**CONSTRUCTION DATE**
1913 (PRIMARY)

**LEVELS**
3

**BLDG AREA**
66,599 SF

**SITE AREA**
172,498 SF
3.96 ACRES

**CLASSROOMS COUNT**
18

**FUNCTIONAL CAPACITY**
NA

**CLUSTER**
JEFFERSON*

**MODULAR BLDG**
3

**ZONING**
R1 RESIDENTIAL 1,000 CU

## HISTORICAL SUMMARY

Kenton School is situated in the Kenton neighborhood of North Portland. The campus occupies a 4 acre, rectangular parcel on the north side of Lombard Avenue. Development in the surrounding area consists primarily of single family residences built between 1900-1950. More recent development includes multi-family buildings and commercial businesses are located on the arterial streets within the vicinity of the school particularly on the south side of Lombard and along Interstate Avenue to the east. The campus consists of a primary rectangular-shaped building with an attached gymnasium and auditorium and three portables  located at the south side of the property.

In comparison with other Portland schools during the same period and constructed of similar styles, the building retains a high degree of integrity and is therefore eligible for the National Register of Historic Places under Criterion A as an example of school planning and the use of the extensible school type to accommodate the rapidly expanding population of Portland. The school is significant as an extensible school building type and is significant under Criterion C. While the building is notable for its Mediterranean Revival style terra cotta detailing, superior examples of the style are found in other schools such as at Irvington.

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

» The majority of the plumbing fixtures had exceeded their typical design lives. A portion of the domestic water distribution had been replaced; however, many of the existing plumbing fixtures were noted to have lead present in the system and the water is not safe for consumption. The water heater was recently replaced, but most of the other domestic water distribution equipment has exceeded its typical design life and should be replaced.

» The vast majority of the heating equipment, air handlers, exhaust fans, and associated equipment had exceeded their typical design lives. Heating equipment and exhaust fans serving the auto shop and work shop areas did not have any major deficiencies.

### Fire Protection

## DEMOGRAPHIC CONTEXT

The Kenton site is located in Census Tract 38.01, bordered by four adjacent census tracts. In this area of the district, enrollment is projected to rise by 3% over the next 15 years.

Of the population of the Kenton site census tract, between 25% and 35% identify as BIPOC, about one third of households are cost burdened, and between 7% and 15% of children are experiencing poverty. The census tracts to the east and north are more racially diverse (35% to 45% of the population identifying as BIPOC), and include a higher percentage of households experiencing cost burden (up to 45%). Childhood poverty is more pronounced in the outer reaches of the site's context along the Columbia corridor and toward St. Johns as well as further east and south.

**Credit**
U.S. Census Bureau's American Community Survey (ACS) 2014-2018 5-year estimates, December 2019 Release.

# KENTON SITE PHYSICAL CONTEXT

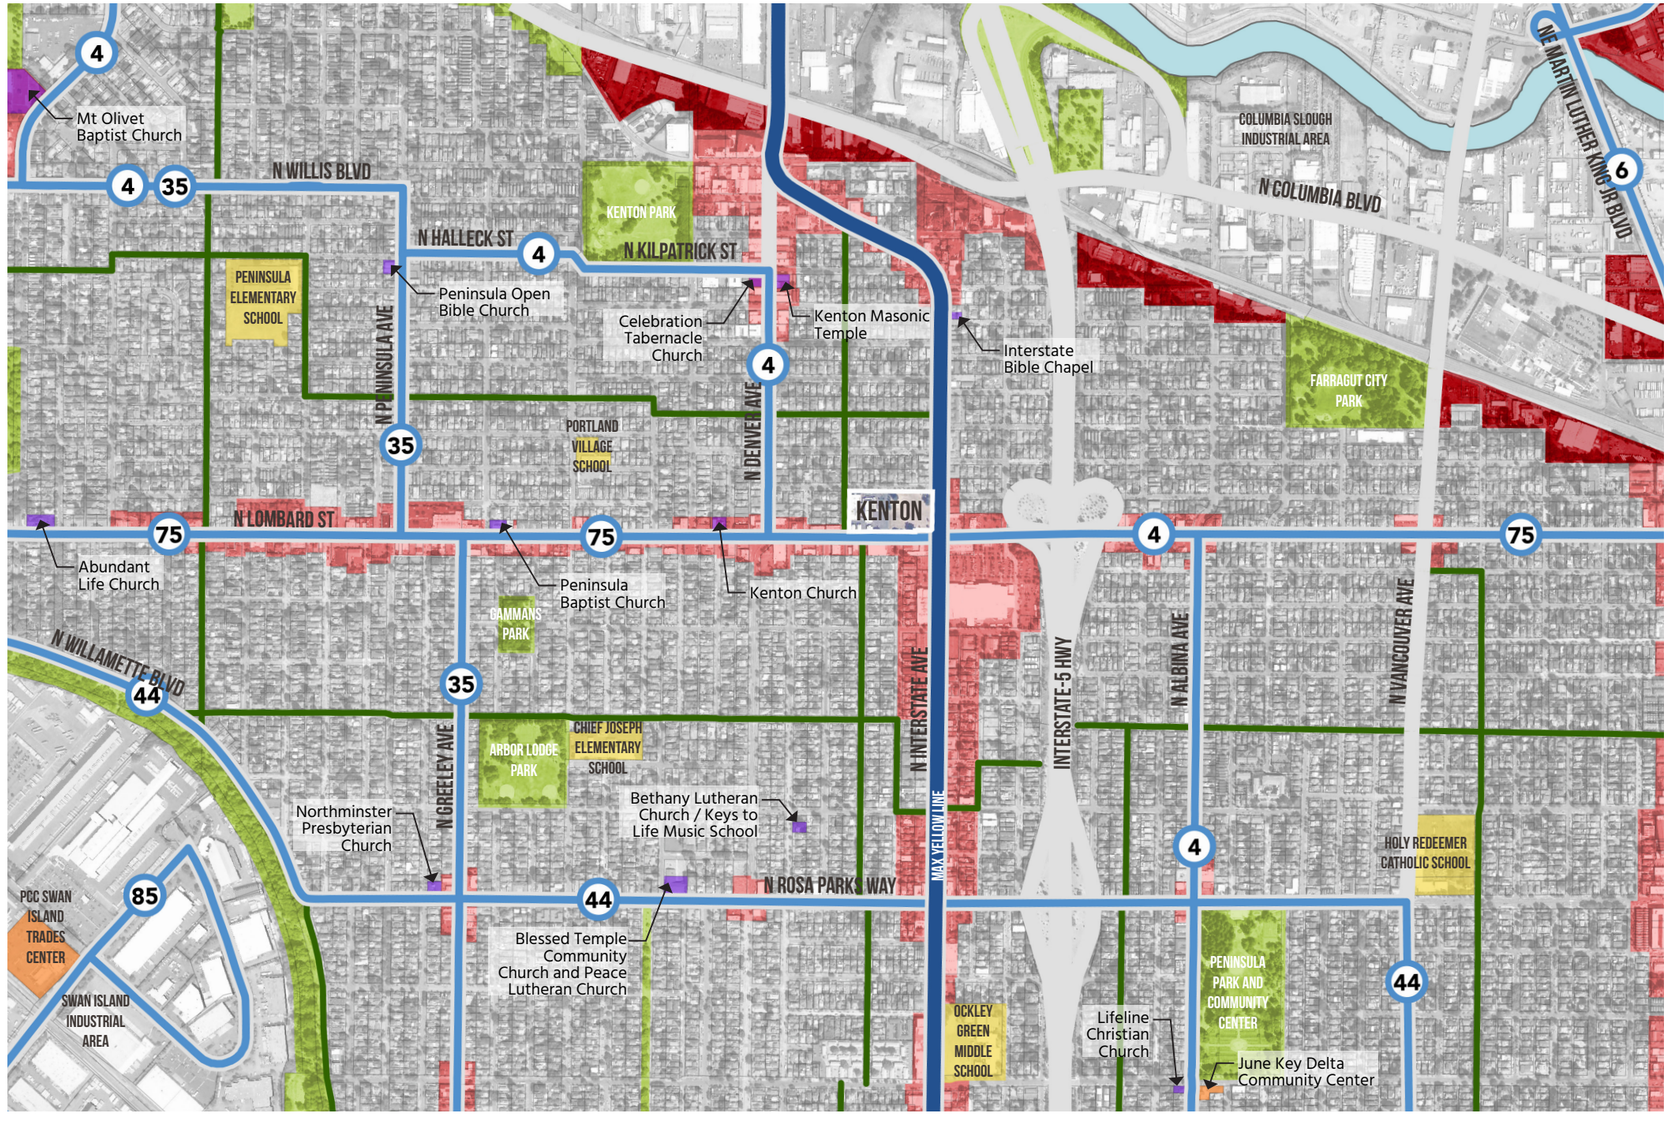


## TRANSPORTATION ACCESS

The Kenton site is located in the Kenton neighborhood of North Portland. The site is located on N Lombard St, a District Collector that extends west to St Johns. N Interstate Avenue is a Neighborhood Collector running north-south on the east edge of the site. Interstate 5 provides regional vehicular access 3 blocks to the east on Lombard. The MAX Yellow Line light rail runs along Interstate Ave, providing convenient access to central Portland and employment areas to the south of Portland. N Lombard is a major bus corridor. A Neighborhood Greenway bike route runs along the west edge of the site on N Fenwick Ave., with an additional east-west route on N Terry St north of the site.

## DISTRICT CONTEXT

The site is within PPS's attendance boundary. Peninsula Elementary School is the closest PPS facility. Kenton Park and Farragut Park are large neighborhood park facilities within 1 mile of the site. The Kenton site was leased until this year by De La Salle HS, who have vacated the building and moved to St Charles Church on NE 42nd Ave.

## ADJACENT USES

The Kenton site is located within a bustling hub of transit waiting areas, large commercial uses including a grocery store, and smaller commercial along N Lombard St. There are few community uses or places of worship surounding the site.

LEGEND

- BUS LINE
- NEIGHBORHOOD GREENWAY
- MAJOR ROAD
- EXISTING MAX LINE
- PARKS
- EMPLOYMENT
- MIXED USE/ COMMERCIAL
- PLACE OF WORSHIP
- COMMUNITY USE
- SCHOOLS

0 200' 400' 800'

# KENTON SITE ANALYSIS

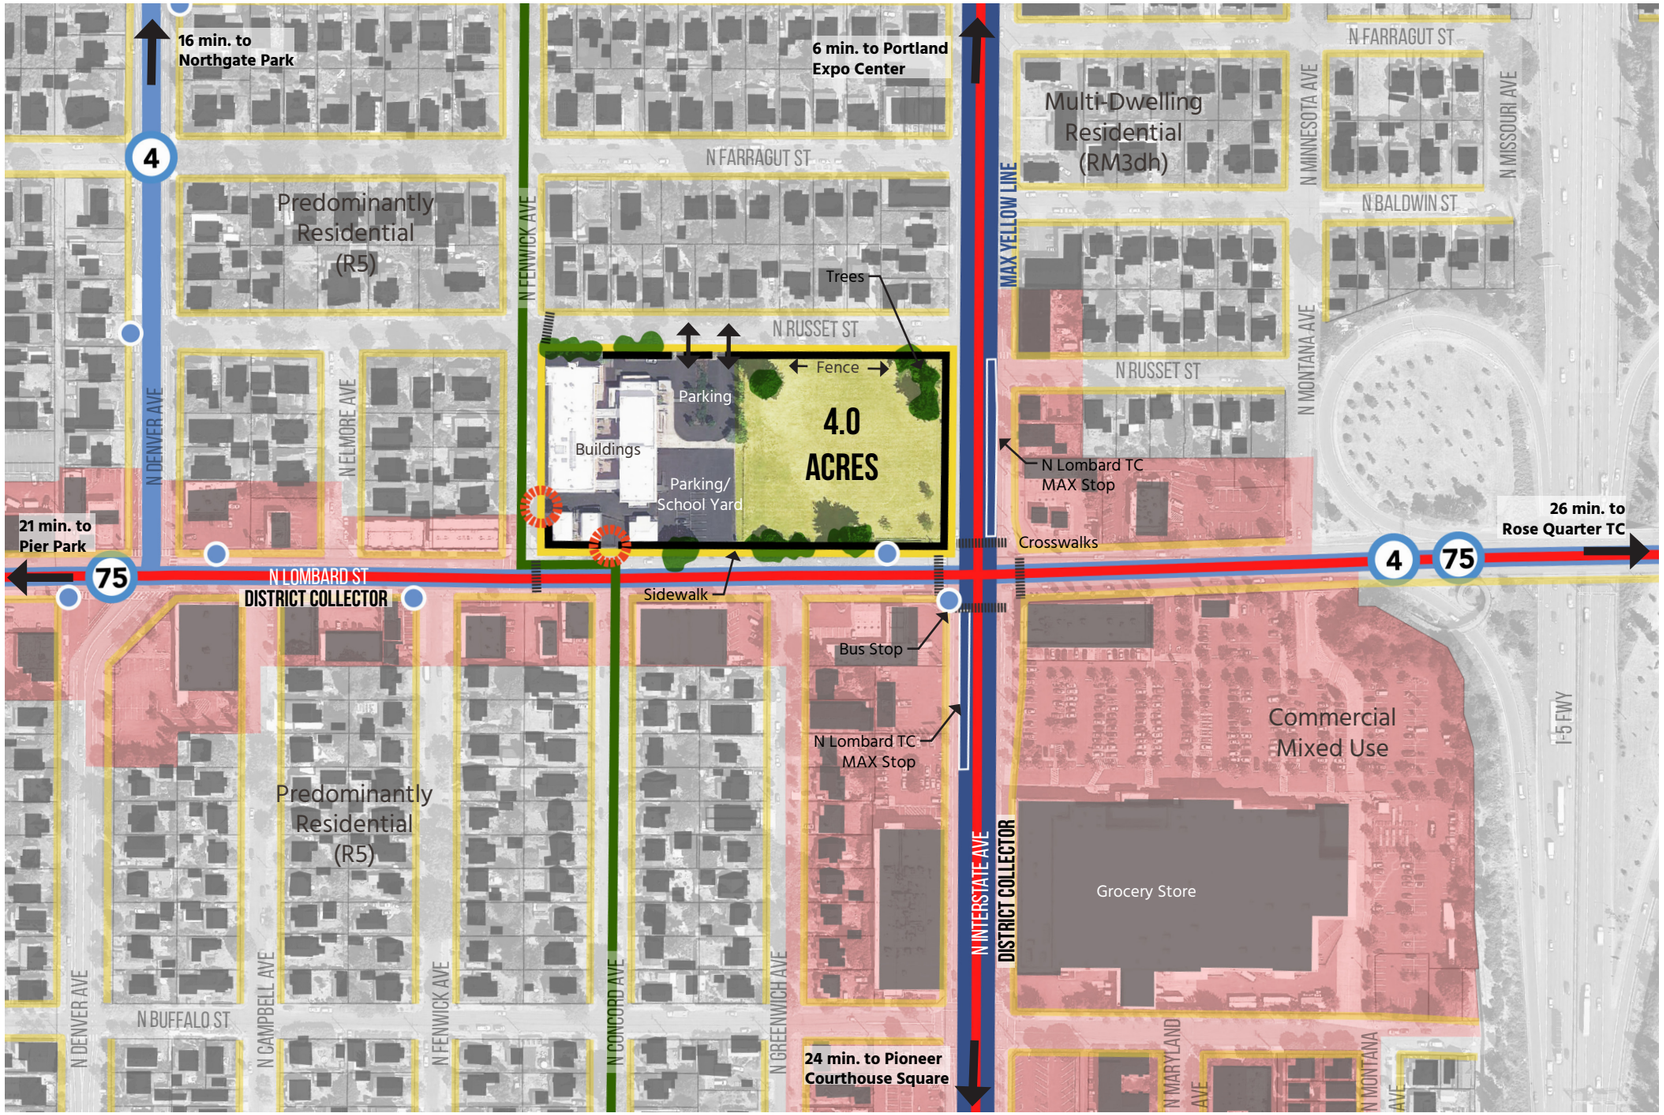


## SITE ANALYSIS

The Kenton site is surrounded to the north and west by predominantly single-family homes, within R5 zoning. N Interstate and N Lombard St are District Collectors. All surrounding streets have sidewalks, and there are pedestrian access points to the site on the north, west and south sides of the site. There are 5 buildings on the site, including a large original 2-story structure built in 1913, with an adjacent gymnasium. Three small classroom portables are located along N Lombard. A paved school yard and two parking lots accessed from N Lombard and N Russet lie to the east of the existing buildings and a large grassy sportsfield occupies the eastern half of the flat site. Some mature conifers line the southern edge of this field.

## POTENTIAL SITE SUITABILITY

While athletics program need in North Portland is high, the site capacity is limited for athletic fields. Early childhood may not be compatible with the surrounding levels of traffic, but a small new facility could be accommodated along N Russet St. If the existing historic building was updated and preserved, this site could be repurposed as a future arts magnet school with the addition of a new theater and central storage area for VAPA materials.

LEGEND

- BUS LINE
- DISTRICT COLLECTOR
- CITY BIKEWAY
- EXISTING MAX LINE
- MAX STOP
- BUS STOP
- SIDEWALK
- FENCE
- VEHICULAR ACCESS

0 50' 100' 200'

# MEEK PROF TECH SCHOOL

**ADDRESS**
4039 NE ALBERTA CT

**CONSTRUCTION DATE**
1953 (PRIMARY)

**LEVELS**
1

**BLDG AREA**
35,945 SF

**SITE AREA**
234,353 SF
5.38 ACRES

**CLASSROOMS COUNT**
16

**FUNCTIONAL CAPACITY**
441 STUDENTS

**CLUSTER**
MCDANIEL

**MODULAR BLDG**
0

**ZONING**
R5 RESIDENTIAL 5,000 CU

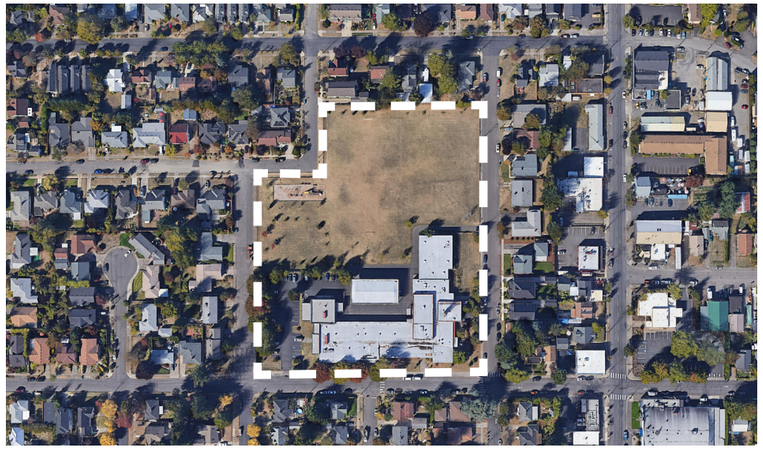

## HISTORICAL SUMMARY

Originally the Alberta Court (Meek) Elementary School when it was constructed in 1953, this Modernist Vernacular style building is situated on a grass and asphalt-covered campus. Clad in red brick, the wood frame structure sits on a poured concrete foundation. The single story building is covered by flat and slightly pitched roofs. The L-shaped plan houses classrooms, a cafetorium, a library, a music room, and an administrative office. Situated in a primarily residential neighborhood in Northeast Portland, the Meek Professional Technical High School was originally constructed in 1953, as the Alberta Court (Meek) Elementary School. The playground, play shed, and playfields are located directly north and northwest of the school. The parking area is located directly west of the building.

The school was built in response to the residential development in northeast Portland during the PPS program of post-war construction and is eligible for the NRHP under Criterion A.

## FACILITY CONDITION SUMMARY

### Mechanical & Plumbing

» The majority of the plumbing fixtures had exceeded their typical design lives. A portion of the domestic water distribution had been replaced; however, many of the existing plumbing fixtures were noted to have lead present in the system and the water is not safe for consumption. The water heater was recently replaced, but most of the other domestic water distribution equipment has exceeded its typical design life and should be replaced.
» The vast majority of the heating equipment, air handlers, exhaust fans, and associated equipment had exceeded their typical design lives. Heating equipment and exhaust fans serving the auto shop and work shop areas did not have any major deficiencies.

### Fire Protection

» The building was observed to have a wet-pipe sprinkler system providing coverage of approximately 25% of the overall building. The piping and sprinkler heads were estimated to be original to the building and had exceeded their typical design life.
» An addressable fire alarm system headend (Silent Knight 5208) and associated detection and signal devices were installed in 2004.

### Electrical

» The building's main electrical switchboard was upgraded in 1998; however, the majority of the panelboards had exceeded their typical design lives. This did not include three panelboards added in 1997 and two more added in 2004 as part of various upgrades.

### Arch/Struct/Site

» The roof hatch had exceeded typical design life. The roof hatch had weak springs, aged hardware and missing seals.
» The remaining exterior architectural components are planned for future assessment.

## DEMOGRAPHIC CONTEXT

The Meek site is located in Census Tract 30, surrounded by five other census tracts. Enrollment is projected to increase by 6% over the next 15 years in this area of the district.

While the site's census tract contains relatively lower child poverty rates and housing cost burdened families, it is important to note that just east of the site, across NE 42nd Ave, the census tracts are significantly more diverse (between 45% to 75% identifying as BIPOC), more cost-burdened (between 35% to 45% of households), and experiencing higher rates of childhood poverty (between 30% and 74% of households). This pattern is consistent with recent gentrification and displacement pushing eastward in this area of Portland. It also overlaps with strong efforts by local community organizations to fight displacement by building affordable housing units in the Cully neighborhood on the east side of NE 42nd Ave.

### Credit

U.S. Census Bureau's American Community Survey (ACS) 2014-2018 5-year estimates, December 2019 Release.

# MEEK SITE PHYSICAL CONTEXT

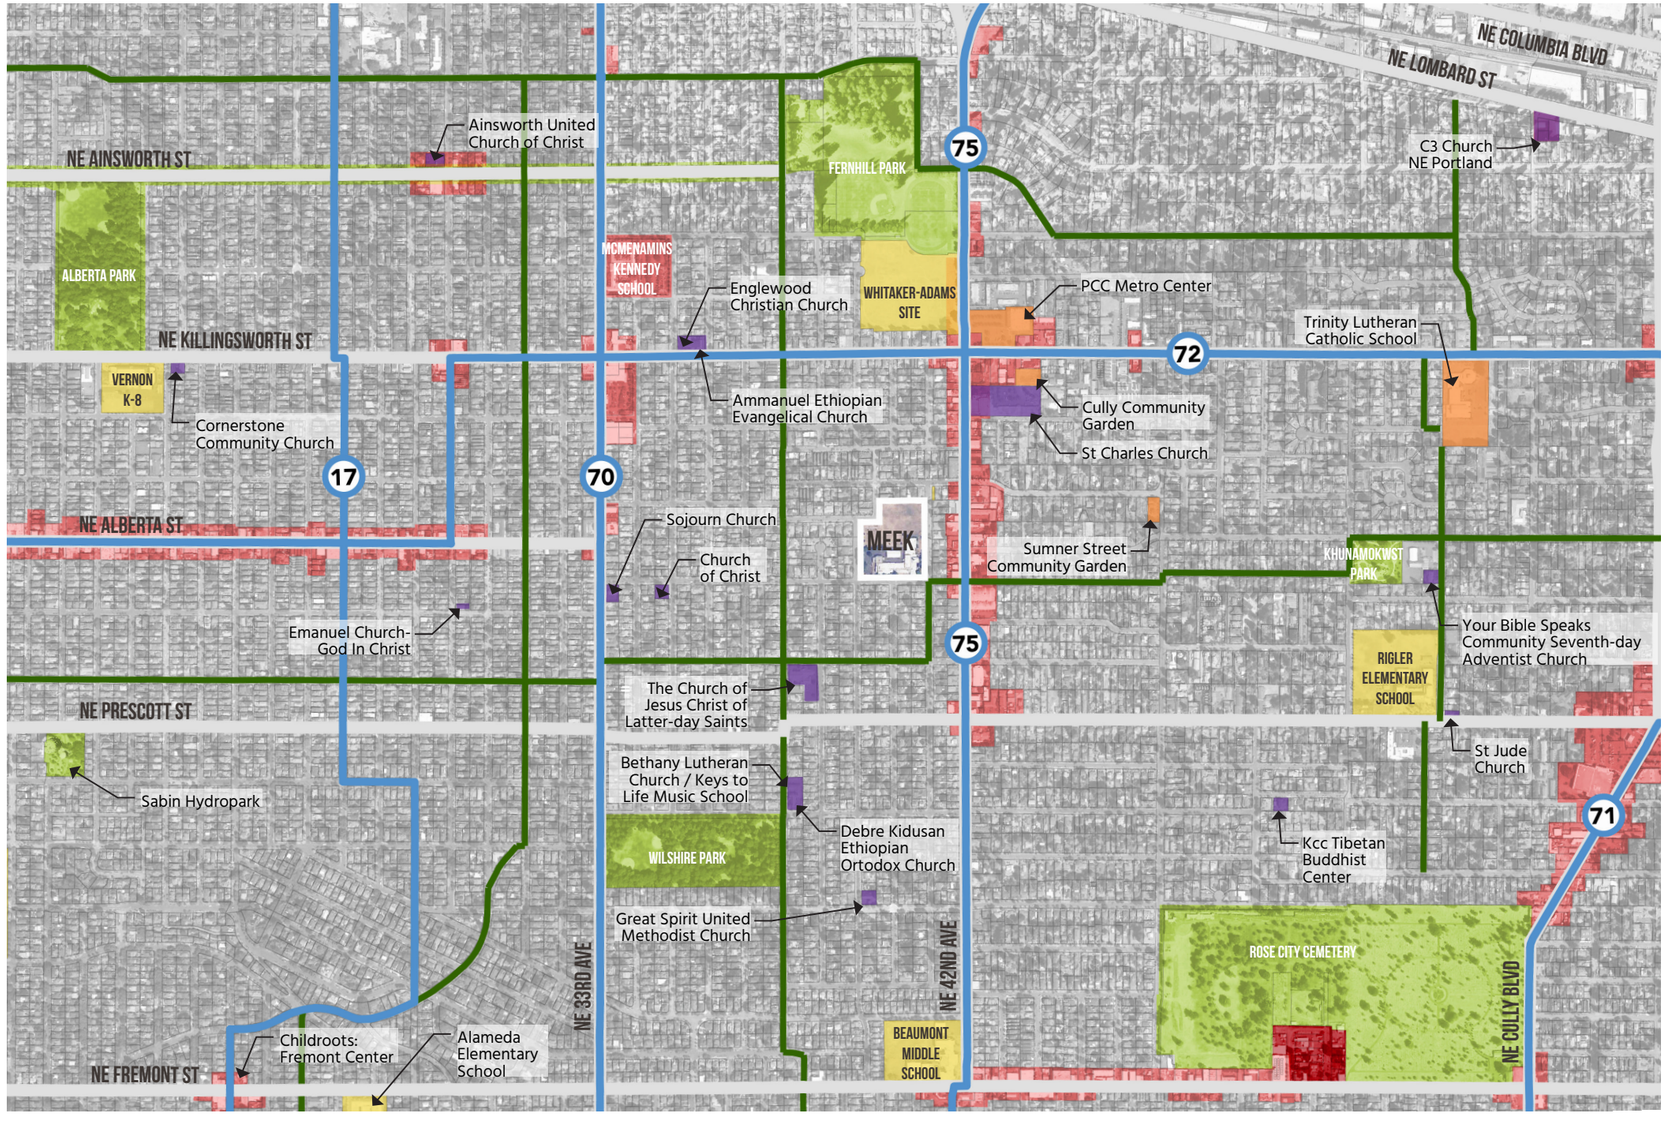


## TRANSPORTATION ACCESS

The Meek site is located in the Concordia neighborhood of NE Portland. The site is easily accessible by multiple modes of transportation. Major nearby road corridors include NE Killingsworth, a District Collector, and NE Prescott St, a Neighborhood Collector. NE 42nd Avenue (Neighborhood Collector) is a commercially-oriented corridor one block to the east. Bus transit serves NE Killingsworth and NE 42nd. A Major City Bikeway/Neighborhood Greenway runs north-south within 2 blocks of the site's west edge on NE 37th and another runs east-west and touches the site's southeast edge, making the site easily accessible by bike and on foot from surrounding neighborhoods.

## DISTRICT CONTEXT

Meek is a Title I CSI school currently being used as a campus for Alliance High School CTE programs. Rigler ES is 1/2-mile to the east along Prescott, Beaumont MS (a Title I, TSI school) is south along NE 42nd, and the vacant Whitaker-Adams site is north on NE 42nd, south of Fernhill Park.

## ADJACENT USES

The Meek site is surrounded by residential neighborhoods.

Commercial areas, services, and community uses are located nearby, along NE 42nd Avenue, with a node of activity at the corner of NE Killingsworth, including PCC's Metro Center, which will include space for community organizations and affordable housing managed by Home Forward.

LEGEND

- BUS LINE
- NEIGHBORHOOD GREENWAY
- MAJOR ROAD
- PARKS
- MIXED USE/ COMMERCIAL
- EMPLOYMENT
- PLACE OF WORSHIP
- COMMUNITY USE
- SCHOOLS

0 200' 400' 800'

# MEEK SITE ANALYSIS

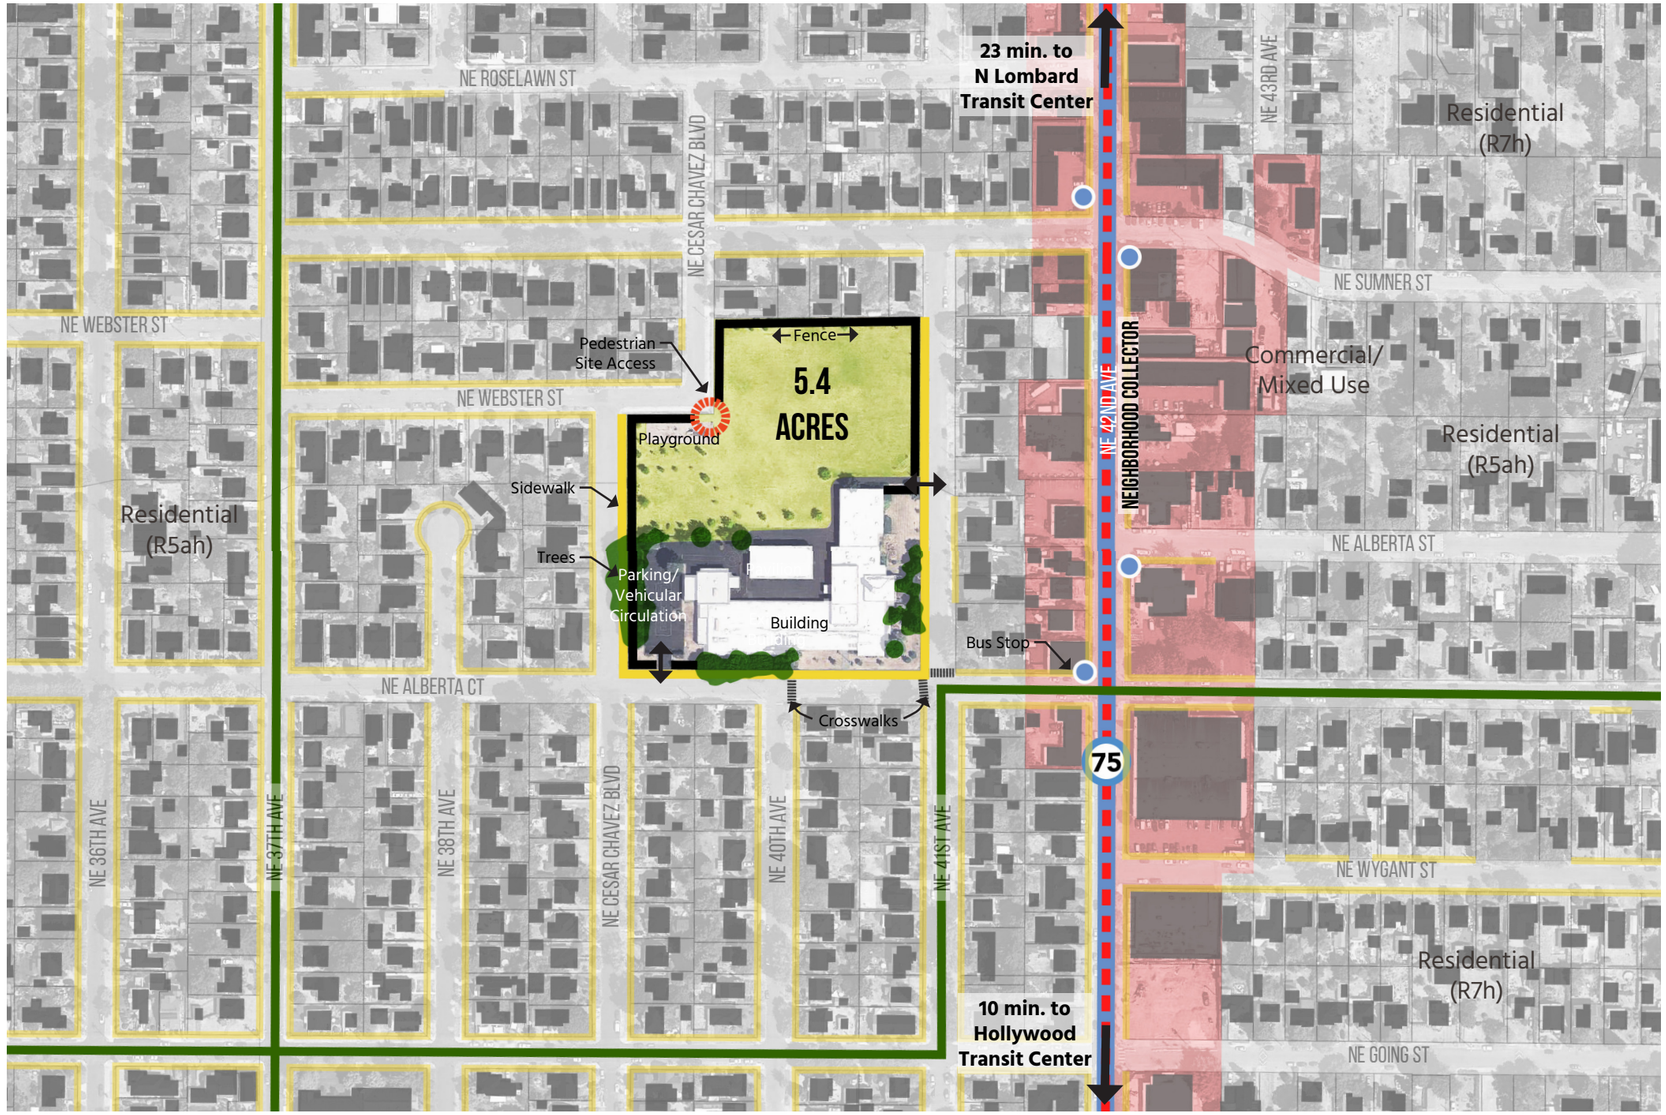


## SITE ANALYSIS

The site is surrounded by residential blocks, primarily single-family detached homes. The surrounding sidewalk network is incomplete, with notable gaps on NE 41st Avenue and NE Cesar Chavez, as well as the south side of NE Alberta Court. The sidewalk network is lacking east of NE 42nd Ave. There are pedestrian access points to the site from the south and NW. The existing school building has a footprint of around 37,000 gsf. A fenced grassy school yard and playground occupies the northern half of the site, including a covered play area immediately north of the school building. Existing vehicular access enters a small parking lot at the southwest corner of the site. The site is flat.

## POTENTIAL SITE SUITABILITY

The building could be renovated or replaced to house a variety of PPS programs. For example, the site could be repurposed as a STEAM facility for nearby Beaumont MS. Its quiet but well-connected location could make it a good site for VAPA or other specialized uses. Its proximity to more affordable and diverse residential areas and its existing outdoor play area could also make it a candidate for early childhood services depending on local demand and potential partnerships.

LEGEND

- BUS LINE
- NEIGHBORHOOD COLLECTOR
- CITY BIKEWAY
- BUS STOP
- SIDEWALK
- FENCE
- VEHICULAR ACCESS
- PEDESTRIAN SITE ACCESS

0 50' 100' 200'

# WHITAKER - ADAMS VACANT SITE

**ADDRESS**
5700 NE CESAR E CHAVEZ BLVD

**CONSTRUCTION DATE**
NA

**LEVELS**
NA

**BLDG AREA**
NA

**SITE AREA**
437,778 SF
10.05 ACRES

**CLASSROOMS COUNT**
NA

**FUNCTIONAL CAPACITY**
NA

**CLUSTER**
NA

**MODULAR BLDG**
NA

**ZONING**
CM2 COMMERCIAL MIXED USE 2
R5 RESIDENTIAL 5,000 CU

## HISTORIC SUMMARY

First a high school and later, in 1983, a middle school, the Whitaker-Adams site has been vacant since 2007 following the discovery of radon and black mold in the existing school.

## DEMOGRAPHIC CONTEXT

The Whitaker-Adams site is located in Census Tract 36.03, bordered by six adjacent census tracts. In this cluster, enrollment is projected to fall by 10% over the next 15 years.

For site census tract, 25% to 35% identify as BIPOC, between 35% and 45% of households are cost-burdened, and between 7% and 15% of children are experiencing poverty.

The census tracts to the east of Whitaker-Adams are more racially diverse (between 45% and 75% of the population identifying as BIPOC). Childhood poverty is also more prevalent to the east, with between 30% and 74% of children under the poverty line.

**Credit**

U.S. Census Bureau's American Community Survey (ACS) 2014-2018 5-year estimates, December 2019 Release.

## EDUCATIONAL PROGRAM FORECAST

Whitaker-Adam is one of three athletics hubs identified by athletics program leadership. As a shared resource across several schools, hubs are a viable path toward expanding existing athletics programming for smaller sites and alleviating schedule constraints regionally.

Most schools do not have enough land area for multiple fields, seating, and lighting. Only one high school site supports comprehensive athletics programming: McDaniel; even McDaniel presents scheduling challenges for a three-tiered athletics schedule.

If developed into an athletics hub, Whitaker-Adams would serve programs at Roosevelt, Grant, Jefferson, and McDaniel by providing:

- Football field with artificial turf
- Two soccer fields with artificial turf
- Three baseball/softball fields
- Bleacher seating around baseball/softball fields
- 4 basketball courts
- 6-lane olympic sized pool
- Storage and support buildings

**Note:** Confirm middle school system capacity in the area before planning for this site (Ref: Board Resolution 3195).

# WHITAKER-ADAMS SITE STUDY

Existing Site

Proposed Athletics Programming

# WHITAKER-ADAMS SITE PHYSICAL CONTEXT

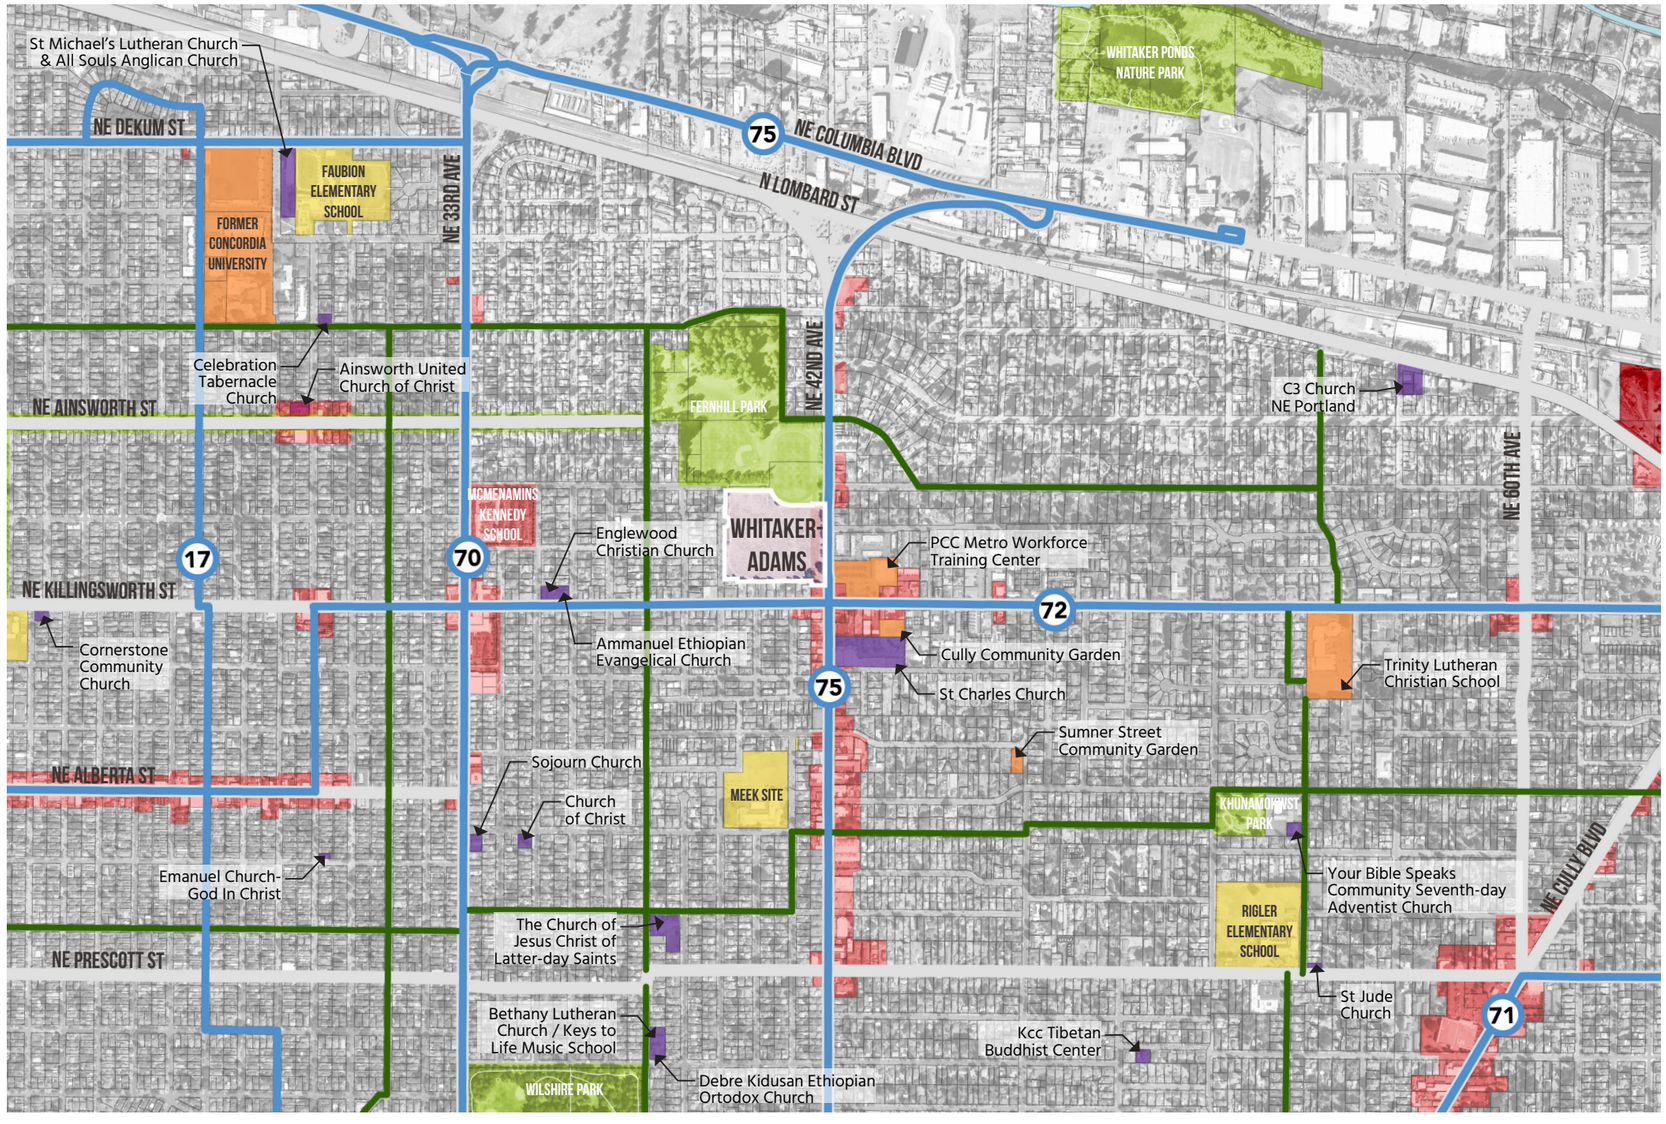


## TRANSPORTATION ACCESS

The Whitaker-Adams site is located in the Concordia neighborhood of Northeast Portland. The east edge of the site faces NE 42nd Ave, a Neighborhood Collector on which the 75 bus line operates. The 70 bus line on NE 33rd Ave is a 1/4 mile walk to the west. NE Killingsworth, a District Collector, is located a half-block to the south of the site. A Major City Bikeway/Neighborhood Greenway runs north-south within 2 blocks of the site's west edge on NE 37th.

## DISTRICT CONTEXT

Faubion K-8, and an Early Childhood facility, is a 1.2 mile walk to the northwest, the Meek site (currently Alliance HS) is a 1/2 mile walk directly south, and Rigler ES is a 1.3 mile walk southeast.

## ADJACENT USES

The site shares its north edge with Fernhill Park, with multiple existing sports fields that PPS already utilizes. PCC Metro Center is directly to the east, across NE 42nd Ave., with the Cully Community Garden located across the street. Commercial uses line NE 42nd Avenue. A residential neighborhood (zoned R5ah) north of Fernhill Park separates the site from the Columbia Blvd industrial corridor.

LEGEND

- BUS LINE
- NEIGHBORHOOD GREENWAY
- MAJOR ROAD
- EXISTING MAX LINE
- PARKS
- EMPLOYMENT
- MIXED USE/ COMMERCIAL
- PLACE OF WORSHIP
- COMMUNITY USE
- SCHOOLS

0 200' 400' 800'

# WHITAKER-ADAMS SITE ANALYSIS

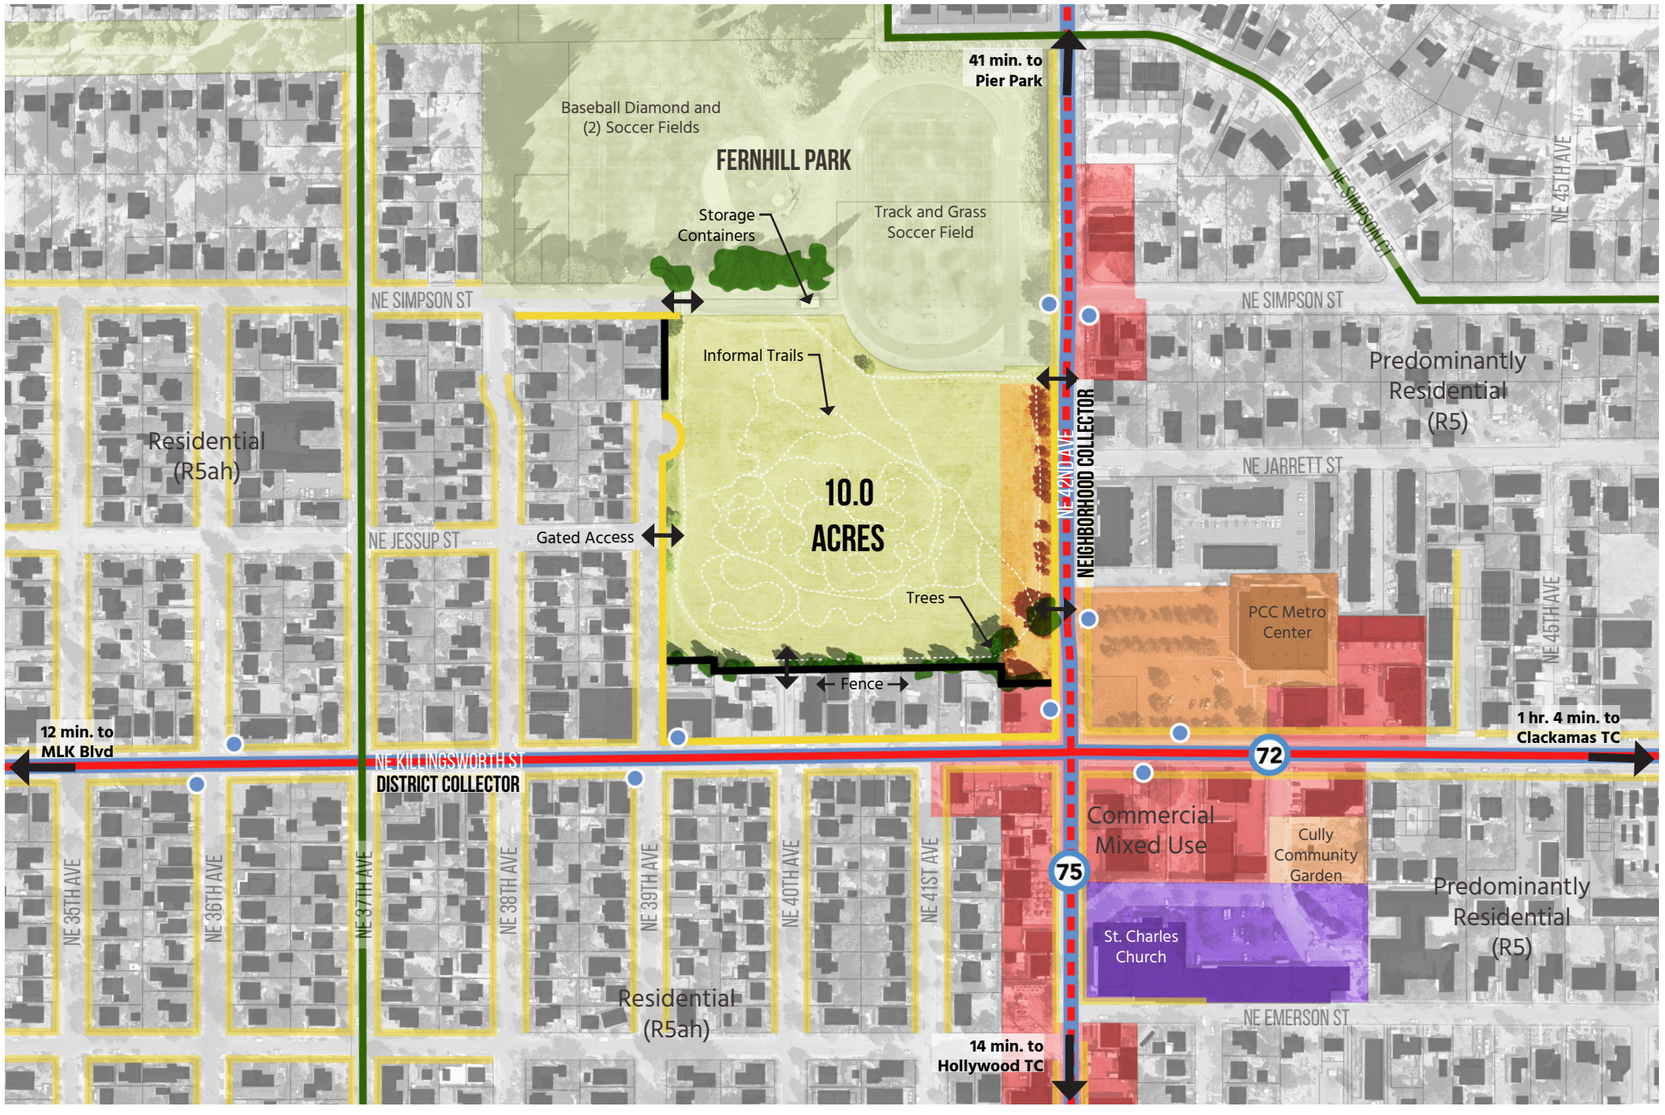


## SITE ANALYSIS

The 10-acre site is located adjacent to Fernhill Park to the north. It is treated as an informal park by a range of users, including cyclists that have created a network of trails. Four saplings have been recently planted at the top of the hill. The site slopes gently downhill from south to north. The site is separated from NE Killingsworth St to the south by a half-block of housing (zoned RM1h); backyards face the site at this edge.

Most surrounding streets have sidewalks, providing safe access to the site from NE Simpson, NE Jessup, NE 42nd and NE 40th. No parking currently exists on the site, but surrounding streets include on-street parking. NE 42nd Ave is a Neighborhood Collector and may require upgrades with major redevelopment.

LEGEND

- BUS LINE
- DISTRICT COLLECTOR
- NEIGHBORHOOD COLLECTOR
- CITY BIKEWAY
- BUS STOP
- SIDEWALK
- FENCE
- VEHICULAR ACCESS

0 50' 100' 200'

# HOLLADAY ANNEX

**ADDRESS**
7100 SE DIVISION ST

**CONSTRUCTION DATE**
1961 (PRIMARY)

**LEVELS**
2

**BLDG AREA**
29,800 SF

**SITE AREA**
93,218 SF
2.14 ACRES

**CLASSROOMS COUNT**
4

**FUNCTIONAL CAPACITY**
75 STUDENTS

**CLUSTER**
FRANKLIN

**MODULAR BLDG**
0

**ZONING**
R2 RESIDENTIAL 2,000 CU

## DEMOGRAPHIC CONTEXT

The Holladay Annex site is located in Census Tract 7.01, bordered by five adjacent census tracts. PPS's attendance boundary runs to the east of the site's adjacent census tract. In this area of the district, enrollment is projected to fall by 5% over the next 15 years.

Of the population of the Holladay Annex site census tract, between 25% and 35% identify as BIPOC, between 25% and 30% of households are cost-burdened, and between 3% and 7% of children are experiencing poverty. The census tracts east of the site are more racially diverse (between 45% and 75% of the population identifying as BIPOC), and include a higher percentage of households experiencing cost burden (more than 45% in some areas) and childhood poverty (between 30% and 74% just east of the site).

**Credit**
U.S. Census Bureau's American Community Survey (ACS) 2014-2018 5-year estimates, December 2019 Release.

# HOLLADAY ANNEX SITE PHYSICAL CONTEXT

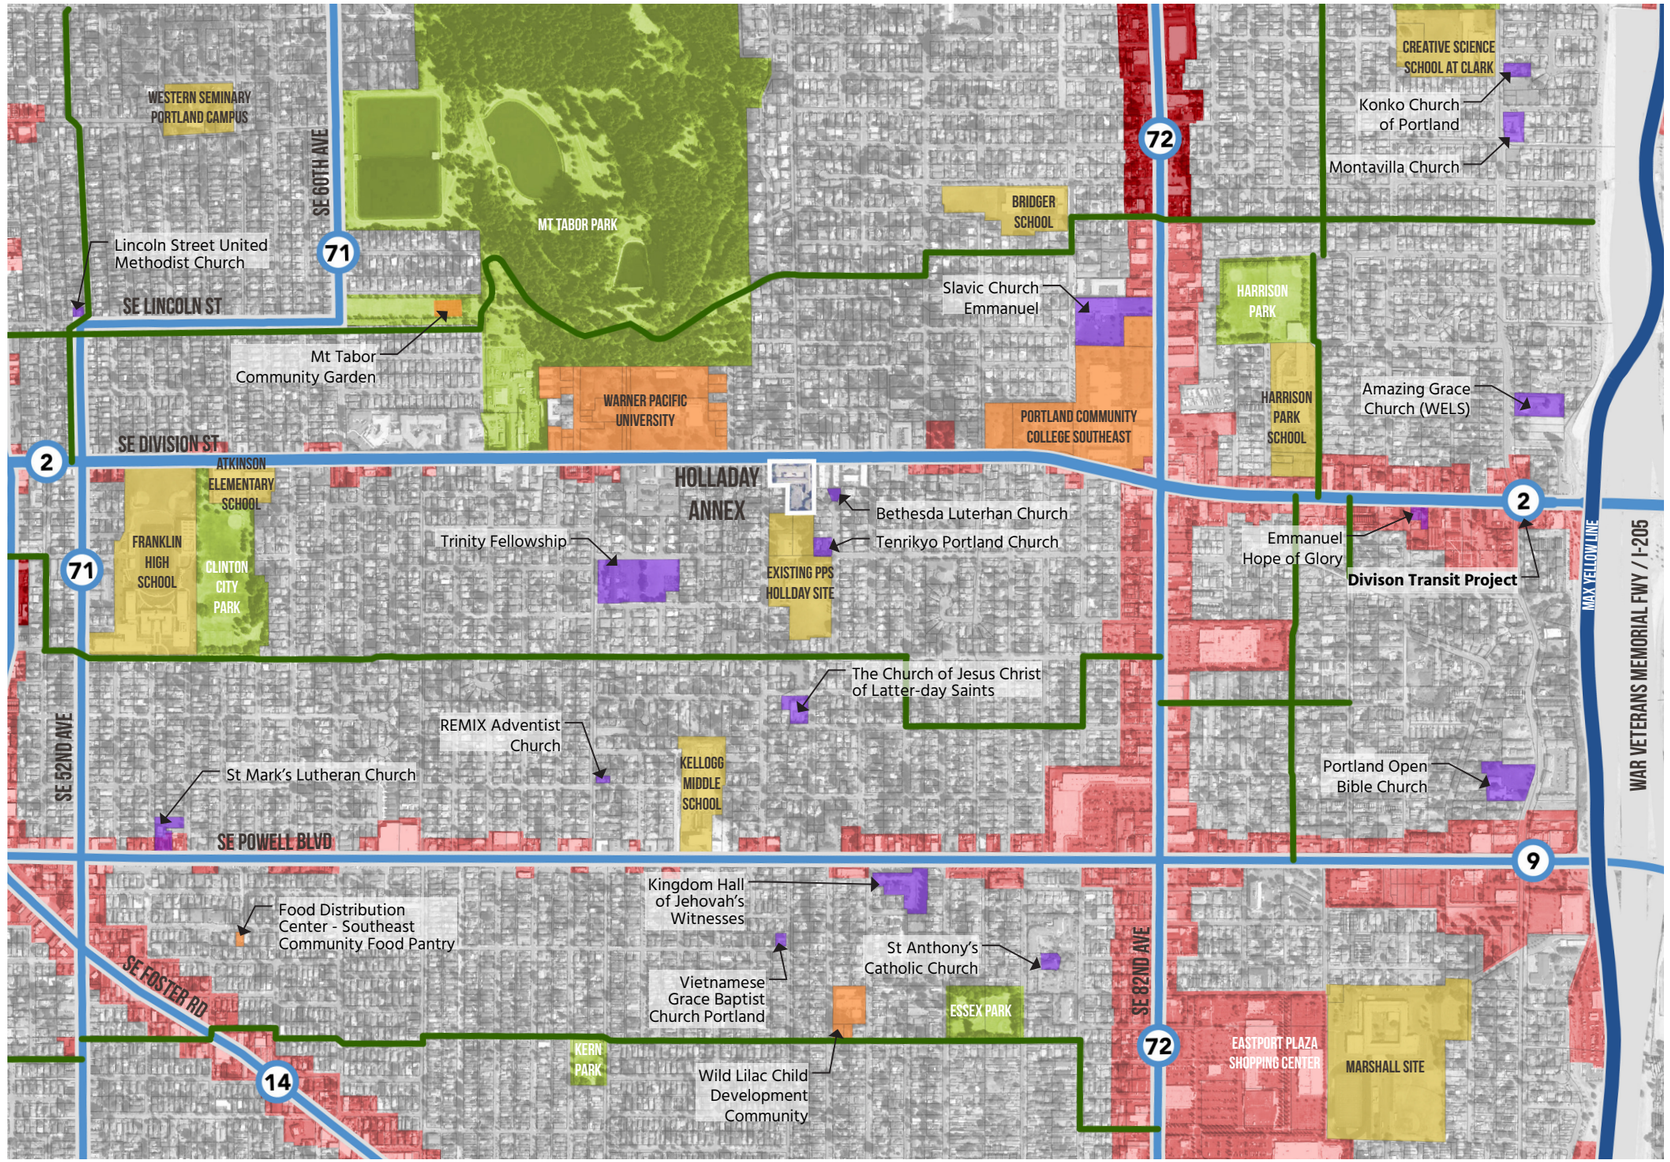


## TRANSPORTATION ACCESS

The Holladay site is located in the South Tabor neighborhood of East Portland. The northern edge of the site faces directly onto SE Division St, a Neighborhood Collector where the Division Transit Project features frequent bus service. SE Powell Blvd, a primary east-west road corridor is a half-mile walk from the site. SE 82nd Ave is the major north-south road corridor that lies 0.65 miles to the east, with I-205 located a mile east of the site. A Neighborhood Greenway runs east-west along SE Woodward 1/4-mile to the south.

## DISTRICT CONTEXT

Holladay Annex is adjoined with the existing Youngson Pioneer School, an elementary special education program. The site is close to other PPS schools, including Kellogg MS, Atkinson ES, Franklin HS, Bridger School, and Harrison Park School. The Marshall site is 1.5 miles to the southeast, across SE 82nd Ave and south of SE Powell Blvd. Mt Tabor Park is a 0.4 mile walk to the northeast through the Warner Pacific University campus. PCC Southeast is also nearby, 1/3 of a mile to the east on the north side of SE Division St.

## ADJACENT USES

The site is located within a mosaic of different land uses, but surrounded predominantly by residential uses with a mix of housing types. SE 82nd Ave, SE Powell Blvd, and SE Division St are all nearby significant commercial/mixed use corridors. Several community uses (SE Community Food Pantry, Wild Lilac Child Development, Mt Tabor Community Garden) and places of worship are nearby.

LEGEND

- BUS LINE
- NEIGHBORHOOD GREENWAY
- MAJOR ROAD
- EXISTING MAX LINE
- PARKS
- MIXED USE/ COMMERCIAL
- PLACE OF WORSHIP
- COMMUNITY USE
- SCHOOLS

0 200' 400' 800'

# HOLLADAY ANNEX SITE ANALYSIS

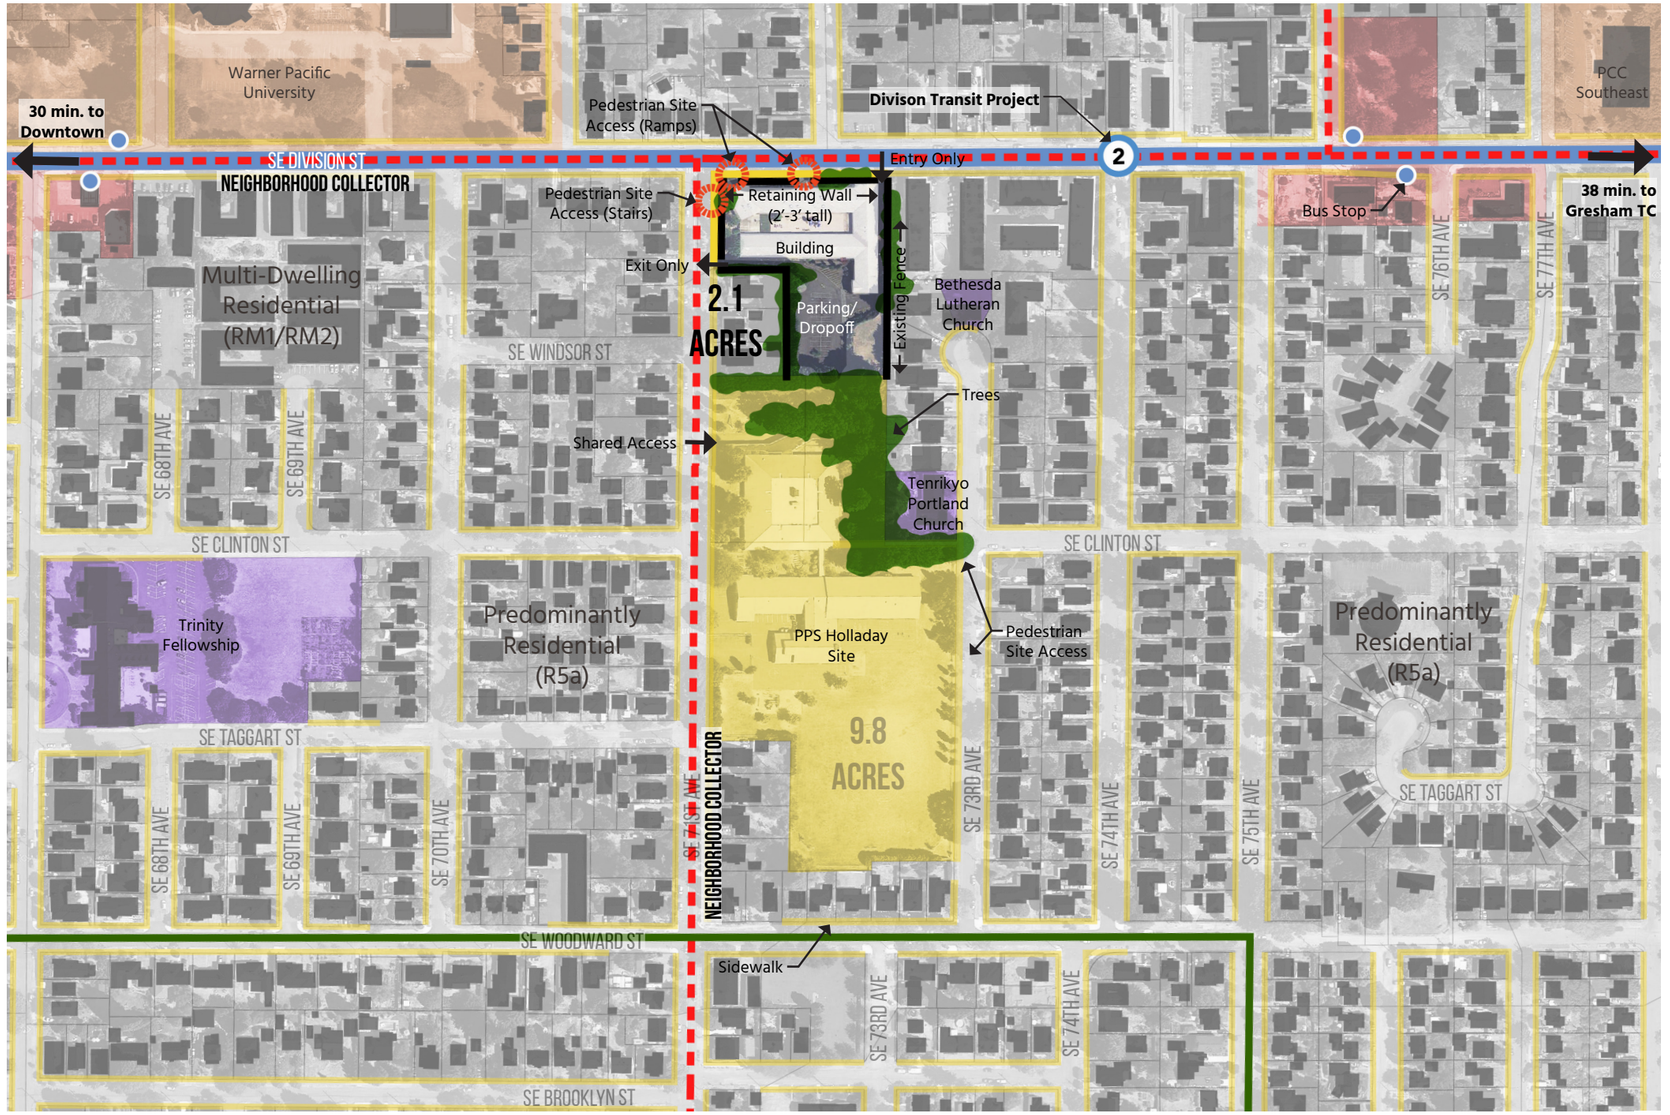


## SITE ANALYSIS

The Holladay Annex site is a 2.3 acre portion of the larger PPS Holladay site. Located on SE Division Street, it consists of a 30,000sf single-story building built in 1961 with a central courtyard and a surface parking lot on the south side of the site. The site is raised approximately 3' above the surrounding sidewalks on the west and northwest sides. Single family structures are adjacent to the west across SE 71st Ave, while a small apartment building flanks the eastern property line. SE Division St and SE 71st St are Neighborhood Collectors and may require street upgrades with major site redevelopment.

## POTENTIAL SITE SUITABILITY

The existing Youngson Pioneer School at the adjacent Holladay Campus has not identified on-site needs that the Annex site could meet. The site capacity is likely not sufficient for a large district hub for athletics, VAPA, or CTE; however, the Annex building has accommodated Kindergarten students in the past, and the site could be compatible as an Early Childhood site if retrofitted to provide adequate outdoor play space, drop-off, and parking.

LEGEND

- BUS LINE
- NEIGHBORHOOD COLLECTOR
- BUS STOP
- SIDEWALK
- FENCE
- VEHICULAR ACCESS
- PEDESTRIAN SITE ACCESS

0 50' 100' 200'