

## Lesson 3 Start uHand2.0

Step 1: Counterclockwise twist the screw on DC power port of expansion board with screwdriver.

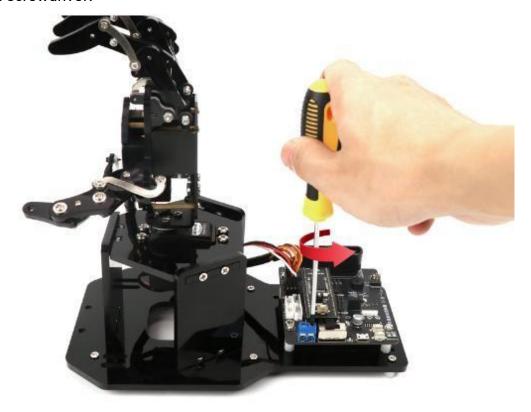

Step 2: Connect the red wire of DC power butted cable to the positive pole (+) on expansion board and the black wire to the negative pole (-). Then tighten the screw with screwdriver.

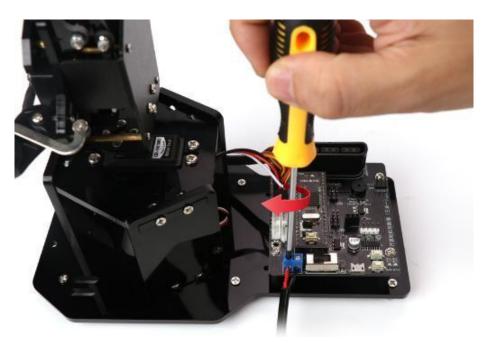

## Hiwonder Technology Co,Ltd

Step 3: Connect the male connector of power adapter to the female connector of DC power butted cable. Then plug the adapter into socket.



Step 4: Switch on the controller. The hand will show the grasping posture, which means the device is boot up successfully.

