


The AES logo consists of the letters "AES" in a bold, white, sans-serif font, centered within a red rounded square.

CONTACT ID DIALER CAPTURE



7794 IntelliPro Fire + 7067 IntelliTap II

Field installation, configuration, test, and migration guide for AES 7744F and 7788F legacy fire subscribers

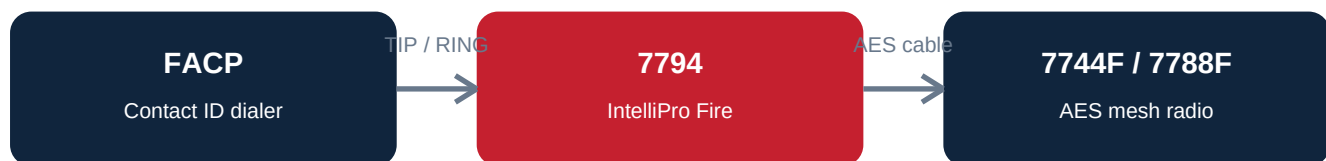

Programming attaches to 7794 J2 - never to 7794 J1 TO RADIO

FIELD COMPANION - NOT A REPLACEMENT FOR THE AES MANUAL. Use the original 7794 or 7067 manual for connector drawings and exact field wiring. Put the account on test and obtain AHJ/central-station authorization before work.

AES Programmer & Troubleshooter

Independent field guide - Revision 1.1 - August 2026

1. What works with what

The 7744F and 7788F can carry Contact ID full data. The currently recommended legacy-fire accessory is the **7794 IntelliPro Fire**. The older **7067 IntelliTap II** was supported by the subscriber family but AES now lists it as discontinued and no longer supported.

Subscriber family	Dialer-capture accessory	Status / action
7744F / 7788F legacy fire	7794 IntelliPro Fire	Recommended legacy-fire Contact ID path
7744F / 7788F legacy fire	7067 IntelliTap II	Historical only; discontinued and unsupported - verify with AES/AHJ
7707 / 7177 IntelliNet 2.0 fire	7794A IntelliPro	Current 2.0 fire accessory; not for legacy 7744F/7788F
7058E / 7350 legacy burglary	7094 IntelliPro	Legacy burglary path
7007 IntelliNet 2.0 burglary	7094A IntelliPro	Current 2.0 burglary path

Do not install a 7794A in a 7744F or 7788F. AES identifies the 7794A as a 2.0 Fire accessory only. Use a legacy 7794 IntelliPro Fire for these subscribers.

2. Before arriving on site

- Confirm subscriber model, firmware, network owner requirements, receiver/automation Contact ID handling, and whether the communicator will be primary or supplemental.
- For a UL-listed primary legacy-fire communicator, verify the AES 7762 Hardware Supervisor requirement. The AES 7795 kit combines the 7794, 7762, and 7740 annunciator.
- Obtain the current FACP programming sheet: dialer account, Contact ID format, receiver number, dial attempts, line supervision, and test plan.
- Have the official AES manual, correct standoffs/insulating washers, factory interconnect cable, approved programmer/cable, meter, and required conduit hardware.
- Notify the monitoring center, place the account on test, record existing subscriber and FACP programming, and coordinate impairment/AHJ requirements.

3. Critical connector safety

Connection	Correct use	Never do this
Subscriber J1	Factory AES accessory cable to approved 7794/7067; carries data and module power	Never connect J1 pin 6 (+12 V) to USB, RS-232, TTL, FTDI, or a PC
7794 J1 - TO RADIO	Factory cable to subscriber	Never attach the handheld or PC programmer here
7794 J2 - HandHeld	7041E programmer or a verified compatible PC-terminal interface	Do not substitute an unverified RJ cable or pinout
FACP TIP/RING	Wire from documented dialer output to the exact 7794 terminals shown in the AES manual	Do not infer terminal order from this companion guide

4. 7794 IntelliPro Fire installation

De-energize the FACP and subscriber AC/battery sources using the manufacturers' shutdown sequence before mounting or wiring. Only qualified fire-alarm personnel should perform this work.

Step	Task	Field action
1	Mount the module	Install the 7794 on the documented subscriber-board standoffs. Fit the insulating washer at H3 and retain the green earth-ground hardware exactly as shown in the AES manual.
2	Connect radio interface	Use the supplied six-wire AES modular cord from 7794 J1 TO RADIO to subscriber J1. This approved accessory connection is different from the PC programming cable.
3	Connect panel dialer	Route FACP TIP and RING to the 7794 AP TIP/RING terminals using the exact primary or supplemental figure in the manual. AES limits the FACP/subscriber arrangement to the same room and no more than 20 ft of conduit.
4	Add supervision if required	For primary communication, install and wire the 7762 Hardware Supervisor and annunciation path per its manual and listing requirements.
5	Restore power and inspect	Confirm no shorts, correct earth ground, correct battery sizing, normal subscriber state, and a slow 7794 heartbeat blink before programming.

5. 7794 Contact ID programming

Connect the AES 7041E programmer to **7794 J2 HandHeld**. The 7794 can also be configured by a PC terminal only through a verified compatible interface. Configure with the panel disconnected when practical so live panel traffic does not interrupt menu navigation.

Control	Action
F1	Enter CONFIG mode
F3	Change the displayed option
F4 / F5	Move up / down through configuration options
E or ESC	Exit configuration
AP report format	Select C for Contact ID
Intercept number	Match the FACP dialed number; AES default is 555 and the allowed entry is 3-20 digits

Control	Action
Phone line / POTS	Set to match the approved primary or supplemental architecture
AP input gain	Use 10 or 20 only as required by the FACP/interface test
CID 4xx letter	Choose U or C to match receiver/automation requirements
Subscriber TTL: AES network guidance recommends 3 hours for Alarm, Trouble, Restoral, and IntelliTap traffic, but network owners must approve values for their own system. Program the subscriber INTELLITAP TTL and verify it after reconnecting the module.	

6. End-to-end acceptance test

- Verify 7794 LED: slow blink (about one pulse/second) indicates normal operation; a fast blink indicates no subscriber communication; solid/no blink requires corrective action per the manual.
- Send a known Contact ID alarm, trouble/fault, supervisory event when applicable, and each required restoral.
- Confirm complete account, qualifier, event, partition/group, and zone/user data at receiver automation - not merely RF receipt.
- Test line-cut/POTS behavior and FACP dialer supervision for the approved architecture.
- Rerun subscriber local status and routing table; confirm accepted NETCON, routes, power, voltage, and antenna condition.
- Reconnect every accessory/programming cable, restore the account to service, and retain the exported session/troubleshooting record.

Configuration values recorded at acceptance

Parameter	Programmed value	Verified
AP report format		Contact ID (C)
Intercept number		
Phone line / POTS mode		
AP input gain		
CID 4xx letter		
Subscriber INTELLITAP TTL		

7. 7067 IntelliTap II - historical workflow

LEGACY / DISCONTINUED / NO LONGER SUPPORTED. Do not treat historical jumper settings as a current approval. Confirm the exact unit, listing, FACP, receiver, network, and AHJ requirements with AES before service or reuse.

Later AES 7744F/7788F manuals identify the 7067 IntelliTap II as a supported J1 dialer-capture accessory, but AES now lists the 7067 as discontinued. The replacement matrix directs legacy fire applications to the 7794 IntelliPro Fire.

Historical item	Technician treatment
Contact ID format	Use only the exact jumper position documented by the supplied 7067 manual; do not infer from a 7794 menu
Line-cut delay	Verify jumper combination against the exact 7067 revision and approved system design
No-phone-line operation	Never combine incompatible jumper modes; verify reset procedure after changes
Subscriber connection	Use only the factory accessory cord; disconnect the module while the subscriber programming interface is attached
Use classification	Treat as supplemental unless the exact listing/AHJ documentation says otherwise

Migration recommendation

Document the existing 7067 settings and successful signals, then plan conversion to a 7794/7795 legacy-fire solution or an approved IntelliNet 2.0 subscriber/module combination. Do not migrate by copying jumper positions directly into IntelliPro settings; rebuild the configuration from the FACP and central-station requirements.

8. Troubleshooting decision table

Symptom	Evidence to collect	Recommended next action
No FACP handshake/kiss-off	FACP dial format, TIP/RING voltage, dialed digits, POTS mode, AP input gain	Verify wiring against official figure; match CID and intercept settings; avoid blind gain changes
7794 fast LED blink	Subscriber J1 cable, module power, connector seating, subscriber state	Remove power safely, inspect factory cable, reconnect, and verify subscriber communication
FACP receives dialer trouble	Both dialer supervision settings and whether panel tests both lines simultaneously	Check manual compatibility restriction and approved primary/supplemental diagram
Signal reaches AES but lacks full CID data	Receiver line card/output, account, qualifier, event, group, zone/user	Verify automation receives IntelliTap-type full-data packets and correct receiver configuration
Weak or delayed delivery	NETCON, routes, Q, RF power, voltage, antenna/coax	Correct radio-network or site RF issues separately from dialer capture

9. Field record

Complete this worksheet during acceptance, then attach the exported session log and troubleshooting-only report. Do not record subscriber cipher values or API keys.

Item	Record
Site / account	
Subscriber / module / firmware	
FACP / Contact ID account	
POTS / intercept / input gain	
INTELLITAP TTL	
Alarm / trouble / supervisory / restoral confirmed	
Central-station operator / time	
Final NETCON / routes / Q	

Acceptance closeout

- All required Contact ID event types and restorals were received with complete account and point data.
- The final subscriber status, routing table, NETCON, power, voltage, antenna, and route evidence were retained.
- Every temporary programming lead was removed and all factory accessory cables were restored.
- The central station released the account from test and the impairment/AHJ process was closed.

Technician / date	Central-station operator / time

10. Official references

The original readable AES 7794, 7794A, 7744F, and 7788F PDFs are the controlling technical references. The supplied 7067 manual is retained as historical material. Check AES Product Support for revisions before field use.

- AES 7794 product page: <https://aes-corp.com/product/7794-subscriber-add-on-module/>
- AES 7794 Installation Manual: <https://aes-corp.com/wp-content/uploads/2022/09/7794-Manual.pdf>
- AES 7794 Quick Start Guide: <https://aes-corp.com/wp-content/uploads/2020/07/7794-Quick-Start-Guide.pdf>
- AES 7744F Installation Manual: <https://aes-corp.com/wp-content/uploads/2020/07/7744-Install-Manual.pdf>
- AES 7788F Installation Manual: <https://aes-corp.com/wp-content/uploads/2020/07/40-7788-Rev-6.pdf>
- AES discontinued-product replacements: <https://aes-corp.com/products/discontinued-products/>
- AES 7794A product page: <https://aes-corp.com/product/7794a-accessory-board/>
- AES 7794A Installation Manual: <https://aes-corp.com/wp-content/uploads/2023/04/40-7794A-Install-Manual-Rev-3-9-20-2018.pdf>
- AES legacy network best practices: <https://aes-corp.com/best-practices-guideline/>

Physical bench validation with known-good 7744F and 7788F units remains required before deployment. Verify the 7794 PC-terminal interface and every programming operation against the actual hardware/firmware revision.

AES Programmer & Troubleshooter

Independent field-use reference