



POSEIDON
MARINE

ROBERT P. SCHONES

541-444-1129 H
541-961-3368 C

RSCHONES@LIVE.COM

P.O. BOX 170
SILETZ, OR 97380

PRIVATE - CONFIDENTIAL

REPORT OF OUT OF WATER SURVEY

VESSEL R/V CORAL SEA

HOME PORT ARCATA, CA.

OFFICIAL NO. 559373

OWNERS HUMBOLDT STATE UNIVERSITY

PHONE 707.672.5579

ADDRESS #1 HARPST ST. ARCATA, CA. 95521

(JIM LONG)

EMAIL jml7001@humboldt.edu

TYPE SINGLE OIL SCREW - WELDED STEEL DISPLACEMENT HULL

WATERS NAVIGATED PACIFIC COASTAL AND INLAND WATERS

YEAR BUILT 1974 **BUILT BY** LINDWALL BOATWORKS **WHERE BUILT** SANTA BARBARA, CA.

WITH EXCEPTION OF DEFECTS NOTED BELOW I FULLY RECOMMEND THE PHYSICAL HAZARD.

ESTIMATED NEW REPLACEMENT VALUE

ESTIMATED PRESENT MARKET VALUE

SURVEYED OUT OF WATER AT TOLEDO SHIPYARD, TOLEDO, OR.

DATE 6/15/2022

BY REQUEST OF OWNER

Robert P. Schones **SURVEYOR**

ROBERT P. SCHONES

VESSEL F/V PAGE 2

HULL LENGTH 83.9R/90.0 OA BEAM 22.4 DEPTH 11.3 DRAFT
LAST DRYDOCKED 6/2022 GROSS TONS 143 NET TONS 43
PLANKING 3/8" STEEL PLATE BOTTOM, 5/16" STEEL PLATE SIDES
FRAMES 3" X 4" X 5/16" ANGLE SPACED 18" OC
MAIN DECK 5/16" STEEL PLATE BEAMS 3" X 4" X 5/16" ANGLE SPACED 18" OC
LONGITUDINALS 3" X 5/16" FLATBAR BULKHEADS
FINISH HOW VENTILATED

VESSEL DESCRIPTION, LAYOUT AND CABINS

GALLEY APPLIANCES

MASTS AND RIGGING

ELECTRONIC AND NAVIGATION EQUIPMENT

ENGINES

BUILT BY

CYLINDERS

INSTALLED

KIND

HORSEPOWER

LOCATED

ENGINE FOUNDATION

EXHAUST CLEAR OF WOODWORK

FUEL USED PER HOUR

GEAR

SHUT OFF VALVES AT SEACHEST

PIPING STEEL SEACHEST TO STAINLESS-STEEL AND BRONZE VALVES TO STEEL PIPING

FUEL LINES TO ENGINE

TANKS

MATERIAL:FUEL OIL TANKS

CAPACITY

VENTED

FILLING LINES

PUMPS

ARE THERE TWO SEPERATE MEANS OF PUMPING BILGES ?

ARE BILGE DISCHARGE LINES CHECK VALVE PROTECTED ?

WATER TANKS

ELECTRICAL SYSTEM

SWITCHBOARD LOCATION

WIRING

DO PROPELLERS EXTEND BELOW KEEL

SKEG OR SHOE

SERVICE

SPEED IN KNOTS

HAS VESSEL BEEN CARED FOR BY OWNER

NO. OF CREW

EXPERIENCE OF OWNER OR MASTER

SAFETY EQUIPMENT

USCG DOCKSIDE SAFTEY EXAM #

STABILITY REPORT BY MARK PUDLO N.A., SEACRAFT DESIGN LLC., DATED 3/14/2007

ALARMS

FIRE EXTINGUISHERS

PLACKARDS POSTED

AUXILIARY ENGINES

PROPELLERS 1 EA 48"D X 32"P LH & RH 3-BLADE BRONZE (NEWLY RECONDITIONED)

TAILSHAFTS 3" AQUAMET 22

SHAFTS LAST DRAWN NOT DETERMINED

PACKING GLANDS DRIPLESS

RUDDERS TWIN 39" X 50" STEEL SPADES

GROUND TACKLE

CONDITION OF HULL

- VESSEL WAS SURVEYED OUT OF THE WATER. UNDERWATER PORTION OF HULL WAS VISUALLY INSPECTED AND FOUND IN GOOD CONDITION, WELL COATED WITH NO DAMAGE OR DEFECTS NOTED. INTERIOR OF HULL WAS ALSO VISUALLY INSPECTED IN ALL BILGES WHERE ACCESSIBLE AND FOUND IN GOOD CONDITION AND WELL COATED. AN AREA OF CONCERN BY PREVIOUS IN WATER SURVEY NOTED CORROSION IN THE BILGES OF THE TANK ROOM. THIS AREA CONTAINS SEVERAL THOUSAND POUNDS OF LEAD INGOTS FOR BALLAST. LEAD INGOTS WERE REMOVED FROM THE AFT BAY OF THIS AREA FOR INSPECTION AND ULTRASOUNDING OF HULL PLATING. TOLEDO SHIPYARD CONDUCTED THE ULTRASOUND TESTING. THIS AREA WAS DESCALED AND RECOATED. RUBBER MATS WERE INSTALLED AND LEAD INGOTS REPLACED. VESSEL CAPTAIN INTENDS TO CONTINUE MAINTAINANCE FORWARD OF THE AREA NOT TESTED OR RECOATED AND HAS RESULTS OF PRESENT ULTRASOUND TEST. USCG REGULATIONS REQUIRE INSPECTED PASSENGER VESSELS TO REPLACE HULL PLATING IF WASTAGE EXCEEDS 25%. A CORE SAMPLE OF BOTTOM HULL PLATING, WHICH WAS WELL COATED AND PRESERVED WAS SOUNDED TO ACERTAIN ORIGIONAL HULL THICKNESS AND MEASURED .380 TO .400 IN THICKNESS. THE DEEPEST PIT IN THE BOTTOM PLATING WAS SOUNDED AT .382 WHICH REPRESENTS 95.5% OF METAL REMAINING. BULKHEAD BETWEEN THE TANK ROOM AND GREY WATER TANK (5/16" OR .330) WAS ALSO SOUNDED. DEEPEST PITTING WAS MEASURED AT .309 REPRESENTING 98.7% OF METAL REMAINING.

OTHER EQUIPMENT NOTED

- BOUBLOUS BOW
- WESTMAR DPC50 16" BOW THRUSTER

- PORT AND STARBOARD ROLLING CHOCKS
- 2" X 10" CHANNEL KEEL COOLERS

REMARKS

- VESSEL WAS SURVEYED WHILE HAULED-OUT FOR MAINTAINENCE INCLUDING NEW BOTTOM AND HULL COATINGS, ZINCS AND RECONDITIONING OF PROPELLERS. PORTIONS OF AFT DECK WERE SANDBLASTED AND RECOATED WITH ANTI-SKID. BILGES WERE FOUND CLEAN OF DEBRIS AND DRY. VESSEL APPEARS TO BE WELL MAINTAINED AND SUITABLE FOR INTENDED SERVICE. THIS OUT OF WATER SURVEY IS INTENDED AS AN ADDENDUM TO IN WATER SURVEY BY DANA R. TEICHEIRA, CMS DATED 9/20/2018.

RECOMMENDATIONS NONE AT TIME OF SURVEY

ATTENDED BY JIM LONG (CAPTAIN)

.....
THIS SURVEY SETS FORTH THE CONDITION OF THE VESSEL AT THE TIME OF THE SURVEY TO THE BEST OF THE SURVEYOR'S ABILITY AND WITHOUT THE REMOVAL OF BULKHEADS, PANELING, CEILING OR OTHER PORTIONS OF HER STRUCTURE AND WITHOUT THE TESTING OF OR OPENING UP OF PROPULSION MACHINERY OR AUXILIARIES, TANKS OR FITTINGS FOR INTERNAL EXAMINATION OR DRAWING OF SHAFTING, OR DISASSEMBLY OF VALVES. THIS REPORT DOES NOT DEAL WITH COAST GUARD SFETY REQUIREMENTS, NOR WAS A STABILITY TEST DONE. IT IS THE OWNER'S RESPONSIBILITY TO ENSURE THAT THE VESSEL IS EQUIPPED TO MEET SAID REQUIREMENTS. THIS IS NOT A CERTIFICATE OF SEAWORTHINESS. IT REPRESENTS THE HONEST, UNBIASED OPINION OF THE SURVEYOR BASED ON CONDITIONS FOUND AND IS NOT A WARRANTY OF THE CONDITION OF THE VESSEL OR ITS HULL, MACHINERY OR EQUIPMENT.



Figure 1 STARBOARD LEAD BALLAST



Figure 2 PORTSIDE LEAD BALLAST



Figure 3 TRANSDUCERS

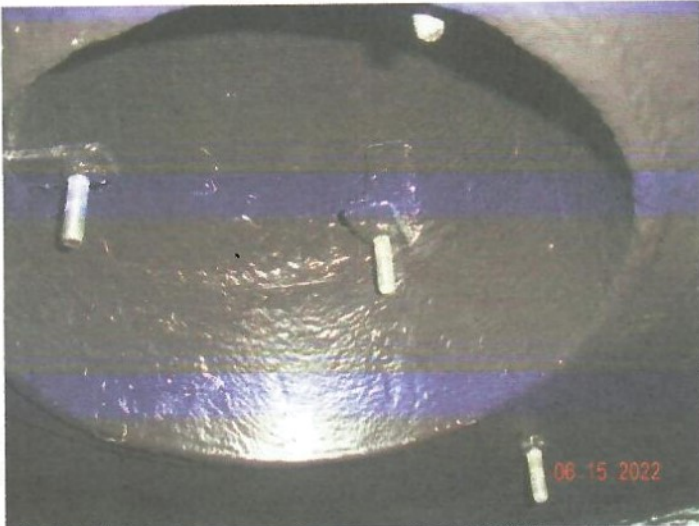


Figure 4 SEACHEST



Figure 5 PROPELLER



Figure 6 RUDDERS AND SHAFTING



Figure 7 SHAFTING



Figure 8 ENGINE KEEL COOLERS



Figure 9 STARBOARD BOW



Figure 10 STARBOARD VIEW



Figure 11 STARBOARD STERN QUARTER



Figure 12 STERN VIEW



Figure 13 PORTSIDE VIEW



Figure 14 WESTMAR BOW THRUSTER



Figure 15 BOUBLOUS BOW



Figure 16 PORTSIDE BOW VIEW