

Installation set — Willard lobby

Measure / shop intent for openings 1–4. Elevations are schematic and not to scale. Est 838 submitted \$4,824.09.

SHEET INDEX

Dwg	Opening	Use this sheet for
WL-INS-01	1 · LOB-1 Concierge window	Inside-mount ripplefold, field opening, addendum layers
WL-INS-02	2 · LOB-2 Reception window	Same opening note as 1, double swag
WL-INS-03	3 · LIN-1 Lincoln window	Stationary panels, valance style open, holdbacks
WL-INS-04	4 · LIN-2 Passway	Double-sided panels, rings, no valance
WL-INS-05	Inside office	Field record only. Not on Est 838. Do not fabricate.

HARDWARE ALREADY ON EST 838 · DO NOT PRICE AGAIN

Opening	On the estimate	Amount
LOB-1	Ripplefold track 10 ft, carriers, endcaps, batons. Removal and installation.	\$480.00
LOB-2	Same track and removal / installation.	\$480.00
LIN-1	Rod, brackets, rings, batons, finish TBD. Two holdback cylinders. Removal and installation.	\$641.88
LIN-2	Rod set, 20 rings (10 per panel), two holdback cylinders. Removal and installation.	\$581.88

The 10 ft track is the priced hardware unit from Invoice 894. It is not a field measurement of the opening. The opening on the sheet is 72 3/16" wide.

OPEN BEFORE CUT

1. Finished length 105" on the field sheet, 106" on Est 838. Show both. Do not pick one on the bench.

2. Lobby lining 23 yd on the sheet, 25 yd napped on Est 838 (12 1/2 + 12 1/2). Submitted quantity stands until Nelma revises it.

3. Only one outside opening was measured. It is drawn on both window 1 and window 2.

4. Est 838 says the ripplefold replaces the swag valance. The addendum prices a new swag with the pair. Confirm the layers before cut.

5. Window 3 valance: single swag or double. The lobby photograph is too far to decide. The elevation uses a neutral scallop marked STYLE TBC.

6. Window 4 has no valance in the photograph. Confirm bullion and leading edge still belong there.
7. Holdback cylinders are already on LIN-1 and LIN-2, four at \$35.94. If bullion replaces them, the credit is \$143.76. No credit is taken here.

8. Sheers are windows 1 and 2 only, assumed at 4 widths each, about the Est 838 length. That fullness is a ballpark assumption.

9. Passway width was not written down. Leading edge is priced once per panel. Both faces of a double-sided panel are still a question.

10. Inside office stays off this lobby price. The circled \$95 per width is not a submitted rate.

11. COM is open: face, sheer, fringe, valance trim, bullion finish. Madalyn and Holloway figures are not a selection.

Opening 1 · Concierge Window

WL-INS-01 · NOT TO SCALE · DRAFT A · 28 Sep 2026




INSTALL NOTES

1. Inside mount. Ripplefold. Elevation shows the dressed-back day position, sheers in the center.
2. Field opening 72 3/16" × 105 5/8". Finished length on the sheet is 105". Est 838 length is 106". Do not cut until those agree.
3. Track on Est 838 is a 10 ft unit with carriers, endcaps, and batons. Cut the track to the opening. Do not treat 10 ft as the window width.
4. Pair is 2W, four labor widths. Main 13 1/2 yd COM. Napped premiere sateen lining 12 1/2 yd on the estimate. The sheet's 23 yd lining covers both lobby pairs, against 25 yd on Est 838.
5. Removal and installation of the pair is already on Est 838 at \$180.00.
6. New single swag is ADD-V1, BALLPARK. Est 838 says this pair replaces the swag valance. Layering is not confirmed.
7. Center drop tassel and bottom trim are separate addendum lines. Trim is COM.
8. Leading-edge fringe on each panel's inner edge. Bullion tiebacks, finish TBD.
9. Sheers: 4 widths, BALLPARK, this window only (with window 2). Sheer removal / installation is incremental to the pair.
10. Face fabric, sheer, fringe, and bullion finish are COM. Nothing is selected.

PROJECT Willard InterContinental	CLIENT Maggie O'Neill / Mariella	DESIGNER Splendor Styling
DRAWING WL-INS-01	OPENING 1 · LOB-1 Concierge	REVISION DRAFT A · 28 Sep 2026

Opening 2 · Reception Window

WL-INS-02 · NOT TO SCALE · DRAFT A · 28 Sep 2026

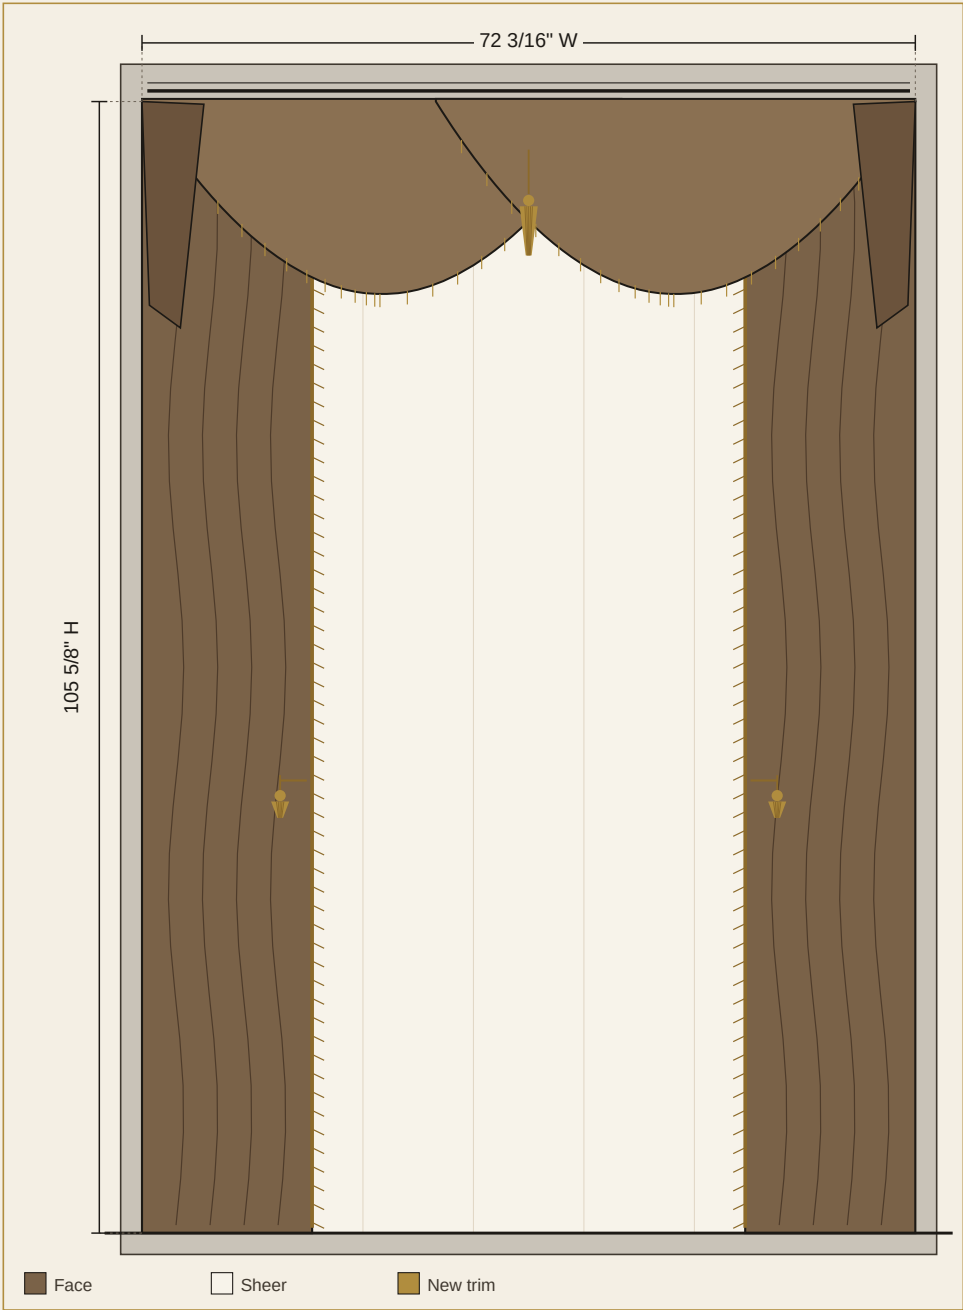


INSTALL NOTES

1. Same field opening as window 1, because the sheet recorded one outside size for the two pairs. Confirm on site.
2. Inside mount ripplefold. Dressed-back day position with sheers.
3. Finished length 105" field / 106" Est 838. Not reconciled.
4. Track, labor, lining, and removal match LOB-1. Submitted subtotal \$1,074.75.
5. Double overlapping swags are ADD-V2, BALLPARK, to match photograph 2. Not a second swag line on top of a valance.
6. Center tassel, bottom trim, leading edge, and bullion match window 1's addendum lines.
7. Sheers on this window and window 1 only.
8. Same open layering question: Est 838 note says the pair replaces the swag valance.

PROJECT Willard InterContinental	CLIENT Maggie O'Neill / Mariella	DESIGNER Splendor Styling
DRAWING WL-INS-02	OPENING 2 · LOB-2 Reception	REVISION DRAFT A · 28 Sep 2026

Opening 3 · Lincoln Lobby Window

WL-INS-03 · NOT TO SCALE · DRAFT A · 28 Sep 2026

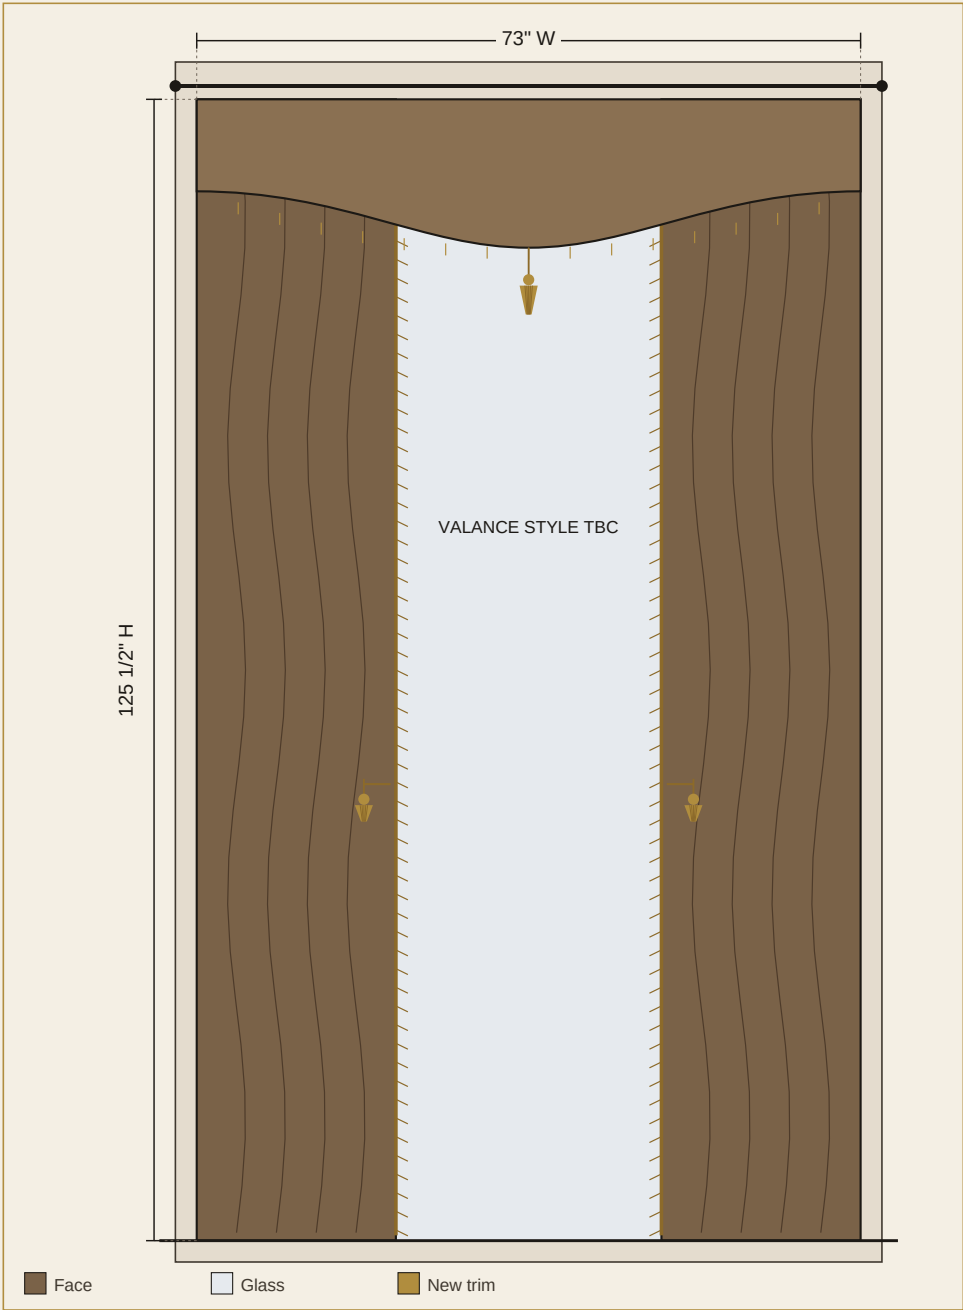


INSTALL NOTES

1. Stationary, non-operable. Two panels @ 1 1/2 W × 125 1/2" finished length.
2. Field opening 73" W × 125 1/2" H. This one matches Est 838.
3. Main 12 yd COM. The sheet says 12 yd with lining in one note. Est 838 prices lining apart, 11 yd premiere sateen. Do not drop the lining.
4. Rod, brackets, rings, batons, finish TBD, already on Est 838 at \$420.00.
5. Two holdback cylinders are on the estimate. Bullion is on the addendum. Keep both, or credit \$71.88 on this opening, is not decided.
6. Formal valance ADD-V3 is BALLPARK. The scallop on the elevation is a placeholder. Style TBC against photographs 1 and 2.
7. No sheers. Photograph 3 is a distant lobby view; do not invent detail from it.
8. Leading edge on each panel. Center tassel and bottom trim are addendum lines. Trim COM.
9. Removal and installation \$150.00 is already on Est 838.

PROJECT Willard InterContinental	CLIENT Maggie O'Neill / Mariella	DESIGNER Splendor Styling
DRAWING WL-INS-03	OPENING 3 · LIN-1 Window	REVISION DRAFT A · 28 Sep 2026

Opening 4 · Lincoln Lobby Passway

WL-INS-04 · NOT TO SCALE · DRAFT A · 28 Sep 2026

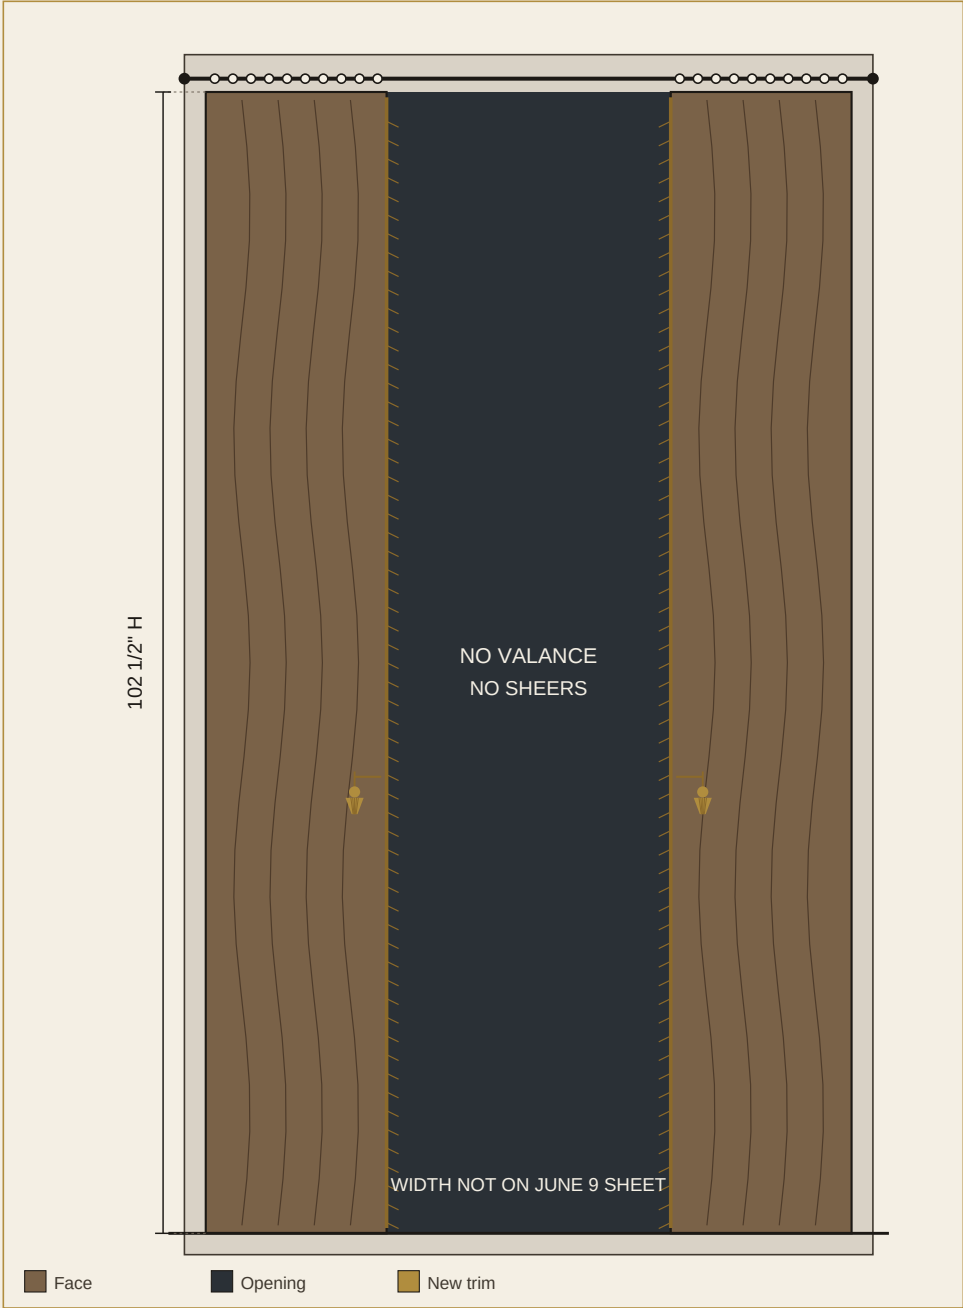

INSTALL NOTES


1. Double-sided panels. 1 1/2 W each face, 3W per panel, two panels. Finished length 102 1/2".
2. Height matches the field sheet and Est 838. Width was not measured. The elevation proportion is diagrammatic and has no width figure.
3. 10 rings per panel, 20 rings on the estimate. Drawn gathered on each panel.
4. Main 20 yd COM matches the sheet. Lining 18 1/2 yd is the Est 838 quantity, separate from the 20 yd.
5. Hardware set and removal / installation are on Est 838. Removal is \$90.00.
6. No valance. No sheers. Do not borrow the lobby swag.
7. Two holdback cylinders are on the estimate. Bullion may replace them. No credit taken.
8. Leading edge is drawn on the lobby face, one per panel, which is the priced count. Trim on the reverse face is not priced.
9. Bullion finish and fringe are COM.

PROJECT Willard InterContinental	CLIENT Maggie O'Neill / Mariella	DESIGNER Splendor Styling
DRAWING WL-INS-04	OPENING 4 · LIN-2 Passway	REVISION DRAFT A · 28 Sep 2026

Concierge Office — measure record only

WL-INS-05 · NOT TO SCALE · DO NOT FABRICATE FROM THIS SHEET

NOT ON EST 838 · NO LINE · NO COM · NO LABOR

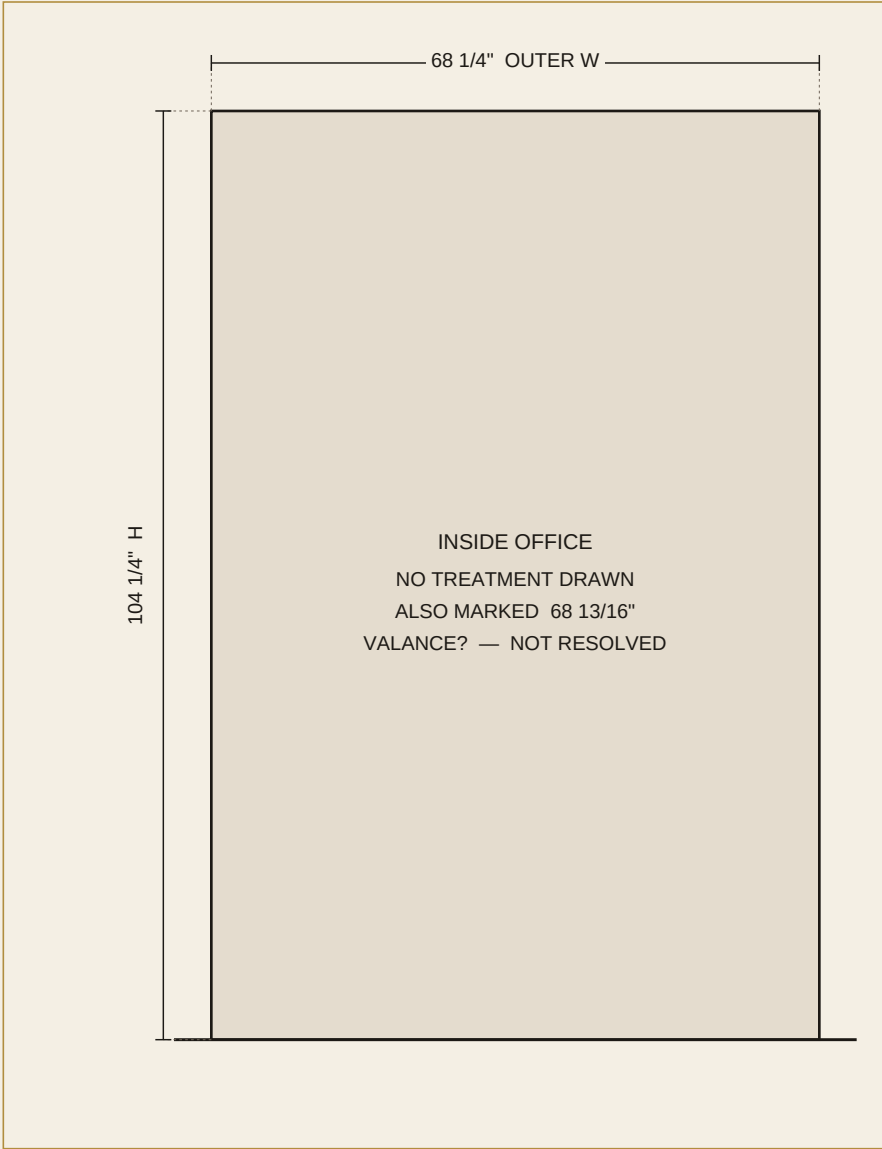

FIELD RECORD

1. Distinct from LOB-1, the lobby concierge window.
2. Outer width 68 1/4". Height 104 1/4".
3. 68 13/16" is written with the word VALANCE? Do not build a valance from that word.
4. Tracks: 8 ft × 2. Carriers: 72. Recorded as written. Not checked against a track schedule.
5. Circled \$95 per width stays a scribble. Lobby labor on Est 838 is \$114.00 per width.
6. No finished length, no pair count, no lining, no fabric, no removal line.
7. If this opening is wanted, it needs its own measure and its own estimate line.

Scratch on the June 9 Lincoln sheet (139×, 140×, 75× W, and the figures 46, 420, 36) is not interpreted and is not a price. Hardware at \$420.00 on LIN-1 and LIN-2 is an Est 838 line, not a reading of that scratch.