

EMPIRE X-CARVE SERIES v1 — 5 DESIGNS

Flat-pack + carve-ready products · all nested inside the safe 700 × 700 mm envelope

X-CARVE 1000mm · EASEL + VECTRIC
Series v1 · 07/24/2026 · parametric — resizable on request
CUT FOR 18.0mm PLY — measure your sheet; slots drawn at 18.5mm

SERIES		PARTS	SETUPS
DESIGN	SIZE / DESCRIPTION		
EMPIRE STOOL	340 × 300 × 450mm · seat height 450 · 4 parts nested 474 × 638 mm	4	2
FLOATING SHELF BRACKETS	pair · 220 × 200mm · for shelves to 250mm deep nested 453 × 214 mm	2	1
SERVING BOARD	420 × 260mm · handle + hang notch · hardwood or ply nested 444 × 284 mm	1	1
WALL ORGANIZER	420 × 300mm back · mail tray + divider · keyhole hangers nested 508 × 446 mm	3	1
PLANT STAND	3-leg interlock · 400mm tall · 300mm top ring nested 424 × 535 mm	4	2

Every design is parametric — new size, new thickness, or a custom variant is a one-line change.

MACHINE ENVELOPE

X-CARVE 1000mm FRAME → 750 × 750 mm ACTUAL CUT AREA



Z clearance 114mm · through-cut stock ≤ 32mm typical

FILES PER DESIGN

XCarve_<NAME>.svg — millimetre-native, import to Easel (verify one known dim after import)
XCarve_<NAME>.dxf — R2000, mm, closed LWPOLYLINES on layer CUT — import to Vetric
Multi-setup designs ship as _setup1 / _setup2 — one sheet load per file

X-CARVE SERIES — CAM SETUP & JOINERY

Same setup for every design in the series · dogbones pre-welded into the vectors

X-CARVE 1000mm · EASEL + VECTRIC

Series v1 · 07/24/2026 · parametric — resizable on request

Bit: 1/4" (6.35mm) upcut · adjust feeds to your material


CAM — EASEL

1. Import SVG · set Units = mm · confirm the imported width matches the sheet frame (700 mm)
2. Material thickness = your MEASURED ply (default drawn for 18.0 mm)
3. Interior shapes (slots, mortises, pierces) → Cut Type: INSIDE, depth = full through +0.5 mm
4. Part outlines → Cut Type: OUTSIDE, depth = full through +0.5 mm
5. Add tabs: 4 per part minimum on parts over 200 mm · 3 mm tall, 6 mm long
6. Bit: 1/4" upcut · softwood ply ~1200 mm/min, 2 mm pass depth (tune to your machine)

CAM — VECTRIC

1. File > Import Vectors > the .dxf · Job Setup: mm, material = measured thickness
2. Layer CUT holds all geometry; LABELS layer is reference only — do not toolpath it
3. Profile toolpath: interior vectors = Inside, exterior = Outside, tabs on
4. Vectors are closed polylines — no joining required; dogbones already present

JOINERY DETAIL — WELDED DOGBONE

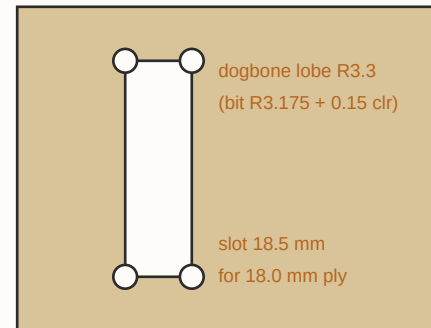

Round bits cannot cut square inside corners. The relief lobes are welded into the cut outline, so the mating tab seats fully with no CAM cleanup step.

Different ply? Say the number — all slots re-cut parametrically in one minute.