



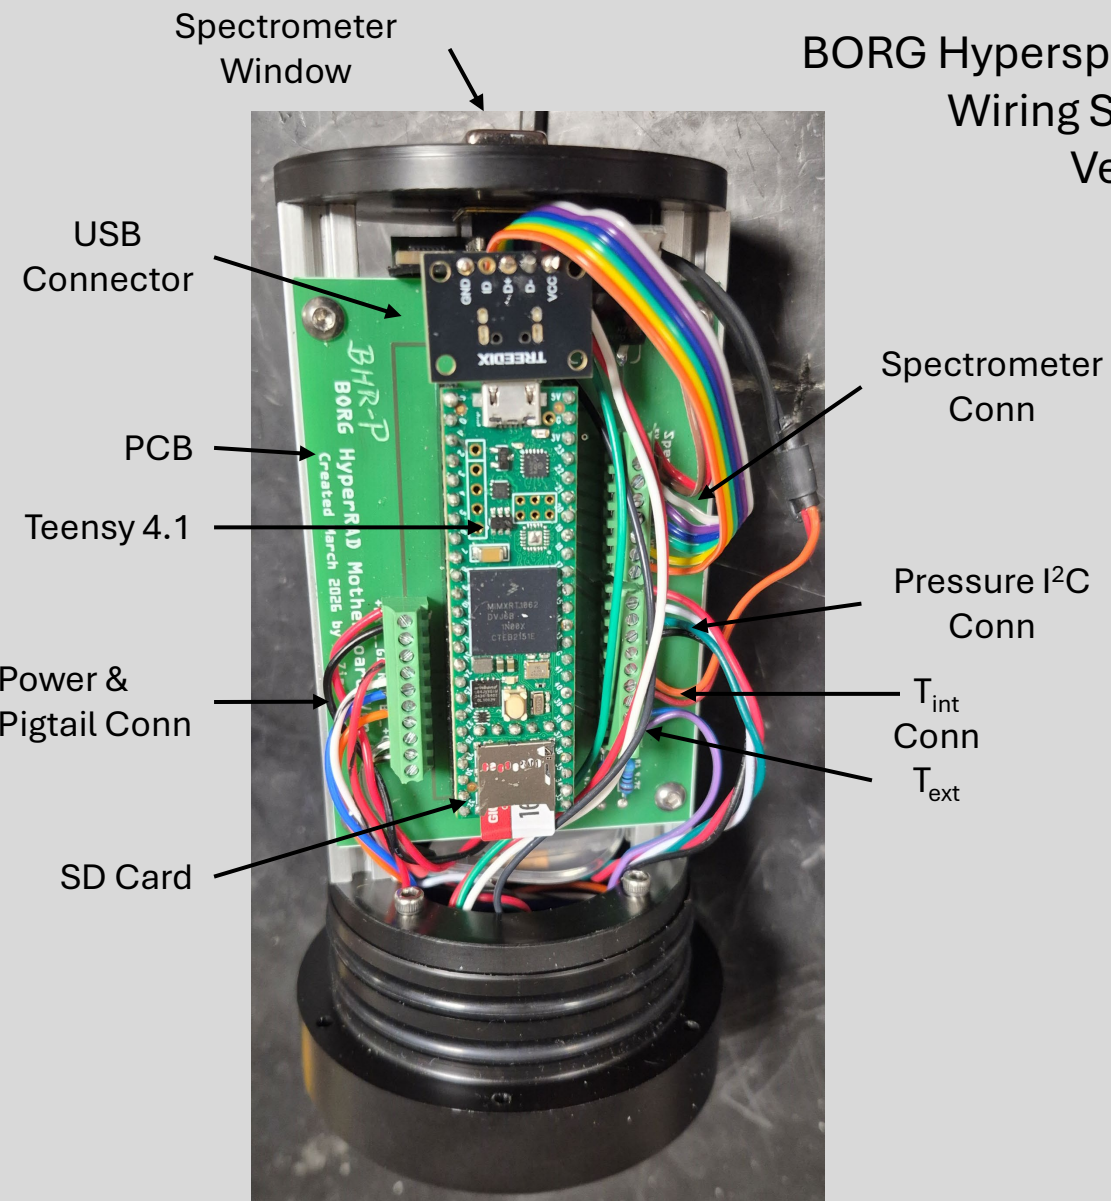


Complete system
attached to the base cap


BORG Hyperspectral Radiometer Wiring Schematics Ver 4.0

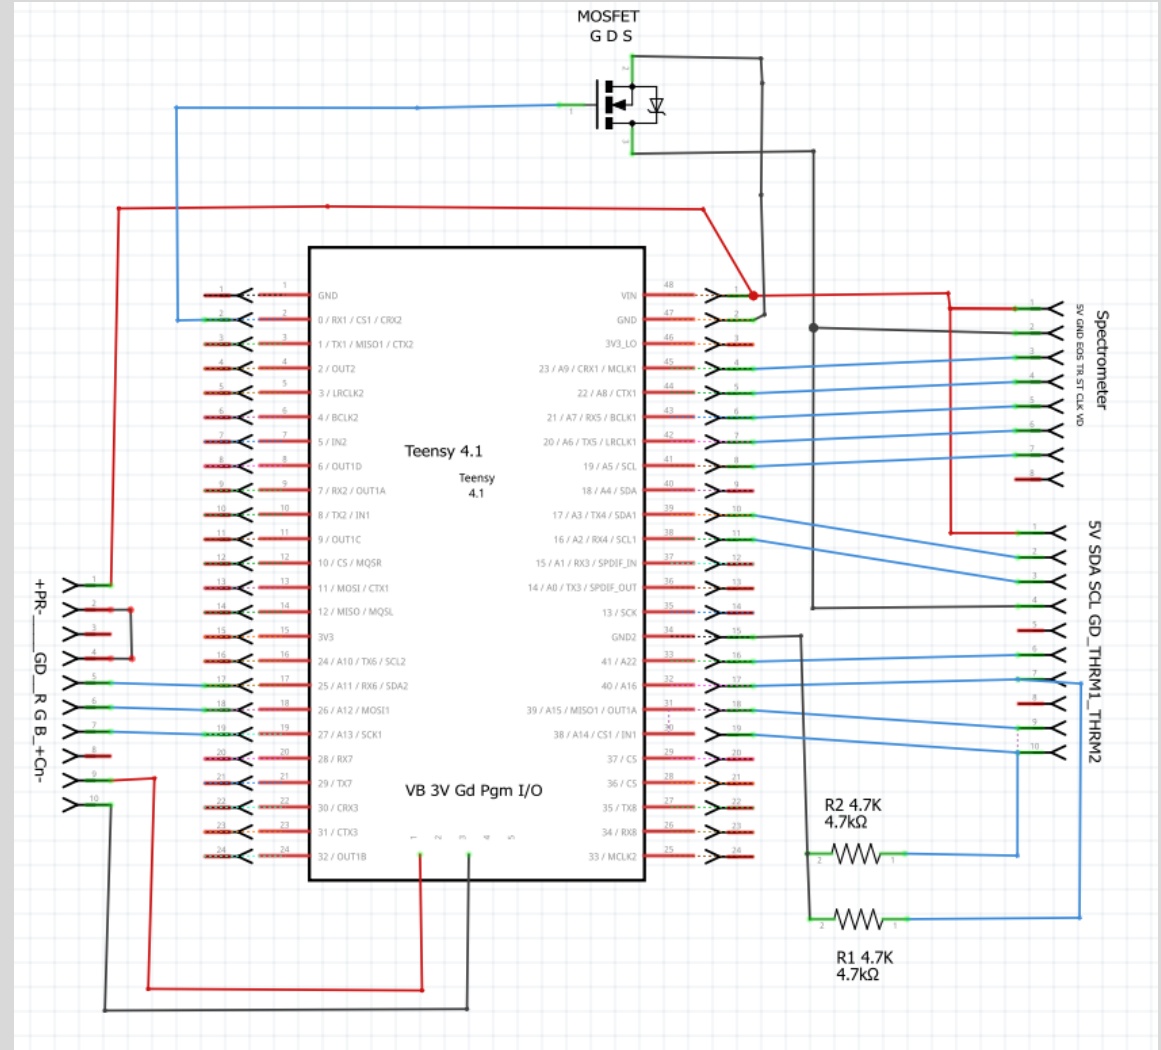

Circuit diagram created
using Fritzing design
software

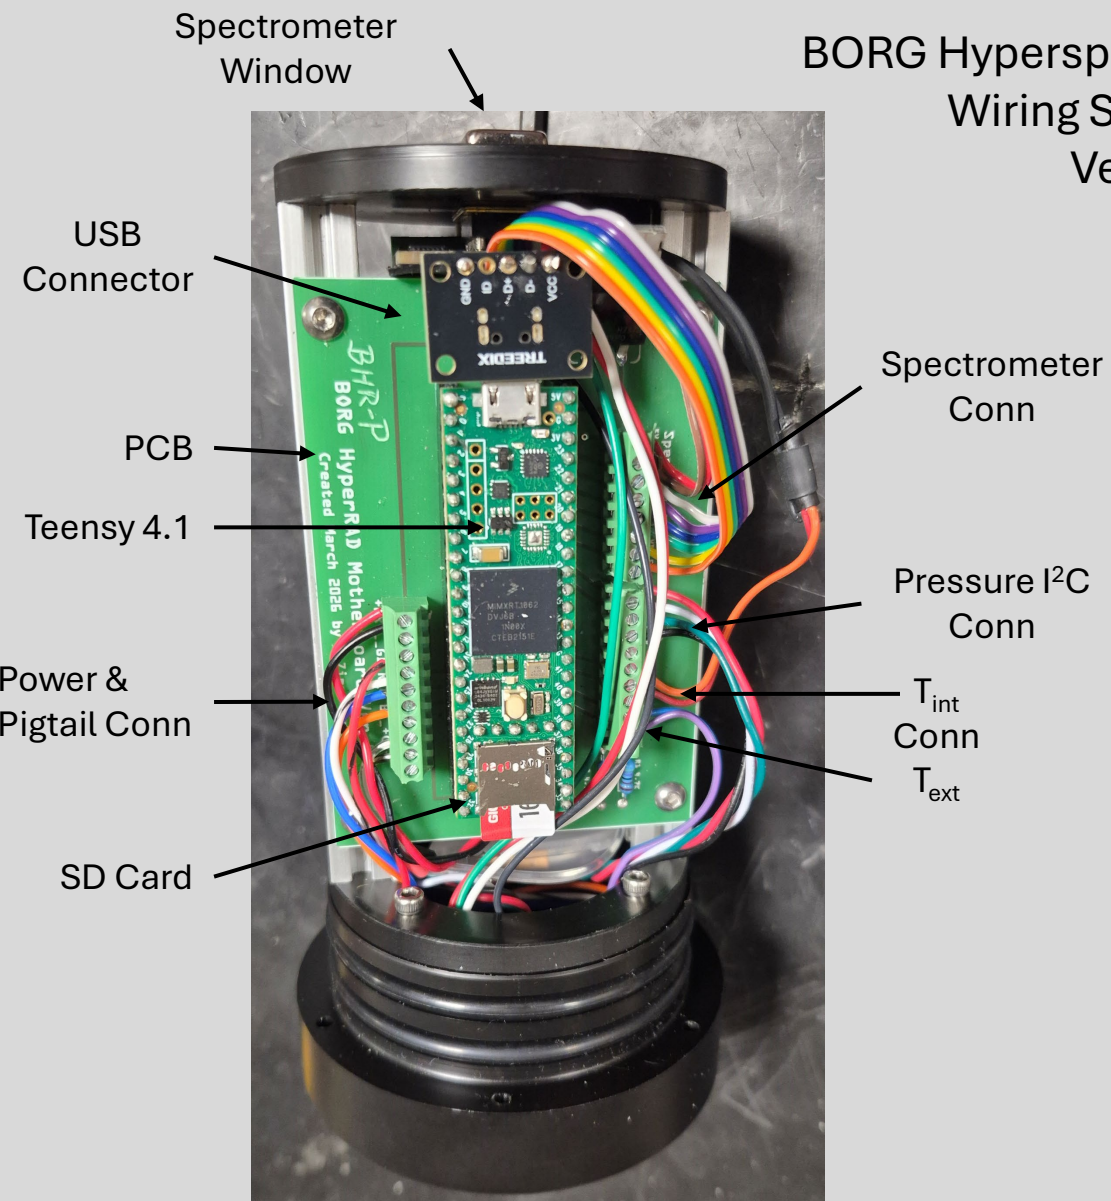

Complete system
attached to the base cap

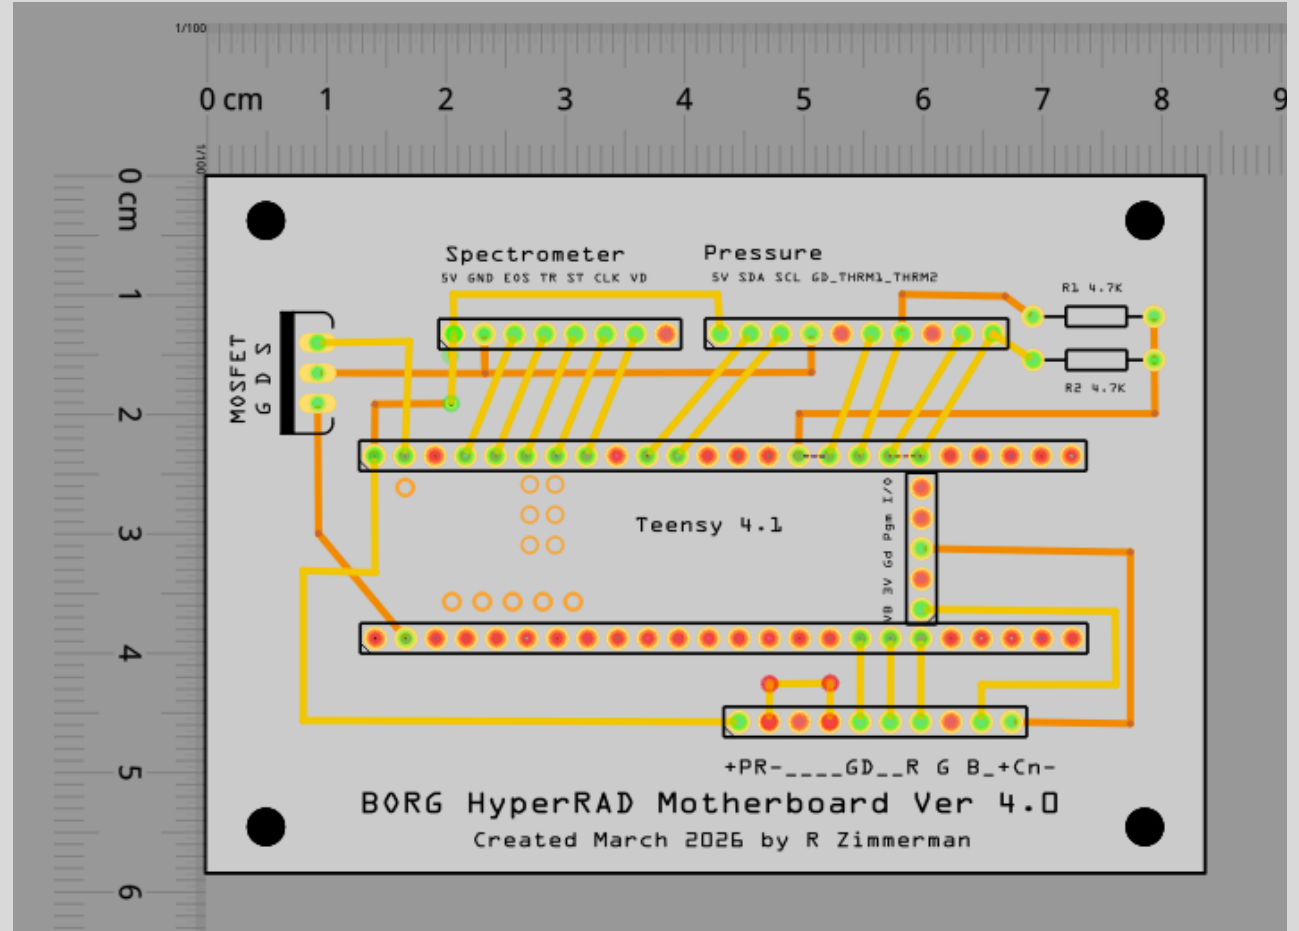

Printed circuit board layout created using
Fritzing design software

BORG Hyperspectral Radiometer
Wiring Schematics
Ver 4.0


SubConn Pin	SubConn Wire Color	Pigtail Connection	USB Cable Connection
1	Black	LED Gnd	USB Gnd
2	White	N/C	Data -
3	Red	N/C	+5V
4	Green	N/C	Data +
5	Orange	LED Blue	LED Blue
6	Blue	LED Green	LED Green
7	White/Black	LED Red	LED Red
8	Red/Black	LED Gnd	LED Gnd

BHR Pigtail Switch



SubConn
Pin Arrangement


BHR USB Cable

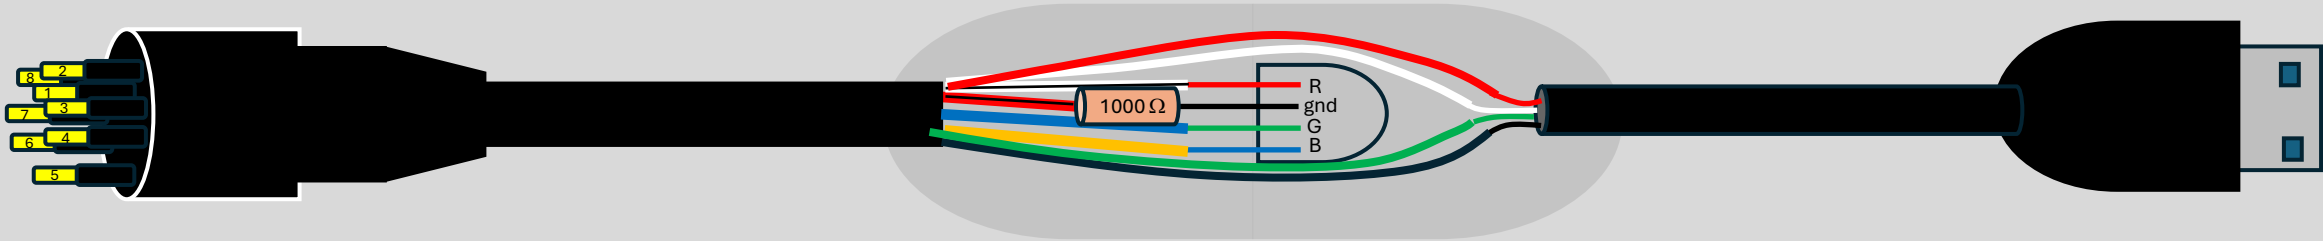

BORG Hyperspectral Radiometer
Wiring Schematics
Ver 4.0



SubConn
Socket Arrangement

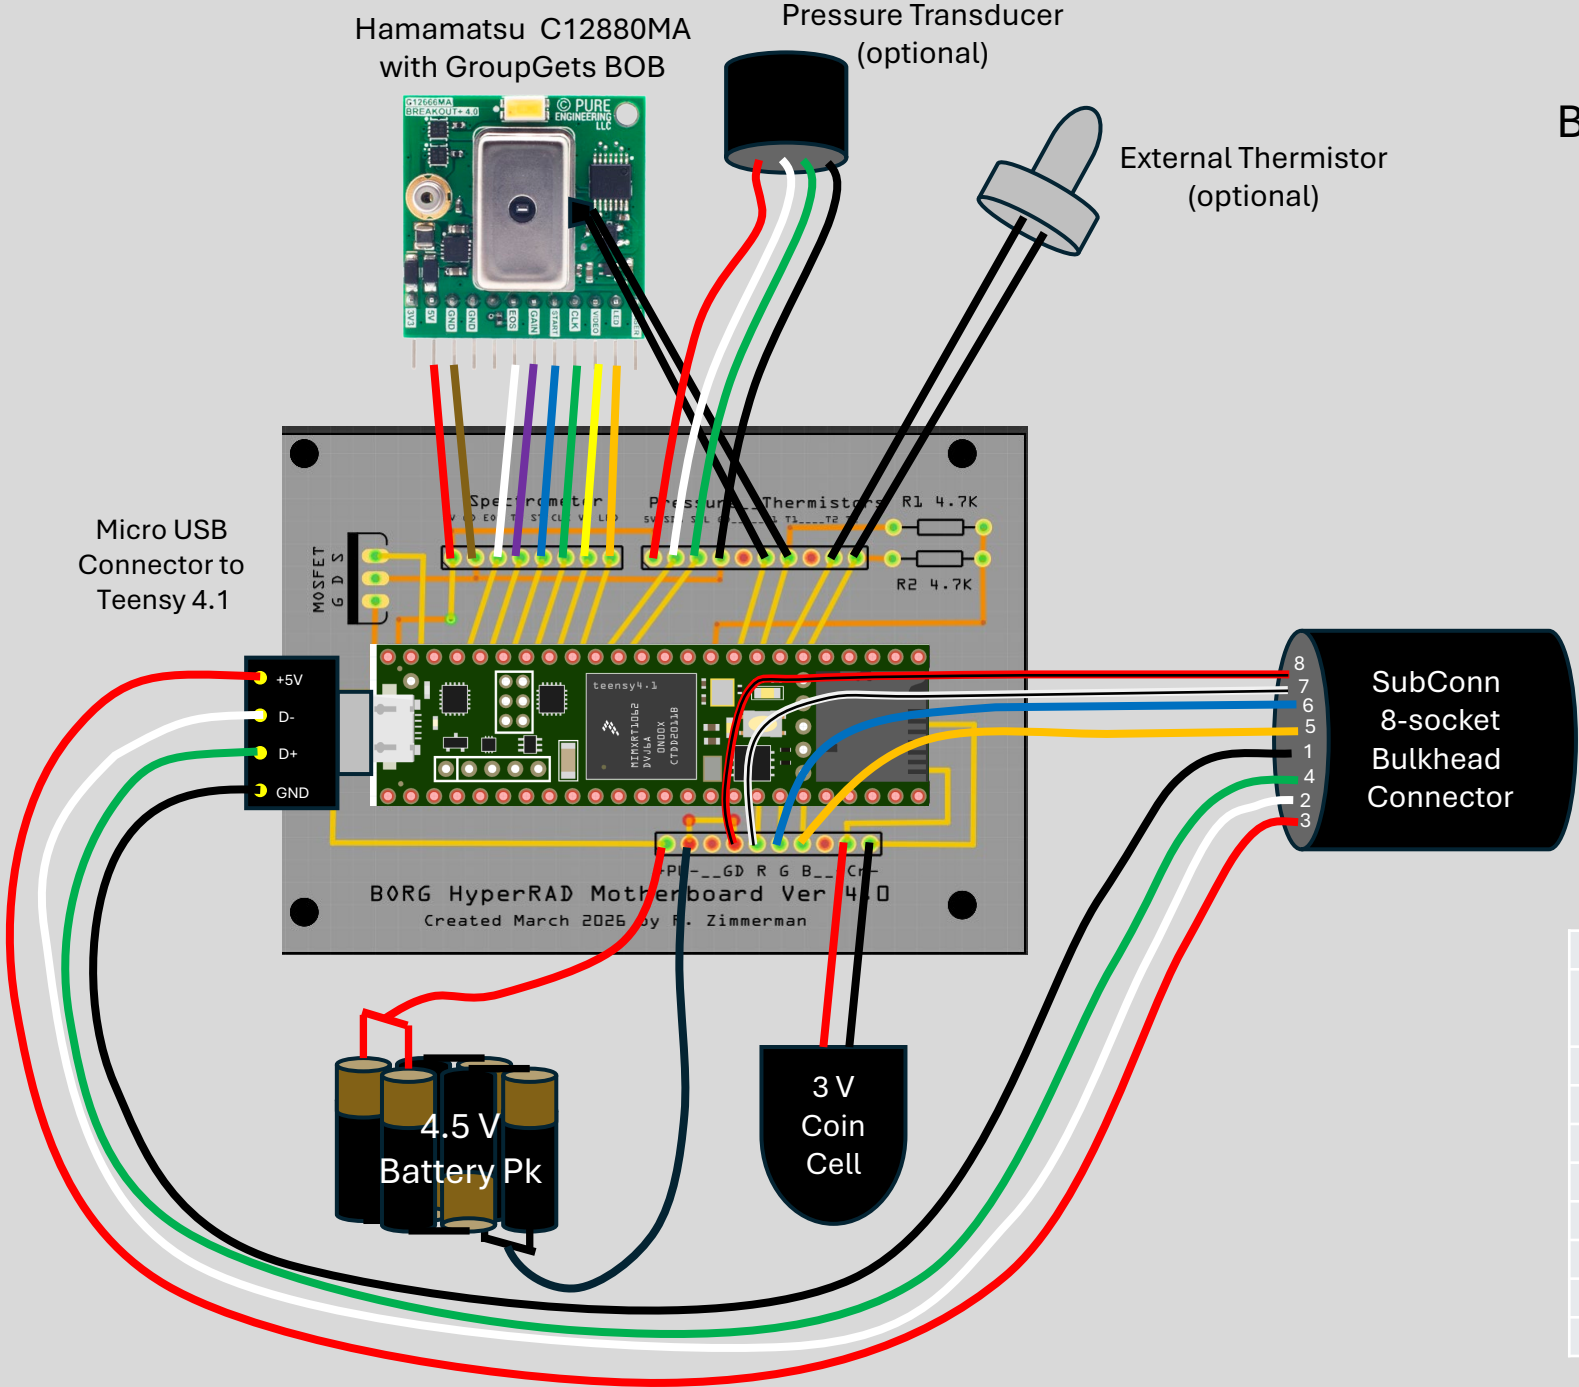

SubConn Wiring to BHR Internal Components		
SubConn Socket	SubConn Wire Color	BHR Connection
1	Black	USB Gnd
2	White	USB Data -
3	Red	USB +5V
4	Green	USB Data +
5	Orange	LED Blue
6	Blue	LED Green
7	White/Black	LED Red
8	Red/Black	Switch/LED Gnd