

Reserve Study
Tower Crossing Condominium Association

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

RESERVE STUDY REPORT

PREPARED FOR

Tower Crossing Condominium Association Glenview, Illinois

CLIENT CONTACT

Braeside Condominium Management
790 Estate Drive, Suite 100
Deerfield, Illinois 60015
Attn: Ken Metz, Property Manager



WEC PROJECT #: 22C-292


DATE OF REPORT: NOVEMBER 18, 2022

PREPARED BY:



Brandon Wall
Associate Engineer

REVIEWED BY:



Rye Waldman, PhD
Director of Engineering and Building
Research

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

TABLE OF CONTENTS

1. EXECUTIVE SUMMARY	1
2. INTRODUCTION.....	6
3. RESERVE STUDY GOALS	6
4. LEVELS OF SERVICE	6
5. ASSUMPTIONS	7
6. DISCLOSURES.....	9
7. RESERVE ANALYSIS	10
8. FIELD INSPECTION.....	11
ASPHALT PAVEMENT	12
CATCH BASINS	14
CONCRETE PAVEMENT.....	15
BRICK PAVERS.....	16
FENCING	17
ENTRANCE MONUMENTS & BRICK COLUMNS	18
SITE LIGHTING.....	19
BUILDING ROOFING	20
GUTTERS AND DOWNSPOUTS.....	22
BRICK FACADE	23
SEALANTS	24
SIDING	25
BALCONIES	26
9. RESERVE STUDY UPDATE.....	27

PHOTOGRAPHS

RESERVE ANALYSIS EXHIBITS

- Exhibit 1 – Element Summary
- Exhibit 2A – Element Replacement Schedule (Inflation Rate = 3%) (6 pages)
- Exhibit 3A – Recommended Funding Plan (Inflation Rate = 3%)
- Exhibit 2B – Element Replacement Schedule (Inflation Rate = 5.0%) (6 pages)
- Exhibit 3B – Recommended Funding Plan (Inflation Rate = 5.0%)
- Exhibit 4 – Fund Balance Comparison

1. EXECUTIVE SUMMARY

Waldman Engineering Consultants, Inc. (WEC) was contracted to perform a Reserve Study for the Tower Crossing Condominium Association located in Glenview, Illinois in accordance with our proposal dated May 10, 2022.

The subject property was originally constructed in 2003-2006 and consists of 17 townhome buildings which are four stories tall and contain a total of 154 units.

To fulfill the terms of the proposal, the engineering staff of WEC prepared this reserve study with a 2-part assessment and analysis process.

Part 1 - Field Assessment

The site inspection was performed by Brandon Wall and consisted of obtaining a general condition of the elements as well as determining the quantity and specifications of the elements. The elements that have been included in the Reserve Study are considered common to the property as provided by the Association and/or its Property Manager and include the following.

- Asphalt Pavement
- Catch Basins
- Concrete Pavement
- Brick Pavers
- Fencing
- Entrance Monuments
- Brick Columns & Monuments
- Site Lighting
- Building Roofing
- Gutters & Downspouts
- Brick Facade
- Siding
- Balconies

Where deemed appropriate, a representative sampling of repetitive or similar systems, components, equipment, units, areas, buildings, etc., was performed during the detailed visual inspection. A representative sampling inspection is deemed appropriate when similar observations, deficiencies, and recommendations are duplicated several times over.

Part 2 - Reserve Analysis

A repair or replacement expense was determined for each of the elements above that met the three part test as outlined below:

1. The element replacement expense is significant enough to impact the financial results of the study.
2. The element has a limited useful life.
3. The element must have a determinant remaining useful life.

The replacement cost estimates are calculated using a combination of bids from local contractors for similar work, actual data that may be provided from property representatives, as well as the latest version (updated quarterly) of the R.S. Means cost estimating database configured for the region that the property is located in. The replacement expenses were then scheduled over the next 30 years according to each element's anticipated remaining useful life. Repair/replacement projects were spread over a number of years for elements that a one year replacement project was not considered practical due to cost or scope of work. In order to accurately determine the level of reserve contributions necessary to meet all anticipated expenses, the present

day expenses had to be inflated to account for future increases in construction costs. Given that predicting long term inflation rates is not possible, a range of potential rates has been used to provide a window for the reserve funding plan. For the purpose of this report, WEC has given two recommended funding plans using inflation rates of 3% and 5.0%. Given the present day expense, the future expense is calculated using the “future value of a single amount formula” as follows:

$$F = P (1 + IR)^n$$

where

F = future expense

P = present day expense

IR = inflation rate expressed as a decimal

n = number of years until future expense occurs

The recommended funding plans were produced for the purpose of determining the amount of money the association would need to set aside in the reserve account each year in order to meet the anticipated expenses over the next 30 years. The reserve account starting balance for the fiscal year January 1, 2022-December 31, 2022 was given to WEC by the property representative and is shown in the table below along with the current annual reserve fund contribution and reserve account interest rate.


Summary of Financial Information	
Projected Starting Reserve Fund Balance (As of 1/1/2022)	\$950,000
Current Reserve Fund Contribution	\$689,915
Reserve Fund Interest Rate	0.05%

Based on the reserve analysis, there is insufficient reserve funds available for the upcoming roof replacement. The current annual level of reserve funding along with increase in the annual reserve contribution over the 30-year reserve term appear to be sufficient to finance the future capital expense projects after the upcoming roof replacement and avoid the need for a future loan or special assessment in the future. Please refer to Exhibits 3A and 3B for the recommended funding plans based on inflation rates of 3% and 5.0%. The following tables summarize the recommended annual reserve fund contributions over the next 30 years.

Recommended Funding Plan Summary (Inflation Rate = 3.0%)					
Year	Reserve Fund Contribution	Year	Reserve Fund Contribution	Year	Reserve Fund Contribution
2023	\$710,612	2033	\$955,004	2043	\$1,283,445
2024	\$731,931	2034	\$983,654	2044	\$1,321,948
2025	\$753,889	2035	\$1,013,163	2045	\$1,361,607
2026	\$776,505	2036	\$1,043,558	2046	\$1,402,455
2027	\$799,801	2037	\$1,074,865	2047	\$1,444,529
2028	\$823,795	2038	\$1,107,111	2048	\$1,487,865
2029	\$848,508	2039	\$1,140,324	2049	\$1,532,501
2030	\$873,964	2040	\$1,174,534	2050	\$1,578,476
2031	\$900,183	2041	\$1,209,770	2051	\$1,625,830
2032	\$927,188	2042	\$1,246,063	2052	\$1,674,605


Recommended Funding Plan Summary (Inflation Rate = 5.0%)					
Year	Reserve Fund Contribution	Year	Reserve Fund Contribution	Year	Reserve Fund Contribution
2023	\$724,411	2033	\$1,179,989	2043	\$1,922,077
2024	\$760,631	2034	\$1,238,988	2044	\$2,018,181
2025	\$798,663	2035	\$1,300,938	2045	\$2,119,090
2026	\$838,596	2036	\$1,365,985	2046	\$2,225,045
2027	\$880,526	2037	\$1,434,284	2047	\$2,336,297
2028	\$924,552	2038	\$1,505,998	2048	\$2,453,112
2029	\$970,780	2039	\$1,581,298	2049	\$2,575,768
2030	\$1,019,319	2040	\$1,660,363	2050	\$2,704,556
2031	\$1,070,285	2041	\$1,743,381	2051	\$2,839,784
2032	\$1,123,799	2042	\$1,830,550	2052	\$2,981,773

The status of the current funding plan as it relates to the recommended funding plan is illustrated in **Exhibit 4**, assuming that the current budgeted amount is increased for inflation annually.

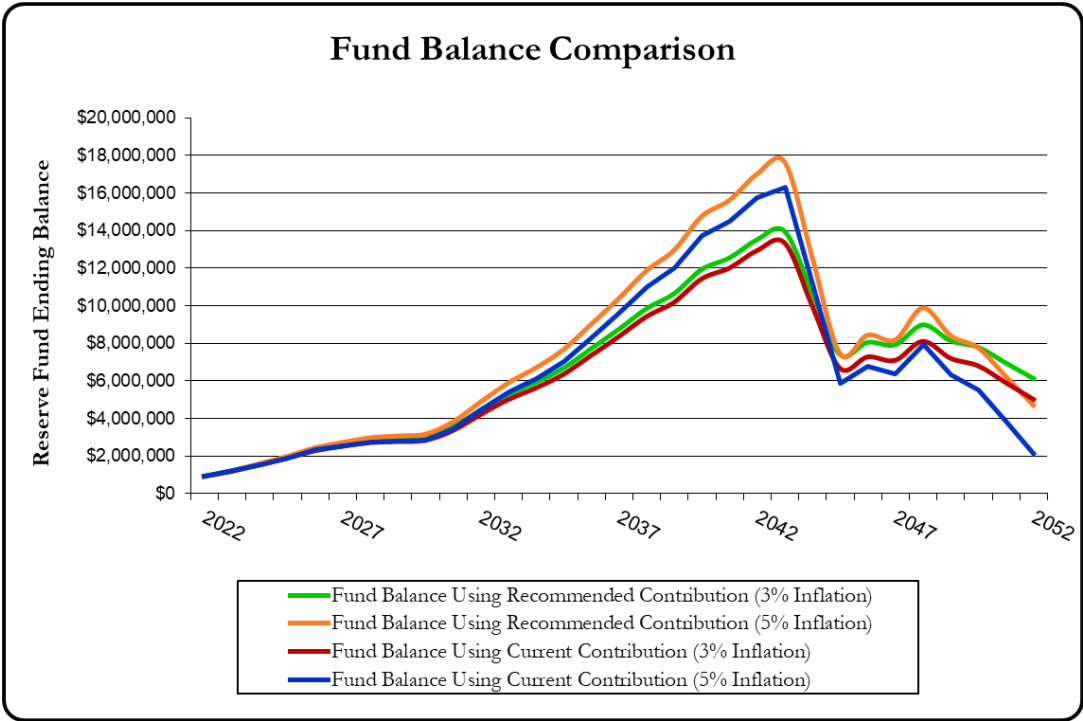

The following chart illustrates the ratio of expenses that will be incurred over the 30-year study period for each of the elements that represent a majority of the future repair or replacement expenses.

ELEMENT FUTURE EXPENSE SUMMARY

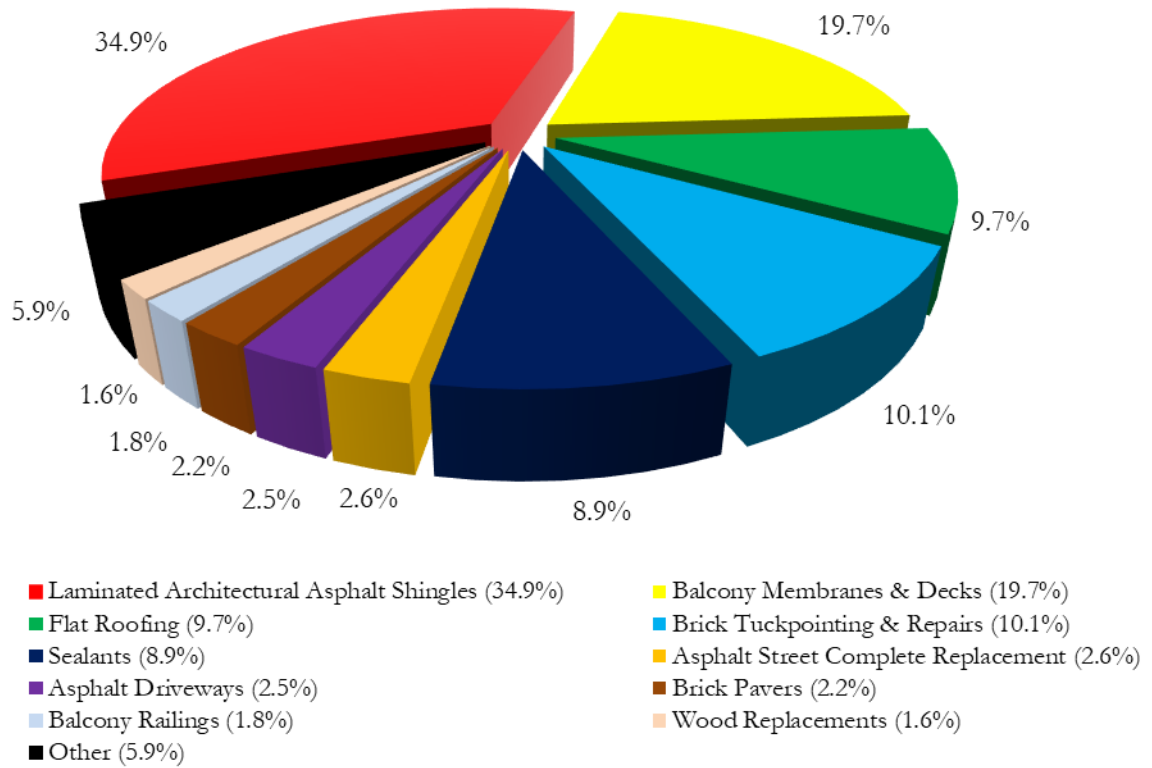

The annual contributions made to the reserve fund are a means to compensate for the difference between the ongoing deterioration of a property and its finances. Since elements deteriorate at varying rates and the finances of the property are typically changing on an annual basis, the need to maintain balance between the two is an ongoing process. Therefore, to maintain this balance, periodic updates to the Reserve Study are recommended approximately every three years. Annual updates may be warranted depending on the age of the property and the amount of repair or replacement activity.

2. INTRODUCTION

Waldman Engineering Consultants, Inc. (WEC) was contracted to perform a Reserve Study for the Tower Crossing Condominium Association located in Glenview, Illinois in accordance with our proposal dated May 10, 2022.

The purpose of the reserve study is to determine a reasonable level of annual reserve fund contributions required to meet the future expenditures for the elements on the property that will likely require major repairs or replacements over the next 30-year period.

3. RESERVE STUDY GOALS

The goals of the Reserve Study are as follows:

- Quantify as well as provide a condition assessment of each major element the association has responsibility for maintaining.
- Determine the typical useful life and remaining useful life of the elements.
- Estimate replacement costs for each element and prepare a schedule of element replacements based on historical performance data and present condition.
- Evaluate the annual reserve fund contributions required to ensure that reserve funds are available when needed to repair or replace the elements without the need to levy a special assessment.

4. LEVELS OF SERVICE

This report is based on the following level of service:

Level 2 – Update Reserve Study with Site Visit: An update reserve study includes a component inventory that is developed from a previous Reserve Study element list, condition assessment based on visual observations, life and valuation estimates, fund status, and funding plan. It is noted the sole difference between Level 1 and Level 2 is wholesale element quantification is not performed for a Level 2 study.

5. ASSUMPTIONS

Several general assumptions have been made for the completion of this study, which are as follows:

1. The elements will be replaced with like kind unless otherwise noted or directed by a representative of the property to use alternate materials.
2. All new installations will comply with current city, state and local building code requirements.
3. The building structure has a remaining useful life greater than 30 years.
4. A maintenance program will be implemented to ensure that all building components, systems, and equipment are maintained and operated at or near optimum capacities.
5. Since cash flow takes place at frequent and varying time intervals within an interest period, a simplified method of assuming that all cash flow occurs at the midpoint of the interest period is used in the reserve analysis.
6. The financial analysis in this study employs the cash flow method for developing the recommended reserve funding plan. This method generates a reserve funding plan to offset the anticipated annual expenditures which vary with time. In addition, the funding plan was generated using the baseline funding method. By definition, the baseline funding method maintains a reserve fund balance above zero for each year of the study.
7. The study is limited to the elements of the property that likely require major repair or replacement during the study period and that have a significant impact on the reserve contributions. Elements that require minor repairs or replacements and are relatively insignificant in cost when compared to the property in its totality are assumed to be funded from the operating and maintenance budget.
8. The following recurring expenses are considered to be maintenance items; therefore, adequate funding for such expenses should be allocated in the operating and maintenance budget, but not limited to the following:
 - Painting of exterior facade, trim, lintels and fencing
 - Applying protective coatings to the balcony decking
 - Expenses associated with typical maintenance of the common area landscaping
 - Crack sealing, seal coating and striping of asphalt pavement
 - Replacing benches
 - Minor localized tuckpointing that may be required for areas of severe distress
9. The following components were reported to be the unit owners' responsibility and therefore are not included in the study:
 - Garage doors
 - Windows and doors
 - Skylights

10. The following components were reported to be the responsibility of separate entities and therefore are not included in the study:
- Street systems, excluding Valor Ct. and Admiral Ct. (including curbs, gutters and catch basins) (Municipality)
 - Sidewalks along streets (Municipality)
 - Light poles and fixtures at streets (Municipality)
 - Mailboxes (USPS)
11. Elements such as electrical, water supply, and wastewater systems for the building along with irrigation and storm water drainage systems located throughout the property are considered to have an extensive lifetime that make it very difficult to predict or establish major repair or replacement expenses. These elements can function indefinitely with ongoing maintenance and repairs which are considered minor when compared to wholesale replacement expenses; therefore, we assume that future minor ongoing maintenance and repair expenses incurred will be funded from the operating and maintenance budget. This assumption is based on the premise that a reserve study is to include elements that have a definable remaining useful life; therefore, incorporating replacement expenses for elements that do not have a predictable useful life into the study can significantly impact the accuracy and validity of the results.
12. This study is reliant on the element quantities documented in the previous reserve studies prepared for the property including:
- Waldman Engineering Consultants Report # 17C-527, November 2017

The previously developed element quantities have been deemed accurate and reliable. Select quantities were verified or updated as part of this report.

6. DISCLOSURES

Waldman Engineering Consultants has no other affiliation with the Tower Crossing Condominium Association other than the preparation of this Reserve Study Report.

This study and report is based on observations of the visible and apparent conditions of a reasonable representative sampling of the property's elements at the time of inspection. Although due diligence was performed during the inspection phase, Waldman Engineering Consultants makes no representations regarding latent or concealed defects that may exist. The inspection did not constitute any invasive investigations and was not intended to determine whether applicable building components, systems, or equipment are adequate or in compliance with any specific or commonly accepted design requirement, building code, or specification. Such tasks as material testing, engineering analysis, destructive testing, or performance testing of building systems, components, or equipment are not considered as part of the scope of work, nor are they considered by the reserve study industry standard.

Judgments in this study are based on estimates of the age and typical useful life of the various elements included in this study. The predictions of useful life and remaining useful life are based on industry and/or statistical comparisons, along with sound engineering judgment. It is necessary to recognize that the actual conditions can alter the useful life of any element. The methods of installation, deferral of maintenance, or other unforeseen conditions make it virtually impossible to predict precisely when each element will require major repair or replacement. The results of this study should not be construed as a guarantee or warranty, either expressed or implied, as to the performance of products, materials, or workmanship.

If the property representative has not disclosed any known issues or problems with materials, components, or systems, it is noted that the validity of this study may be impacted. Where applicable, comments regarding the general condition of the property and any significant deficiencies as observed at the time of inspection have been documented. The information provided by a property representative regarding the financial, physical, or historical data is deemed reliable. The reserve study is intended to be a reflection of the information provided and is not for the purpose of performing an audit, quality analysis, forensic analysis, or background check of historical records.

Pricing used for the repair or replacement costs indicated in this report are derived from the R.S. Means publications in conjunction with other reliable resources such as individual material and equipment suppliers, and contractors. The material and labor pricing provided are estimates and have been augmented, as necessary, to account for specific site conditions (i.e., material handling, scaffolding, etc.). The estimated repair and replacement expenses, unless otherwise noted, do not include allowances for architectural, engineering, or permitting fees.

By review of the property representative, the elements listed in the Exhibit 1 of this report have been identified as the elements for which the property has long-term responsibility for repair and replacement. The property representative assumes full responsibility for determining that the list of elements is complete. Waldman Engineering Consultants has not reviewed any documents or declarations as part of this Reserve Study and assumes no responsibility for the completeness of the inventory.

This report is intended solely for the use of the Tower Crossing Condominium Association in connection with funding for major repairs and replacements and may not be used by any other party for any purpose.

7. RESERVE ANALYSIS

Upon completion of the field assessment, WEC determined whether the elements qualify to be considered a major capital expense for future funding in the Reserve Study based on the following three part test:

1. The element replacement expense is significant enough to impact the financial results of the study.
2. The element has a limited useful life.
3. The element must have a determinant remaining useful life.

Once replacement expenses were determined for all major elements, an element replacement schedule was prepared for a 30 year term. The replacement schedule is based on the element historical performance data, current condition, age, and estimated life expectancy. The National Reserve Study Standard published by CAI dictates that a minimum of a 20 year replacement schedule be used in a Reserve Study. WEC has selected a 30-year reserve term to capture replacement expenses associated with elements that can achieve a long service life.

In order to accurately determine the level of reserve contributions necessary to meet all anticipated expenses, the present day expenses had to be inflated to account for future increases in construction costs. Given that predicting long term inflation rates is not possible, a range of potential rates has been used to provide a window for the reserve funding plan. For the purpose of this report, WEC has given two recommended funding plans using inflation rates of 3% and 5.0%. Given the present day expense, the future expense is calculated using the “future value of a single amount formula” as follows:

$$F = P (1 + IR)^n$$

where

F = future expense

P = present day expense

IR = inflation rate expressed as a decimal

n = number of years until future expense occurs

A recommended funding plan was then developed using a baseline funding method, which maintains a yearly reserve fund ending balance above zero. The results of the funding plan outline the amount of money required to be deposited into the reserve fund each year in order to meet the projected element replacement/repair expenses without the need of levying a special assessment.

This study delivers two economic scenarios using reserve fund interest rates and construction cost inflation rates. It is emphasized that the recommended reserve funding plans presented in **Exhibits 3A and 3B** are each only one of many possible schedules that can be employed to meet the future reserve requirements.

The reserve analysis exhibits included with this report include the following:

- | | |
|-----------------------------|--|
| Exhibit 1 | <i>Element Summary</i> – Includes element quantities, units, estimated present day costs, observed conditions, typical useful life, and estimated remaining useful life |
| Exhibits 2A & 2B | <i>Element Replacement Schedules</i> – Includes replacement expenses and scheduling inflated at the indicated rates (3% and 5%) |
| Exhibits 3A & 3B | <i>Recommended Funding Plans</i> – Presents yearly breakdown of recommended contributions, anticipated expenses, interest accruals, and ending balances based on the two inflation schedules (3% and 5%) |
| Exhibit 4 | <i>Fund Balance Comparison</i> – Chart comparing the difference between the Recommended Funding Plans Year End Balance to Current Funding Plan Year End Balance |

8. FIELD INSPECTION

The contract to perform a Reserve Study for the Tower Crossing Condominium Association required an on-site, visual inspection of the property and a report on the general condition of the elements. The definitions below summarize the method used to determine the condition of each element included in this study.

Condition Definitions

Poor – a major deficiency of a component in which the function or operation is affected, is at or beyond its typical useful life, or whose remaining useful life should not be relied upon as a result of the information gathered regarding actual or effective age or evidence of abuse, excessive wear and tear, exposure to the elements, lack of proper maintenance, etc. This definition specifically excludes deficiencies that may be remedied with routine maintenance, miscellaneous minor repairs, normal operating maintenance, etc., however it may include components that are governed by aesthetics as opposed to performance.

Marginal – no major component deficiencies observed or evidence that would suggest that a major deficiency may exist. The component remains functional and operational, as it exists, however there is evidence that it is nearing its typical useful life.

Satisfactory – no major component deficiencies observed, or evidence that the component is nearing its typical useful life, however it is apparent that the component has not been recently replaced or repaired to its original condition.

Good – no major component deficiencies observed, and it is apparent that the component has been recently replaced or repaired to its original condition.

Varies – the general condition of an element cannot be generally defined by one of the above-mentioned definitions.

During the course of our inspection, several general observations were made regarding the construction and maintenance of the property. In general, a diligent effort was made to distribute the repair and replacement expenses over a number of years to create a more uniform expense report. The following discussions relate to the general features of the elements.

ASPHALT PAVEMENT

Element Description

The streets and driveways throughout the property are constructed of asphalt pavement. The majority of the driveways (estimated at approximately 85%) have been repaired or replaced since the previous study in 2017 and are in satisfactory to good condition. The remaining driveways (approximately 15%) are in need of repair. Repairs are ongoing and consist of saw cutting sections of driveways, removing crazed or alligatored asphalt, and applying a 3" layer of asphalt to the CA6 gravel base. The streets that are the responsibility of the association were noted to generally be in satisfactory condition. Like the driveways, street repair is ongoing with many repairs observed since the 2017 reserve study. Repairs generally consist of saw cutting and removing damaged, potholed sections of asphalt and then applying a 3-4" layer of new asphalt over CA6 gravel base.

An asphalt pavement structure typically consists of two components: the asphalt pavement which is installed atop an aggregate (sand or crushed stone) base. The base usually ranges from 6" to 18" in thickness depending on sub-base (soil) conditions and loading requirements. For residential driveways, construction generally consists of a single layer of asphalt pavement over the granular base. The asphalt pavement at streets is generally composed of multiple layers (commonly 1½" to 2" in thickness) of pavement: a wearing ("surface") course and one or two binder ("base") courses. Larger sections of pavement can sometimes be resurfaced (mill off the top layer and lay new pavement) rather entirely removed and replaced, as long as the existing base and binder course(s) of pavement are in satisfactory condition. With time, asphalt pavement deteriorates as a result of ultraviolet rays breaking down the asphalt binder, surface wear, and an accumulation of cracking that occurs due to freeze/thaw cycles and vehicle loading. Other factors that contribute to pavement deterioration are settlement (as a result inadequate compaction of the subbase) and poor drainage. Water that ponds on the surface accelerates the deterioration process by causing breakdown of the asphalt, sub-base and oils. Cracks that develop then allow moisture to penetrate the pavement down to the granular base course and typically cause the substrate to lose strength which leads to accelerated deterioration due to freeze/thaw cycles.

Based on the observed conditions, known history, and expected useful life, funding has been allocated for replacement of the remaining original driveways beginning in 2023 and the next round of replacements starting in 2030. Assuming that the integrity of the base layers of the streets is not compromised, funding has been allocated for milling and overlayment of the streets starting in 2029 and concluding by 2030. Subsequently, we include complete replacement of the streets from 2046 through 2047. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Periodic (every 3 years) seal coating and crack filling is important preventative maintenance that should be done to extend the life of the pavement. Cracks that are greater than 1/8" in width should be routed out, cleaned, and filled with a rubberized hot tar crack sealant to prevent water from penetrating the pavement. Seal coating minimizes oils from evaporating, reduces the degradation that occurs from ultraviolet light, and prevents water from penetrating the pavement. However, sealcoating may not be economical on older pavement; at some point sealcoating will not do much to extend the life of pavement and is essentially serving an aesthetic purpose. Seal coating, crack sealing, and select patching are considered to be maintenance expenses; therefore, adequate funding should be allocated to the operating and maintenance budget for such expenses.

Deficiencies Noted

- Street sections repaired.
- Street cracks filled.
- Driveway section replaced.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Asphalt Street Milling and Overlayment	86,000	Square Feet	\$320,780	15-20	7-8	Satisfactory
Asphalt Street Complete Replacement	86,000	Square Feet	\$391,300	15-20	24-25	Satisfactory
Asphalt Driveways	47,500	Square Feet	\$210,900	10-15	1-12	Varies

CATCH BASINS

Element Description

The Association is responsible for the site drainage elements including the catch basins and storm sewers. Catch basins can have an extensive useful life, but also can sometimes require periodic repairs which are often performed in conjunction with surrounding asphalt repairs. Based on the observed conditions and expected useful life, funding has been allocated in the form of an allowance for periodic partial repairs to the catch basins in coordination with each street repaving event. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

The storm sewers were inspected at the catch basin inlets only and were not inspected internally. Periodic interior inspections by qualified personnel are recommended. We recommend funding be allocated to the operating and maintenance budget for such expenses. The typical useful life for elements of these systems can vary from 50–100 years. This broad range of useful life makes predicting when significant replacements will be necessary very difficult. At a minimum, it is not expected that significant replacements will be required for the site drainage elements due to normal wear and aging. Including costs for elements such as these into a study can skew the results given that predictions of useful life are very difficult to support. Therefore, funding is not included for replacement of the subsurface drainage piping at this time.

Deficiencies Noted

- No deficiencies noted.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Catch Basin Repairs	31	Each	\$26,649	Up to 60	7-8	Satisfactory

CONCRETE PAVEMENT

Element Description

Concrete pavement consisting of sidewalks and entry stoops with stairs and/or slabs is installed throughout the property. The concrete was in overall satisfactory condition with isolated spalling and cracking observed. Additionally, concrete curbs and gutters are located along the perimeter of the asphalt paved streets. The curbs and gutters were also in satisfactory overall condition with isolated areas of cracks, damage, and deterioration.

It is not expected that complete (100%) replacement of the concrete will be required within this study period; however, partial replacements and repairs are anticipated periodically due to settlement and deterioration that will occur over time, the level of which will depend on variable factors such as base undermining creating trip hazards, the concrete mix, conditions at the time of installation, finishing techniques, local conditions, de-icing agents, and use.

Based on the observed conditions, known history, and expected useful life it is estimated that 60% of the concrete walks and 25% of the stoop stairs and slabs will require repairs and/or replacement over the 30-year period of this study. Funding has been allocated in the form of an allowance for ongoing periodic partial repairs to the concrete every five years over the 30-year study period beginning in 2024 for the walks and 2029 for the stairs and slabs of the stoops. Funding has been allocated in the form of an allowance for replacement of up to 25% of the curbs and gutters in coordination with each street repaving event and 0.5% of the curbs and gutters in coordination with each driveway repaving event. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted

- Sections of curb cracked or broken due to vehicle strikes.
- Heaved sidewalks possibly due to freezing of underlying soil.
- Porch stairs and stoops exhibiting cracks and spalled concrete.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Concrete Curb and Gutter	6,600	Linear Feet	\$334,686	Up to 60	Ongoing	Satisfactory
Concrete Walks	4,000	Square Feet	\$44,000	Up to 60	Ongoing	Satisfactory
Concrete Stoops (Stairs)	4,150	Square Feet	\$351,381	Up to 60	Ongoing	Satisfactory
Concrete Stoops (Slabs)	5,000	Square Feet	\$196,550	Up to 60	Ongoing	Satisfactory

BRICK PAVERS

Element Description

Brick pavers are located throughout the property including at front unit entrances and the common areas and were observed to generally be in satisfactory condition. Areas of settlement were noted. Brick pavers are estimated to have a useful life between 15–25 years depending on the strength of the base material, applied loading, water drainage, local conditions, and use. It is estimated that the pavers will require replacement within the 30-year period of this study due to settlement and wear.

We have included reserve expenditures for periodic partial repairs in 2023 and replacement of pavers starting in 2027 and concluding in 2033. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted

- Loose brick pavers.
- Loose mortar joints.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Brick Pavers	20,700	Square Feet	\$436,977	15-25	10-13	Satisfactory

FENCING

Element Description

Aluminum fencing is installed at the front elevations of the units throughout the property including the railings at the stairs. The fencing is constructed primarily of painted aluminum. The fencing was observed to generally be in satisfactory condition, however localized areas of corrosion and deterioration were noted. Porch railings have been painted and railings have been set in epoxy, which addressed corrosion at the base of the posts. Additionally, we noted bulged sides resulting in loss adhesion of the factory finish. This condition may be due to freezing of trapped water inside the posts.

Aluminum fencing is constructed of hollow, thin walled, extruded aluminum components. Many factors affect the life of aluminum fencing, including the thickness of the tubing, the quality of finish, and the quality of the aluminum and fasteners. It is estimated that wholesale replacement will be required during this study period.

Based on the observed conditions, known history, and expected useful life, funding has been allocated for wholesale replacement of the fencing from 2034 through 2035. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted *(sampling only, not intended to be a comprehensive list of every defect)*

- Bent or damaged fencing with faded oxidized paint.
- See photograph section of this report for examples of observed deficiencies.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Aluminum Fencing	4,200	Linear Feet	\$286,356	25-30	12-13	Satisfactory

ENTRANCE MONUMENTS & BRICK COLUMNS

Element Description

Located at the north and south ends of the property are three brick masonry entrance monuments with sandblasted limestone signage. Also installed throughout the property are brick masonry columns installed at the aluminum fencing, brick masonry enclosures for the mailboxes, and brick masonry columns at the concrete bench structures. Monuments and enclosures of this type typically require tuckpointing and repair due to deterioration caused by moisture, freeze/thaw cycles, road salts, and damage. Additionally, renovations to the property identification entrance monument signage should be anticipated in order to update the appearance of the property.

Based on the observed conditions and expected useful life, funding has been allocated for periodic tuckpointing and repairs to the monuments, columns, and mailbox enclosures in 2027 and every five years thereafter. Funding has been allocated for the entrance monument signage in 2032. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted

- Missing mortar at capstone of column.
- Missing mortar base of column.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Brick Tuckpointing at Monuments and Columns	8,110	Square Feet	\$84,993	20-30	Ongoing	Satisfactory
Entrance Monument Signage	3	Each	\$15,000	15-25	Ongoing	Satisfactory

SITE LIGHTING

Element Description

The lighting located throughout the development consists of approximately 15' tall metal poles with mounted fixtures that were observed to generally be in satisfactory condition. Also installed at the property are bollard lights at the underpasses between buildings. Often, the need for replacement is determined by the extent of damage to the lighting such as corrosion or movement of the poles, the frequency and costs of repairs due to the age of the lighting, or merely the desire to change the aesthetic appearance of the lighting to maintain the market value of the property.

Based on the observed conditions, funding has been allocated for replacement of the post lighting in year 2033 and the bollard lighting in 2028. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling. For the purpose of this study, we assume the wiring and concrete foundations have a useful life that is beyond this study period; therefore, the expenses associated with replacement of these elements have not been included in this study. Future updates to this study should include the expense to replace the wiring and concrete foundations if so warranted.

Deficiencies Noted

- o No deficiencies noted.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Post Lighting	16	Each	\$51,600	15-25	11	Satisfactory
Bollard Lighting	8	Each	\$6,000	10-20	6	Satisfactory

BUILDING ROOFING

Element Description

Sloped Roofing

The roofs are covered with a layer of laminated architectural asphalt shingles. Though we are not informed of a significant history of leaks associated with the sloped roofs, the shingles appeared to be in marginal condition. We noted isolated shingle lift, and the shingles exhibit varying degrees of granular loss, damage and deterioration throughout the property. Additionally, we are informed that shingle blow-off is increasing in frequency as the roofs continue to age. These conditions are indicative of shingles that may be nearing the end of their useful life.

Replacement of asphalt shingles is often considered necessary over time due to degradation of the shingles as evident by curling at the shingle corners, torn shingle tabs, cracking, and excessive granule loss. In some instances, replacement may be required due to chronic problems with moisture penetration associated with poor installation practices.

The shingles are obviously the main element of a roof, but several other components are critical to a reliable roofing system that performs well throughout its useful life. The basis for the roof system is a sound and level roof deck. Displaced or damaged roof sheathing can cause punctures, cracking, or overstressing of the shingles and reduce their useful life. A quality underlayment should then be installed over the entire roof deck. Felt underlayment fabric is installed to provide an additional layer of moisture protection should shingles be blown off or damaged. Underlayments also provide temporary moisture protection during installation, a protective barrier layer between the shingles and wood sheathing and are typically required by building codes. A self-adhering bituminous underlayment (ice and water shield), which is a thicker, rubber like membrane, is recommended to be installed along the building eaves, valleys, near penetrations, around skylights, and at low sloped roofing sections. These types of underlayments provide greater resistance to leakage at roofing areas that are more vulnerable to penetration and a barrier to seepage resulting from ice dams that form at the eaves. An aluminum drip edge should be installed along the length of all eaves to direct moisture off and away from the building components.

Two other critical elements of the roofing system are the insulation (between the living space and the attic) and ventilation components. A poorly insulated and ventilated roof/attic typically results in high moisture levels and warm temperatures within the attic creating the ideal environment for mold and mildew growth. Excessive heat buildup can also occur during warm weather, which reduces the useful life of the shingles and increases energy costs. During cold weather months, heat loss from the units through the attics leads to the formation of ice dams at the building eaves, aside from the lost energy dollars. Therefore, insulation in the attics needs to be continuous and of proper R-value, however the insulation details at attic penetrations are also critical. Discharging of exhaust fans directly into the attic must also be avoided, as this practice undermines the insulation and ventilation system.

Ventilation of the attic is typically achieved by installing louvered or perforated vents at the soffit (underside of the eave) and either a continuous vent along the roof's ridges or numerous static vents spaced throughout the roof near the ridges. Depending on the style of construction, preformed baffles may be required in the attic at

soffit vent locations to allow for proper air flow around the installed insulation. Determining the adequacy of the installed insulation and ventilation systems is beyond the scope of this study.

Based on the observed conditions, known history, expected useful life, and due to other ongoing major expenditures, wholesale replacement of the roofing is anticipated over a two-year period from 2023 through 2024. Given the limited reserve funds available at this time, it is anticipated that this project will be covered either via special assessment or loan and is not including in the funding plan. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life and to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling. The flashing material at plumbing stacks, curbs, etc. are integral with the entire roof system; therefore, they are considered as part of the overall roof replacement. Our estimated cost is for installation of laminated asphalt shingles, as the durability and performance of laminated shingles typically makes them a better value long-term than three-tab shingles. The replacement costs of the sloped roofing systems are higher than average based on several factors, including but not limited to building height, high slope of the roofs, and the configuration including many relatively small, discrete areas.

Note: When planning the exact budgetary requirements for such a large capital expenditure project, it is recommended that an engineering professional prepare specifications and compare contractor bids in order to best understand the actual impact on the reserve fund.

Flat Roofing

The flat sections of roofing are covered with a modified bitumen roofing membrane. Replacement of modified bitumen roof systems is often considered necessary due to degradation of the membrane, seam failure, ponding water, and severe blistering. We understand that the flat roofs have been problematic and historically the source of many leaks. However, over the course of the past approximately 10 years, many of the flat roofing sections have been replaced. Based on conversations with Management and the Association's preferred contractor, an estimated 80% of the flat roofs have been repaired. Given their condition and ongoing problems, it is anticipated that wholesale replacement of the flat roofing will occur in 2023–2024. Given the limited reserve funds available at this time, it is anticipated that this project will be covered either via special assessment or loan and is not including in the funding plan. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life and to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling. Our replacement expenditures are based on an average historic replacement cost.

Deficiencies Note

- No deficiencies noted

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Laminated Architectural Asphalt Shingles	160,000	Square Feet	\$2,502,400	20-25	1-3	Poor
Flat Roofing	61,000	Square Feet	\$1,351,760	15-20	1-20	Varies

GUTTERS AND DOWNSPOUTS

Element Description

The gutters and downspouts are installed at the Valencia and Drake model styles at the transitions from the sloped roof portions to the flat roof/deck areas. Replacement of these elements is often considered necessary due to damage and fading of the finish as a result of continued exposure to ultraviolet light. Typical damage includes deterioration of joint seals at gutters which may result in leaking, denting, missing or loose fasteners, and deformation. Even though the performance life of these elements will generally exceed the aesthetic life, the appearance is critical in maintaining the value of the property. Therefore, the limiting factor concerning the useful life of these elements is generally the aesthetic appearance of the finish.

Based on the observed conditions and expected useful life, funding has been allocated for wholesale replacement of the gutters and downspouts in conjunction with the phased sloped roofing replacements. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted

- o No deficiencies noted.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Gutters and Downspouts	900	Square Feet	\$11,997	20-30	4-8	Satisfactory

BRICK FACADE

Element Description

The buildings throughout the property are constructed with a brick masonry veneer at the exterior facades at all elevations. In general, the brick should last the life of the property; however, shear cracks, shrinkage cracks, separation cracks, dislodged mortar, holes, unfilled joints, erosion, and other forms of deterioration occur to the mortar joints. Localized tuckpointing is considered necessary to prevent the potential of moisture penetration that can lead to more costly repairs such as spalling or cracking of brick, interior moisture damage, corrosion of the steel lintels, etc. Therefore, to mitigate moisture penetration, it is common practice to grind out the mortar joints, generally to a depth of either ¾” or to sound mortar, whichever is greater, and tuckpoint the joints with new mortar. Mortar joints generally have a life expectancy of 30 to 50 years before a significant quantity of tuckpointing is considered necessary. Face grouting of the mortar joints is not recommended as it has a substantially reduced useful life because it eliminates the step of grinding out the existing mortar joint. Face grouting generally has a useful life in the range of 10 to 20 years depending on the condition of the existing mortar joints that the newly applied mortar is being bonded to, quality of workmanship, type of new mortar, exposure, etc. Therefore, for the purpose of this analysis we assume that grinding of the mortar joints will be performed.

At the time of the previous reserve studies (2013 and 2017), it was reported that issues with moisture penetration were ongoing with investigations and repairs being performed. What appeared to be newly installed flashing and drip edges were noted above select windows throughout the property and are presumed to be installed to address leakage issues. Active leakage was not reported to be a current issue at any units, however the potential for future leakage exists and will be rectified as issues arise. Based on the history of previous repairs, funding has been allocated in the form of an allowance every other year for the duration of the study for localized repairs and replacements at the brick masonry beginning in 2023. It is noted that predicting when deficiencies will arise is difficult given that the flashing systems are concealed, however for the purpose of this study funding has been provided for potential repair projects. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted

- Missing mortar and stress crack in brick.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Brick Tuckpointing & Repairs	250,000	Square Feet	\$3,580,000	30-50+	Ongoing	Varies

SEALANTS

Element Description

Sealant/caulk is applied around windows, doors, and between other dissimilar materials. These cracks and gaps can allow moisture to penetrate these areas. Sealant failures can occur over time as a result of improper installation, or a loss of the sealant's elastic and adhesion properties caused by the aging process. An opening in the sealant is a path for moisture to penetrate into the building, creating the potential for damage or accelerated deterioration to other building components. It is critical that sealants be replaced prior to the presence of failures to prevent costly damage from occurring. Sealants were replaced since the 2017 reserve study and were observed to be in good condition.

Funding for a phased sealant replacement has been allocated and scheduled to start in 2028 and continue through 2031. Interim allowances for minor replacements of sealants have also been included. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling.

Deficiencies Noted *(sampling only, not intended to be a comprehensive list of every defect)*

- Original sealants are noted to be deteriorated.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Sealants	1	Allowance	\$875,000	8-12	6-10	Varies

SIDING

Element Description

The Valencia and Drake unit styles have a small amount of fiber cement siding installed at the roof deck areas. Over time, cracks will begin to form in the siding as a result of changes in the moisture content and the inherent property that cementitious materials shrink with time. Sealants must also be maintained, checked and periodically replaced to ensure a watertight system and maintain the life expectancy of the cladding.

Based on the observed conditions, reported previous work, and typical useful life for fiber cement siding, funding has been allocated for periodic partial replacements of the siding every five years beginning in 2023. Please refer to the table below for a summary of the element quantities, present day cost, and remaining useful life as well as to Exhibits 2A (3% inflation rate) and 2B (5% inflation rate) for the estimated expenses and scheduling. The replacement costs are higher than average based on several factors, including but not limited to building height and the configuration including many relatively small, discrete areas. Paint finish applications and the replacement of sealants is considered a maintenance item; therefore, adequate funding should be allocated to the operating and maintenance budget for their replacement.

Deficiencies Noted

- No deficiencies noted.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Fiber Cement Siding	6,200	Square Feet	\$139,996	20-30+	Ongoing	Varies

BALCONIES

Element Description

The balconies throughout the property consist of both cantilevered as well as simply supported structures of which the framing is encapsulated by soffit, fascia, and a membrane system with wood or composite decking. The balcony framing consists of wood. Each balcony has a drainage system. Aluminum railings are installed at all balconies and were replaced approximately ten years ago. We are informed that the manner of installation of the replacement railings is problematic due to many potential avenues of moisture infiltration.

We are informed by the Association's construction manager that the balcony at 1823 Admiral Court was replaced in 2021 using a design to address drainage system issues. This design addressed the drainage issues but was found to be cost prohibitive. The balcony at 1805 Admiral Court was replaced in mid-2022 which abandoned the roof drains and associated PVC plumbing and did so in a cost-effective manner. This design was found acceptable and is being implemented for all the units going forward. Currently the balconies at 1817 Admiral Court and 1823 Valor Court are being replaced using this design. The remaining 150 balcony systems are scheduled to be replaced using this design and funds will have to be allocated for these repairs.

Based on the information provided, replacement of the remaining original balcony assemblies is projected from 2023 through 2028. Our expenditures are based on an average historical cost provided by Management and the Association's preferred contractor and includes replacement of the balcony assemblies and reinstallation of the existing railings. Following completion of the near-term balcony replacements, we assume a more typical useful life, and include funding for subsequent replacements from 2043 through 2052. Additionally, we include replacement of the railings in coordination with the subsequent balcony replacement project. Finally, an ongoing replacement allowance has been included every five years beginning in 2029 for replacement of wood components considered to be above and beyond typical maintenance.

Deficiencies Noted

- Missing wood soffit
- Balcony currently under repair.

Element Name	Quantity	Units	Present Day Expense	Typical Useful Life	Remaining Useful Life	General Condition
Balcony Railings	154	Each	\$254,999	20-30	23-29	Satisfactory
Balcony Membranes & Decks	154	Each	\$1,850,000	15-25	1-23	Varies
Wood Replacements	1	Allowance	\$58,000	3-5	1-23	Varies

9. RESERVE STUDY UPDATE

The annual contributions made to the reserve fund are a means to compensate for the difference between the ongoing deterioration of a property and its finances. Since elements deteriorate at varying rates and the finances are typically changing on an annual basis, the need to maintain balance between the two is an ongoing process. In order to maintain this balance, it may be appropriate to have the reserve study updated.

When considering an update to a study, the following questions should be considered:

- Has there been a significant departure (i.e., 2% to 3%) from the anticipated rates for interest, inflation, and construction cost increases previously assumed?
- Have any major elements been added or replaced since the previous study?
- Have any elements sustained premature deterioration due to unseasonable weather or lack of maintenance since the previous study?
- Have any repairs or replacements been accelerated or deferred from the estimated schedule previously generated?

If the answer is “yes” to one or more of the above questions, then an update to the reserves study should be strongly considered.

Generally, a property that is relatively new in age and is not undergoing any major repairs or replacements should have the reserve study updated approximately every 3 years to maintain the validity of the estimates. However, if the property is older and is experiencing major repairs or replacements, then the study should be updated on an annual basis.

An update to a previous reserve study can typically be performed for a percentage of the original cost of the study. The re-evaluation can include a field walk down of the property, or simply an update to the tables.

PHOTOGRAPHS



Asphalt street repair on Admiral Court



Asphalt street repair on Valor Court



Asphalt section repair at entrance to Admiral Court



Driveway along Admiral Court with asphalt section replaced

PHOTOGRAPHS



Driveway along Patriot Blvd with asphalt section replaced



Typical driveway on Admiral Court



Typical catch basin on Admiral Court



Broken concrete due to vehicle strikes

PHOTOGRAPHS



Typical porch and walkway on Admiral Court



Typical porch and walkway on Patriot Blvd




Typical porch and walkway on Valor Drive.



Porch and walkway on Valor Court.

PHOTOGRAPHS

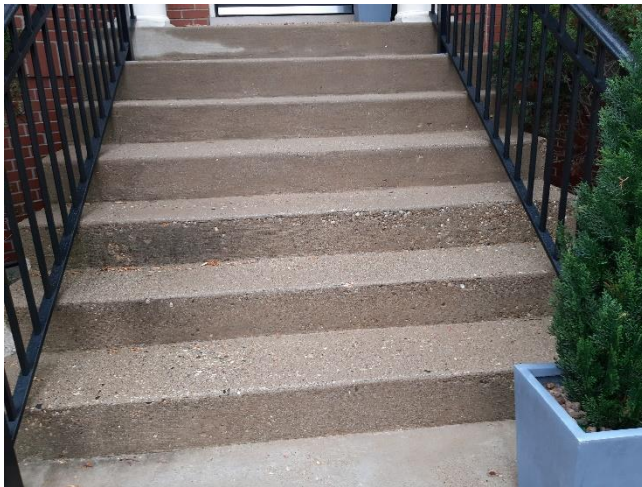

Porch stairs exhibiting cracks and spalled concrete



Typical sidewalk




Sidewalk heaved possibly due to freezing of underlying soil



Porch stoop with cracked slab

PHOTOGRAPHS

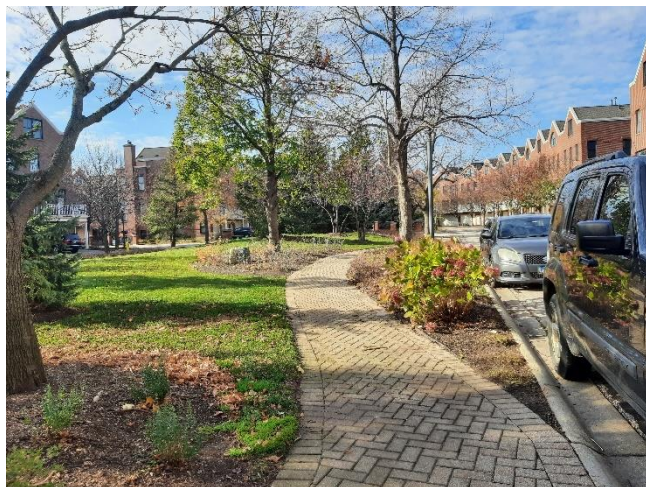


Brick paver unit walkway



Brick pavers at common area



Brick pavers with loose mortar joints

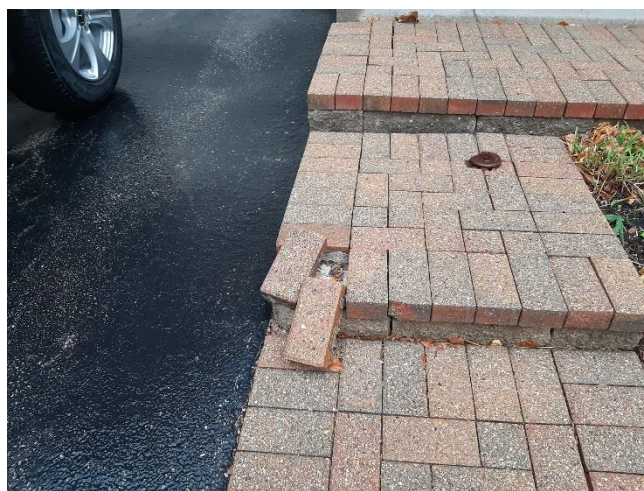


Brick paver walkway with loose pavers

PHOTOGRAPHS



Typical aluminum fence

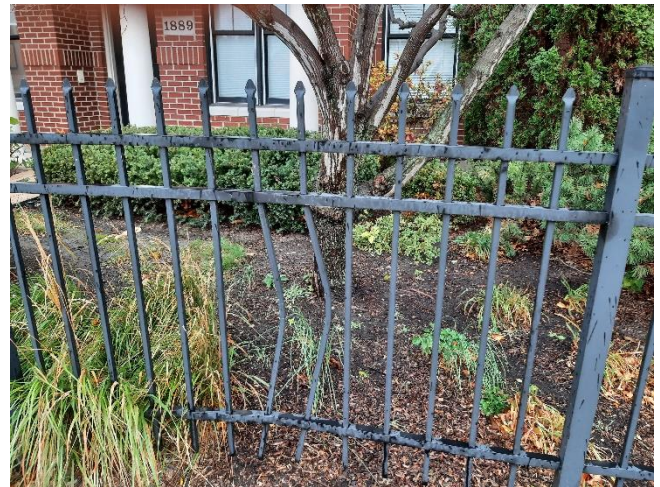

Damaged aluminum fence with faded oxidized paint




Masonry column with aluminum fence



Missing mortar at capstone of column

PHOTOGRAPHS

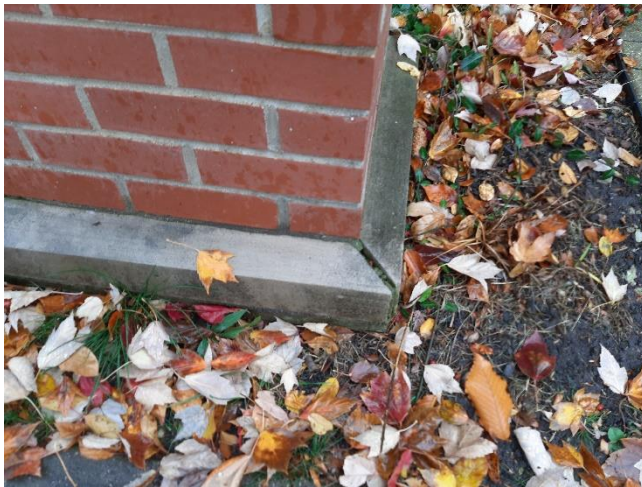

Missing mortar at base of column



Masonry column and view of back of the property identification signage



Light post and fixture



Bollard lighting

PHOTOGRAPHS



Building overview along Admiral Court



Building overview along Valor Drive



Overview of laminated architectural shingles on sloped roofs




Typical modified bitumen flat roofs.

PHOTOGRAPHS



Overview of gutters and downspouts atop sloped roofs

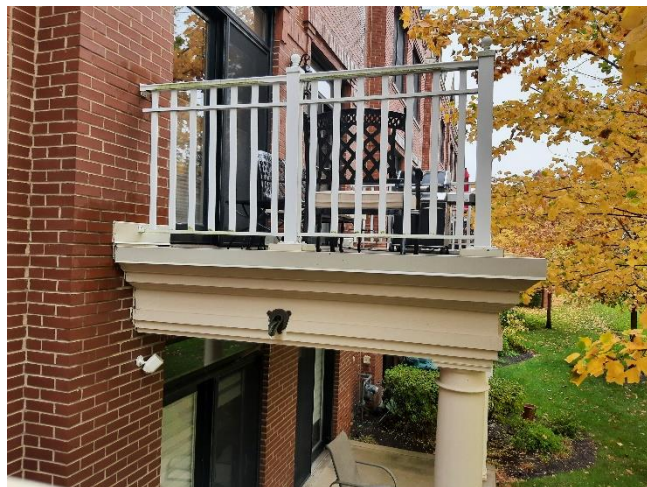

Overview of downspout on balcony system



Overview of masonry facade along Admiral Court



Façade exhibiting recent tuckpointing.

PHOTOGRAPHS



Missing mortar and sheer crack in masonry



Typical sealants around windows



Overview of balcony system



Missing wood soffit showing existing balcony drainage system

PHOTOGRAPHS



Balcony roof system replacement underway



Fiber cement siding on roof deck area

EXHIBIT 1

Element Summary
Tower Crossing Condominium Association
WEC Project No: 22C-292
Version # : 1.0

ELEMENT NAME	QUANTITY	UNITS	PRESENT DAY EXPENSE	UNIT COST	TOTAL EXPENSES (30 YEARS)	TYPICAL USEFUL LIFE	REMAINING USEFUL LIFE	GENERAL CONDITION
Asphalt Street Milling and Overlayment	86,000	Square Feet	\$320,780	\$3.73	\$402,094	15-20	7-8	Satisfactory
Asphalt Street Complete Replacement	86,000	Square Feet	\$391,300	\$4.55	\$810,705	15-20	24-25	Satisfactory
Asphalt Driveways	47,500	Square Feet	\$210,900	\$4.44	\$777,452	10-15	1-12	Varies
Catch Basin Repairs	31	Each	\$26,649	\$859.65	\$88,617	Up to 60	7-8	Satisfactory
Concrete Curb and Gutter	6,600	Linear Feet	\$334,686	\$50.71	\$307,489	Up to 60	Ongoing	Satisfactory
Concrete Walks	4,000	Square Feet	\$44,000	\$11.00	\$41,830	Up to 60	Ongoing	Satisfactory
Concrete Stoops (Stairs)	4,150	Square Feet	\$351,381	\$84.67	\$148,386	Up to 60	Ongoing	Satisfactory
Concrete Stoops (Slabs)	5,000	Square Feet	\$196,550	\$39.31	\$83,002	Up to 60	Ongoing	Satisfactory
Brick Pavers	20,700	Square Feet	\$436,977	\$21.11	\$669,918	15-25	10-13	Satisfactory
Aluminum Fencing	4,200	Linear Feet	\$286,356	\$68.18	\$414,399	25-30	12-13	Satisfactory
Brick Tuckpointing at Monuments and Columns	8,110	Square Feet	\$84,993	\$10.48	\$88,293	20-30	Ongoing	Satisfactory
Entrance Monument Signage	3	Each	\$15,000	\$5,000.00	\$20,159	15-25	10	Satisfactory
Post Lighting	16	Each	\$51,600	\$3,225.00	\$71,426	15-25	11	Satisfactory
Bollard Lighting	8	Each	\$6,000	\$750.00	\$20,104	10-20	6	Satisfactory
Laminated Architectural Asphalt Shingles	160,000	Square Feet	\$2,502,400	\$15.64	\$10,680,509	20-25	1-2	Poor
Flat Roofing	61,000	Square Feet	\$1,351,760	\$22.16	\$2,957,071	15-20	1-2	Poor
Gutters and Downspouts	900	Square Feet	\$11,997	\$13.33	\$63,747	20-30	4-8	Satisfactory
Brick Tuckpointing & Repairs	250,000	Square Feet	\$3,580,000	\$14.32	\$3,105,009	30-50+	Ongoing	Varies
Sealants	1	Allowance	\$875,000	\$875,000.00	\$2,739,779	8-12	6-10	Varies
Balcony Railings	154	Each	\$254,999	\$1,655.84	\$548,557	20-30	23-29	Satisfactory
Balcony Membranes & Decks	154	Each	\$1,850,000	\$12,012.99	\$6,021,620	15-25	1-23	Varies
Wood Replacements	1	Allowance	\$58,000	\$58,000.00	\$501,807	3-5	7	Varies
Fiber Cement Siding	6,200	Square Feet	\$139,996	\$22.58	\$64,607	20-30+	Ongoing	Varies
TOTALS			\$13,381,324		\$30,626,580			

Printed by WEC on Nov 18, 2022

EXHIBIT 2A

Element Replacement Schedule (Inflation Rate = 3.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	1	2	3	4	5
	2023	2024	2025	2026	2027
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement					
Asphalt Driveways	\$32,584				
Catch Basin Repairs					
Concrete Curb and Gutter	\$1,724	\$1,775	\$1,829		
Concrete Walks		\$4,668			
Concrete Stoops (Stairs)					
Concrete Stoops (Slabs)					
Brick Pavers	\$13,503				\$126,644
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$9,853
Entrance Monument Signage					
Post Lighting					
Bollard Lighting					
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts	\$6,178	\$6,364			
Brick Tuckpointing & Repairs	\$36,874		\$39,120		\$41,502
Sealants	\$9,013				
Balcony Railings					
Balcony Membranes & Decks	\$342,990	\$353,280	\$363,878	\$374,795	\$386,038
Wood Replacements					
Fiber Cement Siding	\$7,210				
ANNUAL TOTALS	\$450,075	\$366,087	\$404,826	\$374,795	\$564,037
PAGE 1 OF 6					

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2A

Element Replacement Schedule (Inflation Rate = 3.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	6	7	8	9	10
	2028	2029	2030	2031	2032
Asphalt Street Milling and Overlayment		\$142,027	\$260,067		
Asphalt Street Complete Replacement					
Asphalt Driveways			\$53,432		\$56,686
Catch Basin Repairs		\$11,799	\$21,605		
Concrete Curb and Gutter		\$37,046	\$67,835		\$2,249
Concrete Walks		\$5,411			
Concrete Stoops (Stairs)		\$21,608			
Concrete Stoops (Slabs)		\$12,087			
Brick Pavers	\$130,443	\$134,357	\$138,387		
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$11,422
Entrance Monument Signage					\$20,159
Post Lighting					
Bollard Lighting	\$7,164				
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts					
Brick Tuckpointing & Repairs		\$88,059		\$93,422	
Sealants	\$261,199	\$269,035	\$277,106	\$285,419	
Balcony Railings					
Balcony Membranes & Decks	\$220,900				
Wood Replacements		\$71,333			
Fiber Cement Siding	\$8,358				
ANNUAL TOTALS	\$628,064	\$792,761	\$818,433	\$378,841	\$90,516

PAGE 2 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2A

Element Replacement Schedule (Inflation Rate = 3.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	11	12	13	14	15
	2033	2034	2035	2036	2037
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement					
Asphalt Driveways		\$60,139		\$63,801	
Catch Basin Repairs					
Concrete Curb and Gutter		\$2,386		\$2,531	
Concrete Walks		\$6,273			
Concrete Stoops (Stairs)		\$25,049			
Concrete Stoops (Slabs)		\$14,012			
Brick Pavers					
Aluminum Fencing		\$204,138	\$210,262		
Brick Tuckpointing at Monuments and Columns					\$13,242
Entrance Monument Signage					
Post Lighting	\$71,426				
Bollard Lighting					
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts					
Brick Tuckpointing & Repairs	\$99,111		\$105,147		\$111,550
Sealants				\$13,235	
Balcony Railings					
Balcony Membranes & Decks					
Wood Replacements		\$82,694			
Fiber Cement Siding	\$9,689				
ANNUAL TOTALS	\$180,227	\$394,690	\$315,409	\$79,567	\$124,792
PAGE 3 OF 6					

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2A

Element Replacement Schedule (Inflation Rate = 3.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	16	17	18	19	20
	2038	2039	2040	2041	2042
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement					
Asphalt Driveways	\$67,687				
Catch Basin Repairs					
Concrete Curb and Gutter	\$2,685				
Concrete Walks		\$7,273			
Concrete Stoops (Stairs)		\$29,039			
Concrete Stoops (Slabs)		\$16,243			
Brick Pavers	\$21,037			\$22,987	
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$15,351
Entrance Monument Signage					
Post Lighting					
Bollard Lighting					
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts					
Brick Tuckpointing & Repairs		\$295,860		\$313,878	
Sealants				\$383,579	\$395,087
Balcony Railings					
Balcony Membranes & Decks					
Wood Replacements		\$95,865			
Fiber Cement Siding	\$11,233				
ANNUAL TOTALS	\$102,641	\$444,280		\$720,444	\$410,437

PAGE 4 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2A

Element Replacement Schedule (Inflation Rate = 3.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	21	22	23	24	25
	2043	2044	2045	2046	2047
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement				\$286,356	\$524,349
Asphalt Driveways	\$78,467		\$83,246		\$88,316
Catch Basin Repairs				\$19,502	\$35,710
Concrete Curb and Gutter	\$3,113		\$3,303	\$61,231	\$112,121
Concrete Walks		\$8,431			
Concrete Stoops (Stairs)		\$33,664			
Concrete Stoops (Slabs)		\$18,831			
Brick Pavers		\$25,119			\$27,448
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$17,796
Entrance Monument Signage					
Post Lighting					
Bollard Lighting					
Laminated Architectural Asphalt Shingles		\$2,397,429	\$2,469,351		
Flat Roofing		\$1,295,056	\$1,333,908		
Gutters and Downspouts		\$11,494	\$11,839		
Brick Tuckpointing & Repairs	\$332,993		\$353,272		\$374,786
Sealants	\$406,939	\$419,148			
Balcony Railings	\$16,935	\$52,330	\$53,899	\$55,516	\$57,182
Balcony Membranes & Decks	\$122,863	\$379,647	\$391,037	\$402,768	\$414,851
Wood Replacements		\$111,134			
Fiber Cement Siding	\$13,022				
ANNUAL TOTALS	\$974,332	\$4,752,281	\$4,699,854	\$825,373	\$1,652,559

PAGE 5 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2A

Element Replacement Schedule (Inflation Rate = 3.0%)
Tower Crossing Condominium Association
WEC Project No: 22C-292
Version #: 1.0

ELEMENT NAME	26	27	28	29	30	TOTAL
	2048	2049	2050	2051	2052	EXPENSES
Asphalt Street Milling and Overlayment						\$402,094
Asphalt Street Complete Replacement						\$810,705
Asphalt Driveways		\$93,694		\$99,400		\$777,452
Catch Basin Repairs						\$88,617
Concrete Curb and Gutter		\$3,717		\$3,944		\$307,489
Concrete Walks		\$9,774				\$41,830
Concrete Stoops (Stairs)		\$39,026				\$148,386
Concrete Stoops (Slabs)		\$21,830				\$83,002
Brick Pavers			\$29,993			\$669,918
Aluminum Fencing						\$414,399
Brick Tuckpointing at Monuments and Columns					\$20,630	\$88,293
Entrance Monument Signage						\$20,159
Post Lighting						\$71,426
Bollard Lighting	\$12,940					\$20,104
Laminated Architectural Asphalt Shingles		\$1,389,638	\$1,431,328	\$1,474,267	\$1,518,495	\$10,680,509
Flat Roofing					\$328,108	\$2,957,071
Gutters and Downspouts		\$6,662	\$6,862	\$7,068	\$7,280	\$63,747
Brick Tuckpointing & Repairs		\$397,611		\$421,825		\$3,105,009
Sealants			\$20,019			\$2,739,779
Balcony Railings	\$58,897	\$60,664	\$62,484	\$64,359	\$66,290	\$548,557
Balcony Membranes & Decks	\$427,296	\$440,115	\$453,319	\$466,918	\$480,926	\$6,021,620
Wood Replacements					\$140,781	\$501,807
Fiber Cement Siding	\$15,096					\$64,607
ANNUAL TOTALS	\$514,229	\$2,462,731	\$2,004,005	\$2,537,781	\$2,562,510	\$30,626,580
PAGE 6 OF 6						

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 3A

Recommended Funding Plan

Interest Rate - 1.00% Inflation Rate - 3.00%

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version # : 1.0

STUDY YEAR	FISCAL YEAR	RECOMMENDED CONTRIBUTION	PERCENTAGE OF INCREASE	PROJECTED EXPENSES	INTEREST RECEIVED	RESERVE FUND ENDING BALANCE
0	2022	\$689,915				\$950,000
1	2023	\$710,612	3.00%	\$450,075	\$10,803	\$1,221,340
2	2024	\$731,931	3.00%	\$366,087	\$14,043	\$1,601,227
3	2025	\$753,889	3.00%	\$404,826	\$17,758	\$1,968,046
4	2026	\$776,505	3.00%	\$374,795	\$21,689	\$2,391,446
5	2027	\$799,801	3.00%	\$564,037	\$25,093	\$2,652,303
6	2028	\$823,795	3.00%	\$628,064	\$27,502	\$2,875,535
7	2029	\$848,508	3.00%	\$792,761	\$29,034	\$2,960,316
8	2030	\$873,964	3.00%	\$818,433	\$29,881	\$3,045,728
9	2031	\$900,183	3.00%	\$378,841	\$33,064	\$3,600,134
10	2032	\$927,188	3.00%	\$90,516	\$40,185	\$4,476,990
11	2033	\$955,004	3.00%	\$180,227	\$48,644	\$5,300,410
12	2034	\$983,654	3.00%	\$394,690	\$55,949	\$5,945,323
13	2035	\$1,013,163	3.00%	\$315,409	\$62,942	\$6,706,019
14	2036	\$1,043,558	3.00%	\$79,567	\$71,880	\$7,741,890
15	2037	\$1,074,865	3.00%	\$124,792	\$82,169	\$8,774,133
16	2038	\$1,107,111	3.00%	\$102,641	\$92,764	\$9,871,366
17	2039	\$1,140,324	3.00%	\$444,280	\$102,194	\$10,669,605
18	2040	\$1,174,534	3.00%		\$112,569	\$11,956,708
19	2041	\$1,209,770	3.00%	\$720,444	\$122,014	\$12,568,047
20	2042	\$1,246,063	3.00%	\$410,437	\$129,859	\$13,533,532
21	2043	\$1,283,445	3.00%	\$974,332	\$136,881	\$13,979,525
22	2044	\$1,321,948	3.00%	\$4,752,281	\$122,644	\$10,671,836
23	2045	\$1,361,607	3.00%	\$4,699,854	\$90,027	\$7,423,616
24	2046	\$1,402,455	3.00%	\$825,373	\$77,122	\$8,077,819
25	2047	\$1,444,529	3.00%	\$1,652,559	\$79,738	\$7,949,528
26	2048	\$1,487,865	3.00%	\$514,229	\$84,363	\$9,007,527
27	2049	\$1,532,501	3.00%	\$2,462,731	\$85,424	\$8,162,720
28	2050	\$1,578,476	3.00%	\$2,004,005	\$79,500	\$7,816,690
29	2051	\$1,625,830	3.00%	\$2,537,781	\$73,607	\$6,978,346
30	2052	\$1,674,605	3.00%	\$2,562,510	\$65,344	\$6,155,785
	Totals	\$34,497,598		\$30,626,580	\$2,024,683	

Order: 002W2RQG
Address: 2048 Valero St
Order Date: 07-01-2022
Printed by WEC on Nov 18, 2022
HomeWiseDocs

EXHIBIT 2B

Element Replacement Schedule (Inflation Rate = 5.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	1	2	3	4	5
	2023	2024	2025	2026	2027
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement					
Asphalt Driveways	\$33,217				
Catch Basin Repairs					
Concrete Curb and Gutter	\$1,757	\$1,845	\$1,937		
Concrete Walks		\$4,851			
Concrete Stoops (Stairs)					
Concrete Stoops (Slabs)					
Brick Pavers	\$13,765				\$139,426
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$10,847
Entrance Monument Signage					
Post Lighting					
Bollard Lighting					
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts	\$6,298	\$6,613			
Brick Tuckpointing & Repairs	\$37,590		\$41,443		\$45,691
Sealants	\$9,188				
Balcony Railings					
Balcony Membranes & Decks	\$349,650	\$367,133	\$385,489	\$404,764	\$425,002
Wood Replacements					
Fiber Cement Siding	\$7,350				
ANNUAL TOTALS	\$458,814	\$380,442	\$428,869	\$404,764	\$620,967
PAGE 1 OF 6					

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2B

Element Replacement Schedule (Inflation Rate = 5.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	6	7	8	9	10
	2028	2029	2030	2031	2032
Asphalt Street Milling and Overlayment		\$162,493	\$303,320		
Asphalt Street Complete Replacement					
Asphalt Driveways			\$62,319		\$68,707
Catch Basin Repairs		\$13,499	\$25,199		
Concrete Curb and Gutter		\$42,384	\$79,117		\$2,726
Concrete Walks		\$6,191			
Concrete Stoops (Stairs)		\$24,721			
Concrete Stoops (Slabs)		\$13,828			
Brick Pavers	\$146,398	\$153,718	\$161,404		
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$13,844
Entrance Monument Signage					\$24,433
Post Lighting					
Bollard Lighting	\$8,041				
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts					
Brick Tuckpointing & Repairs		\$100,748		\$111,075	
Sealants	\$293,146	\$307,803	\$323,193	\$339,353	
Balcony Railings					
Balcony Membranes & Decks	\$247,918				
Wood Replacements		\$81,612			
Fiber Cement Siding	\$9,380				
ANNUAL TOTALS	\$704,882	\$906,999	\$954,552	\$450,428	\$109,710

PAGE 2 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2B

Element Replacement Schedule (Inflation Rate = 5.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	11	12	13	14	15
	2033	2034	2035	2036	2037
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement					
Asphalt Driveways		\$75,749		\$83,514	
Catch Basin Repairs					
Concrete Curb and Gutter		\$3,005		\$3,313	
Concrete Walks		\$7,902			
Concrete Stoops (Stairs)		\$31,551			
Concrete Stoops (Slabs)		\$17,649			
Brick Pavers					
Aluminum Fencing		\$257,127	\$269,983		
Brick Tuckpointing at Monuments and Columns					\$17,669
Entrance Monument Signage					
Post Lighting	\$88,254				
Bollard Lighting					
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts					
Brick Tuckpointing & Repairs	\$122,460		\$135,012		\$148,851
Sealants				\$17,324	
Balcony Railings					
Balcony Membranes & Decks					
Wood Replacements		\$104,160			
Fiber Cement Siding	\$11,972				
ANNUAL TOTALS	\$222,686	\$497,143	\$404,996	\$104,151	\$166,521

PAGE 3 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2B

Element Replacement Schedule (Inflation Rate = 5.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	16	17	18	19	20
	2038	2039	2040	2041	2042
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement					
Asphalt Driveways	\$92,074				
Catch Basin Repairs					
Concrete Curb and Gutter	\$3,653				
Concrete Walks		\$10,085			
Concrete Stoops (Stairs)		\$40,269			
Concrete Stoops (Slabs)		\$22,525			
Brick Pavers	\$28,616			\$33,127	
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$22,551
Entrance Monument Signage					
Post Lighting					
Bollard Lighting					
Laminated Architectural Asphalt Shingles					
Flat Roofing					
Gutters and Downspouts					
Brick Tuckpointing & Repairs		\$410,271		\$452,324	
Sealants				\$552,770	\$580,409
Balcony Railings					
Balcony Membranes & Decks					
Wood Replacements		\$132,937			
Fiber Cement Siding	\$15,280				
ANNUAL TOTALS	\$139,622	\$616,087		\$1,038,221	\$602,960

PAGE 4 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2B

Element Replacement Schedule (Inflation Rate = 5.0%)

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version #: 1.0

ELEMENT NAME	21	22	23	24	25
	2043	2044	2045	2046	2047
Asphalt Street Milling and Overlayment					
Asphalt Street Complete Replacement				\$454,313	\$848,052
Asphalt Driveways	\$117,512		\$129,557		\$142,836
Catch Basin Repairs				\$30,941	\$57,756
Concrete Curb and Gutter	\$4,662		\$5,140	\$97,146	\$181,338
Concrete Walks		\$12,871			
Concrete Stoops (Stairs)		\$51,394			
Concrete Stoops (Slabs)		\$28,748			
Brick Pavers		\$38,348			\$44,393
Aluminum Fencing					
Brick Tuckpointing at Monuments and Columns					\$28,782
Entrance Monument Signage					
Post Lighting					
Bollard Lighting					
Laminated Architectural Asphalt Shingles		\$3,660,086	\$3,843,091		
Flat Roofing		\$1,977,125	\$2,075,981		
Gutters and Downspouts		\$17,547	\$18,425		
Brick Tuckpointing & Repairs	\$498,687		\$549,803		\$606,158
Sealants	\$609,429	\$639,901			
Balcony Railings	\$25,362	\$79,890	\$83,885	\$88,079	\$92,483
Balcony Membranes & Decks	\$183,999	\$579,597	\$608,577	\$639,005	\$670,956
Wood Replacements		\$169,665			
Fiber Cement Siding	\$19,501				
ANNUAL TOTALS	\$1,459,153	\$7,255,173	\$7,314,457	\$1,309,484	\$2,672,753

PAGE 5 OF 6

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 2B

Element Replacement Schedule (Inflation Rate = 5.0%)
Tower Crossing Condominium Association
WEC Project No: 22C-292
Version #: 1.0

ELEMENT NAME	26	27	28	29	30	TOTAL
	2048	2049	2050	2051	2052	EXPENSES
Asphalt Street Milling and Overlayment						\$465,814
Asphalt Street Complete Replacement						\$1,302,365
Asphalt Driveways		\$157,477		\$173,619		\$1,136,580
Catch Basin Repairs						\$127,394
Concrete Curb and Gutter		\$6,248		\$6,888		\$441,160
Concrete Walks		\$16,427				\$58,327
Concrete Stoops (Stairs)		\$65,593				\$213,529
Concrete Stoops (Slabs)		\$36,691				\$119,440
Brick Pavers			\$51,390			\$810,584
Aluminum Fencing						\$527,111
Brick Tuckpointing at Monuments and Columns					\$36,733	\$130,427
Entrance Monument Signage						\$24,433
Post Lighting						\$88,254
Bollard Lighting	\$21,334					\$29,375
Laminated Architectural Asphalt Shingles		\$2,335,650	\$2,452,433	\$2,575,054	\$2,703,807	\$17,570,121
Flat Roofing					\$584,223	\$4,637,330
Gutters and Downspouts		\$11,198	\$11,757	\$12,345	\$12,963	\$97,146
Brick Tuckpointing & Repairs		\$668,289		\$736,788		\$4,665,191
Sealants			\$34,301			\$3,706,818
Balcony Railings	\$97,107	\$101,962	\$107,060	\$112,413	\$118,034	\$906,276
Balcony Membranes & Decks	\$704,503	\$739,729	\$776,715	\$815,551	\$856,328	\$8,754,914
Wood Replacements					\$250,673	\$739,046
Fiber Cement Siding	\$24,889					\$88,372
ANNUAL TOTALS	\$847,833	\$4,139,263	\$3,433,657	\$4,432,659	\$4,562,761	\$46,640,007
PAGE 6 OF 6						

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs

EXHIBIT 3B

Recommended Funding Plan

Interest Rate - 1.00% Inflation Rate - 5.00%

Tower Crossing Condominium Association

WEC Project No: 22C-292

Version # : 1.0

STUDY YEAR	FISCAL YEAR	RECOMMENDED CONTRIBUTION	PERCENTAGE OF INCREASE	PROJECTED EXPENSES	INTEREST RECEIVED	RESERVE FUND ENDING BALANCE
0	2022	\$689,915				\$950,000
1	2023	\$724,411	5.00%	\$458,814	\$10,828	\$1,226,424
2	2024	\$760,631	5.00%	\$380,442	\$14,165	\$1,620,779
3	2025	\$798,663	5.00%	\$428,869	\$18,057	\$2,008,629
4	2026	\$838,596	5.00%	\$404,764	\$22,255	\$2,464,717
5	2027	\$880,526	5.00%	\$620,967	\$25,945	\$2,750,221
6	2028	\$924,552	5.00%	\$704,882	\$28,601	\$2,998,491
7	2029	\$970,780	5.00%	\$906,999	\$30,304	\$3,092,576
8	2030	\$1,019,319	5.00%	\$954,552	\$31,250	\$3,188,592
9	2031	\$1,070,285	5.00%	\$450,428	\$34,985	\$3,843,434
10	2032	\$1,123,799	5.00%	\$109,710	\$43,505	\$4,901,027
11	2033	\$1,179,989	5.00%	\$222,686	\$53,797	\$5,912,126
12	2034	\$1,238,988	5.00%	\$497,143	\$62,830	\$6,716,802
13	2035	\$1,300,938	5.00%	\$404,996	\$71,648	\$7,684,391
14	2036	\$1,365,985	5.00%	\$104,151	\$83,153	\$9,029,378
15	2037	\$1,434,284	5.00%	\$166,521	\$96,633	\$10,393,773
16	2038	\$1,505,998	5.00%	\$139,622	\$110,770	\$11,870,919
17	2039	\$1,581,298	5.00%	\$616,087	\$123,535	\$12,959,665
18	2040	\$1,660,363	5.00%		\$137,898	\$14,757,926
19	2041	\$1,743,381	5.00%	\$1,038,221	\$151,105	\$15,614,191
20	2042	\$1,830,550	5.00%	\$602,960	\$162,280	\$17,004,061
21	2043	\$1,922,077	5.00%	\$1,459,153	\$172,355	\$17,639,341
22	2044	\$2,018,181	5.00%	\$7,255,173	\$150,208	\$12,552,558
23	2045	\$2,119,090	5.00%	\$7,314,457	\$99,549	\$7,456,740
24	2046	\$2,225,045	5.00%	\$1,309,484	\$79,145	\$8,451,446
25	2047	\$2,336,297	5.00%	\$2,672,753	\$82,832	\$8,197,823
26	2048	\$2,453,112	5.00%	\$847,833	\$90,005	\$9,893,106
27	2049	\$2,575,768	5.00%	\$4,139,263	\$91,114	\$8,420,724
28	2050	\$2,704,556	5.00%	\$3,433,657	\$80,562	\$7,772,184
29	2051	\$2,839,784	5.00%	\$4,432,659	\$69,757	\$6,249,067
30	2052	\$2,981,773	5.00%	\$4,562,761	\$54,586	\$4,722,664
	Totals	\$48,818,930		\$46,640,007	\$2,283,656	

Order: 002W2RQGS

Address: 2048 Valero St

Order Date: 07-01-2022


Document Not for Sale

Printed by WEC on Nov 18, 2022

HomeWiseDocs

EXHIBIT 4

Fund Balance Comparison
Tower Crossing Condominium Association
WEC Project No: 22C-292
Version # : 1.0

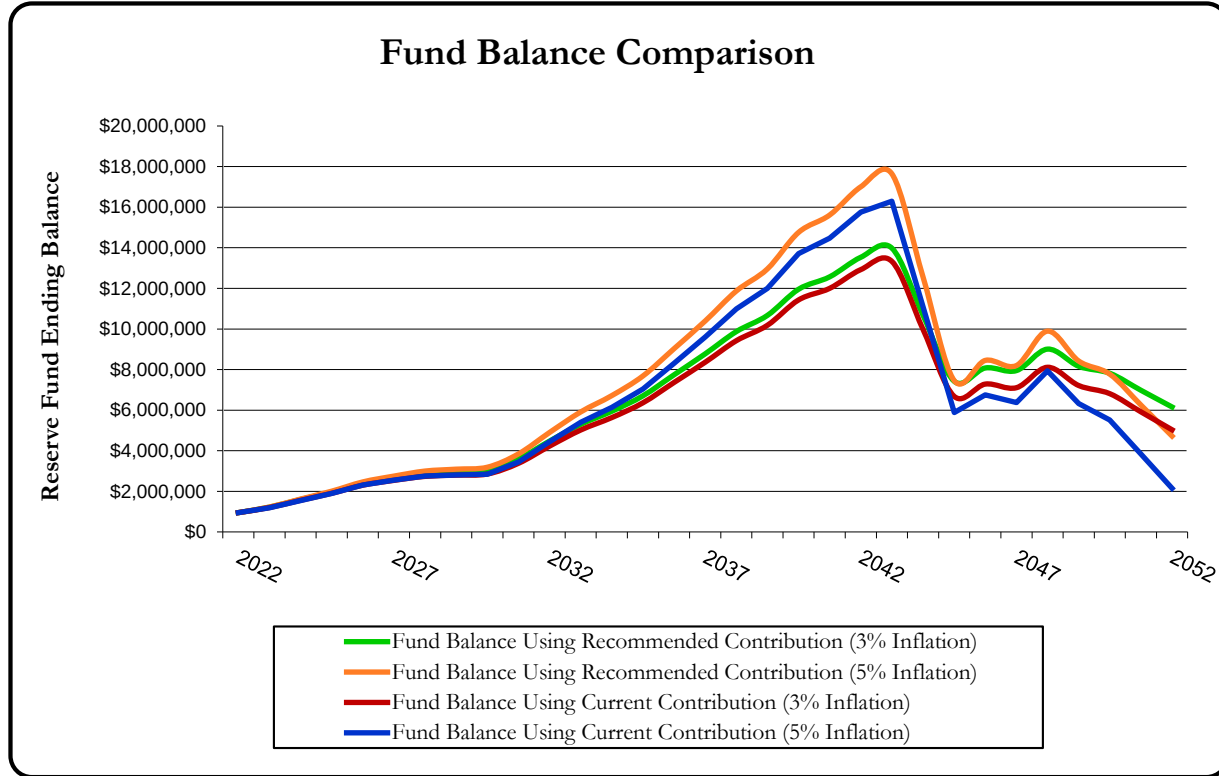

Note: Fund balance using current contribution is calculated using annual funding increases equal to the inflation rates of 3% and 5%.

Printed by WEC on Nov 18, 2022

Order: QS2W2RQGL
Address: 2048 Valor Ct
Order Date: 07-01-2024
Document not for resale
HomeWiseDocs