



SOCOTEC

**STRUCTURAL INTEGRITY RESERVE STUDY
REPORT**

High Point Place Condominium Association, Inc.
2100 West First Street
Fort Myers, FL 33901

SOCOTEC Project Number 3113-013.01

April 2023



April 4, 2023

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.

C/O FirstService Residential
Attn: James Cox, CAM
2104 West First Street
Fort Myers, Florida 33901
Telephone: 786.539.9907
Email: james.cox@fsresidential.com

Subject: Report of Engineering Consulting Services
STRUCTURAL INTEGRITY RESERVE STUDY
High Point Place Condominium
2100 West First Street
Fort Myers, Lee County, Florida 33901
SOCOTEC Project Number 3113-013.01

Socotec Consulting, Inc. (SOCOTEC) is pleased to present this Structural Integrity Reserve Study (SIRS) completed for the subject structures located at 2100 West First Street in Fort Myers, Lee County, Florida. Our services were completed in general accordance with our proposal dated August 23, 2022, and authorized by the Association on August 25, 2022.

This study is presented to help you comply with the requirements of the recently amended Florida Statute 718. The amendment to Statute 718 requires all condominium buildings that are three-stories or greater in height to have fully funded straight-line Structural Integrity Reserves by December 31, 2024, regardless of the age of the structure.

This SIRS identifies the common areas that were visually inspected by a licensed engineer and presents the typical useful life, estimated remaining useful life and the estimated replacement cost or deferred maintenance expense of the common area components. It also provides a recommend annual reserve amount that achieves the estimated replacement cost or deferred maintenance expense for each common area component by the end of the estimated remaining useful life of each component. The components mandated by the recent amendment that are to be visually inspected by a licensed engineer (or architect) are as follows:

- Roof(s)
- Load bearing walls/primary structural members
- Floors
- Foundations
- Fireproofing and fire protection systems
- Plumbing
- Electrical systems
- Waterproofing and exterior painting
- Windows
- Other building component elements >\$10,000 that negatively affect the above elements

SOCOTEC has endeavored to conduct the services identified herein in a manner consistent with that level of care and skill ordinarily exercised by members of the same profession currently practicing in the same locality and under similar conditions as this project. No other representation, express or implied, is included or intended in this document. We used routine and repeatable visual and engineering methodologies to evaluate the structural condition of the subject building to form our professional engineering opinions. This report identifies each component observed, the estimated useful life, remaining life, and opinion of the current cost to replace/refurbish these items.

Our opinions of the replacement or deferred maintenance costs for each line item are based on our experience with similar projects, known construction industry averages, historical cost data, or simple verbal estimates obtained from suppliers of different components. Opinions of cost information are inclusive of labor, material, appropriate overhead, general conditions, and profit. The costs presented are opinions, actual costs may vary significantly based the cost of materials, the labor market, and geographical demands for construction services at the time of actual contracting of the work. This report is classified as a SIRS as outlined in the State of Florida Statute 718.112.

This report contains our opinion of the conditions observed at the time our site inspections. The actual useful life of the components may or may not be as long as estimated due to a variety of controllable and uncontrollable factors, such as weather, maintenance schedule, physical abuse, or abnormal wear. If such case occurs, SOCOTEC should be contacted to provide additional review and revision of this study, if appropriate.

This SIRS is intended to provide guidance for the Association to plan their set aside reserves for the listed components. This report should not be used for performing an audit, forensic analyses, or background checks of historical records.

SOCOTEC personnel completed on-site inspections of the subject property on September 15, 2022 to evaluate the in-place condition of common area components as identified herein. Information provided by the official representative of the Association regarding financial, physical,



quantity, or historical issues will be deemed reliable by SOCOTEC for this study and is assumed to be complete and correct.

Sincerely,

SOCOTEC CONSULTING, INC.

Nicholas Massaro, P.E.
Project Engineer
Florida Registration No. 94693

Thomas E. Conrecode

Thomas E. Conrecode, P.E.
Principal Engineer
Florida Registration No. 46571



TABLE OF CONTENTS

PROJECT INFORMATION	1
FUNDING ANALYSIS	2
SUMMARY	3
BUILDING COMPONENTS	5
Roofing.....	5
Load-Bearing Walls or Other Primary Structural Members	5
Floors/Deck Assemblies	5
Foundations	6
Fireproofing and Fire Protection Systems	6
Plumbing Systems	7
Electrical Systems.....	7
Waterproofing and Exterior Painting.....	8
Windows	9

APPENDICIES

Appendix A: Site Vicinity Map

Appendix B: Site Aerial

Appendix C: Site Photographs

Appendix D: Straight-Line Present Funding Method Reserve Data Sheet



PROJECT INFORMATION

High Point Place is located north of W. First Street in Fort Myers, Lee County, Florida. In general, the subject Association consists of two 32-story high-rise structures and two 3-story structures with a total of 273 residential units, which includes

- Roofs
- Primary structural members
- Floor/deck assemblies
- Foundations
- Fireproofing and fire protection systems
- Plumbing systems
- Electrical systems
- Waterproofing and exterior painting
- Windows
- Enclosed lanais
- Other appurtenant components.

The buildings were constructed in two phases. Phase 1 was completed circa 2006, and Phase 2 was completed circa 2007. Towers 1 and 2 are conventionally built and supported on a deep auger cast pile foundation with cast-in-place concrete columns/beams, post-tension cable and conventionally reinforced decks, and stucco-covered in-fill masonry block exterior walls. Buildings 1 and 2 are assumed to be cast-in-place concrete frame structures supported on a foundation system. The condominium roofs consist primarily of low slope modified bitumen membrane and sloped clay barrel roof tile areas. The porte-cochere and parking garage ingress/egress areas are also topped with sloped clay barrel roof tiles.

A licensed professional engineer led team completed physical site observations of the subject property on September 15, 2022. Our services did not include uncovering building materials or performing invasive testing for the purposes of verifying in-place or constructed work.

Appendix A illustrates the subject site location with respect to the local vicinity, whereas Appendix B shows an aerial photograph of the subject site. Limited photographs collected during the time of our site visit are represented in Appendix C. Appendix D includes the Straight-Line Funding Analysis reserve data sheets produced to determine the recommended annual reserve allocation and projected reserve budget for the subject property.



FUNDING ANALYSIS

The **Straight-Line Present Funding Analysis** calculates the annual contribution amount for each individual line-item component by dividing the component's unfunded balance by its remaining useful life. A component's unfunded balance is its current replacement/deferred maintenance cost less the reserve balance in the component at the beginning of the analysis period. The annual contribution rate for each individual line-item component is then summed to calculate the total annual contribution rate for this analysis. This method does not take inflation or interest into consideration when calculating the annual contribution amount.

The Association's estimated SIRS fund balance for the end of the current fiscal period is based on information provided to us. The actual or projected total reserve balance presented was not audited. The reserve data spreadsheet completed for the Association depicting the SIRS results are located within Appendix "D" (Straight-Line Analysis) at the end of this report.



SUMMARY

SITE DATA

Property Name: High Point Place
Property Address: 2100 West First Street
Fort Myers, FL 33901
Total Structure(s)/Units: Two 32-story structures and two 3-story structures/273 residential units
Year of Site Development: Circa 2006 and 2007
Budget Year Start: January 1, 2024
Budget Year End: December 31, 2024

ANALYSIS

Tower 1

Total number of elements scheduled for SIRS funding 27

Recommended Straight-Line Present Funding Contributions for 2024 \$301,426

(Required for Structural Integrity Reserves to be 100% funded.)

Therefore, we recommend the Association utilize an annual Structural Integrity Reserve Assessment of \$301,426 in order to fully fund the required Structural Integrity Reserve Study components based on the Straight-Line funding method and an initial funding of \$2,194,533 to the SIRS from your current capital reserves.

Tower 2

Total number of elements scheduled for SIRS funding 28

Recommended Straight-Line Present Funding Contributions for 2024 \$334,029

(Required for Structural Integrity Reserves to be 100% funded.)

Therefore, we recommend the Association utilize an annual Structural Integrity Reserve Assessment of \$334,029 in order to fully fund the required Structural Integrity Reserve Study components based on the Straight-Line funding method and an initial funding of \$1,815,859 to the SIRS from your current capital reserves.

Building 1

Total number of elements scheduled for SIRS funding 13



Recommended Straight-Line Present Funding Contributions for 2024 **\$20,485**

(Required for Structural Integrity Reserves to be 100% funded.)

Therefore, we recommend the Association utilize an annual Structural Integrity Reserve Assessment of \$20,485 in order to fully fund the required Structural Integrity Reserve Study components based on the Straight-Line funding method and an initial funding of \$85,240 to the SIRS from your current capital reserves.

Building 2

Total number of elements scheduled for SIRS funding 13

Recommended Straight-Line Present Funding Contributions for 2024 **\$16,692**

(Required for Structural Integrity Reserves to be 100% funded.)

Therefore, we recommend the Association utilize an annual Structural Integrity Reserve Assessment of \$16,692 in order to fully fund the required Structural Integrity Reserve Study components based on the Straight-Line funding method and an initial funding of \$66,275 to the SIRS from your current capital reserves.



BUILDING COMPONENTS

The building component categories included in this study are summarized and described below. We have included only those common area components required under Florida Statute 718 guidelines for Structural Integrity Reserve Studies. The age of each of the statutorily required components, their remaining useful life, and other specifics are listed on the Straight-Line Analysis in Appendix D at the end of this report. The typical service life provided in Appendix D is based on routine maintenance being conducted to the component throughout its service life.

Roofing

Modified Bitumen - Several areas of the condominium roofs at the High Point Place Association are covered with a modified bitumen membrane and granular cap sheet. This type of roof system typically has a useful life of 20 to 25 years under normal operating conditions and periodic maintenance. The modified bitumen systems on the main roofs of the condominium towers and buildings appear to be in fair to good condition for their age with several areas of discoloration observed at the time of our site visit. In total, the modified bitumen roof system covers Tower 1, Tower 2, Building 1, and Building 2 with approximately 7,500, 11,250, 990, and 885 square feet of total roof area, respectively. We recommend these modified bitumen membranes be scheduled for replacement circa 2039 based on a typical 20-year useful life.

Clay Tiles – The condominium towers, buildings, mechanical buildings, porte-cocheres, and parking garage entrances located at High Point Place are primarily covered with sloped clay barrel-shaped roof tiles. Typically, these tiles are mechanically fastened to an underlying waterproofing membrane over decking and have a typical useful life of 25 years before requiring replacement. We understand the tiles were replaced circa 2019. Overall, these tiles cover approximately 54,460 square feet of roof and were observed to be in good condition. Therefore, we recommend the Association schedule to replace these clay tiles circa 2044.

Load-Bearing Walls or Other Primary Structural Members

Concrete Frame - The load bearing structural members include cast-in-place concrete elements with post-tension cable and conventionally reinforced decks. Exterior walls consist of stucco covered concrete and masonry walls. These types of primary structural members typically have a useful life of 100 or more years when properly maintained/repared. However, during the life of this type of structure it is common for periodic maintenance to be required to correct localized deterioration. No signs of significant damage or deterioration were observed during our site visit. We have included a reserve item for completing required periodic maintenance to the cast-in-place concrete structural elements.

Floors/Deck Assemblies

Concrete Floor Slabs/Decks – The concrete floor slabs/decks consist of post-tension cable and conventionally reinforced concrete slabs supported by concrete beams and columns. This type of concrete floor slab/deck typically has a useful life of 100 or more years when properly maintained/repared. During the life of this type of slab/deck it is common for periodic



maintenance to be required to correct localized deterioration at the exposed edges/sections of the slabs/decks. No evidence of slab/deck deterioration or damage was observed during our inspection. However, evidence of surface cracking of the parking garage was observed during our site visit. We have included a reserve item for completing required periodic maintenance to the exterior portions of the slabs/decks that are exposed to the natural elements.

Foundations

Deep Foundation System – Plans available for review indicate that Towers 1 and 2 are supported on a deep foundation system. It is assumed that Buildings 1 and 2 are supported on a shallow foundation system. No signs of excessive settlement or displacement were observed during our site visit. Deep foundation elements typically are concealed by the ground surface and do not require replacement or repair due to deferred maintenance during their useful life. Only those portions of foundations that are exposed to the elements may require partial replacement and/or repairs during their useful life.

Fireproofing and Fire Protection Systems

Fireproofing - Fireproofing in this building is accomplished by fire-rated assemblies constructed/installed during original construction of the structure as well as fire-sealing around penetrations through all fire-rated assemblies (i.e. walls, floors, and roof). During the life of a building, alterations typically require penetrations through or modifications to fire-rated assemblies. Penetrations or modifications to fire assemblies/sealants should be properly repaired/replaced during these types of projects. Most if not all local municipalities require multi-family residential structures to be inspected by the local fire department having jurisdiction over them periodically and specifically for all permitted modifications to the structure. It is not common for buildings to require top-to-bottom replacement of fire assemblies and sealants during their life cycle. All replacement, repairs, and deferred maintenance to the fireproofing, not associated with a permitted modification to the structure, should be completed on a yearly basis as required by the local Fire Marshall following their inspection of the building. Therefore, we have not included any reserves for fireproofing.

Audio Visual Fire Alarms and Fire Safety System Controls - The fire safety control systems for Tower 1 and Tower 2 are located in mechanical closets located on the second level of each tower near the main lobby entrances. The fire safety control systems for Building 1 and Building 2 are located in mechanical closets located on the ground floor of each building. Numerous audio and visual alarms are located throughout the subject site. These control systems have a typical useful life of 25-years before requiring an updated system. Therefore, we recommend the fire alarm system and audio/visual alarms be scheduled for an update circa 2031. These items were observed to be in good operable condition at the time of our site visit.

Emergency Fire Pumps, and Controls - The emergency fire pumps systems and their respective control panels are located in a mechanical room located on the ground level of the condominium towers. We understand the emergency fire pumps, and control panels are original components with typical useful lives of 30 years. Therefore, we anticipate the replacement year to be around



2036 for these components. These items were observed to be in fair condition for their age at the time of our site visit.

Stairwell Louver Fans - The pressure within each of the 10 interior stairwells located in Tower 1 and Tower 2 is regulated by a louver fan typically located near the roof of the building. With a typical useful life of 25 years, these fans should be scheduled for replacement circa 2031.

Plumbing Systems

Domestic Water Pumps and Controls - The domestic water pumps and control system for the tower buildings are located in a mechanical room located on the ground level near the center of the complex. With useful lifespans of around 15 and 20 years, respectively. The pumps were replaced circa 2018 and the control panels are assumed to be original components. These components should be anticipated to be replaced circa 2033 and 2026, respectively. This element includes four 30-horsepower pumps and two control panel systems. These items were observed to be in fair condition at the time of our site visit.

Pipes – Inspection/Repair - Our experience indicates that sanitary stacks (vertical laundry, kitchen, and sewer pipes) occasionally build up with debris and require servicing. Sanitary stacks can also deteriorate to the point where lining or replacement is warranted. Typically, these sanitary stacks can last up to 50-plus years with routine maintenance and cleaning. Lateral sanitary plumbing lines are normally unit owner owned/responsibility components, and they are typically not relined. They are typically replaced by the unit owner during a unit renovation under a permitted renovation. We have included a reserve to address periodic inspections, cleaning, and replacement/relining of the sanitary stack lines.

Potable Water Lines - Our experience indicates that main potable waterlines typically can last up to 70 to 100-plus years with routine maintenance. Normal replacement or repair of main potable water lines is accomplished on an as-needed basis. Lateral potable water plumbing lines are typically unit owner owned/responsibility components, and they are typically replaced by the unit owner during a unit renovation under a permitted renovation. We have not included reserves for replacement or repairing these lines.

Electrical Systems

Emergency Generators - Each tower structure includes a generator and supporting 200-gallon diesel fuel tank that appear to be in fair to good condition for their age. With normal usage and maintenance, we anticipate the generators will require major overhaul around the year 2046 based on an approximate 40-year useful life. The estimated costs include the main generator unit and other system components.

Diesel Fuel Tanks - The Association also owns two 200-gallon diesel fuel tanks located in a mechanical room located on the ground level of the condominium towers. Commercial diesel tanks similar to these typically have a useful life of approximately 35 years. Therefore, we recommend the Association anticipate having the diesel fuel tanks replaced circa 2041 assuming



they are original components.

Electrical System – Currently there are no indications of any deterioration or issues with the electrical system for the building. Localized breaker panels and branch circuits are typically replaced during common area or individual unit renovations as required to accommodate the renovation. A reserve has been included for periodic replacement/upgrades of major electrical system components such as main service panels and feeder lines.

Waterproofing and Exterior Painting

Full Exterior Paint/Repair - The High Point Place Condominium structures and site exterior components were last painted circa 2013. We understand the buildings are currently scheduled to begin repainting in 2023 or 2024 and be completed by the end of 2024. We understand the current cost, which includes surface preparation, repairs to the stucco, repairs to concrete, edge waterproofing, and full recoating of the exterior elements, is estimated to range from \$2.0M – \$2.3M for the property.

Garage Roof Deck Waterproofing - We understand the roof decks above the parking garages consist of a combination of roadway, common area deck, and planter areas that are waterproofed with a Tremco Vulkem 250 GC product. We estimate that the elevated roadways and common area decks located throughout the property are covered by approximately 21,670 and 30,900 square feet of waterproofing topped with interlocking concrete pavers, respectively. We understand the elevated roadway decks were waterproofed circa 2014 whereas the common area decks are original. We recommend replacing the waterproofing on the elevated roadways circa 2032 based on an estimated 18-year useful life, we understand the Association plans on replacing the waterproofing for the common area circa 2027.

Planter Waterproofing - Landscaping planters located on an elevated deck typically require new waterproofing on a 10- to 20-year basis depending on the waterproofing material used and installation quality during original construction. We understand the Association plans to start replacing the planter waterproofing circa 2027. We understand there to be approximately \$1,200,000 worth of total planter waterproofing work that includes soil/vegetation removal, waterproofing removal and reapplication, and soil/vegetation replacement work at the subject condominium.

Expansion Joints - Although no expansion joint plans were provided to us for this study, we approximate 1,400 linear feet or more of expansion joints located at the subject site. At the time of our site visit, the expansion joints appeared to be in good to fair condition. Assuming the expansion joints are original components, we anticipate a replacement project should be scheduled for 2027. It is also recommended to have the expansion joints replaced in conjunction with the deck waterproofing replacement projects. We understand expansion joints at two locations have already been replaced in 2022.



Windows

Common Area Windows - We assume all Association-owned windows are original components. The common area windows are located in the lobbies, office, gym, and social rooms at the High Point Place Condominium. With an anticipated useful life of approximately 30 years for windows, we estimate the next replacement date to be 2036 or as needed.



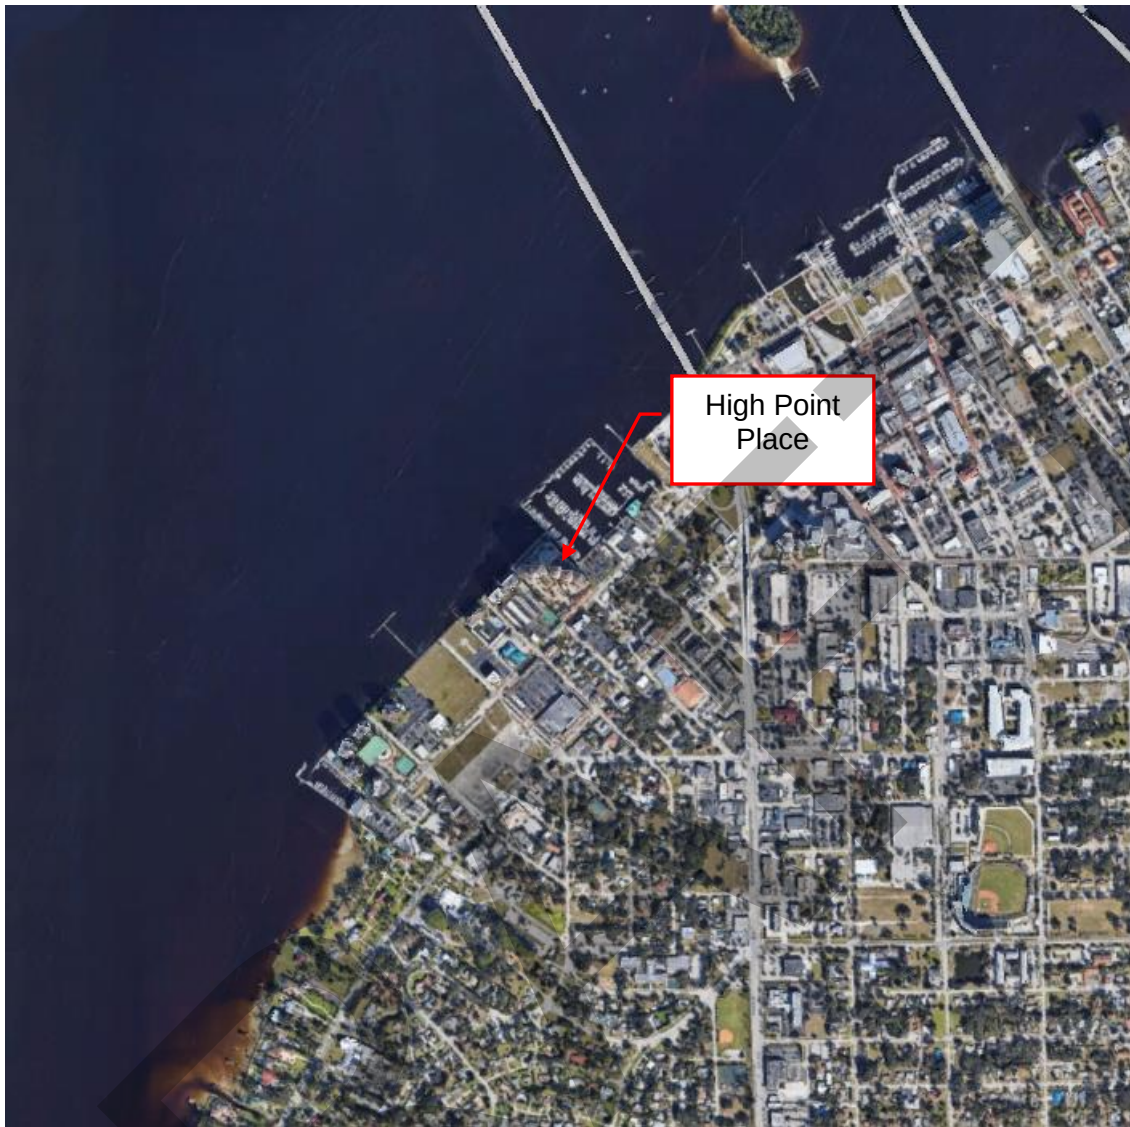


Image: Google Earth




Appendix A: Site Vicinity Map

**HIGH POINT PLACE CONDOMINIUM
ASSOCIATION, INC.**

**2100 West First Street
Fort Myers, Lee County, Florida 33901**

SOCOTEC Project Number 3113-013.01

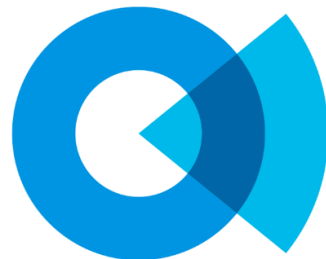

SOCOTEC

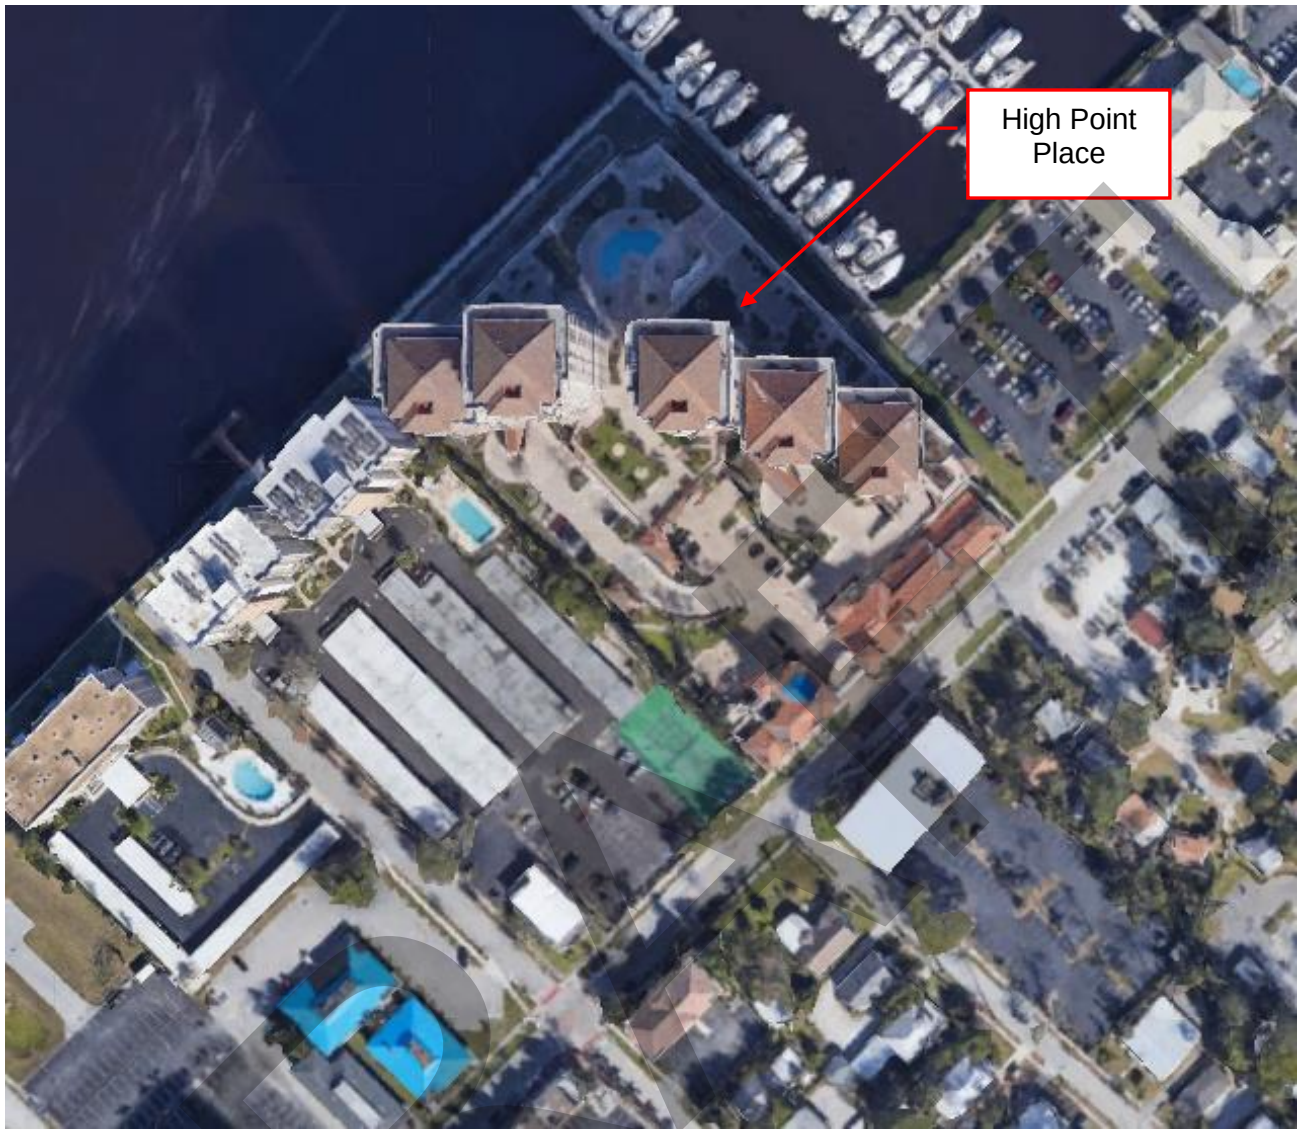


Image: Google Earth




Appendix B: Site Aerial Map

**HIGH POINT PLACE CONDOMINIUM
ASSOCIATION, INC.**

2100 West First Street
Fort Myers, Lee County, Florida 33901

SOCOTEC Project Number 3113-013.01

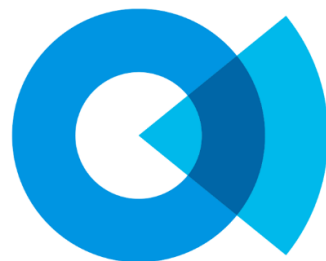


SOCOTEC

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01

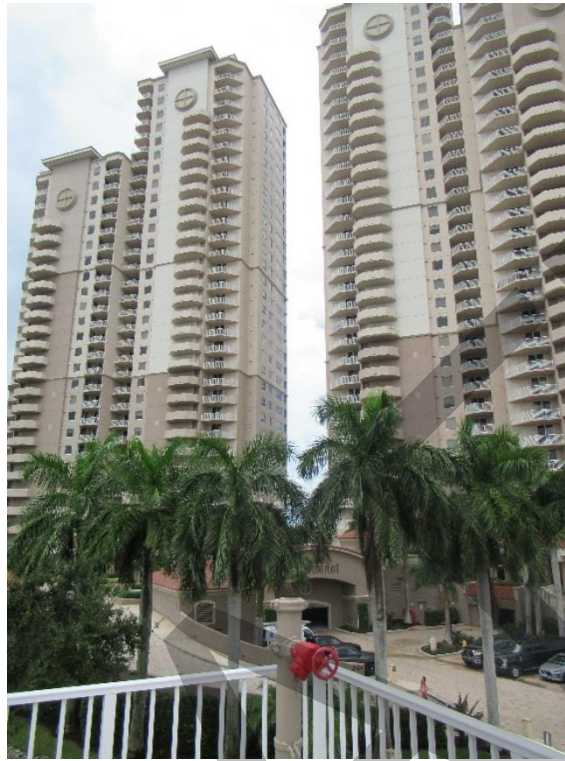

South elevation of Towers 1 and 2.



West elevation of Tower 1.

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



North elevation of Tower 2.



North elevation of Tower 1

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



Common area windows on the level 3 pool deck.



North elevation of parking garage.

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



Common area windows on the level 3 pool deck.



Tower 1 modified bitumen flat roof.

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



Tower 2 roof.



Overview of fire pump room.

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



Overview of Tower 1 elevator room.



Tower 1 level 27 electric room.

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



Tower 1 main electric room.



Structural members at the level 1 parking garage.

APPENDIX C: SITE PHOTOGRAPHS

High Point Place

SOCOTEC Project No. 3113-013.01



City Homes level 1 walkway.



City Homes modified bitumen flat roof.

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.

Structural Integrity Reserve Study Straight-Line Present Funding Method Tower 1

BUILDING COMPONENT / ELEMENT	SERVICE LIFE (YRS)	INSTALL/LAST REPAIR DATE	REMAINING LIFE (YRS)	QUANTITY	UNITS	UNIT COSTS (\$)	ESTIMATED REPLACEMENT COST	NORMAL ANNUAL CONTRIBUTION	CALCULATED CURRENT RESERVE REQUIREMENT	PROVIDED ACCOUNT BALANCE*	ANNUAL FUNDING REQUIRED TO BE 100% FUNDED (2024)
ROOFS											
CLAY TILES - TOWER	25	2019	20	12860	SF	\$ 34	\$ 437,240	\$ 17,490	\$ 87,448	\$ 87,448	\$ 17,490
CLAY TILES - PORTE COCHERE	25	2019	20	550	SF	\$ 20	\$ 11,000	\$ 440	\$ 2,200	\$ 2,200	\$ 440
MODIFIED BITUMEN	20	2019	15	7500	SF	\$ 46	\$ 345,000	\$ 17,250	\$ 86,250	\$ 86,250	\$ 17,250
CLAY TILES - MECH. BLDGS AND GARGE ENTRANCE	25	2019	20	1820	SF	\$ 20	\$ 36,400	\$ 1,456	\$ 7,280	\$ 7,280	\$ 1,456
ARCHWAY	25	2019	20	1	LS	\$ 20,000	\$ 20,000	\$ 800	\$ 4,000	\$ 4,000	\$ 800
ROOFS - TOTAL							\$ 849,640	\$ 37,436	\$ 187,178	\$ 187,178	\$ 37,436
LOAD BEARING WALLS/STRUCTURAL MEMBERS											
LOAD BEARING WALLS/STRUCTURAL MEMBERS REPAIR	10	N/A	10	1	LS	\$ 30,000	\$ 30,000	\$ 3,000	\$ -	\$ -	\$ 3,000
LOAD BEARING WALLS/STRUCTURAL MEMBERS - TOTAL							\$ 30,000	\$ 3,000	\$ -	\$ -	\$ 3,000
FLOORS											
GARAGE FLOORS - RESTORATION	15	2023	14	1	LS	\$ 20,000	\$ 20,000	\$ 1,333	\$ 1,333	\$ 1,333	\$ 1,333
CONCRETE FLOOR SLAB REPAIR	10	N/A	10	1	LS	\$ 30,000	\$ 30,000	\$ 3,000	\$ -	\$ -	\$ 3,000
FLOORS - TOTAL							\$ 50,000	\$ 4,333	\$ 1,333	\$ 1,333	\$ 4,333
FOUNDATIONS											
DEEP FOUNDATIONS	100	2006	N/A	1	LS	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
FOUNDATIONS - TOTAL							\$ -	\$ -	\$ -	\$ -	\$ -
FIREPROOFING AND FIRE PROTECTION SYSTEMS											
FIRE ALARM SYSTEMS	25	2006	7	1	LS	\$ 30,000	\$ 30,000	\$ 1,200	\$ 21,600	\$ 21,600	\$ 1,200
UPDATE AUDIO AND VISUAL ALARMS	25	2006	7	1	LS	\$ 32,800	\$ 32,800	\$ 1,312	\$ 23,616	\$ 23,616	\$ 1,312
EMERGENCY FIRE PUMPS AND CONTROLS	30	2006	12	1	Each	\$ 85,000	\$ 85,000	\$ 2,833	\$ 51,000	\$ 51,000	\$ 2,833
STAIRCASE PRESSURIZATION LOUVER FANS	25	2006	7	5	Each	\$ 6,000	\$ 30,000	\$ 1,200	\$ 21,600	\$ 21,600	\$ 1,200
FIREPROOFING AND FIRE PROTECTION SYSTEMS - TOTAL							\$ 177,800	\$ 6,545	\$ 117,816	\$ 117,816	\$ 6,545
PLUMBING SYSTEMS											
WATER PUMPS (30-HP)	15	2018	9	2	Each	\$ 11,200	\$ 22,400	\$ 1,493	\$ 8,960	\$ 8,960	\$ 1,493
WATER PUMP CONTROLS	20	2006	2	1	Each	\$ 25,000	\$ 25,000	\$ 1,250	\$ 22,500	\$ 22,500	\$ 1,250
PIPES - INSPECTION/REPAIR BUDGET	20	2019	15	1	LS	\$ 22,000	\$ 22,000	\$ 1,100	\$ 5,500	\$ 5,500	\$ 1,100
PLUMBING SYSTEMS - TOTAL							\$ 69,400	\$ 3,843	\$ 36,960	\$ 36,960	\$ 3,843
ELECTRICAL SYSTEMS											
EMERGENCY GENERATOR	40	2006	22	1	Each	\$ 125,000	\$ 125,000	\$ 3,125	\$ 56,250	\$ 56,250	\$ 3,125
DIESEL FUEL TANK - 200 GAL	35	2006	17	1	Each	\$ 12,000	\$ 12,000	\$ 343	\$ 6,171	\$ 6,171	\$ 343
ELECTRICAL SYSTEM UPGRADE	50	2006	32	1	LS	\$ 80,000	\$ 80,000	\$ 1,600	\$ 28,800	\$ 28,800	\$ 1,600
ELECTRICAL SYSTEMS - TOTAL							\$ 217,000	\$ 5,068	\$ 91,221	\$ 91,221	\$ 5,068
WATERPROOFING AND EXTERIOR PAINTING											
EXTERIOR PAINT/REPAIR	7	2024	7	1	LS	\$ 567,430	\$ 567,430	\$ 81,061	\$ -	\$ -	\$ 81,061
SEALANT REPLACEMENT	14	2024	14	1	LS	\$ 212,350	\$ 212,350	\$ 15,168	\$ -	\$ -	\$ 15,168
STUCCO RESTORATION BUDGET	14	2024	14	1	LS	\$ 159,260	\$ 159,260	\$ 11,376	\$ -	\$ -	\$ 11,376
BALCONY MEMBRANE REPLACEMENT	14	2024	14	1	LS	\$ 100,000	\$ 100,000	\$ 7,143	\$ -	\$ -	\$ 7,143
WTRPF. 2ND LEVEL - DECK	18	2014	8	12450	SF	\$ 50	\$ 622,500	\$ 34,583	\$ 345,833	\$ 345,833	\$ 34,583
WTRPF. 3RD LEVEL - POOL DECK	21	2006	4	20350	SF	\$ 50	\$ 1,017,500	\$ 48,452	\$ 823,690	\$ 823,690	\$ 48,452
PLANTER WATERPROOFING	16	2011	3	1	LS	\$ 600,000	\$ 600,000	\$ 37,500	\$ 487,500	\$ 487,500	\$ 37,500
EXPANSION JOINTS	20	2007	3	700	LS	\$ 100	\$ 70,000	\$ 3,500	\$ 59,500	\$ 59,500	\$ 3,500

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.
Structural Integrity Reserve Study
Straight-Line Present Funding Method
Tower 1

BUILDING COMPONENT / ELEMENT	SERVICE LIFE (YRS)	INSTALL/LAST REPAIR DATE	REMAINING LIFE (YRS)	QUANTITY	UNITS	UNIT COSTS (\$)	ESTIMATED REPLACEMENT COST	NORMAL ANNUAL CONTRIBUTION	CALCULATED CURRENT RESERVE REQUIREMENT	PROVIDED ACCOUNT BALANCE*	ANNUAL FUNDING REQUIRED TO BE 100% FUNDED (2024)
WATERPROOFING AND EXTERIOR PAINTING - TOTAL							\$ 3,349,040	\$ 238,784	\$ 1,716,524	\$ 1,716,524	\$ 238,784
WINDOWS											
COMMON AREA WINDOWS AND FRAMES	30	2006	12	1	LS	\$ 72,500	\$ 72,500	\$ 2,417	\$ 43,500	\$ 43,500	\$ 2,417
WINDOWS - TOTAL							\$ 72,500	\$ 2,417	\$ 43,500	\$ 43,500	\$ 2,417
TOTALS							\$ 4,815,380	\$ 301,426	\$ 2,194,533	\$ 2,194,533	\$ 301,426
Normal Annual Contribution = The annual amount that should have been collected at the commencement service life in order to be fully funded for the replacement. SF= Square Feet, LF= Linear Foot, LS= Lump Sum, Each=Per Unit, UNK=Unknown (Estimated Replacement Cost / Service Life) *The starting account balance for the individual line items were provided by the Association											

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.

Structural Integrity Reserve Study Straight-Line Present Funding Method Tower 2

BUILDING COMPONENT / ELEMENT	SERVICE LIFE (YRS)	INSTALL/LAST REPAIR DATE	REMAINING LIFE (YRS)	QUANTITY	UNITS	UNIT COSTS (\$)	ESTIMATED REPLACEMENT COST	NORMAL ANNUAL CONTRIBUTION	CALCULATED CURRENT RESERVE REQUIREMENT	PROVIDED ACCOUNT BALANCE*	ANNUAL FUNDING REQUIRED TO BE 100% FUNDED (2024)
ROOFS											
CLAY TILES - TOWER	25	2019	20	19290	SF	\$ 34	\$ 655,860	\$ 26,234	\$ 131,172	\$ 131,172	\$ 26,234
CLAY TILES - PORTE COCHERE	25	2019	20	1470	SF	\$ 20	\$ 29,400	\$ 1,176	\$ 5,880	\$ 5,880	\$ 1,176
MODIFIED BITUMEN	20	2019	15	11250	SF	\$ 46	\$ 517,500	\$ 25,875	\$ 129,375	\$ 129,375	\$ 25,875
CLAY TILES - MECH. BLDGS AND GARGE ENTRANCE	25	2019	20	1820	SF	\$ 20	\$ 36,400	\$ 1,456	\$ 7,280	\$ 7,280	\$ 1,456
ARCHWAY	25	2019	20	1	LS	\$ 20,000	\$ 20,000	\$ 800	\$ 4,000	\$ 4,000	\$ 800
ROOFS - TOTAL							\$ 1,259,160	\$ 55,541	\$ 277,707	\$ 277,707	\$ 55,541
LOAD BEARING WALLS/STRUCTURAL MEMBERS											
LOAD BEARING WALLS/STRUCTURAL MEMBERS REPAIR	10	N/A	10	1	LS	\$ 30,000	\$ 30,000	\$ 3,000	\$ -	\$ -	\$ 3,000
LOAD BEARING WALLS/STRUCTURAL MEMBERS - TOTAL							\$ 30,000	\$ 3,000	\$ -	\$ -	\$ 3,000
FLOORS											
GARAGE FLOORS - RESTORATION	15	2023	14	1	LS	\$ 20,000	\$ 20,000	\$ 1,333	\$ 1,333	\$ 1,333	\$ 1,333
CONCRETE FLOOR SLAB REPAIR	10	N/A	10	1	LS	\$ 30,000	\$ 30,000	\$ 3,000	\$ -	\$ -	\$ 3,000
FLOORS - TOTAL							\$ 50,000	\$ 4,333	\$ 1,333	\$ 1,333	\$ 4,333
FOUNDATIONS											
DEEP FOUNDATIONS	100	2006	N/A	1	LS	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
FOUNDATIONS - TOTAL							\$ -	\$ -	\$ -	\$ -	\$ -
FIREPROOFING AND FIRE PROTECTION SYSTEMS											
FIRE ALARM SYSTEMS	25	2006	7	1	LS	\$ 30,000	\$ 30,000	\$ 1,200	\$ 21,600	\$ 21,600	\$ 1,200
UPDATE AUDIO AND VISUAL ALARMS	25	2006	7	1	LS	\$ 32,800	\$ 32,800	\$ 1,312	\$ 23,616	\$ 23,616	\$ 1,312
EMERGENCY FIRE PUMPS AND CONTROLS	30	2006	12	1	Each	\$ 85,000	\$ 85,000	\$ 2,833	\$ 51,000	\$ 51,000	\$ 2,833
STAIRCASE PRESSURIZATION LOUVER FANS	25	2006	7	5	Each	\$ 6,000	\$ 30,000	\$ 1,200	\$ 21,600	\$ 21,600	\$ 1,200
FIREPROOFING AND FIRE PROTECTION SYSTEMS - TOTAL							\$ 177,800	\$ 6,545	\$ 117,816	\$ 117,816	\$ 6,545
PLUMBING SYSTEMS											
WATER PUMPS (30-HP)	15	2018	9	2	Each	\$ 11,200	\$ 22,400	\$ 1,493	\$ 8,960	\$ 8,960	\$ 1,493
WATER PUMP CONTROLS	20	2006	2	1	Each	\$ 25,000	\$ 25,000	\$ 1,250	\$ 22,500	\$ 22,500	\$ 1,250
PIPES - INSPECTION/REPAIR BUDGET	20	2019	15	1	LS	\$ 22,000	\$ 22,000	\$ 1,100	\$ 5,500	\$ 5,500	\$ 1,100
PLUMBING SYSTEMS- TOTAL							\$ 69,400	\$ 3,843	\$ 36,960	\$ 36,960	\$ 3,843
ELECTRICAL SYSTEM											
EMERGENCY GENERATOR	40	2006	22	1	Each	\$ 125,000	\$ 125,000	\$ 3,125	\$ 56,250	\$ 56,250	\$ 3,125
DIESEL FUEL TANK - 200 GAL	35	2006	17	1	Each	\$ 12,000	\$ 12,000	\$ 343	\$ 6,171	\$ 6,171	\$ 343
ELECTRICAL SYSTEM UPGRADE	50	2006	32	1	LS	\$ 80,000	\$ 80,000	\$ 1,600	\$ 28,800	\$ 28,800	\$ 1,600
ELECTRICAL SYSTEMS - TOTAL							\$ 217,000	\$ 5,068	\$ 91,221	\$ 91,221	\$ 5,068
WATERPROOFING AND EXTERIOR PAINTING											
EXTERIOR PAINT/REPAIR	7	2024	7	1	LS	\$ 843,370	\$ 843,370	\$ 120,481	\$ -	\$ -	\$ 120,481
SEALANT REPLACEMENT	14	2024	14	1	LS	\$ 278,700	\$ 278,700	\$ 19,907	\$ -	\$ -	\$ 19,907
STUCCO RESTORATION BUDGET	14	2024	14	1	LS	\$ 159,260	\$ 159,260	\$ 11,376	\$ -	\$ -	\$ 11,376
BALCONY MEMBRANE REPLACEMENT	14	2024	14	1	LS	\$ 100,000	\$ 100,000	\$ 7,143	\$ -	\$ -	\$ 7,143
WTRPF. 2ND LEVEL - DECK	18	2014	8	7750	SF	\$ 50	\$ 387,500	\$ 21,528	\$ 215,278	\$ 215,278	\$ 21,528
WTRPF. 3RD LEVEL - RAMP	18	2014	8	1470	SF	\$ 50	\$ 73,500	\$ 4,083	\$ 40,833	\$ 40,833	\$ 4,083
WTRPF. 4TH LEVEL - DECK	19	2007	3	10550	SF	\$ 50	\$ 527,500	\$ 27,763	\$ 444,211	\$ 444,211	\$ 27,763
PLANTER WATERPROOFING	16	2011	3	1	LS	\$ 600,000	\$ 600,000	\$ 37,500	\$ 487,500	\$ 487,500	\$ 37,500

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.

Structural Integrity Reserve Study

Straight-Line Present Funding Method

Tower 2

BUILDING COMPONENT / ELEMENT	SERVICE LIFE (YRS)	INSTALL/LAST REPAIR DATE	REMAINING LIFE (YRS)	QUANTITY	UNITS	UNIT COSTS (\$)	ESTIMATED REPLACEMENT COST	NORMAL ANNUAL CONTRIBUTION	CALCULATED CURRENT RESERVE REQUIREMENT	PROVIDED ACCOUNT BALANCE*	ANNUAL FUNDING REQUIRED TO BE 100% FUNDED (2024)
EXPANSION JOINTS	20	2007	3	700	LS	\$ 100	\$ 70,000	\$ 3,500	\$ 59,500	\$ 59,500	\$ 3,500
WATERPROOFING AND EXTERIOR PAINTING - TOTAL							\$ 3,039,830	\$ 253,281	\$ 1,247,322	\$ 1,247,322	\$ 253,281
WINDOWS											
COMMON AREA WINDOWS AND FRAMES	30	2006	12	1	LS	\$ 72,500	\$ 72,500	\$ 2,417	\$ 43,500	\$ 43,500	\$ 2,417
WINDOWS - TOTAL							\$ 72,500	\$ 2,417	\$ 43,500	\$ 43,500	\$ 2,417
TOTALS							\$ 4,915,690	\$ 334,029	\$ 1,815,859	\$ 1,815,859	\$ 334,029
Normal Annual Contribution = The annual amount that should have been collected at the commencement service life in order to be fully funded for the replacement. SF= Square Feet, LF= Linear Foot, LS= Lump Sum, Each=Per Unit, UNK=Unknown (Estimated Replacement Cost / Service Life)											
*The starting account balance for the individual line items were provided by the Association											

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.

Structural Integrity Reserve Study

Straight-Line Present Funding Method

Building 1

BUILDING COMPONENT / ELEMENT	SERVICE LIFE (YRS)	INSTALL/LAST REPAIR DATE	REMAINING LIFE (YRS)	QUANTITY	UNITS	UNIT COSTS (\$)	ESTIMATED REPLACEMENT COST	NORMAL ANNUAL CONTRIBUTION	CALCULATED CURRENT RESERVE REQUIREMENT	PROVIDED ACCOUNT BALANCE*	ANNUAL FUNDING REQUIRED TO BE 100% FUNDED (2024)
ROOFS											
CLAY TILES	25	2019	20	11300	SF	\$ 20	\$ 226,000	\$ 9,040	\$ 45,200	\$ 45,200	\$ 9,040
MODIFIED BITUMEN	20	2019	15	990	SF	\$ 24	\$ 23,760	\$ 1,188	\$ 5,940	\$ 5,940	\$ 1,188
ARCHWAY	25	2019	20	1	LS	\$ 5,000	\$ 5,000	\$ 200	\$ 1,000	\$ 1,000	\$ 200
ROOFS - TOTAL							\$ 254,760	\$ 10,428	\$ 52,140	\$ 52,140	\$ 10,428
LOAD BEARING WALLS/STRUCTURAL MEMBERS											
LOAD BEARING WALLS/STRUCTURAL MEMBERS REPAIR	10	N/A	10	1	LS	\$ 10,000	\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
LOAD BEARING WALLS/STRUCTURAL MEMBERS - TOTAL							\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
FLOORS											
CONCRETE FLOOR SLAB REPAIR	10	N/A	10	1	LS	\$ 10,000	\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
FLOORS - TOTAL							\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
FOUNDATIONS											
DEEP FOUNDATIONS	100	2006	N/A	1	LS	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
FOUNDATIONS - TOTAL							\$ -	\$ -	\$ -	\$ -	\$ -
FIREPROOFING AND FIRE PROTECTION SYSTEMS											
FIRE ALARM SYSTEMS	25	2006	7	1	LS	\$ 7,500	\$ 7,500	\$ 300	\$ 5,400	\$ 5,400	\$ 300
UPDATE AUDIO AND VISUAL ALARMS	25	2006	7	1	LS	\$ 8,200	\$ 8,200	\$ 328	\$ 5,904	\$ 5,904	\$ 328
FIREPROOFING AND FIRE PROTECTION SYSTEMS - TOTAL							\$ 15,700	\$ 628	\$ 11,304	\$ 11,304	\$ 628
PLUMBING SYSTEMS											
PIPES - INSPECTION/REPAIR BUDGET	20	2019	15	1	LS	\$ 5,500	\$ 5,500	\$ 275	\$ 1,375	\$ 1,375	\$ 275
PLUMBING SYSTEMS- TOTAL							\$ 5,500	\$ 275	\$ 1,375	\$ 1,375	\$ 275
ELECTRICAL SYSTEM											
ELECTRICAL SYSTEM UPGRADE	50	2006	32	1	LS	\$ 30,000	\$ 30,000	\$ 600	\$ 10,800	\$ 10,800	\$ 600
ELECTRICAL SYSTEMS - TOTAL							\$ 30,000	\$ 600	\$ 10,800	\$ 10,800	\$ 600
WATERPROOFING AND EXTERIOR PAINTING											
EXTERIOR PAINT/REPAIR	7	2019	2	8,100	SF	\$ 1.20	\$ 9,720	\$ 1,389	\$ 6,943	\$ 6,943	\$ 1,389
SEALANT REPLACEMENT	14	2019	9	1	LS	\$ 7,500	\$ 7,500	\$ 536	\$ 2,679	\$ 2,679	\$ 536
STUCCO RESTORATION BUDGET	14	2024	14	1	LS	\$ 39,815	\$ 39,815	\$ 2,844	\$ -	\$ -	\$ 2,844
BALCONY MEMBRANE REPLACEMENT	14	2024	14	1	LS	\$ 25,000	\$ 25,000	\$ 1,786	\$ -	\$ -	\$ 1,786
WATERPROOFING AND EXTERIOR PAINTING - TOTAL							\$ 82,035	\$ 6,554	\$ 9,621	\$ 9,621	\$ 6,554
WINDOWS											
COMMON AREA WINDOWS AND FRAMES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
WINDOWS - TOTAL							\$ -	\$ -	\$ -	\$ -	\$ -
TOTALS							\$ 407,995	\$ 20,485	\$ 85,240	\$ 85,240	\$ 20,485
Normal Annual Contribution = The annual amount that should have been collected at the commencement service life in order to be fully funded for the replacement.											
SF= Square Feet, LF= Linear Foot, LS= Lump Sum, Each=Per Unit, UNK=Unknown (Estimated Replacement Cost / Service Life) *The starting account balance for the individual line items were provided by the Association											

HIGH POINT PLACE CONDOMINIUM ASSOCIATION, INC.

Structural Integrity Reserve Study

Straight-Line Present Funding Method

Building 2

BUILDING COMPONENT / ELEMENT	SERVICE LIFE (YRS)	INSTALL/LAST REPAIR DATE	REMAINING LIFE (YRS)	QUANTITY	UNITS	UNIT COSTS (\$)	ESTIMATED REPLACEMENT COST	NORMAL ANNUAL CONTRIBUTION	CALCULATED CURRENT RESERVE REQUIREMENT	PROVIDED ACCOUNT BALANCE*	ANNUAL FUNDING REQUIRED TO BE 100% FUNDED (2024)
ROOFS											
CLAY TILES	25	2019	20	5350	SF	\$ 20	\$ 107,000	\$ 4,280	\$ 21,400	\$ 21,400	\$ 4,280
MODIFIED BITUMEN	20	2019	15	885	SF	\$ 24	\$ 21,240	\$ 1,062	\$ 5,310	\$ 5,310	\$ 1,062
ARCHWAY	25	2019	20	1	LS	\$ 5,000	\$ 5,000	\$ 200	\$ 1,000	\$ 1,000	\$ 200
ROOFS - TOTAL							\$ 133,240	\$ 5,542	\$ 27,710	\$ 27,710	\$ 5,542
LOAD BEARING WALLS/STRUCTURAL MEMBERS											
LOAD BEARING WALLS/STRUCTURAL MEMBERS REPAIR	10	N/A	10	1	LS	\$ 10,000	\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
LOAD BEARING WALLS/STRUCTURAL MEMBERS - TOTAL							\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
FLOORS											
CONCRETE FLOOR SLAB REPAIR	10	N/A	10	1	LS	\$ 10,000	\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
FLOORS - TOTAL							\$ 10,000	\$ 1,000	\$ -	\$ -	\$ 1,000
FOUNDATIONS											
DEEP FOUNDATIONS	100	2006	N/A	1	LS	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
FOUNDATIONS - TOTAL							\$ -	\$ -	\$ -	\$ -	\$ -
FIREPROOFING AND FIRE PROTECTION SYSTEMS											
FIRE ALARM SYSTEMS	25	2006	7	1	LS	\$ 7,500	\$ 7,500	\$ 300	\$ 5,400	\$ 5,400	\$ 300
UPDATE AUDIO AND VISUAL ALARMS	25	2006	7	1	LS	\$ 8,200	\$ 8,200	\$ 328	\$ 5,904	\$ 5,904	\$ 328
FIREPROOFING AND FIRE PROTECTION SYSTEMS - TOTAL							\$ 15,700	\$ 628	\$ 11,304	\$ 11,304	\$ 628
PLUMBING SYSTEMS											
PIPES - INSPECTION/REPAIR BUDGET	20	2019	15	1	LS	\$ 5,500	\$ 5,500	\$ 275	\$ 1,375	\$ 1,375	\$ 275
PLUMBING SYSTEMS- TOTAL							\$ 5,500	\$ 275	\$ 1,375	\$ 1,375	\$ 275
ELECTRICAL SYSTEM											
ELECTRICAL SYSTEM UPGRADE	50	2006	32	1	LS	\$ 30,000	\$ 30,000	\$ 600	\$ 10,800	\$ 10,800	\$ 600
ELECTRICAL SYSTEMS - TOTAL							\$ 30,000	\$ 600	\$ 10,800	\$ 10,800	\$ 600
WATERPROOFING AND EXTERIOR PAINTING											
EXTERIOR PAINT/REPAIR	7	2019	2	12,600	SF	\$ 1.20	\$ 15,120	\$ 2,160	\$ 10,800	\$ 10,800	\$ 2,160
SEALANT REPLACEMENT	14	2019	9	1	LS	\$ 12,000	\$ 12,000	\$ 857	\$ 4,286	\$ 4,286	\$ 857
STUCCO RESTORATION BUDGET	14	2024	14	1	LS	\$ 39,815	\$ 39,815	\$ 2,844	\$ -	\$ -	\$ 2,844
BALCONY MEMBRANE REPLACEMENT	14	2024	14	1	LS	\$ 25,000	\$ 25,000	\$ 1,786	\$ -	\$ -	\$ 1,786
WATERPROOFING AND EXTERIOR PAINTING - TOTAL							\$ 91,935	\$ 7,647	\$ 15,086	\$ 15,086	\$ 7,647
WINDOWS											
COMMON AREA WINDOWS AND FRAMES	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
WINDOWS - TOTAL							\$ -	\$ -	\$ -	\$ -	\$ -
TOTALS							\$ 296,375	\$ 16,692	\$ 66,275	\$ 66,275	\$ 16,692
Normal Annual Contribution = The annual amount that should have been collected at the commencement service life in order to be fully funded for the replacement.											
SF= Square Feet, LF= Linear Foot, LS= Lump Sum, Each=Per Unit, UNK=Unknown (Estimated Replacement Cost / Service Life) *The starting account balance for the individual line items were provided by the Association											