


MISSING STRUTS




0.525%

no matched voxel on the nominal cylinder and every cross-section empty — a count of zero, so the call carries no threshold to tune

89 of 16,949 measurable struts

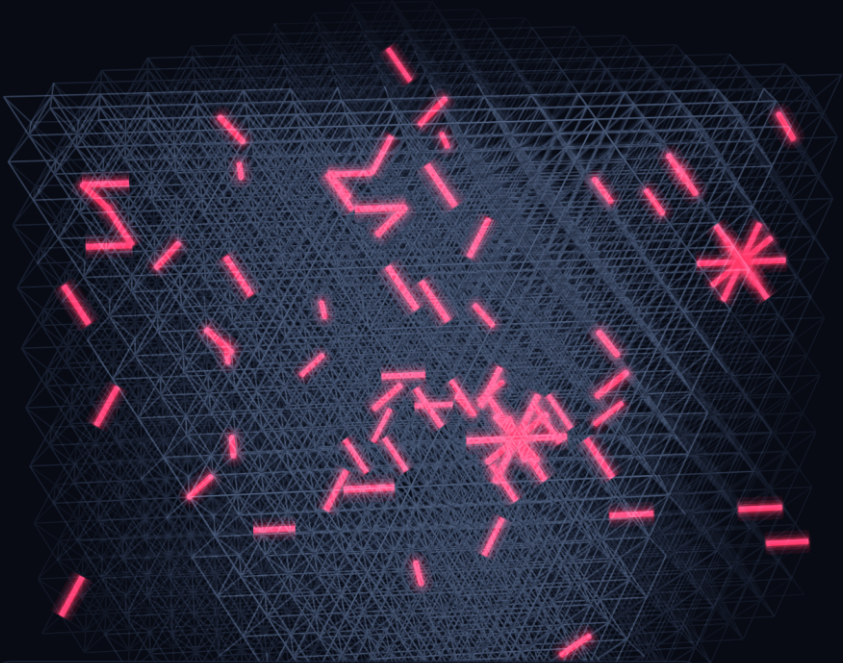

THE DEFECTS ARE NOT INDEPENDENT
40% share a junction with another missing strut
10% ± 5% if the same 89 were scattered at random
one junction has 12 of its struts gone

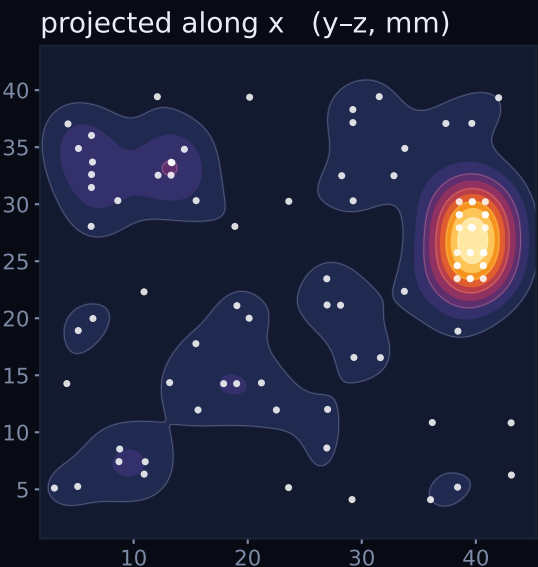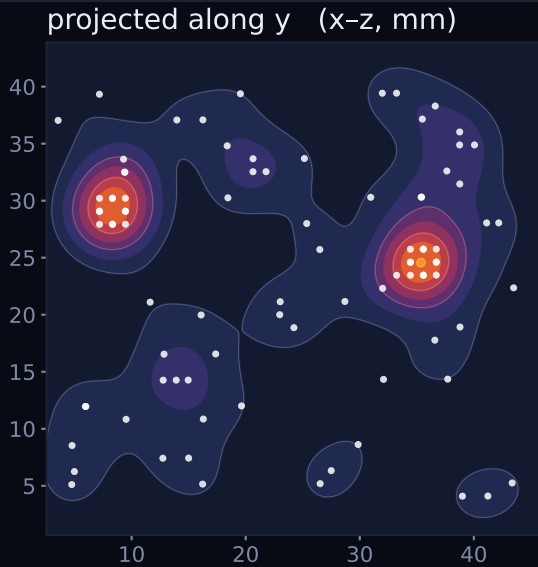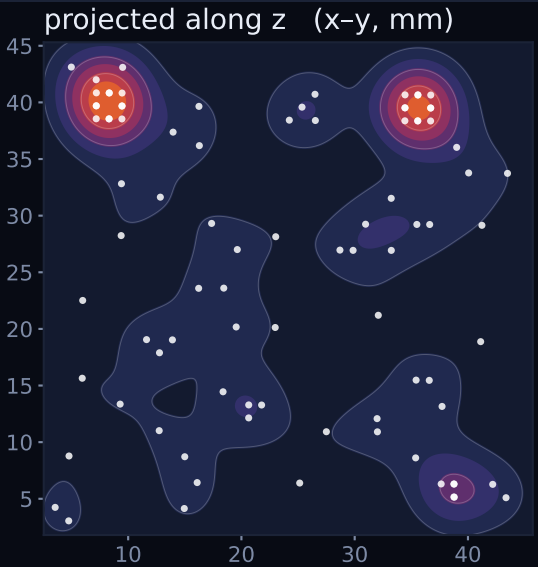

scored against the CAD

0.stl — 0.5.stl gives the struts the design deleted

88

true positive

1

false positive

2

false negative

0.989

precision

0.978

recall

91

designed out

9x9x9 octet lattice · 58.18 μm/voxel · 350 μm nominal strut · registration correction applied
972 boundary caps and 777 plate-embedded struts excluded, not counted as healthy

