
Five dwellings for the October acoustic treatment slot

To Aiden Hawthorn, operations manager. From Keelan Moher, environmental engineer. 16 October 2026. Autumn 2026 noise survey, Tulcarra Foods Drumlorne. Slot to be ordered Monday 26 October.

The survey put a meter at each of the fourteen positions in the schedule for two weeks between 31 August and 11 October. The specific sound level below is the plant's own contribution at the dwelling over the assessment period, with the residual sound of each position's surroundings taken off in energy. The five dwellings the slot reaches are NSL04 (DW-101), NSL11 (DW-104), NSL07 (DW-110), NSL02 (DW-103), NSL13 (DW-105). NSL06 is the first dwelling off the list, 1.3 dB below the fifth.

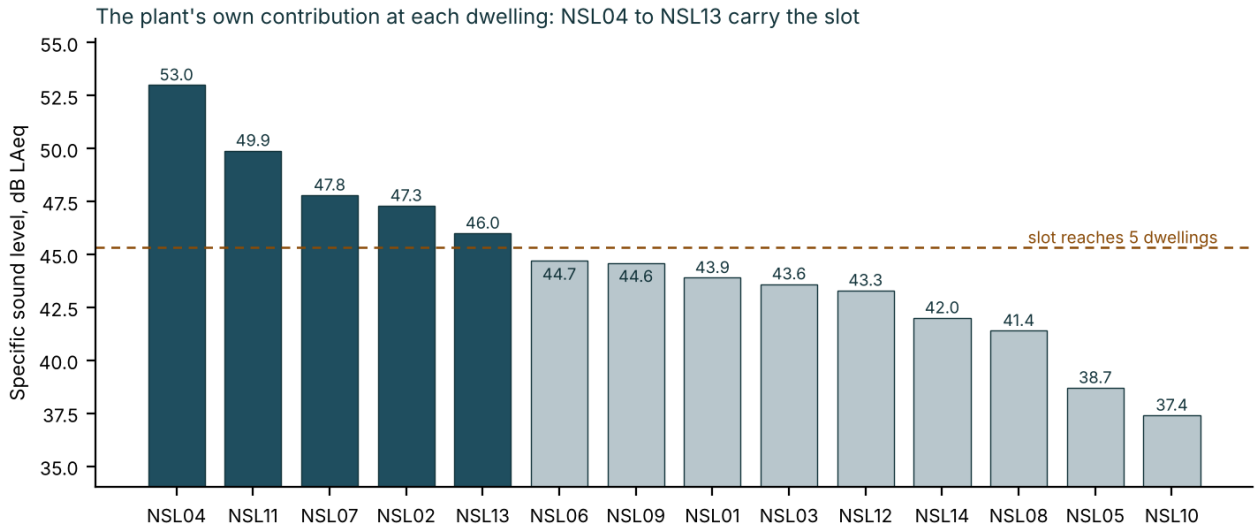

What the slot covers

Position	Dwelling	Specific sound level, dB LAeq	Glazing
NSL04	DW-101, cottage, plant boundary field	53.0	with acoustic trickle vents
NSL11	DW-104, dormer, plant access road	49.9	with acoustic trickle vents
NSL07	DW-110, farmhouse, Coolnagree	47.8	with acoustic trickle vents
NSL02	DW-103, farmhouse, Drumlorne Upper	47.3	with acoustic trickle vents
NSL13	DW-105, cottage, Drumlorne Upper	46.0	standard unit

A tone is prominent at 6 of the fourteen positions, NSL02, NSL03, NSL04, NSL07, NSL09, NSL11, and at every one of them it sits in the 400 Hz band. Four of the five the slot covers carry it, and those take the glazing with acoustic trickle vents; NSL13 takes the standard unit.

The plant through the survey

The blowers ran through every assessment minute of the survey, so no position was measured with the plant off load. What moved week to week was the dewatering shift and the engine's own stops, and the minutes behind each level with a centrifuge running are in the position table beside the levels.

Week beginning	Blower air delivered, thousand Nm3	Centrifuge runs	Engine hours run
31 August	689	12	164.3
7 September	678	13	162.0
14 September	679	9	166.0
21 September	700	12	163.2
28 September	668	8	160.5
5 October	686	13	164.7

Levels are to one decimal place. Minutes the mast counted rain in, minutes it showed above the plan's wind limit and minutes a meter recorded nothing for are out of every level, as the plan requires, and the 11 deployments whose field checks sat away from the calibrator, on two of the five meters, have been corrected.