


0 100 1000mm

section A-A

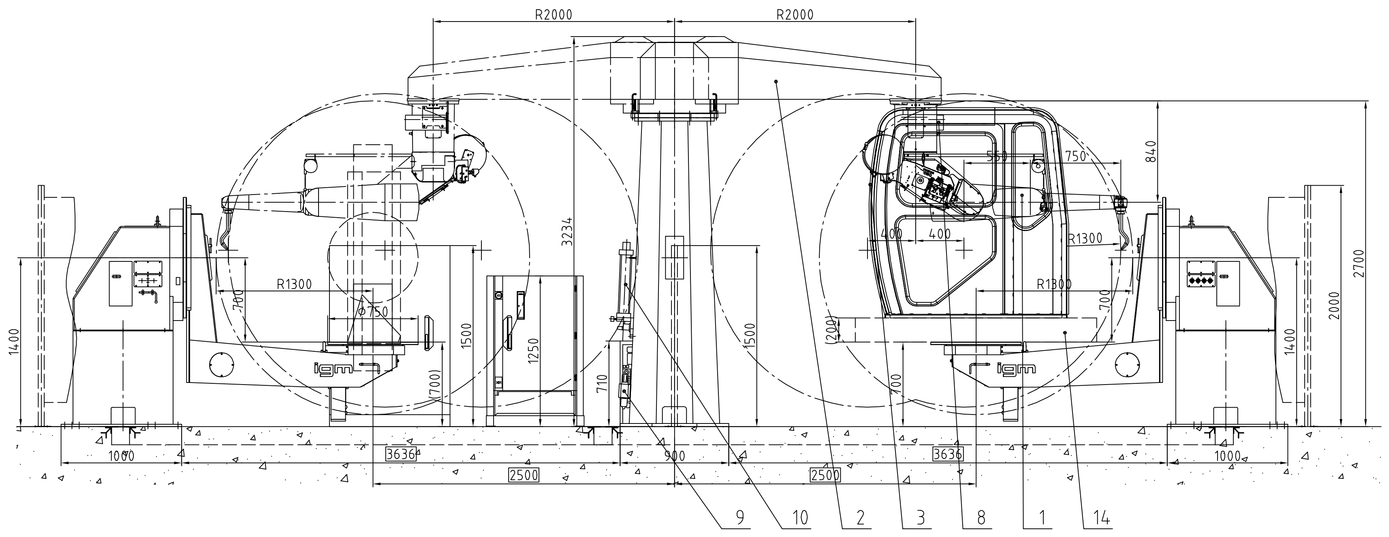


view X

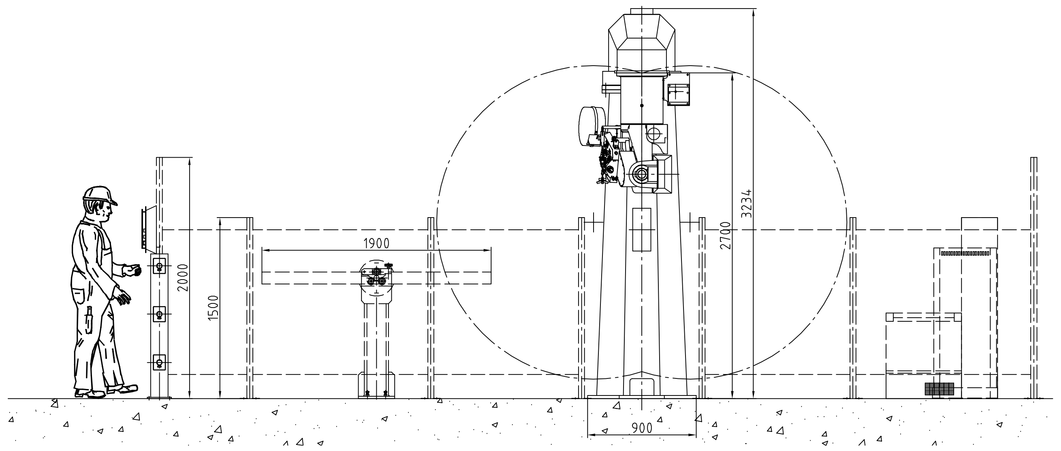

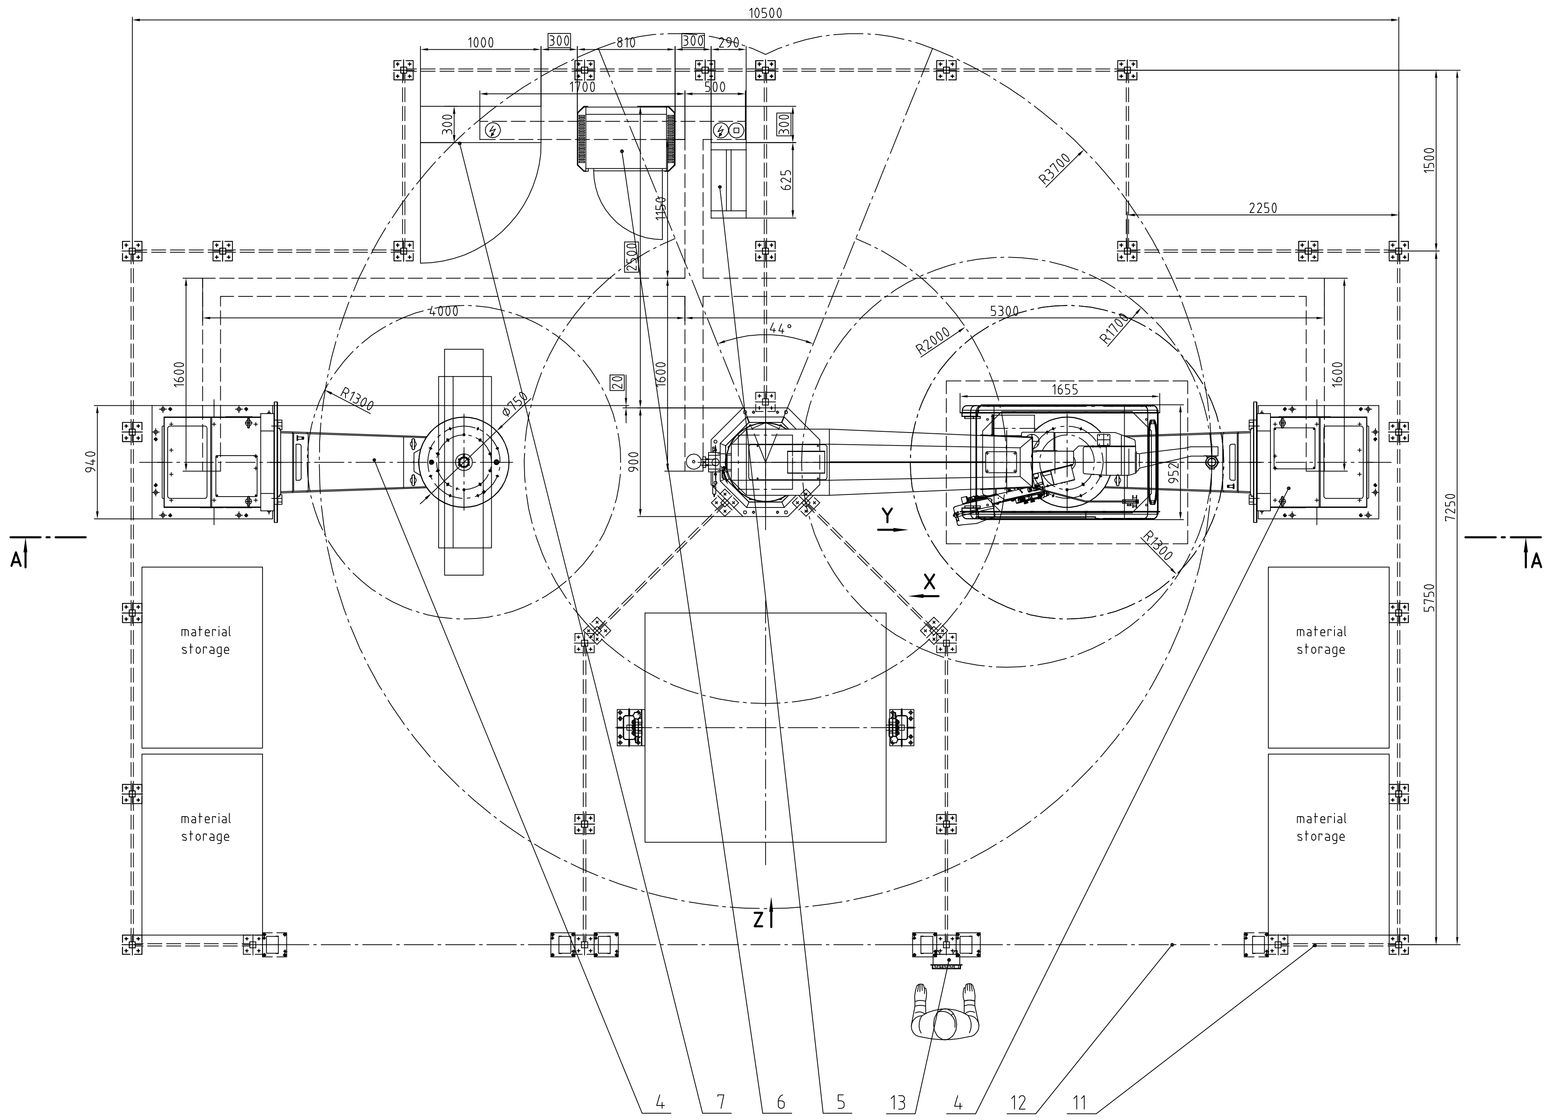


view Y

(only RWM2)

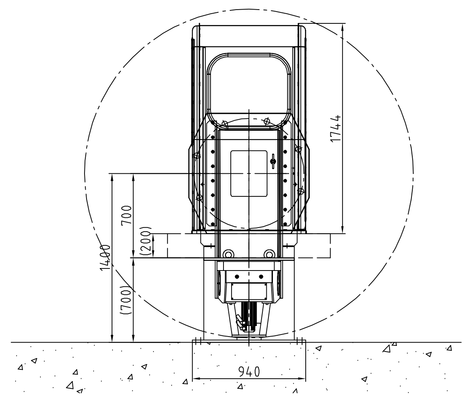

view Z

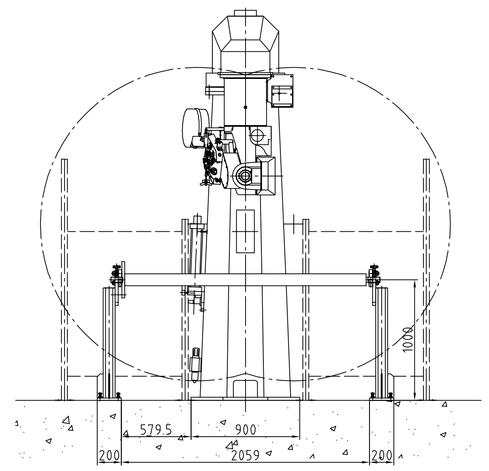

Instructions for Setting up Installation


- Marked dimensions (e.g. (1200)) define the position of the single components of the installation relative to each other.
- In the case of step programs generated by igm the marked dimensions have to be observed for the coarse positions of the system components. The exact position of the workpiece manipulators relative to the robots has to be determined in this case via the supplied program.
- Reference dimensions (A, B, C, D,...) shall be confirmed by customer after receipt of Layout.
- Proposal for assembling: HILTI anchor bolts M20. Minimum drilling depth for the supplied HILTI anchor bolts is 200mm. No pit holes for anchor bolts to be provided by customer.
- The anchor bolts are placed after the final adjustment of the installation.
- The cable channels should not have electrical connection between machine parts.
- Requirements on site:
  - ⊙ = dry, purified, compressed air; 6 bar Quality ISO 8573.1 Class 2
  - ⓟ = power supply; EN 50160 see positions control cabinet and power source
  - ⓜ = shielding gas supply; 1 - 3 bar

Remarks re. foundations

- This drawing provides basic information for the elaboration of the foundation drawings. The indicated data refer to the machine equipment, only.
- The static calculations of the foundation shall be done by the customer's building contractor who is also responsible for the selection of the appropriate material and the necessary subsoil investigations.
- All cable channels should be made of an antimagnetic material (e.g. Al-plate).
- Indicated safety walls are for information only and do not comply European safety standards since they are not applicable in Asia.

proposed design of the cable channel

(under the floor; scale M 1:5)

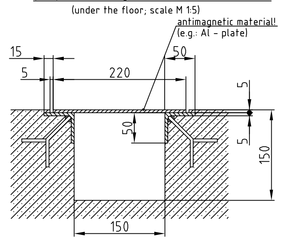

14	Pallet
13	Ext. operator's panel
12	3- beam safety light barrier
11	Security separating wall
10	Pressure amplifier
9	Air maintenance unit
8	Mech. torch cleaning
7	Additional cabinet - 3x400V±10%+N+PE, 50Hz, 25.5kVA, 50A, 5x10mm²
6	Control cabinet KRC2
5	Power source TPS 5000 - 3x400V, 50Hz, 15.1kVA, 35A, 4x6mm²
4	L- manipulator RWM2/500A1- RC/ High Speed
3	Wire drive VS
2	Rotary robot gallow RST.2- 2000- RCi
1	Robot RTi 370- S
Pos.	Benennung / description