

Riverside Community Library - Facilities Permit Packet

Permit Application + Intake Cover | Rev 2 resubmittal 2026-06-11

RECEIVED JUN 12 2026
BUILDING SAFETY

PERMIT NO.	PARCEL	ZONING	OCCUPANCY	TYPE
PR-26-18422	073W22AB-04400	PS - Public Service	A-3 Library	II-B

Field	Application value	Reviewer / intake mark
Applicant / GC	Northbank Builders LLC CCB 218774 (503) 555-0186	accepted
Owner	City of Salem Facilities Division	municipal
Scope	Replace 4 rooftop units; restroom accessibility upgrades; breakroom sink relocation	Verify: submittal shows 5 RTUs?
Work area	3,860 sq ft	matches code matrix
Construction valuation	\$486,750	CO-02 later revises contract to \$512,430
Sprinklered	Yes - NFPA 13	fire review routed
Structural work	No structural work checked	roof curb detail appears later

REQUESTED INSPECTIONS

framing above ceiling; mechanical final; electrical rough-in;
plumbing final; accessibility final.

MINI FEE BAR



Plan Review \$2840

MEP \$1615

Technology Fee \$145

Review routing

- ☒ Building
- ☒ Fire
- ☒ Mechanical
- ☒ Electrical
- ☒ Plumbing
- ☐ Planning

Intake conflict


Typed scope says 4 rooftop units.
Reviewer note asks whether
submittal shows 5 RTUs. Do not
collapse this into a single final
count.

Code Summary + Occupant Load / Egress Plan

Dense code matrix with embedded egress plan and photo placard

Area / item	Factor	Calculation	Occupants / value		
Building gross area			18,240 sq ft		
Permit work area			3,860 sq ft		
Community meeting room	15 net	1,185 sq ft / 15	79 occupants	Reading	Stacks
Reading room affected area	50 gross	1,420 sq ft / 50	29 occupants		
Staff/break/admin	150 gross	610 sq ft / 150	5 occupants		
Restrooms/circulation/mech	accessory	645 sq ft	not counted		
Calculated subtotal			113 occupants		
Existing posted placard	photo inset		92 occupants		
Common path / travel		48 ft / 137 ft	2 exits req; 3 provided		
Door widths		Door 103 = 34 in; Door 117 = 32 in	maintain route		

Egress path: common path 48 ft; longest exit access 137 ft.

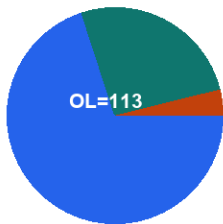

Meeting 70% | Reading 26% | Staff 4%

Fire marshal


OL calc must include community room storage overflow. Cover note 'no change to occupant load' conflicts with calculated OL=113 and placard=92.

Accessibility note: Maintain 44 in min accessible route except at existing stacks pinch point noted.

Site Plan / Logistics / Fire Access

Plan overlay with fire lane, crane pick zone, utility callouts, and hydrant conflict

Scale: 1" = 30'-0". North arrow points 18 degrees west of sheet up.

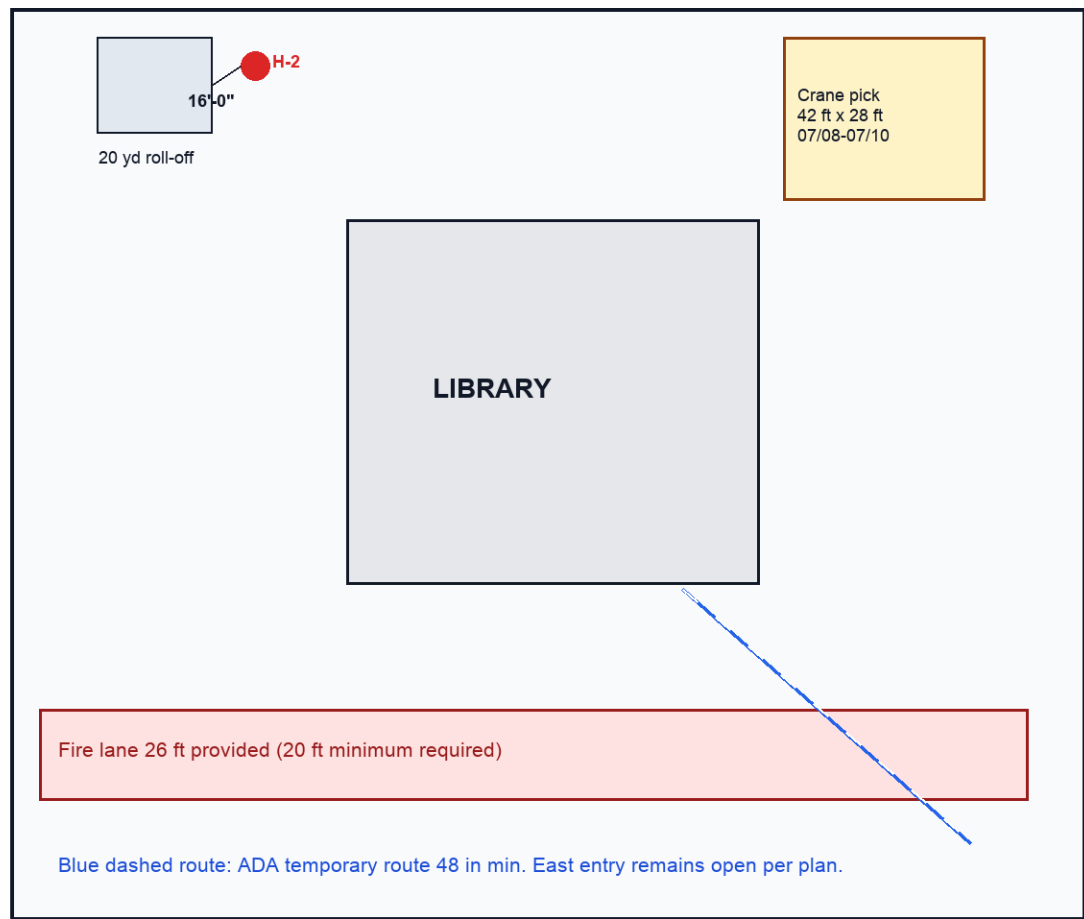

Utilities

Gas shutoff: south wall, grid C/2.
Electrical service: 800A, 120/208V, 3-phase.

Work hours

7:00 AM - 5:30 PM
weekdays. Public entrance to remain open: East entry only.

Conflict


Fire access markup says do not stage within 20 ft of hydrant. Dimension string shows dumpster 16 ft from H-2.

Site quantities

Fence 146 LF. Staging area 1,120 sq ft. Tree protection 12 ft radius around oak T-3.

A2.1 Enlarged Floor Plan / Restroom + Breakroom Alteration

Architectural plan with RFI references, fixture schedule, and accessibility conflicts

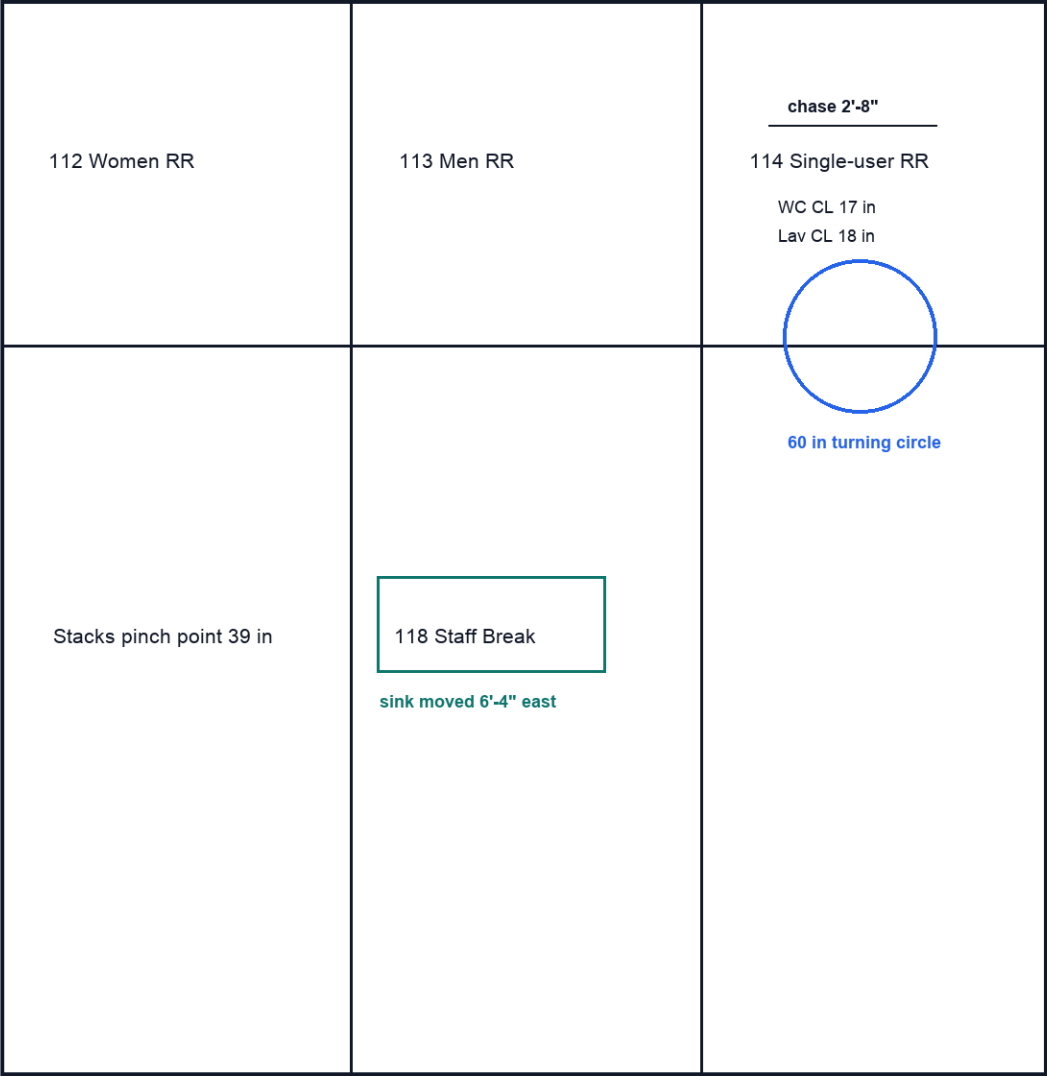

Fixture / wall schedule

Tag	Value
W3	3 5/8 in metal stud; 5/8 in GWB each side
Door 114	34 in clear width
Rear grab bar	36 in
Side grab bar	42 in
Casework C-12B'-6"	length

RFI-07

Revises chase from 2'-8" to 3'-2"; maintain 60" turning circle; shift lav 4" east.

Existing condition

Stacks aisle pinch point is 39 in clear, tagged EXISTING NONCONFORMING - DO NOT REDUCE.


M1.3 / E1.2 Mechanical + Electrical Coordination Overlay

RTU schedule, electrical breakers, duct notes, reviewer stamp, and curb conflict

Overlay sheet combines rooftop equipment, reflected ceiling access, disconnects, smoke detector tie-ins, and panel schedule fragments.

Equip	Tons	Serves	MCA	MOCP	Breaker
RTU-1	7.5	Reading Room	38A	50A	2P-50
RTU-2	5	Staff/Admin	27A	35A	2P-35
RTU-3	10	Community Room	52A	70A	2P-70
RTU-4	3	Restrooms/Storage	18A	25A	2P-25
Total scheduled	25.5				

REVIEW
FIELD VERIFY

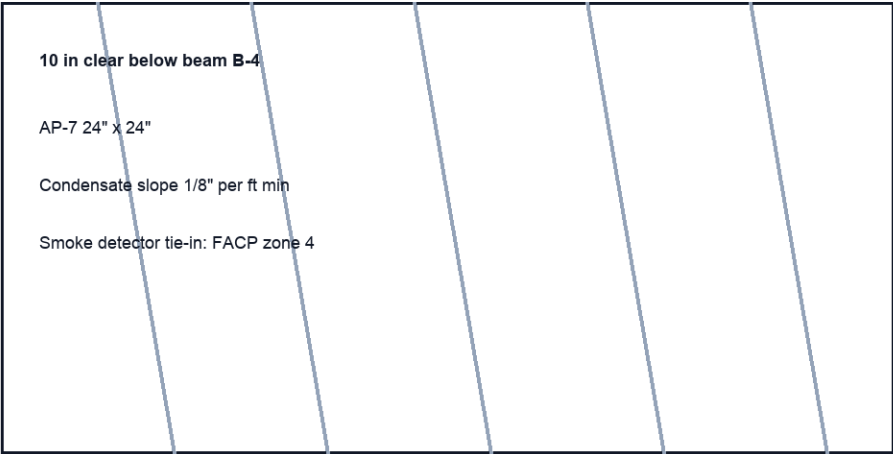

Curb openings

Mechanical C-3 opening: 54" x 78". Structural curb detail / CO-02 later requires 58" x 80".

Schedule state

This sheet lists 4 RTUs totaling 25.5 tons. Do not add ERV-1 to the original mechanical schedule; CO-02 adds it later.

RFI Log + Selected RFI Responses

Layered scanned-email cards with handwritten field note

RFI	Submitted	Question / response	Impact
RFI-07	2026-06-03	Cleanout conflicts with 2'-8" chase; response 2026-06-06: revise chase to 3'-2", maintain 60" turnspit in 114 east	potential 1 day
RFI-08	2026-06-04	Beam B-4 reduces duct clearance; response: flatten duct to 12" x 34" for 9'-0" run; keep 350 CFM day-7.	1 day
RFI-09	2026-06-07	East entry cannot remain open during crane pick; response: use west entry during crane pick only, provide route and signage.	no impact
RFI-10	2026-06-08	RTU-3 submitted model exceeds basis of design capacity. Formal status pending.	see handwritten note

Architect response box

RFI-07 response dated 2026-06-06.
Revise chase to 3'-2". Maintain 60"
turning circle in Room 114. Shift lav
4" east.

Blue field note

RFI-10 resolved by CO-02, see 6/18
email. Formal log on this page still
says pending.

IMPACT MATRIX CHIPS

cost potential

schedule 1 day

permit yes

inspection note

Change Order CO-02 + Cost / Schedule Summary

Formal CO with signatures, waterfall, schedule strip, and backup quote conflict

Field	Value
Change order	CO-02 dated 2026-06-18
Original contract	\$486,750
Prior approved changes	\$0
CO-02 amount	\$25,680
Revised contract	\$512,430
Original substantial completion	2026-08-21
Added days	3 calendar days
Revised substantial completion	2026-08-24

SIGNATURES

Signer	Role	Date
Dana Hu	Owner Facilities Manager	2026-06-19
Leo Martinez	Contractor	2026-06-18
Priya Soto	Architect	2026-06-20


Schedule ambiguity

CO-02 adds 3 calendar days. RFI-08 separately notes 1 day, but packet does not prove the days are additive.

CO SCOPE

Upsize RTU-3 from 10 tons to 12.5 tons. Add ERV-1 with 450 CFM outside air. Modify curb C-3 to 58" x 80". Add electrical breaker 3P-80A in panel MDP.

COST WATERFALL

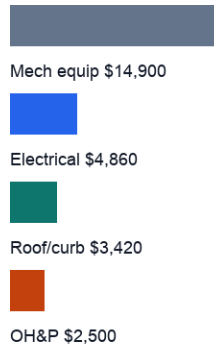

OWNER APPROVED
SUBJECT TO PERMIT REVIEWER ACCEPTANCE

Photo Observation Sheet + Punch / Inspector Notes

Six-photo grid with embedded tape dimensions, arrows, and inspector observations

Photo 1 | 2026-06-27 08:42

East entry staging condition



36" clear at door, not 48"

Photo 2 | 2026-06-27 09:05

Hydrant H-2 and dumpster



16'-0" tape; relocate before crane pick

Photo 3 | 2026-06-28 13:18

Room 114 chase mockup



3'-2"; RFI-07 incorporated

Photo 4 | 2026-06-28 14:10

Existing stacks aisle



39"; existing nonconforming

Photo 5 | 2026-06-29 10:22

Roof curb C-3 layout



58" x 80"; matches CO-02, not M1.3

Photo 6 | 2026-06-29 11:47

Temporary west entry signage



Accessible Entrance During Crane Pick July 8-10

INSPECTOR OBSERVATIONS

- OBS-14: East entry route shown on logistics plan not maintained on 06/27; corrected route required before public opening.
- OBS-15: Dumpster within 20 ft hydrant clearance; move minimum 4 ft west.
- OBS-16: Room 114 chase revised per RFI-07; verify turning circle after lav shift.
- OBS-17: Curb C-3 field layout follows CO-02; confirm permit resubmittal reflects structural opening.