

ROUTINE MECHANICAL INSPECTION

Rotating equipment condition report

EQUIPMENT
Cooling Water Pump P-204A

INSPECTION DATE
04 September 2026

WORK ORDER
WO-26-0917

SERVICE
Cooling water circulation

INSPECTOR
A. Kumar

OPERATING STATE
Running

OPERATING MEASUREMENTS

Measurement	Observed	Acceptance	Status
Suction pressure	3.2 bar	3.0-3.5 bar	PASS
Discharge pressure	8.7 bar	8.5-9.0 bar	PASS
Inboard bearing temperature	86 C	80 C maximum	ALERT
Outboard bearing temperature	74 C	80 C maximum	PASS
Drive-end horizontal vibration	6.8 mm/s RMS	4.5 mm/s maximum	ALERT
Mechanical seal leakage	0 drops/min	0 drops/min	PASS

INSPECTOR SUMMARY

- Inboard bearing temperature is 6 C above the stated maximum.
- Drive-end horizontal vibration is 2.3 mm/s RMS above the stated maximum.
- Check alignment and bearing lubrication within 24 hours. Keep the pump in monitored service.

FIELD OBSERVATIONS

Handwritten note and marked equipment diagram


HANDWRITTEN OBSERVATION

Oil seep at inboard bearing.

Recheck after 48 h.

A. Kumar

MARKED EQUIPMENT DIAGRAM

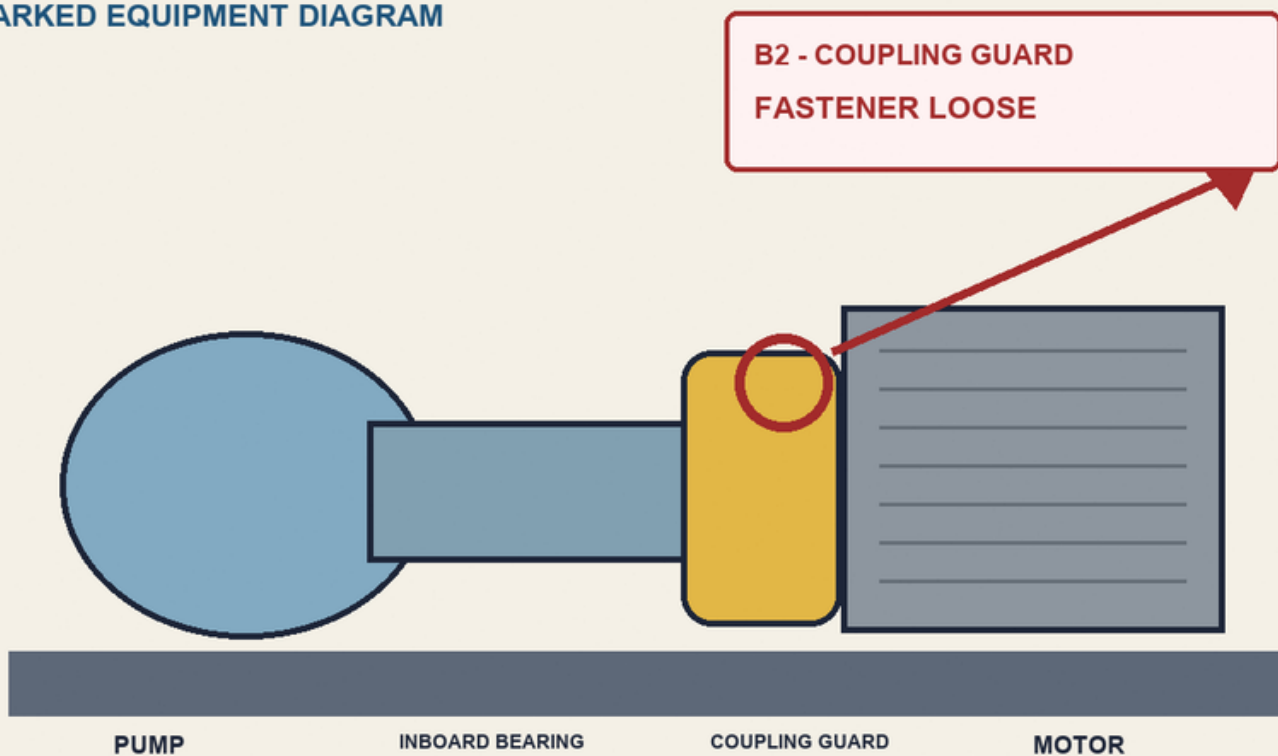

ACTION Tighten fastener B2 before the next restart. Record completion in WO-26-0917.

EQUIPMENT PHOTOGRAPH

Reference image and approval recommendation



Figure 1. Pump P-204A equipment photograph, reference only.

Do not diagnose a defect from this image without a separate visual inspection.

RECOMMENDATION FOR APPROVAL

- Approve maintenance inspection of alignment and bearing lubrication within 24 hours.
- Tighten coupling guard fastener B2 before the next restart.
- Continue monitored service and repeat temperature and vibration readings after 48 hours.