


Project

Firmware requirements

- Main loop requirements
 - The control loop should be implemented at 500 Hz frequency.
 - The motor PWM should be updated at 500 Hz and the IR sensor should be read at 500 Hz frequency.
 - Initially, the robot should be in “Halted” state.
 - In this state, the PWM DC of all the motors should be 0.
 - The left and right-side lights should blink at 1 Hz. The low intensity lights should be off.
 - Once the button RE8 is pressed, the robot should go in the “Moving” state.
 - In this state, the PWM is generated to as it follows
 - Given the speed and yawrate signals received from the UART (see below), the PWM for the left and right motors should be generated accordingly:
 $\text{left_pwm} = \text{speed} - \text{yawrate}$, $\text{right_pwm} = \text{speed} + \text{yawrate}$, saturated to $\pm 100\%$.
 - The left and right-side lights should be off. The low intensity lights should be on.
 - If the button RE8 is pressed for a second time, the robot should go back in the “Halted” state.
 - If the robot, while in the moving state, senses an obstacle closer than a predefined threshold in cm, it should change to a state “Obstacle Avoidance”.
 - In this state, the robot should rotate clockwise of about 90 degrees, move forward for two seconds, and then rotate anti-clockwise back to the previous heading. If now it senses no obstacles, it goes back to the “Moving state”. Otherwise, the procedure is repeated for a maximum of three times. If an obstacle is still sensed, the state is changed to “Halted”.
 - The right-side lights should blink at 1 Hz. The low intensity lights should be on. The left-light side should be off.
 - If the button RE8 is pressed, the robot should go to the “Halted” state
 - In all states:
 - The robot should acquire the filtered accelerometer values x,y,z at 10 Hz and the magnetometer values at 10 Hz.
 - Pressing the button RE9 should trigger a message that reports the number of data available at that moment inside the TX and RX circular buffers: \$M\$BUF,tx,rx*
 - The LED A0 and should blink at 1 Hz frequency at all times, to indicate the functioning of the main loop.
- Motor control
 - Four PWM signals must be generated to control the buggy, on pins RD1 to RD4 (PR65 to RP68) using four Output Compare peripherals.
 - The frequency of the PWM signals must be 10 kHz.
 - The actuation of the wheels follows the specification reported in the table below:

Command	PWM with DC > 0	PWM with DC = 0
Left wheels forward (left_pwm > 0)	RD2 = left_pwm	RD1 = 0
Left wheels backward (left_pwm < 0)	RD1 = -left_pwm	RD2 = 0
Right wheels forward (right_pwm > 0)	RD4 = right_pwm	RD3 = 0
Right wheels backward (right_pwm < 0)	RD3 = -right_pwm	RD4 = 0

- Battery sensing
 - The voltage of the battery (BAT-VSENSE in the figure below) is available on pin AN11. It is sensed after a partitioning circuit, i.e., in between a 200 kohm resistor and a 100 kohm resistor.

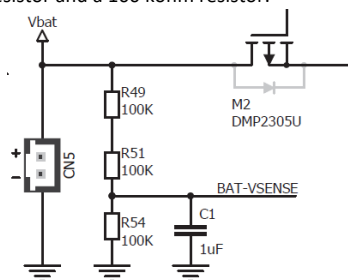

- IR sensor
 - The infrared sensor should be mounted on the *Buggy Mikrobus* 1 or 2 (i.e., in front of the buggy). The signal can be read on AN14/AN15, while the enable to the IR sensor must be given on the digital I/O on RB9/RA3.
- Data logging / command interface through UART

- The UART to RS232 module should be installed on the *Clicker Mikrobis* 2. The TX signal should be remapped to RD0/RP64, while the RX signal should be remapped to RD11/RPI75.
- The microcontroller should send, to the PC, the following messages (in all the states)
 - \$MBATT,v_batt* where v_batt is the sensed battery in Volt, at 1 Hz frequency. Use two digits, i.e., X.YZ
 - \$MDIST,distance* where distance is the sensed distance in cm, at 10 Hz frequency. Use an integer.
 - \$MANGLE,roll,pitch,yaw* where roll, pitch, yaw are the three angles computed using the accelerometer and the magnetometer at 10 Hz frequency.
- The microcontroller should receive, from the PC, the following messages (in all the states)
 - \$PCREF,speed,yawrate*, where speed is a signal from -100 to 100% for the forward motion and yawrate is also a signal from -100 to 100% indicating the angular velocity (positive being anticlockwise).
 - The message can come at any frequency, until bandwidth saturation.
- Given the chosen UART baud rate, the firmware should never lose a message due to its implementation (i.e., proper dimensioning of buffers), even with full use of the bandwidth.

Evaluation criteria

Among other things, these criteria will be used:

- Adherence to the provided specifications
- Correctness of the interrupts service routines
- Correct handling of shared data
- Management of the UART FIFO and circular buffers on both sending and receiving
- General code cleanliness
- Use of AI tools is allowed only as a reference/debugging aid. Students must fully understand and justify every part of the implementation.

Pin Mapping

- RB8 Left side lights
- RF1 Right-side lights
- RF0 brakes
- RG1 low intensity lights
- RA7 beam headlights
- AN11 battery sensing
- RD1/RP65 left PWM backward motion
- RD2/RP66 left PWM forward motion
- RD3/RP67 right PWM backward motion
- RD4/RP68 right PWM forward motion
- AN14 or AN15 IR sensor voltage
- RB9 or RA3 IR sensor enable
- RD0/RP64 UART TX
- RD11/RPI75 UART RX