

Midsouth Home Inspections
1280 River Hollow Cove
Cordova, TN 38016
(901) 336-3551
midsouthhomeinspections.com
diley123@yahoo.com
Inspected By: Dan Iley



Home Inspection Report

Prepared For:

Unspecified Client

Property Address:

2881

Cordell

Memphis, TN 38118

Inspected on Thu, Jun 13 2024 at 10:15AM

Table of Contents

General	4
Site	4
Exterior	5
Roofing	7
Structure	7
Electrical	10
HVAC	12
Plumbing	15
Bathrooms	16
Kitchen	20
Laundry	22
Interior	22
Report Summary	27

Thank you for the opportunity to conduct a home inspection of the property listed above. We understand that the function of this report is to assist you in understanding the condition of the property to assist in making an informed purchase decision.

The report contains a review of components in the following basic categories: site, exterior, roofing, structure, electrical, HVAC, plumbing, and interior. Additional categories may or may not be included. The report is designed to be easy to read and comprehend however it is important to read the entire report to obtain a full understanding of the scope, limitations and exclusions of the inspection.

In addition to the checklist items of the report there are several comments which are meant to help you further understand certain conditions observed. These are easy to find by looking for their icons along the left side margin. Comments with the blue icon are primarily informational and comments with the orange icon are also displayed on the summary. Please read them all.

DEFINITION OF CONDITION TERMS

Satisfactory: At the time of inspection the component is functional without observed signs of a substantial defect.

Marginal: At the time of inspection the component is functioning but is estimated to be nearing end of useful life. Operational maintenance recommended. Replacement anticipated.

Repair or Replace: At the time of inspection the component does not function as intended or presents a Safety Hazard. Repair or replacement is recommended.

Further Evaluation: The component requires further technical or invasive evaluation by qualified professional tradesman or service technician to determine the nature of any potential defect, the corrective action and any associated cost.

General

Property Type:	Single Family
Stories:	One
Approximate Age:	60 years old
Age Based On:	Shelby county assessors website
Bedrooms/Baths:	3/2
Door Faces:	South
Furnished:	No
Occupied:	No
Weather:	Sunny
Temperature:	Warm
Soil Condition:	Dry
Utilities On During Inspection:	Electric Service, Gas Service, Water Service

Square Footage



Comment 1:
1344 ft.²

Site

The condition of the vegetation, grading, surface drainage and retaining walls that are likely to adversely affect the building is inspected visually as well as adjacent walkways, patios and driveways.

Site Grading:	Mostly Level, Sloped Away From Structure Condition: Satisfactory
Vegetation:	Generally Maintained Condition: Satisfactory
Driveway:	Concrete Condition: Satisfactory
Walkways:	Concrete Condition: Satisfactory
Steps/Stoops:	Concrete Condition: Satisfactory

(Site continued)

Patios/Decks: Concrete
Condition: Satisfactory

Exterior

The visible condition of exterior coverings, trim and entrances are inspected with respect to their effect on the condition of the building.

Exterior Covering: Brick, Vinyl Siding
Condition: Satisfactory
Exterior Trim Material: Wood, Vinyl, Aluminum
Condition: Satisfactory
Windows: Aluminum
Condition: Satisfactory
Entry Doors: Wood, Steel
Condition: Satisfactory



Comment 2:
General pictures of exterior.



Figure 2-1



Figure 2-2

(Exterior continued)



Figure 2-3



Figure 2-4



Comment 3:
Overhead light not working in storage room.



Figure 3-1

(Exterior continued)

**Comment 4:**

No legible house numbers were noted at time of inspection.

Roofing

The visible condition of the roof covering, flashings, skylights, chimneys and roof penetrations are inspected. The purpose of the inspection is to determine general condition, NOT to determine life expectancy.

Inspection Method:	Walked Roof/Arms Length
Roof Design:	Gable
Roof Covering:	3 Tab Shingle
	Condition: Satisfactory
Approximate Roof Age:	5 to 7 years old
Ventilation Present:	Gable Ends
	Condition: Satisfactory
Chimney :	Brick
	Condition: Satisfactory
Flashings:	Metal
	Condition: Satisfactory
Soffit and Fascia:	Wood, Aluminum, Vinyl
	Condition: Satisfactory
Gutters & Downspouts:	Metal
	Condition: Satisfactory

Structure

The visible condition of the structural components is inspected. The determination of adequacy of structural components is beyond the scope of a home inspection.

Foundation Types:	Crawl Space
Foundation Material:	Poured Concrete, Concrete Block
	Condition: Satisfactory
Signs of Water Penetration:	Moisture
	Condition: Satisfactory

(Structure continued)

Floor Structure:	Wood Frame
	Condition: Satisfactory
Subflooring:	Solid Wood Plank
	Condition: Satisfactory
Wall Structure:	Full Masonry
	Condition: Satisfactory



Comment 5:
Foundation was in satisfactory condition at time of inspection.



Figure 5-1



Figure 5-2

Attic

Attic Entry:	Hallway
Roof Framing Type:	Joist and Rafters
	Condition: Satisfactory
Roof Deck Material:	Solid Wood Plank
	Condition: Satisfactory
Insulation:	Blown In Fiberglass
	Condition: Satisfactory

(Attic continued)



Comment 6:

Attic is in good condition.. Framing is sound and there is no evidence of leaks



Figure 6-1



Figure 6-2



Comment 7:

Some insulation missing as noted by pictures.



Figure 7-1



Figure 7-2

Electrical

The inspector can not inspect hidden wiring or verify if the number of outlets is per the National Electric Code. A representative number of outlets, switches and fixtures are tested for operation.

Type of Service:	Overhead
Main Disconnect Location:	Service Panel
Service Panel Location:	Storage room
Service Panel Manufacturer:	General Electric
	Condition: Satisfactory
Service Voltage:	240 volts
Service Amperage:	200 amps
Service Panel Ground:	Ground Rod
Branch Circuit Wiring:	Non-Metallic Shielded Copper
	Condition: Satisfactory
Overcurrent Protection:	Breakers
	Condition: Satisfactory
GFCI/AFCI Breakers:	Yes
	Condition: Satisfactory
Smoke Detectors:	9 volt Battery Type
	Condition: Satisfactory

(Electrical continued)



Comment 8:



Figure 8-1



Comment 9:

Empty breaker slots need to be covered for safety.



Figure 9-1

(Electrical continued)



Comment 10:

Carbon monoxide detector is installed.



Figure 10-1

HVAC

HVAC System Type: Central Split System

Heating

The heating system is inspected visually and operated by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of the heating system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Location:	Attic
Type of Equipment:	Forced Air
	Condition: Satisfactory
Manufacturer:	Temp star
Heating Fuel:	Gas
	Condition: Satisfactory
Approximate Age:	Three years old

(Heating continued)

Filter Type:

Disposable

Condition: Satisfactory

Type of Distribution:

Metal Ducting

Condition: Satisfactory



Comment 11:

Heat operating as intended.

Register temps above 100 degrees



Figure 11-1



Figure 11-2

Furnaces over 10 years old should be checked, cleaned and serviced yearly by a licensed contractor.

The cooling system is inspected by operation of the equipment by normal controls to determine general condition NOT life expectancy. The capacity or adequacy of cooling system is beyond the scope of a home inspection. A licensed HVAC contractor should be consulted if in question.

Energy Source:	Electric
Type of Equipment:	Split System
	Condition: Satisfactory
Condenser Make:	Carrier
Condenser Approximate Age:	Two years old

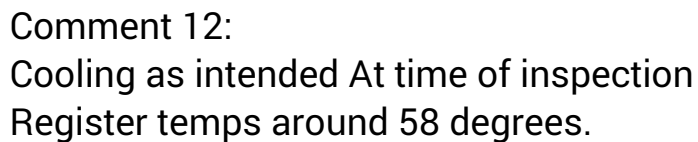


Figure 12-2

Air conditioners over 10 years old and heat pumps over 5 years old should be checked, cleaned and serviced yearly by a licensed contractor.

Plumbing

The plumbing system is inspected visually and by operating a representative number of fixtures and drains. Private water and waste systems are beyond the scope of a home inspection.

Supply Pipe Material:	Copper
	Condition: Satisfactory
Location of Main Water Shutoff:	At Meter
Waste Pipe Material:	PVC, Cast Iron
	Condition: Satisfactory
Location of Fuel Shutoff:	At Meter

Water Heater

Manufacturer:	Rheem
Fuel:	Natural Gas
Capacity:	40 gal
Approximate Age:	Eight years old
Temp & Pressure Relief Valve:	Present With Blow Off Leg
	Condition: Satisfactory
Fuel Disconnect:	In Same Room

(Water Heater continued)



Comment 13:
Hot water temperature 117°.



Figure 13-1

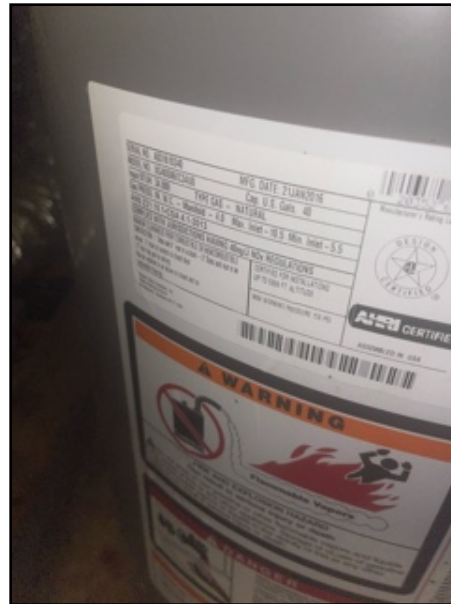


Figure 13-2

Bathrooms

(Bathrooms continued)



Comment 14:



Figure 14-1



Figure 14-2



Figure 14-3



Figure 14-4

(Bathrooms continued)



Comment 15:

Knobs or handles need to be installed on vanity and hall bathroom.



Figure 15-1



Comment 16:

No mirror installed in master bathroom.

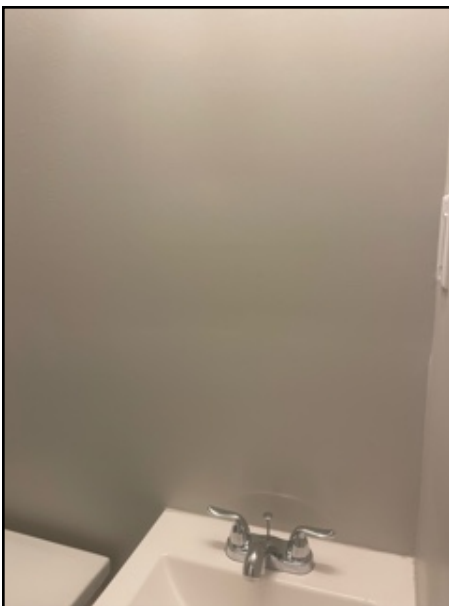


Figure 16-1

(Bathrooms continued)



Comment 17:
Toilet will not flush in master bathroom.



Figure 17-1



Comment 18:
No water pressure in master bathroom sink.



Figure 18-1

(Bathrooms continued)



Comment 19:

Shower water in master bathroom only gets lukewarm Further evaluation needed by Plumber.



Figure 19-1

Kitchen

Cabinets:	Wood Condition: Satisfactory
Countertops:	Laminated Condition: Satisfactory
Sink:	Double Condition: Satisfactory

(Kitchen continued)



Comment 20:



Figure 20-1



Figure 20-2



Comment 21:

Drawer guide and double switch cover needed in kitchen.



Figure 21-1



Figure 21-2

Laundry

Dryer Venting:	To Exterior
	Condition: Satisfactory
Laundry Hook Ups:	Yes
	Condition: Satisfactory



Comment 22:

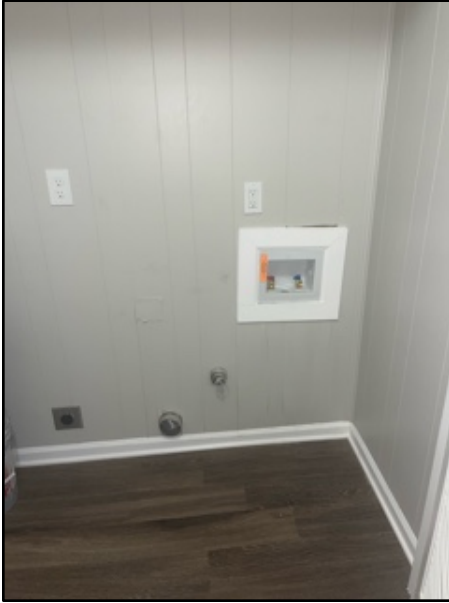


Figure 22-1

Interior

The interior inspection is limited to readily accessible areas that are not concealed by furnishings or stored items. A representative number of windows and doors.

Floors:	Vinyl
	Condition: Satisfactory
Walls:	Painted Drywall
	Condition: Satisfactory
Window Types:	Single Hung
	Condition: Satisfactory
Window Materials:	Aluminum
Entry Door Types:	Hinged
	Condition: Satisfactory

(Interior continued)

Entry Door Materials: Wood, Steel
Interior Door Materials: Wood



Comment 23:
General pictures of Living room, dining area, bedrooms and closets.



Figure 23-1

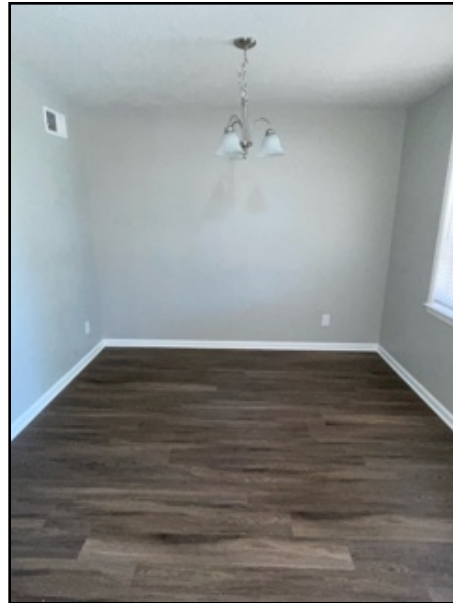


Figure 23-2



Figure 23-3



Figure 23-4

(Interior continued)



Figure 23-5



Figure 23-6



Figure 23-7



Figure 23-8

(Interior continued)



Figure 23-9

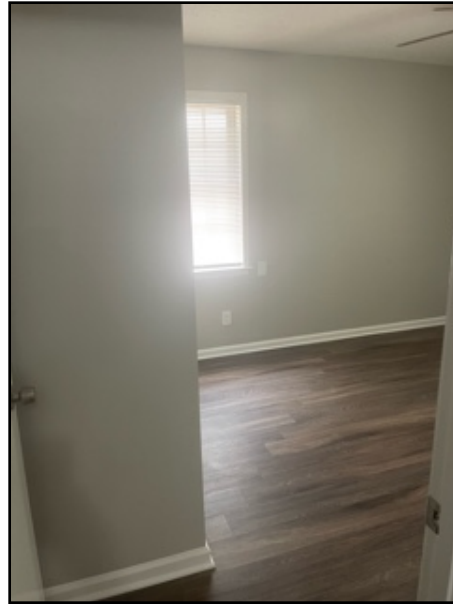


Figure 23-10



Figure 23-11



Figure 23-12

(Interior continued)



Comment 24:
Ceiling fan not working in living room.



Figure 24-1

Report Summary

Exterior

1) Overhead light not working in storage room.



Figure 3-1

2) No legible house numbers were noted at time of inspection.

(Report Summary continued)

Structure: Attic

3) Some insulation missing as noted by pictures.



Figure 7-1



Figure 7-2

Electrical

4) Empty breaker slots need to be covered for safety.



Figure 9-1

(Report Summary continued)

Bathrooms

5) Knobs or handles need to be installed on vanity and hall bathroom.



Figure 15-1

6) No mirror installed in master bathroom.

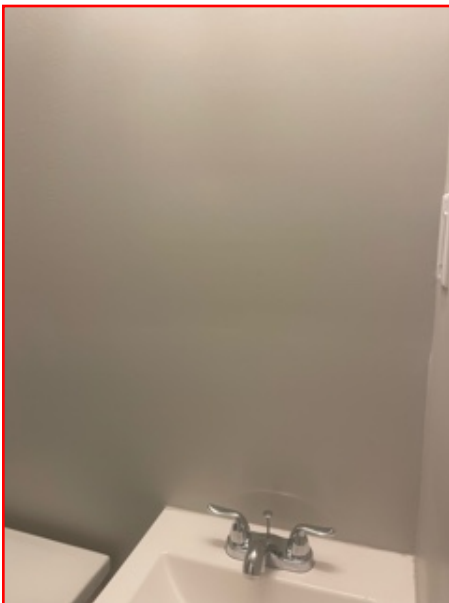


Figure 16-1

7) Toilet will not flush in master bathroom.

(Report Summary continued)



Figure 17-1

8) No water pressure in master bathroom sink.



Figure 18-1

9) Shower water in master bathroom only gets lukewarm Further evaluation needed by Plumber.

(Report Summary continued)



Figure 19-1

Kitchen

10) Drawer guide and double switch cover needed in kitchen.



Figure 21-1



Figure 21-2

(Report Summary continued)

Interior

11) Ceiling fan not working in living room.



Figure 24-1