
## 4576551

1 Automatic Drive • P.O. Box 440 • Bellows Falls, VT 05101-0440 USA (800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

Valve Body

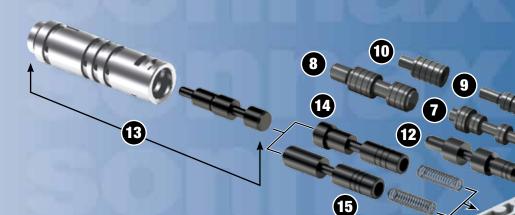

1 84754-34K

**TCC Regulated Apply Valve Kit** 

Helps cure:

- TCC slip
- Code 741
- Ratio Codes

Note: Requires tool kit 84754-TL3

(2) 84754-43K **TCC Apply Valve Kit** 



Helps cure:

- Code 741
- No lockup
- Falling out of lockup hot
- Converter shudder
- High-slip RPM

Note: 84754-50K requires tool kit F-84754-TL50 & the VB-FIX reaming fixture





**Oversized Pressure Regulator Valve Kit** 

Helps cure:

- High/Unstable line pressure
- Slide/Rotor failures
- Lube/Overheated converter issues

Note: Requires tool kit 84754-TL46





Helps cure:

- Code 1811
- Maximum adaptive/long shift
- TCC slippage/piston failure

Note: Requires tool kit F-84596-TL & the VB-FIX reaming fixture





**Oversized Torque Signal Valve** 

Helps cure:

- Code 1811
- Poor/Intermittent line rise
- Slip/Shudder condition
- TCC codes 741, 742


Note: Requires tool kit 84754-TL44

(6) 84754-30K

**Boost Valve & Sleeve Kit** 

Helps cure:

- Harsh reverse engagement
- Soft shifts, especially 1-2
- Low line rise forward/reverse

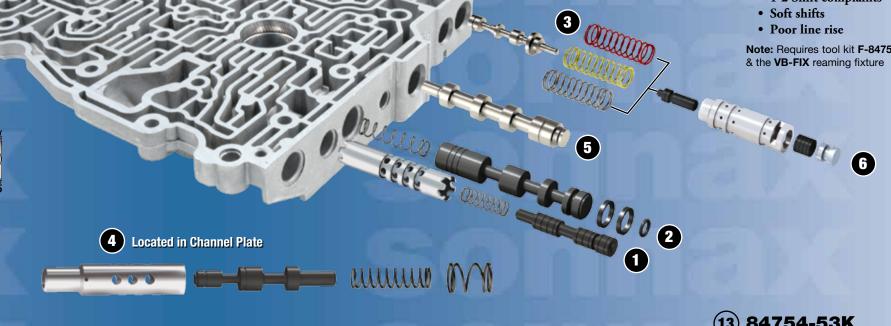

(7) 84754-36K 2-3 Shift Valve

(8) 84754-37K

3-2 Downshift Valve

- (9) 84754-38K 3-4 Shift Valve
- (10) 84754-39K

4-3 Downshift Valve

Helps cure:

• Erratic/Temperature sensitive shifts

11

- Wrong gear starts
- Worn shift valves

(11) 84754-40K



## **Oversized 1-2 & Reverse** Servo Boost Valve Kit


Helps cure:

- Delayed engaements
- Flared 1-2
- Low reverse pressure
- Burned 1-2 band

Note: Requires tool kit 84754-TL2

(12) 84754-57K

Valve Kit





- 1-2 Shift complaints
- Soft shifts
- Poor line rise

Note: Requires tool kit F-84754-TL57 & the VB-FIX reaming fixture






2-3 Accumulator Valve Kit


Helps cure:

- 2-3 Shift complaints
- Soft shifts
- Poor line rise





(15) 84754-58K Volvo



Helps cure:

- 3-4 Shift complaints
- Soft shifts
- Poor line rise

Note: Requires tool kit F-84754-TL55 & the VB-FIX reaming fixture

