PART NUMBERS 15741-05K, F-15741-TL5

Complaint

SECONDARY COMPLAINTS

Cause

The K2 Clutch control valve provides source pressure for control of clutch (band) apply and release. Responding to TCU and the linear solenoid the K2 control valve will establish control timing of apply & release relative to engine torque. Bore wear will cause an overlap or premature exhaust of clutch pressure.

Correction

Ream the valve bore and install the Sonnax improved valve and sleeve assembly and calibrated spring.

K2 Clutch Control Valve Kit

15741-05K

1 K2 Clutch Control Valve





1 Reamer

1 Guide Pin


1 Reamer Jig



Note: Fits BMW 6F21WA & VW/Audi O9G, 09K, 09M.

Flare upshifts or downshifts

• Bind up, excess clutch overlap, clutch distress • Pressure control out of range codes

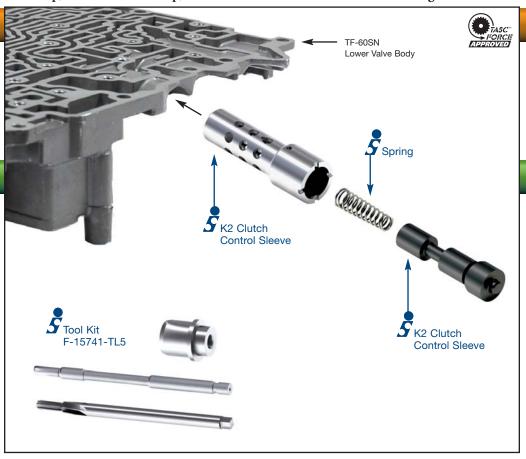

Features & Benefits

- Highly wear-resistant sleeve provides additional support to the control valve.
- Hard-coat anodized aluminum valve is wear-resistant, and has more sealing contact with bore than OEM to minimize leakage.
- New spring maintains OEM operating pressures.
- Allows salvage of previously non-repairable valve bodies and avoids searching for, and purchase
 of expensive replacement valve bodies.

You need this if...

Either a Wet Air Test or a Vacuum Test in the two locations shown, result in leakage. A vacuum test must hold a minimum of 18".

