46RH/RE A727 & 47RH/RE

Part Numbers 22900-10, 22900-15

COMPLAINT

No reverse or slip after low/reverse drum resurfacing

CAUSE

OEM strut of insufficient length to adequately hold drum after resurfacing

CORRECTION

These extended length struts compensate for material removed by machining when used drums are salvaged by machining the outer diameter.


Oversized Band Strut

22900-10

1 Oversized Band Strut, .100"

22900-15

1 Oversized Band Strut, .150"

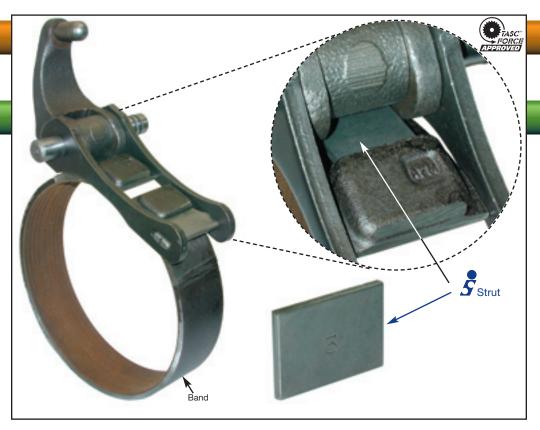

Sonnax Part Summary

After the low/reverse brake drum has been resurfaced and the brake band has been relined, the band may not hold during apply, causing a slip or no reverse. Sonnax has designed two extended struts, **22900-10** and **22900-15** to address these problems..

Features and Benefits:

- **22900-10** is .100" longer and **22900-15** is .150" longer to regain correct band adjustment.
- Use of these struts eliminates the need to use specially relined bands with a thicker lining.

