
41TE (604) '92

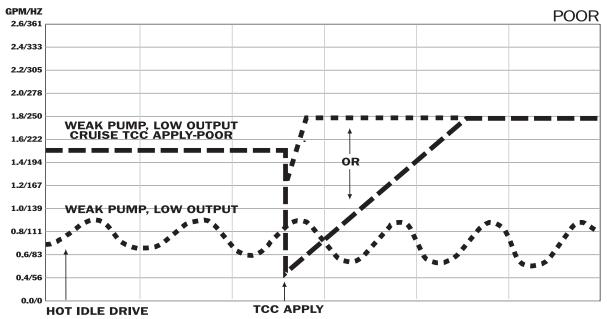

Correction: A good TCC should be quick and sharp rise to 1.8 to 2.1 gpm.

Notes: New valve body and weak pump may set code 38, low and erratic at low rpm. Three-second screen.