PART NUMBER 56200-02K

## Complain

SECONDARY COMPLAINT

## CAUSE

The pump flow control canister and plunger valve wear, allowing the plunger valve to stick open and/or leakage to occur. The canister o-ring relaxes and pressure bleeds past it.

## CORRECTION

This kit includes a harder canister with more support for the plunger valve, which prevents sticking, A case-hardened plunger valve with self-centering annular grooves, a replacement spring, and larger o-ring for improved sealing are also included.


# Pump Flow Control Valve Kit

#### 56200-02K

- 1 Pump Canister
- 1 Plunger Valve
- 1 Spring
- 1 O-Ring

### Delayed engagements

• Low line pressure

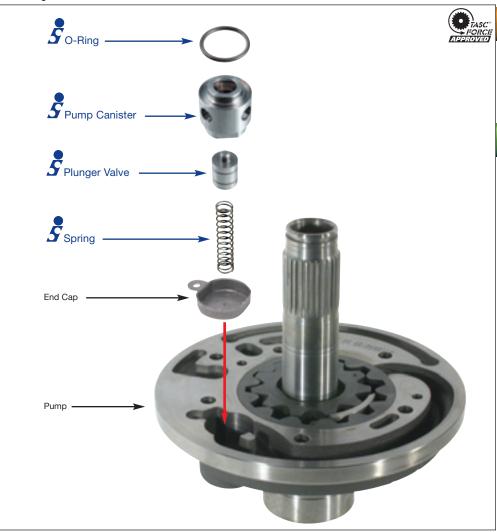

#### **Part Summary**

The OEM flow control valve is designed to increase pump efficiency by rerouting excess line pressure back to the suction side of the pump. It is common for the plunger valve to become stuck open, or for the canister to wear. This decreases line pressures and results in delayed engagements. The Sonnax pump flow control valve kit eliminates the sticking and wear problems with redesigned and precisely machined parts.

#### **Features & Benefits**

- Harder canister material resists wear and has improved valve support to prevent sticking.
- Plunger valve is made from case-hardened steel and has annular grooves to prevent side loading.
- Larger o-ring eliminates pressure loss at the pump face.

