
KM (175.5 '94 HYUNDAI)

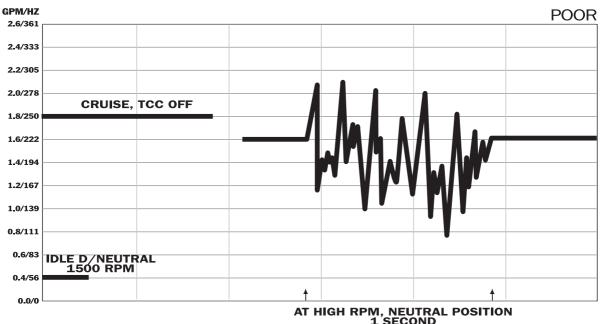

Condition: Slip bump forward, TCC pulling down, engine stall, delayed engagements, falling out of gear.

Correction: Gasket on filter to suction port leaking, low oil on stick.

Notes: Abnormal aeration.