PART NUMBERS 77917-01K, -471, -500

COMPLAINT

SECONDARY COMPLAINTS

CAUSE

MTV boost loss and insufficient line rise.

Correction

These replacement assemblies prevent oil loss between the oustide diameter of the TV sleeve and the pump body.

Throttle Boost Valve & Sleeve

77917-01K .423" diameter **77917-471** .471" diameter **77917-500** .500" diameter

Each includes the following

1 Boost Valve

1 Boost Sleeve

2 O-Rings


Also Available:

K77898

Reverse Boost Valve Kit

Burned 3-4 clutch

• Shortened band life • Soft slide shifts

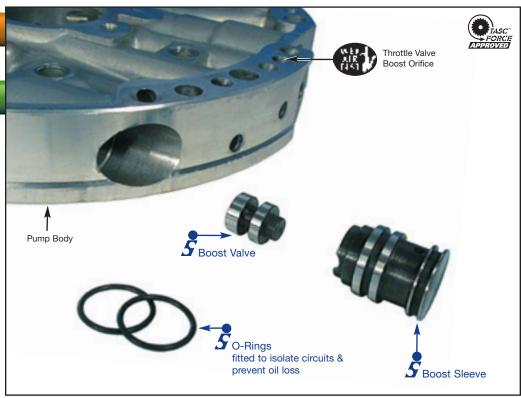

Sonnax Part Summary

A common problem in 4L60 transmissions is burned bands and/or 3-4 clutches. This failure can be reduced by eliminating throttle boost oil leakage. The Sonnax replacement assemblies **77917-01K** (.423" diameter), **77917-471** (.471" diameter) and **77917-500** (500" diameter) eliminate these problems for a variety of applications.

Features & Benefits

- Throttle valve boost valve and sleeve are made from made from hardened steel for better wear resistance.
- O-rings on sleeve separate throttle pressure and reverse boost circuits, providing additional protection against cross leaks.
- O-rings prevent loss of oil between the outside diameter of the throttle valve sleeve and pump body.

