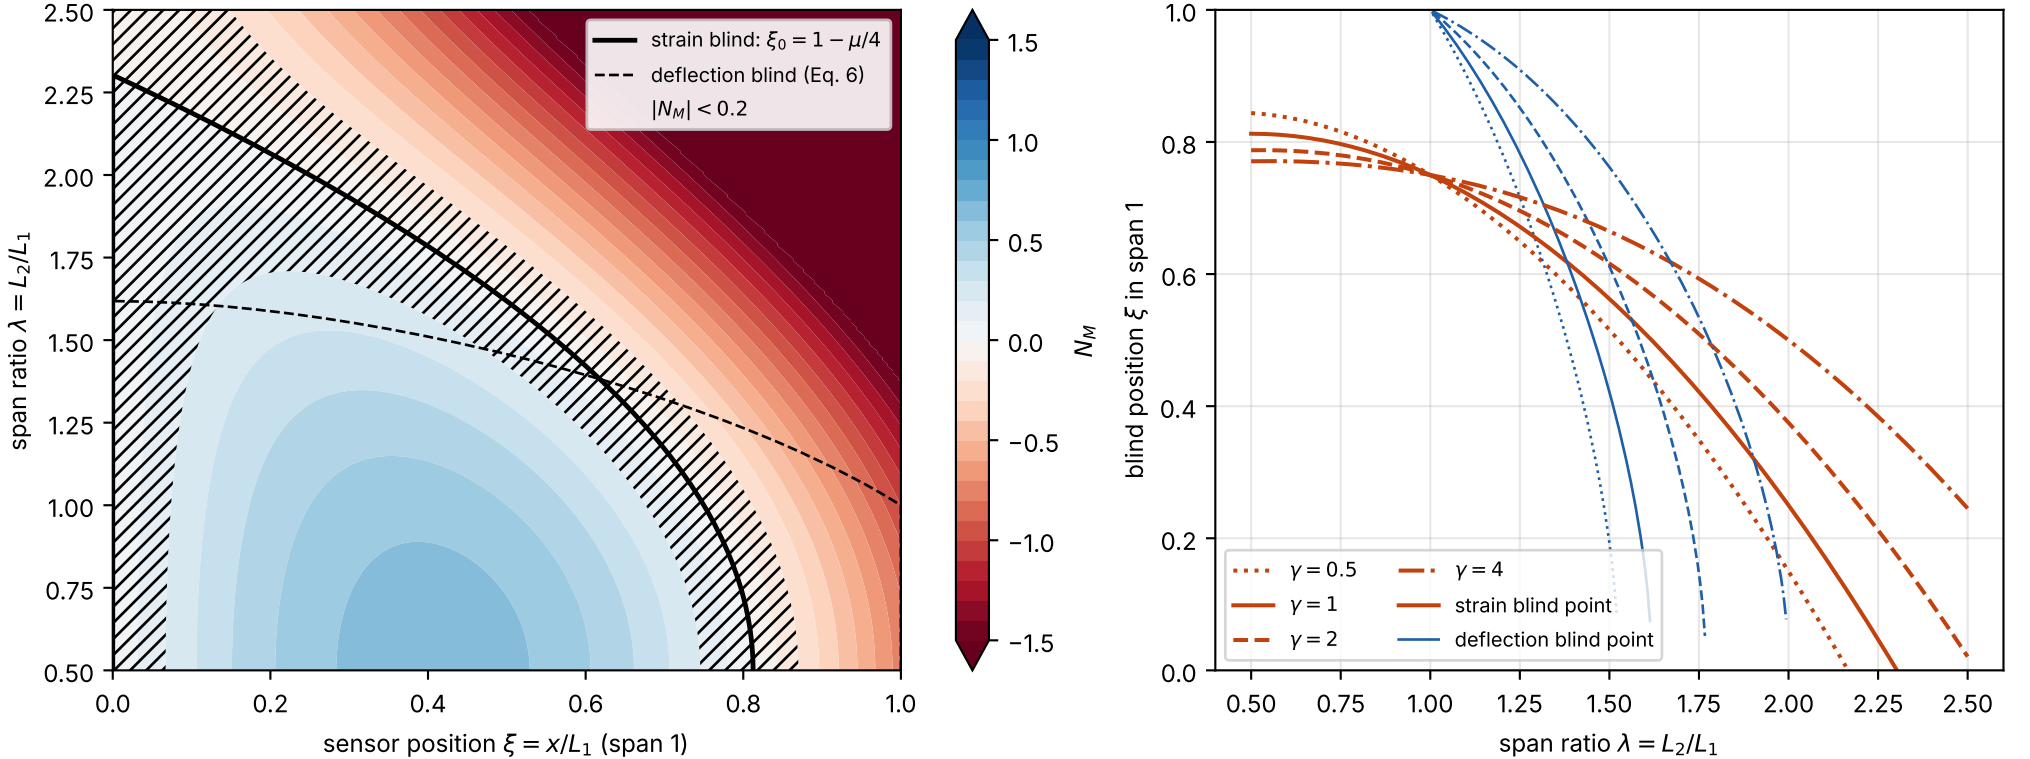

(a) strain indicator $N_M = 8M_q(x_m)/(q_0 L_1^2)$, $\gamma = 1$
strain blind: $\xi_0 = 1 - \mu/4$
deflection blind (Eq. 6)
$|N_M| < 0.2$
span ratio $\lambda = L_2/L_1$
sensor position $\xi = x/L_1$ (span 1)
N_M
(b) blind positions: strain for every $\mu < 4$, deflection only for $1 < \mu < 2$
blind position ξ in span 1
span ratio $\lambda = L_2/L_1$
$\gamma = 0.5$
$\gamma = 1$
$\gamma = 2$
$\gamma = 4$
strain blind point
deflection blind point