
First Steps with CodeWarrior and setting HCS12 Serial Monitor via GDI Target Interface within an existing project


- 1. Run the CodeWarrior IDE with the shortcut created in the program group.
- 2. Open the project.
- 3. Choose the menu **Project > Debug** to start the debugger.
- 4. Choose in the debugger menu **Component > Set Target...** to select another target interface.

Figure 2.3 GDI Target Interface Selection

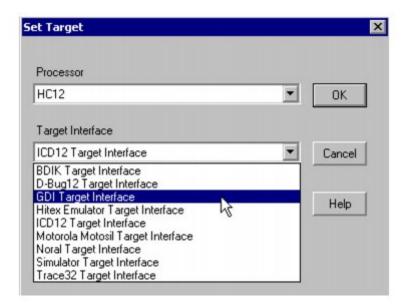

5. Now in the GDI Setup dialog, press the browse button and browse for the *hcs12serialmon* dll file.

Figure 2.4 Browse for HCS12SerialMon GDI DLL

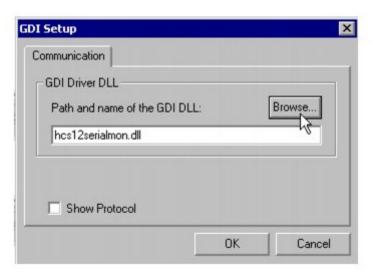

6. Now in the Monitor Setup dialog, choose the correct Host serial communication port if necessary. In the *Load Options* panel, you can specify not to mass erase automatically the target processor before flashing (by default, mass erasing is performed).

Figure 2.5 Monitor Setup Dialog



7. Press the OK button to start debugging.

