


Touchscreen Calibration

This article shows the starting options for the touchscreen calibration tool in IGEL OS.

Menu path: **User Interface > Input > Touchscreen > Touchscreen Calibration**

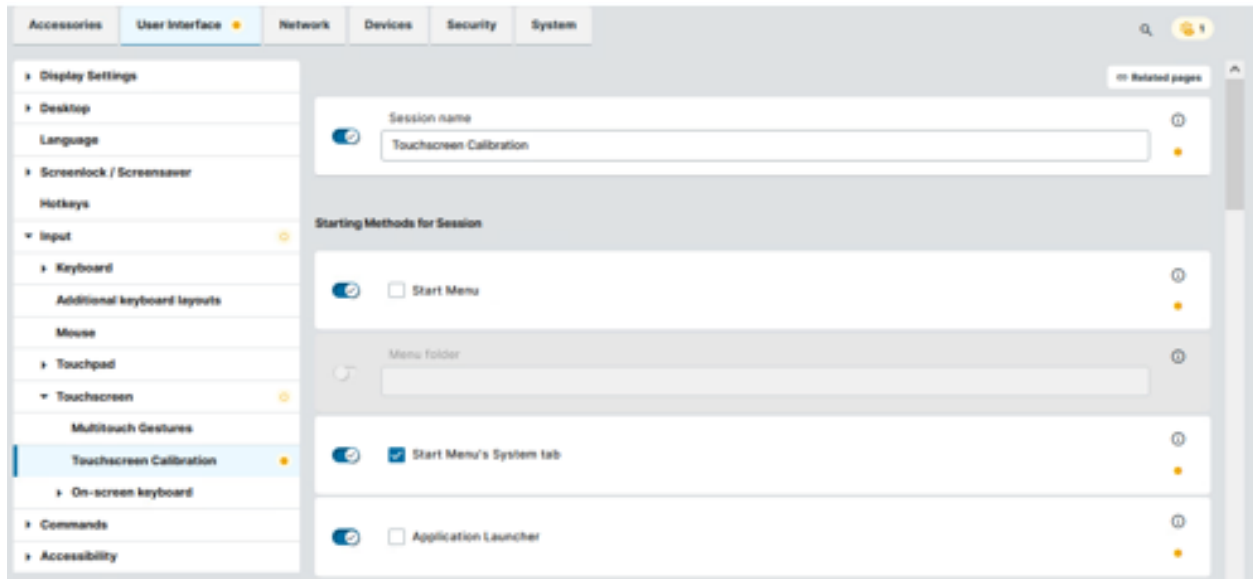

Unable to render {include} The included page could not be found.

Setting up the Calibration Tool

1. Go to [User Interface > Input > Touchscreen](#).
2. Activate **Enable touchscreen** and configure the rest of the settings according to your needs.
3. In the **Touchscreen monitor** dropdown, select **Automatic** as the recommended setting. If you must select a specific port, ensure it matches the physical connection (e.g., DisplayPort, HDMI).
4. Save the settings and run the calibration. The calibration starts automatically if enabled, or can be started manually based on the **Starting Methods for Session** settings.

Troubleshooting

If you selected a specific port under **Touchscreen monitor** and the calibration does not start, this can be due to a mismatch with the physical connection.

1. Check if you see the `Calibrated touchscreen port not found` in the logs.
2. Verify that the selected port is physically connected.
3. Use the command `get_drm connectors x11 connected` to list connected ports.
4. Change the settings inline with the connected ports.
5. Try the calibration again.

If the calibration still does not work and you are unsure why:

→ Switch back to **Automatic** in the **Touchscreen monitor** dropdown, and try the automatic calibration.