



IMU 추적 QC — FR5 teleop 프로빙 블록 'probe' · chip

회색 띠 = 오른쪽 확대 구간


지연 6 ms 상관 0.915 보정후 RMS 6.17 deg

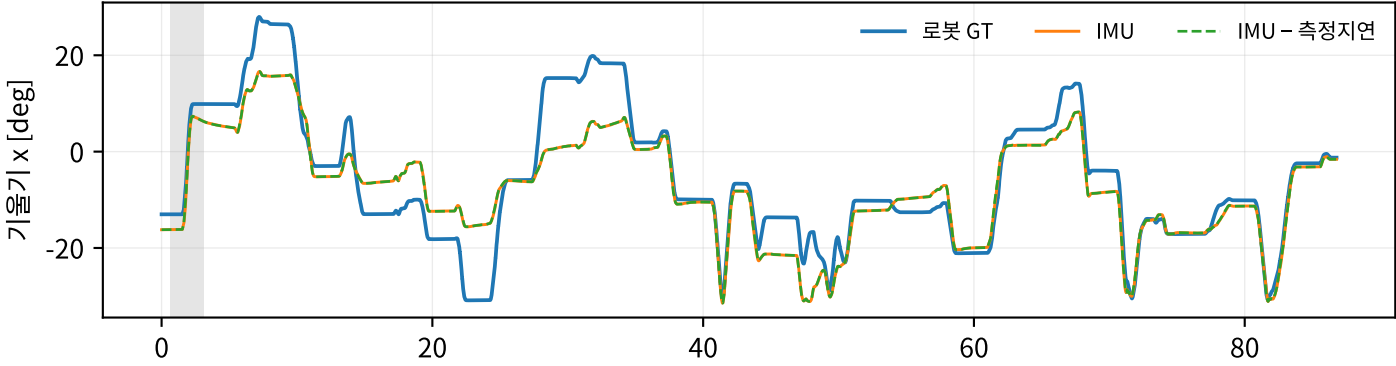




확대 — 세 행 모두 같은 창

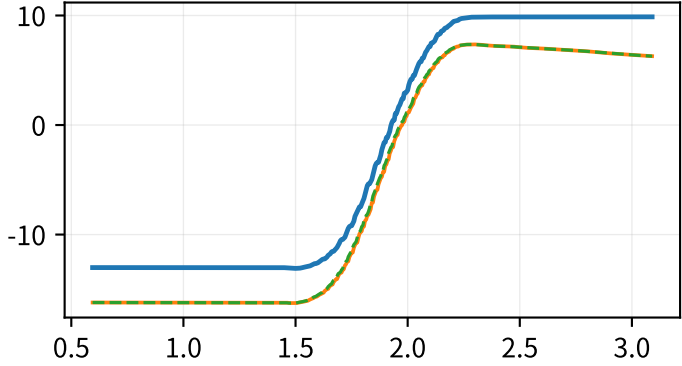




스크립트 자극 없음 — 오차 분포

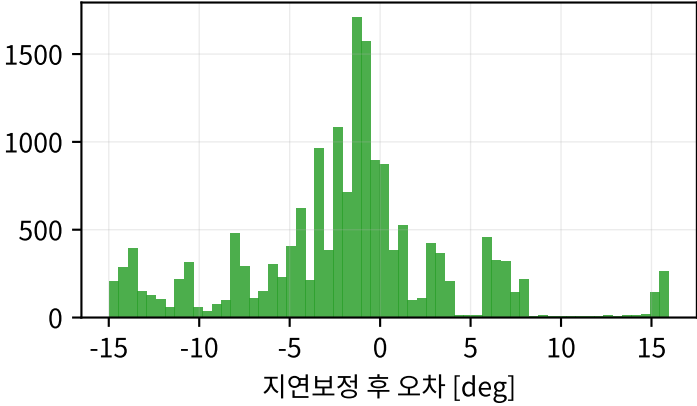


지연 3 ms 상관 0.977 보정후 RMS 3.98 deg

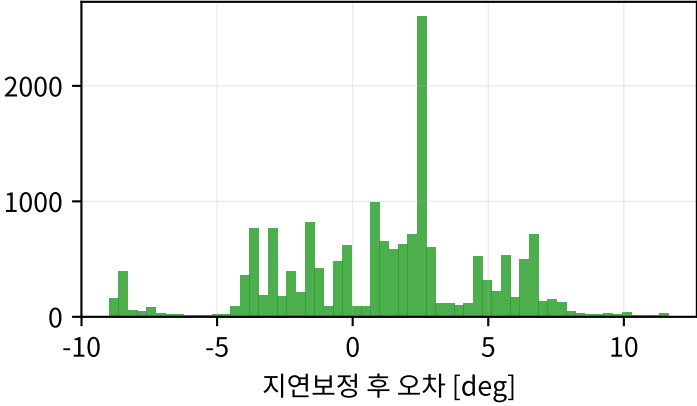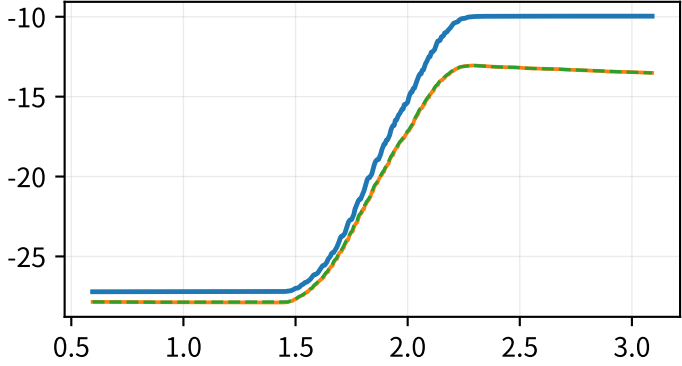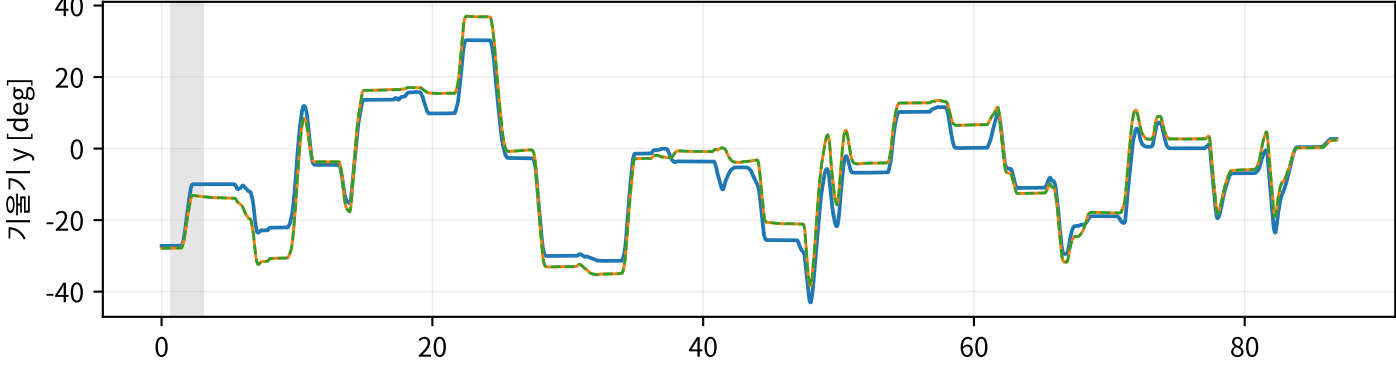


지연 -81 ms 상관 0.930 보정후 RMS 11.23 deg 기준 28 ms / 0.999

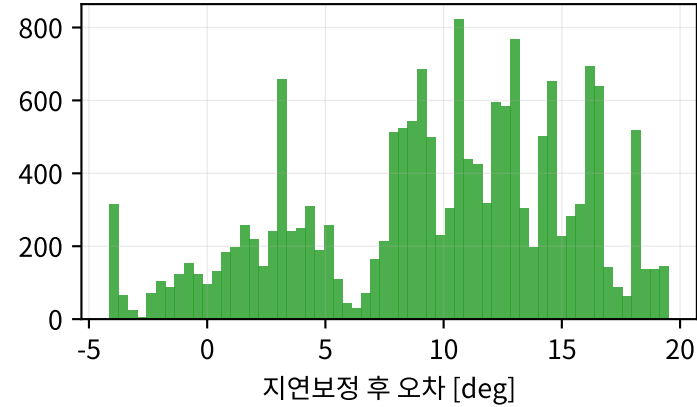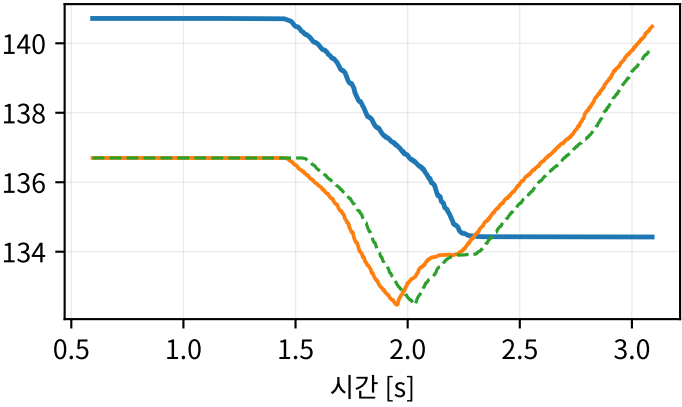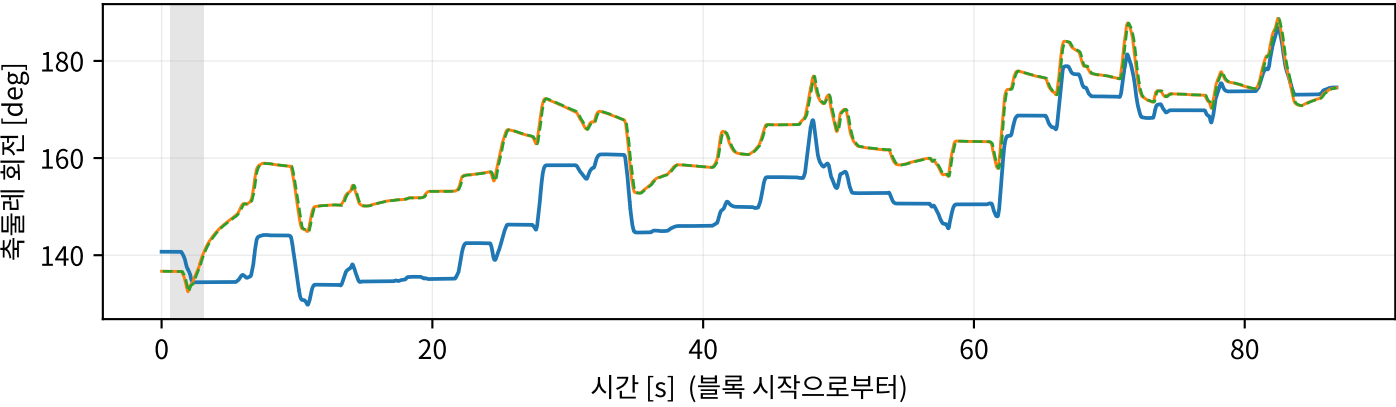

ZUPT 구간별 변위 오차 n=21

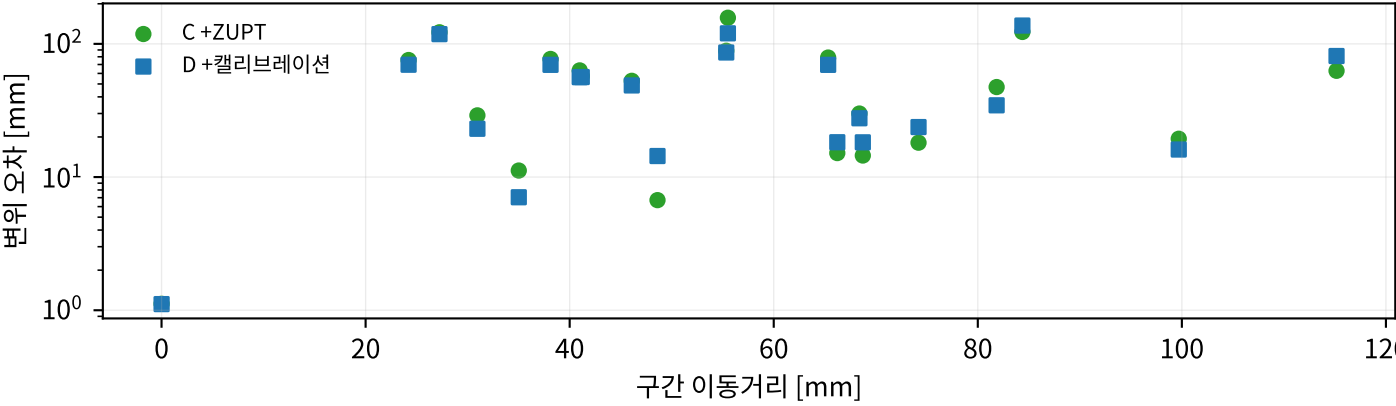

정지 구간 오차 바닥

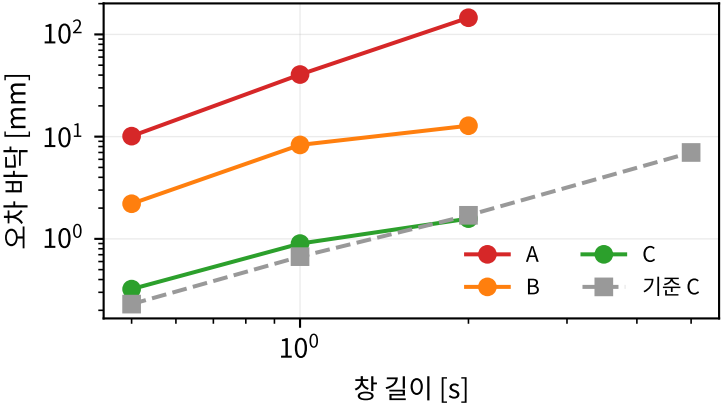

판정		
정렬 잔차 RMS	0.81 / 3	통과
동적 각오차 RMS (지연보정)	2.50 / 2	불합격
회전 실패 지연 [값]	20.95 / 50	통과
상호상관 최소	1.00 / 0.99	통과
heading(spin) 드리프트	0.23 / 1	통과
변위 오차 바닥 / § 9 실측 (최대 배수)	1.40 / 2	통과
[참고] 변위 오차 0.5 s 창 (C)	1.12 / —	-
[참고] 변위 오차 1 s 창 (C)	14.82 / —	-
[참고] 변위 오차 2 s 창 (C)	55.09 / —	-
[참고] 100 mm 이동 상대오차 (C,	미측정 / —	-