Revo 2.2.0 New Features in the Calibration Interface

Calibration processes have been made easier, with more helpful cues, and now account for changes made during Wax Calibration.

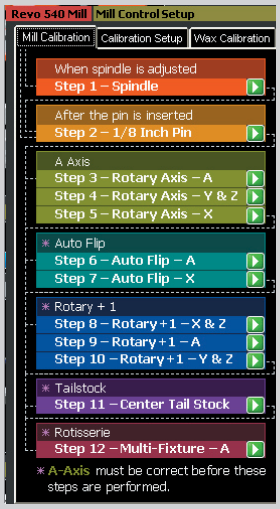

Revo 2.2.0 incorporates changes that will help in calibrating the tailstock while considering adjustments to the manual offsets that may have been needed during the Wax Calibration process. Other changes to the interface will help to ensure your calibration process and mill jobs run as smoothly and correctly as possible.

The proper order for running a complete mill calibration follows below. An account of other changes to the Revo software in this version - reminders for Step 2 of Calibration, Seek Tool, and helpful, illustrated cues for the Center Tail Stock step - follow this description.

Icon Key

Revo 540 Mill **Calibration Interface**

Mill Calibration **Mill Calibration Tab**

Wax Calibration **Wax Calibration Tab**

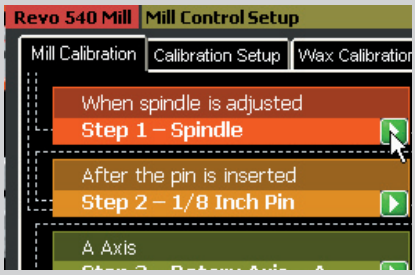

1 When to run Step 1

Only run Step 1 of the Mill Calibration interface if this is the very first time you've calibrated the mill, or if the collet was removed from the spindle or the spindle or collet were otherwise adjusted.

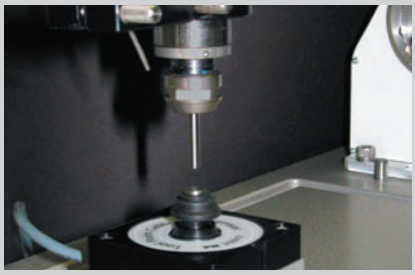

2 When to Run Step 2

Run Step 2 EVERY TIME you begin a calibration process. Since this step measures the dowel pin with the tool sensor, it is necessary every time the dowel pin is removed and replaced in preparation for calibration.

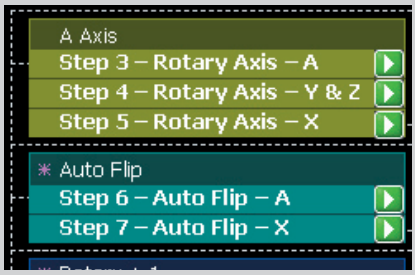

3 About Steps 3 - 7

Run these steps as necessary when running a complete calibration or when calibrating one fixture at a time. Be sure to note that steps 3 - 5, A axis calibration, must be run before calibrating any of the other fixtures.

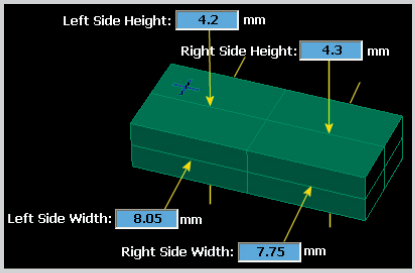

4 NEW!! When to run Wax Calibration

BEFORE running any steps between Step 8 and Step 12, run the Wax Calibration file found in this section of the Calibration interface.

Be VERY certain to run Wax Calibration BEFORE STEP 11!!

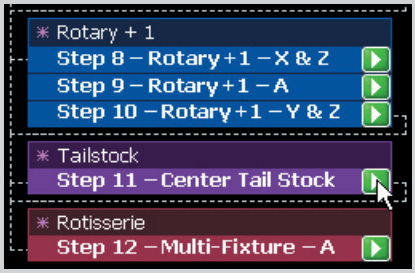

5 About Steps 8 - 12

AFTER running Wax Calibration, run steps 8 - 12. If you only need to calibrate the Tail Stock, run Wax Calibration, then jump to Step 11. Make certain you run Step 11 to re-center the tail stock EVERY TIME you run Wax Calibration and the manual offsets change.

Other Changes in Revo 2.2.0

After changing from a cutter to the dowel pin to begin a calibration step, the mill will now prompt you to run Step 2 to measure the dowel pin if you have not done so already. Similarly, the mill will prompt you to run Seek Tool if you have not done so after completing a calibration step and before beginning a mill job. Finally, Step 11 has improved graphics and cues for proper centering of the tail stock.