

MANUAL CUTTING PLANS

DXF geometry converted for manual marking and cutting

Coordinate / drilling rules

All dimensions in millimetres. Individual panel datum is lower-left = X0 / Y0.

X = horizontal from LEFT edge. Y = vertical UP from BOTTOM edge.

Sheet material: 18 mm plywood.

Dia 5 mm blind holes: 11 mm deep. Dia 15 mm cam holes: 14 mm deep.

Dia 20 mm holes: THROUGH. Dia 35 mm cup holes: 13 mm deep.

Where a 15 mm cam-lock hole is shown, drill an 8 mm mating edge hole centred on the cam bore.

Dia 5 and Dia 15 fixing holes may be omitted when using timber blocks / L-brackets.


Outer radii shown on the panel drawings are taken from the actual DXF bulge arcs.

DXF annotation/lettering is not treated as cut geometry.

Detected cut panels: 32 | Sheet counts: 8 / 9 / 8 / 7


Sheet 1 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

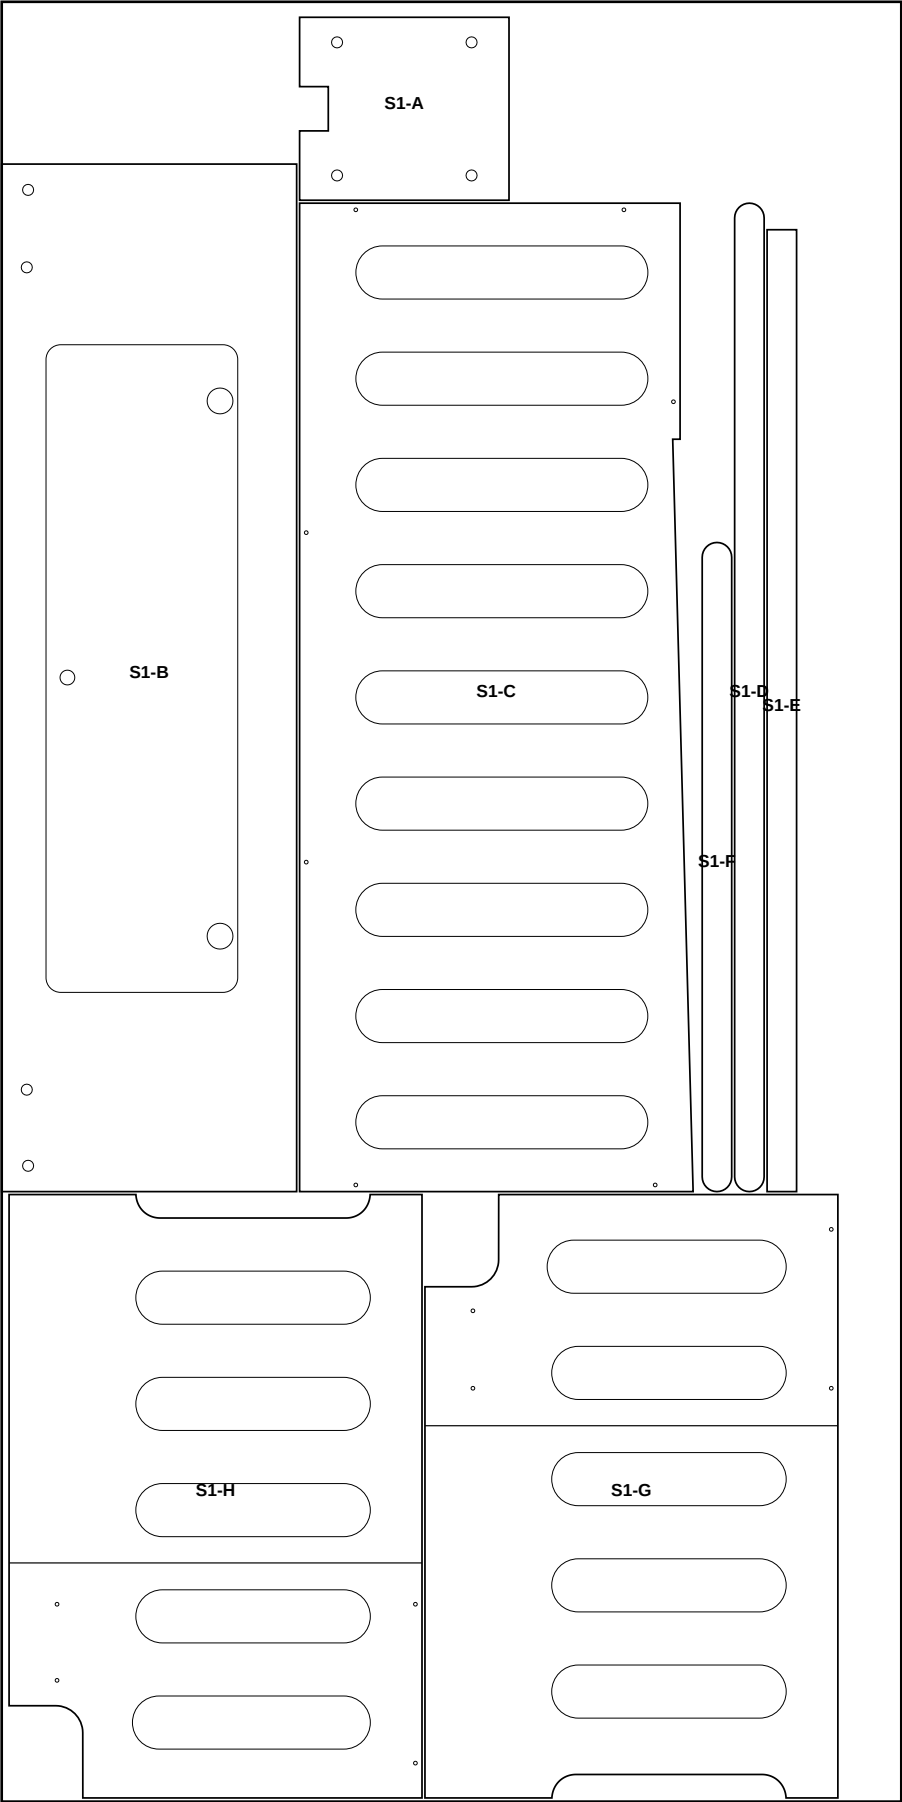


Sheet 2 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

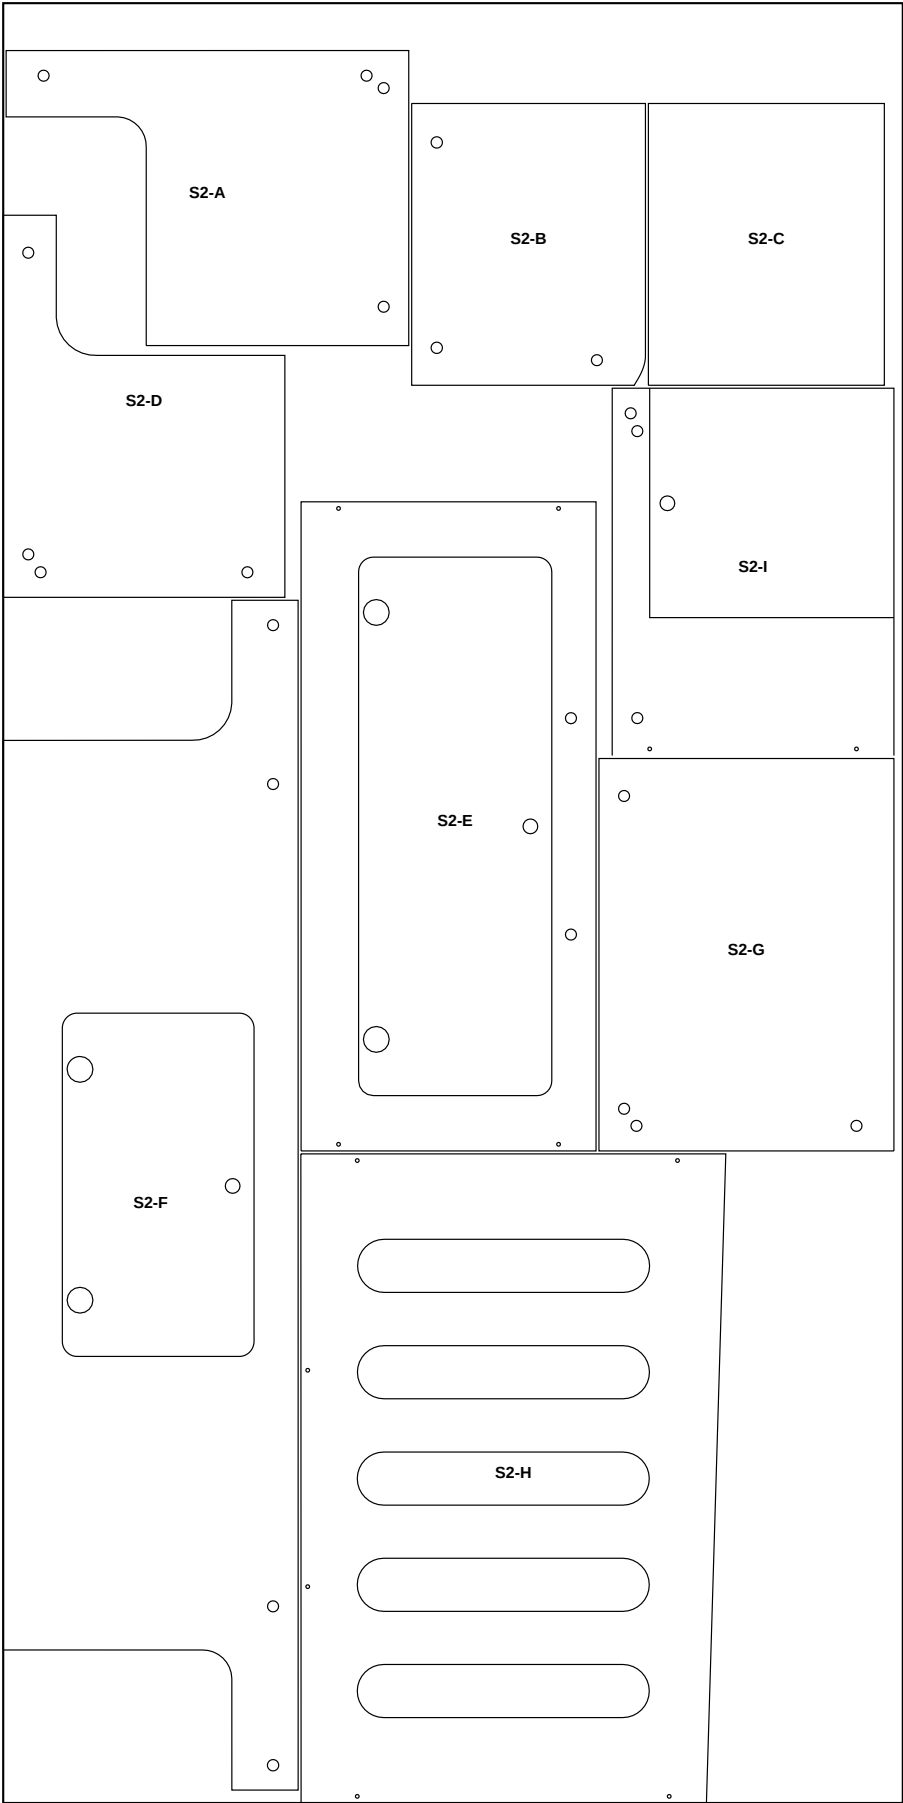


Sheet 3 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

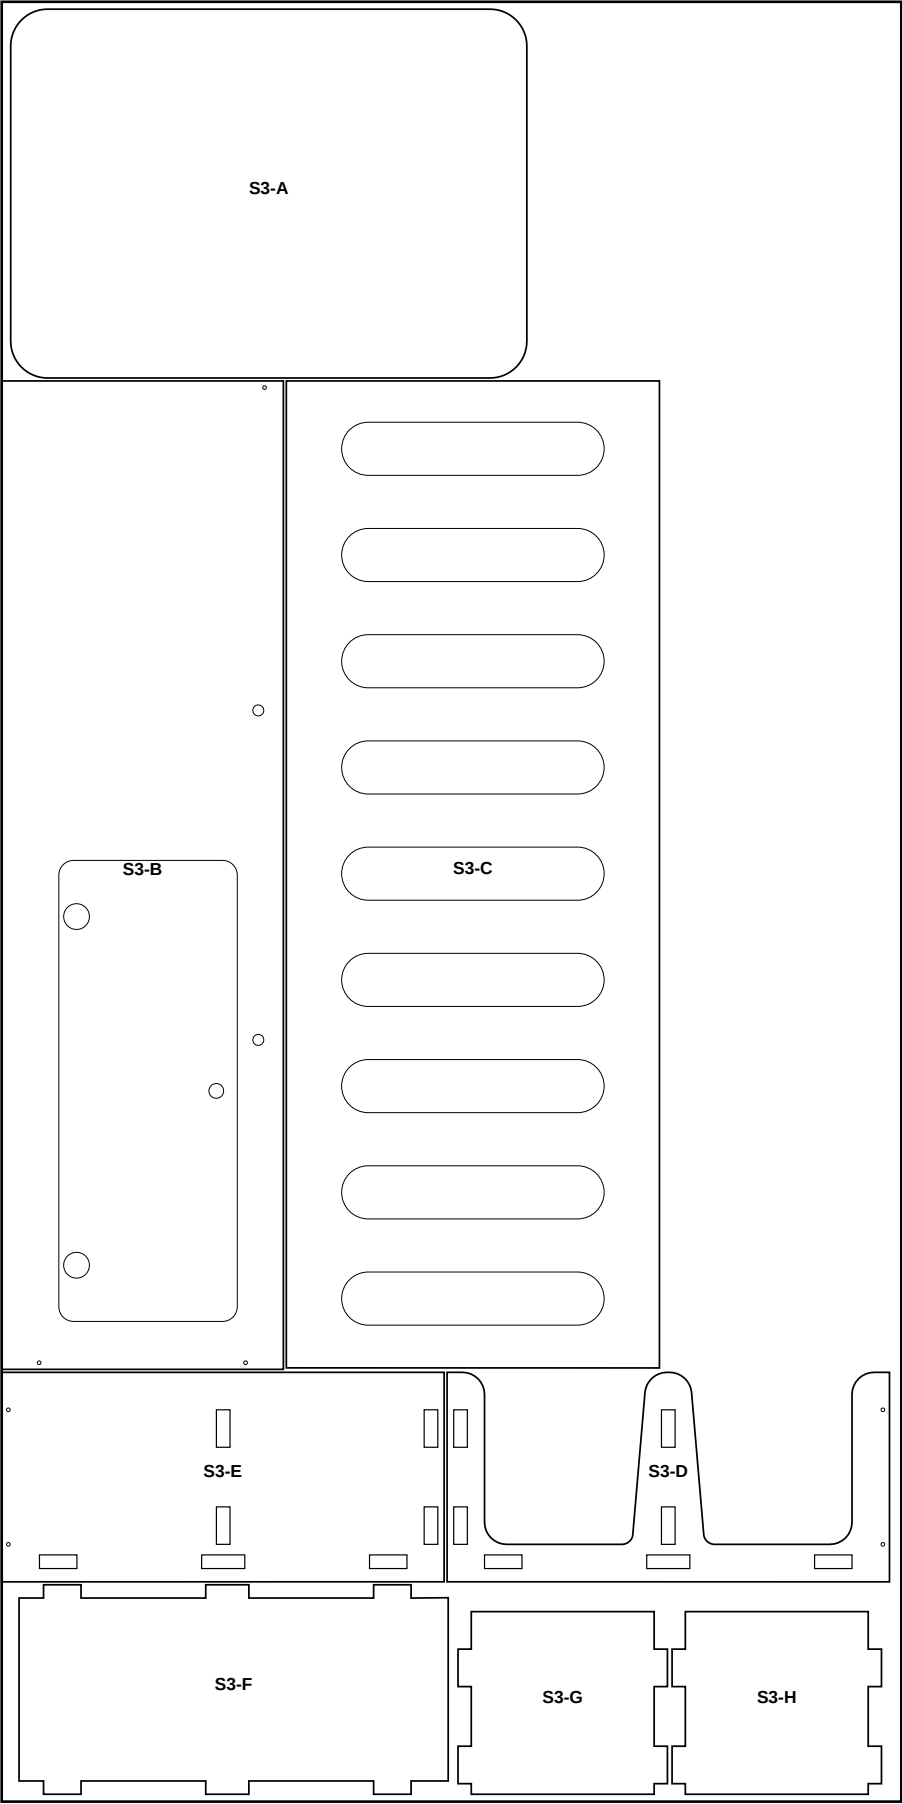


Sheet 4 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

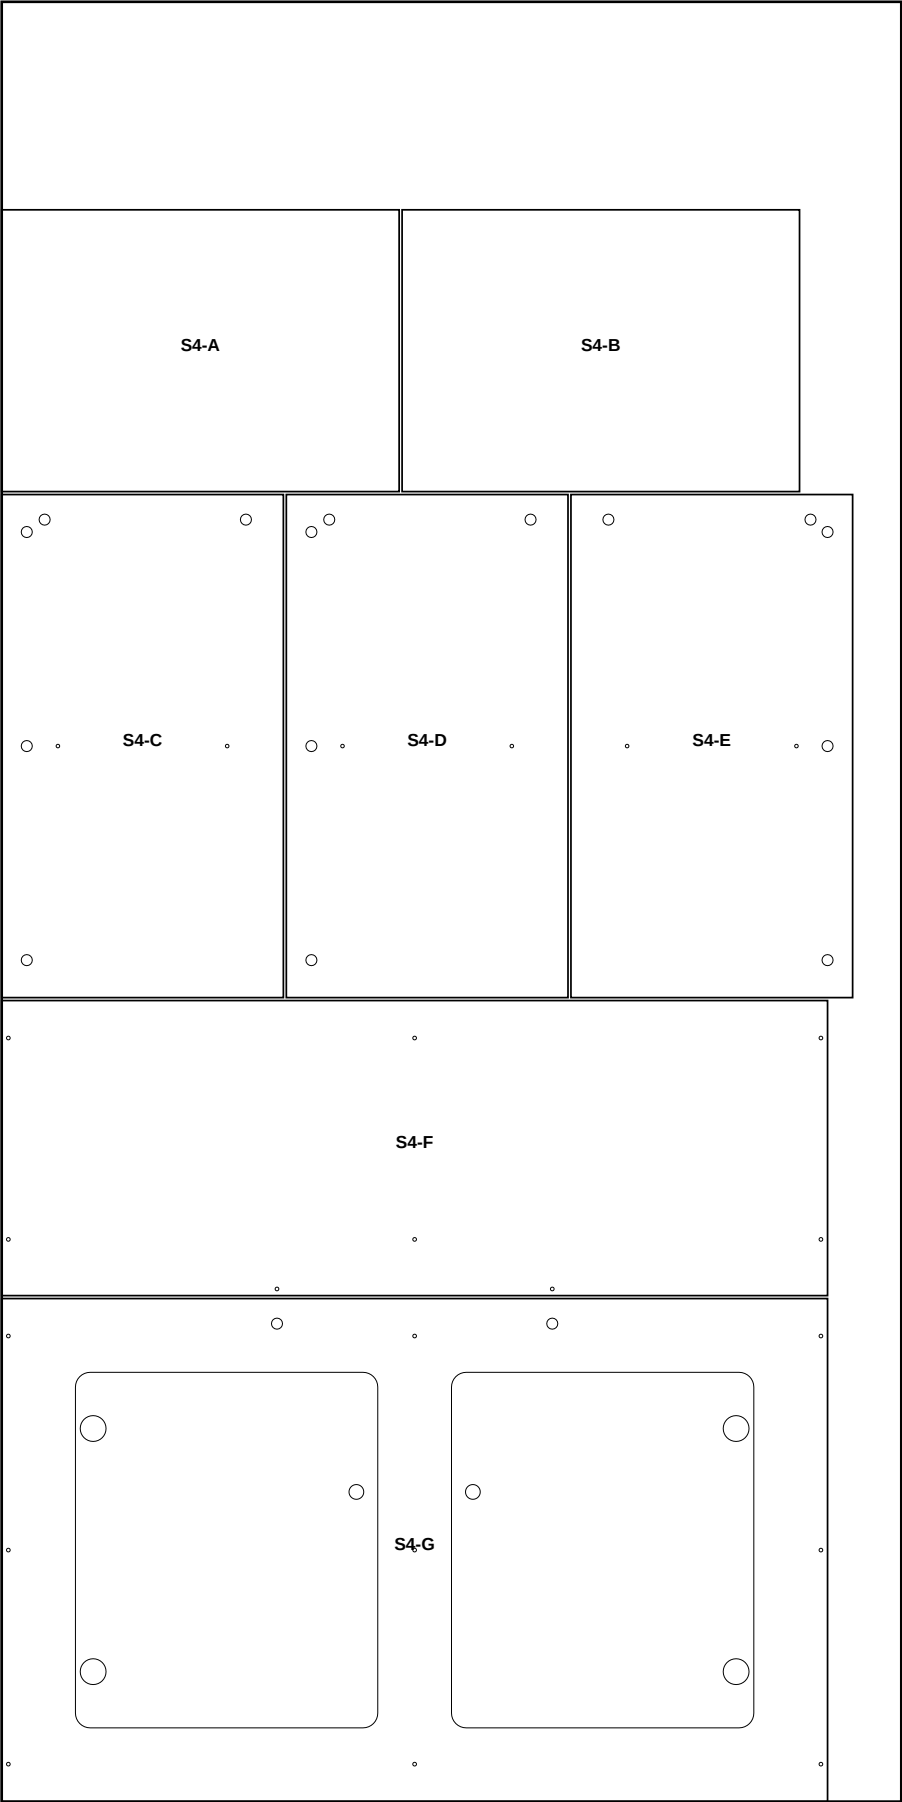

S1-A - Part detail

Overall 284.0 x 248.0 mm | 18 mm plywood | datum lower-left = X0 Y0

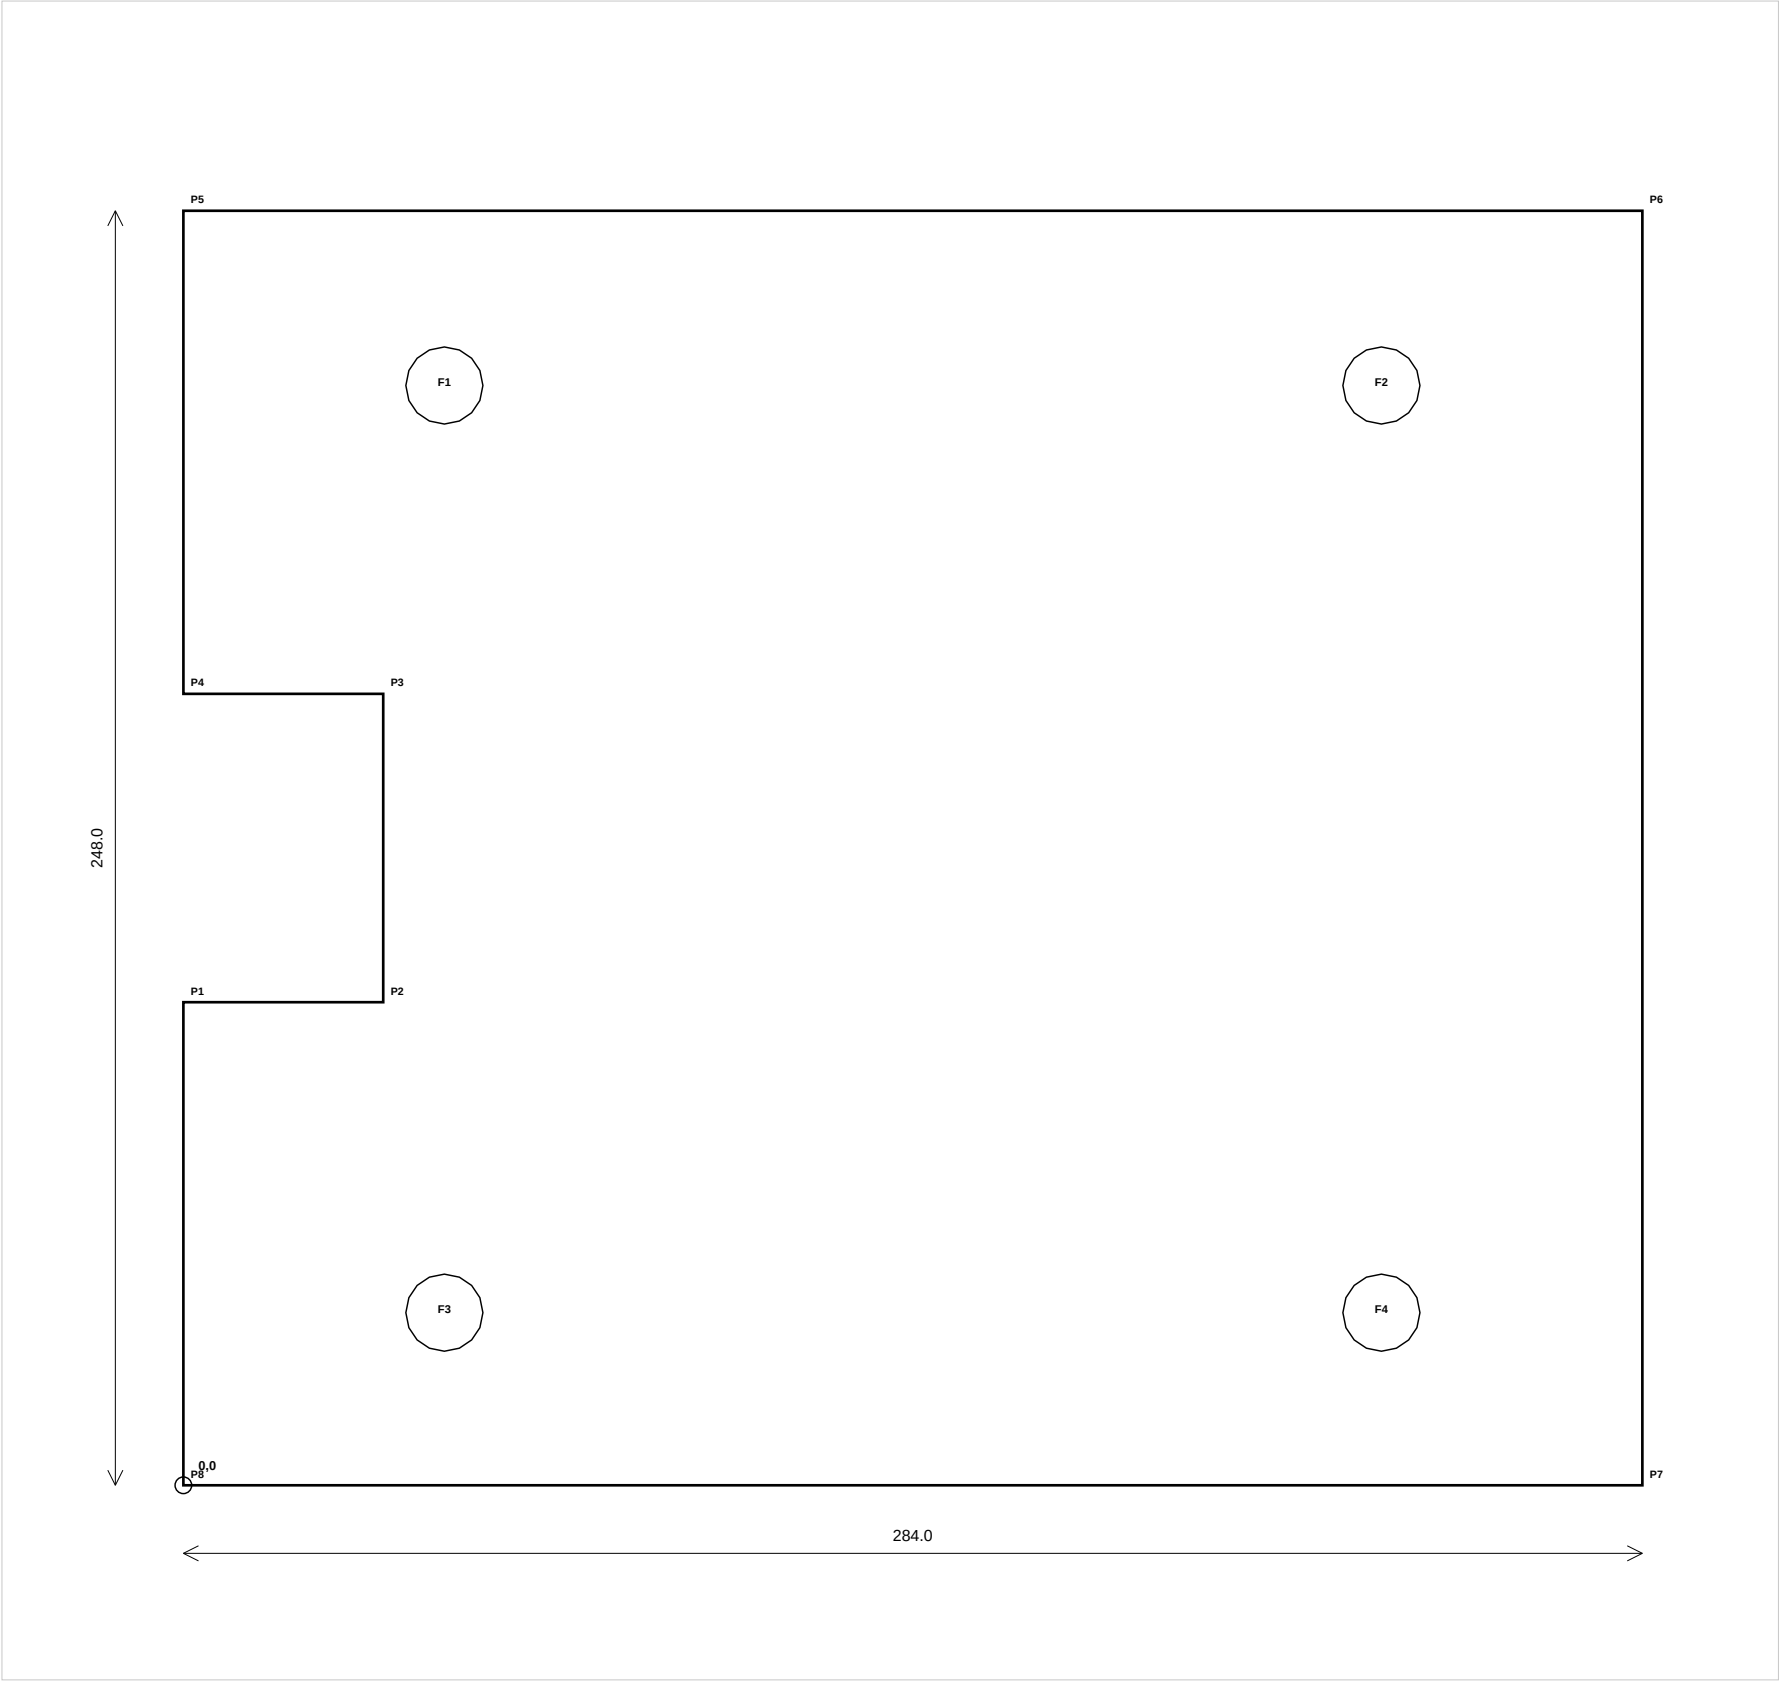

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 214.0
F2	Dia 15 x 14 deep	X 233.2 Y 214.0
F3	Dia 15 x 14 deep	X 50.8 Y 33.6
F4	Dia 15 x 14 deep	X 233.2 Y 33.6


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X38.9 Y94.0	LINE
P2	X38.9 Y154.0	LINE
P3	X0.0 Y154.0	LINE
P4	X0.0 Y248.0	LINE
P5	X284.0 Y248.0	LINE
P6	X284.0 Y0.0	LINE
P7	X0.0 Y0.0	LINE
P8	X0.0 Y94.0	LINE

S1-B - Part detail

Overall 400.0 x 1393.0 mm | 18 mm plywood | datum lower-left = X0 Y0

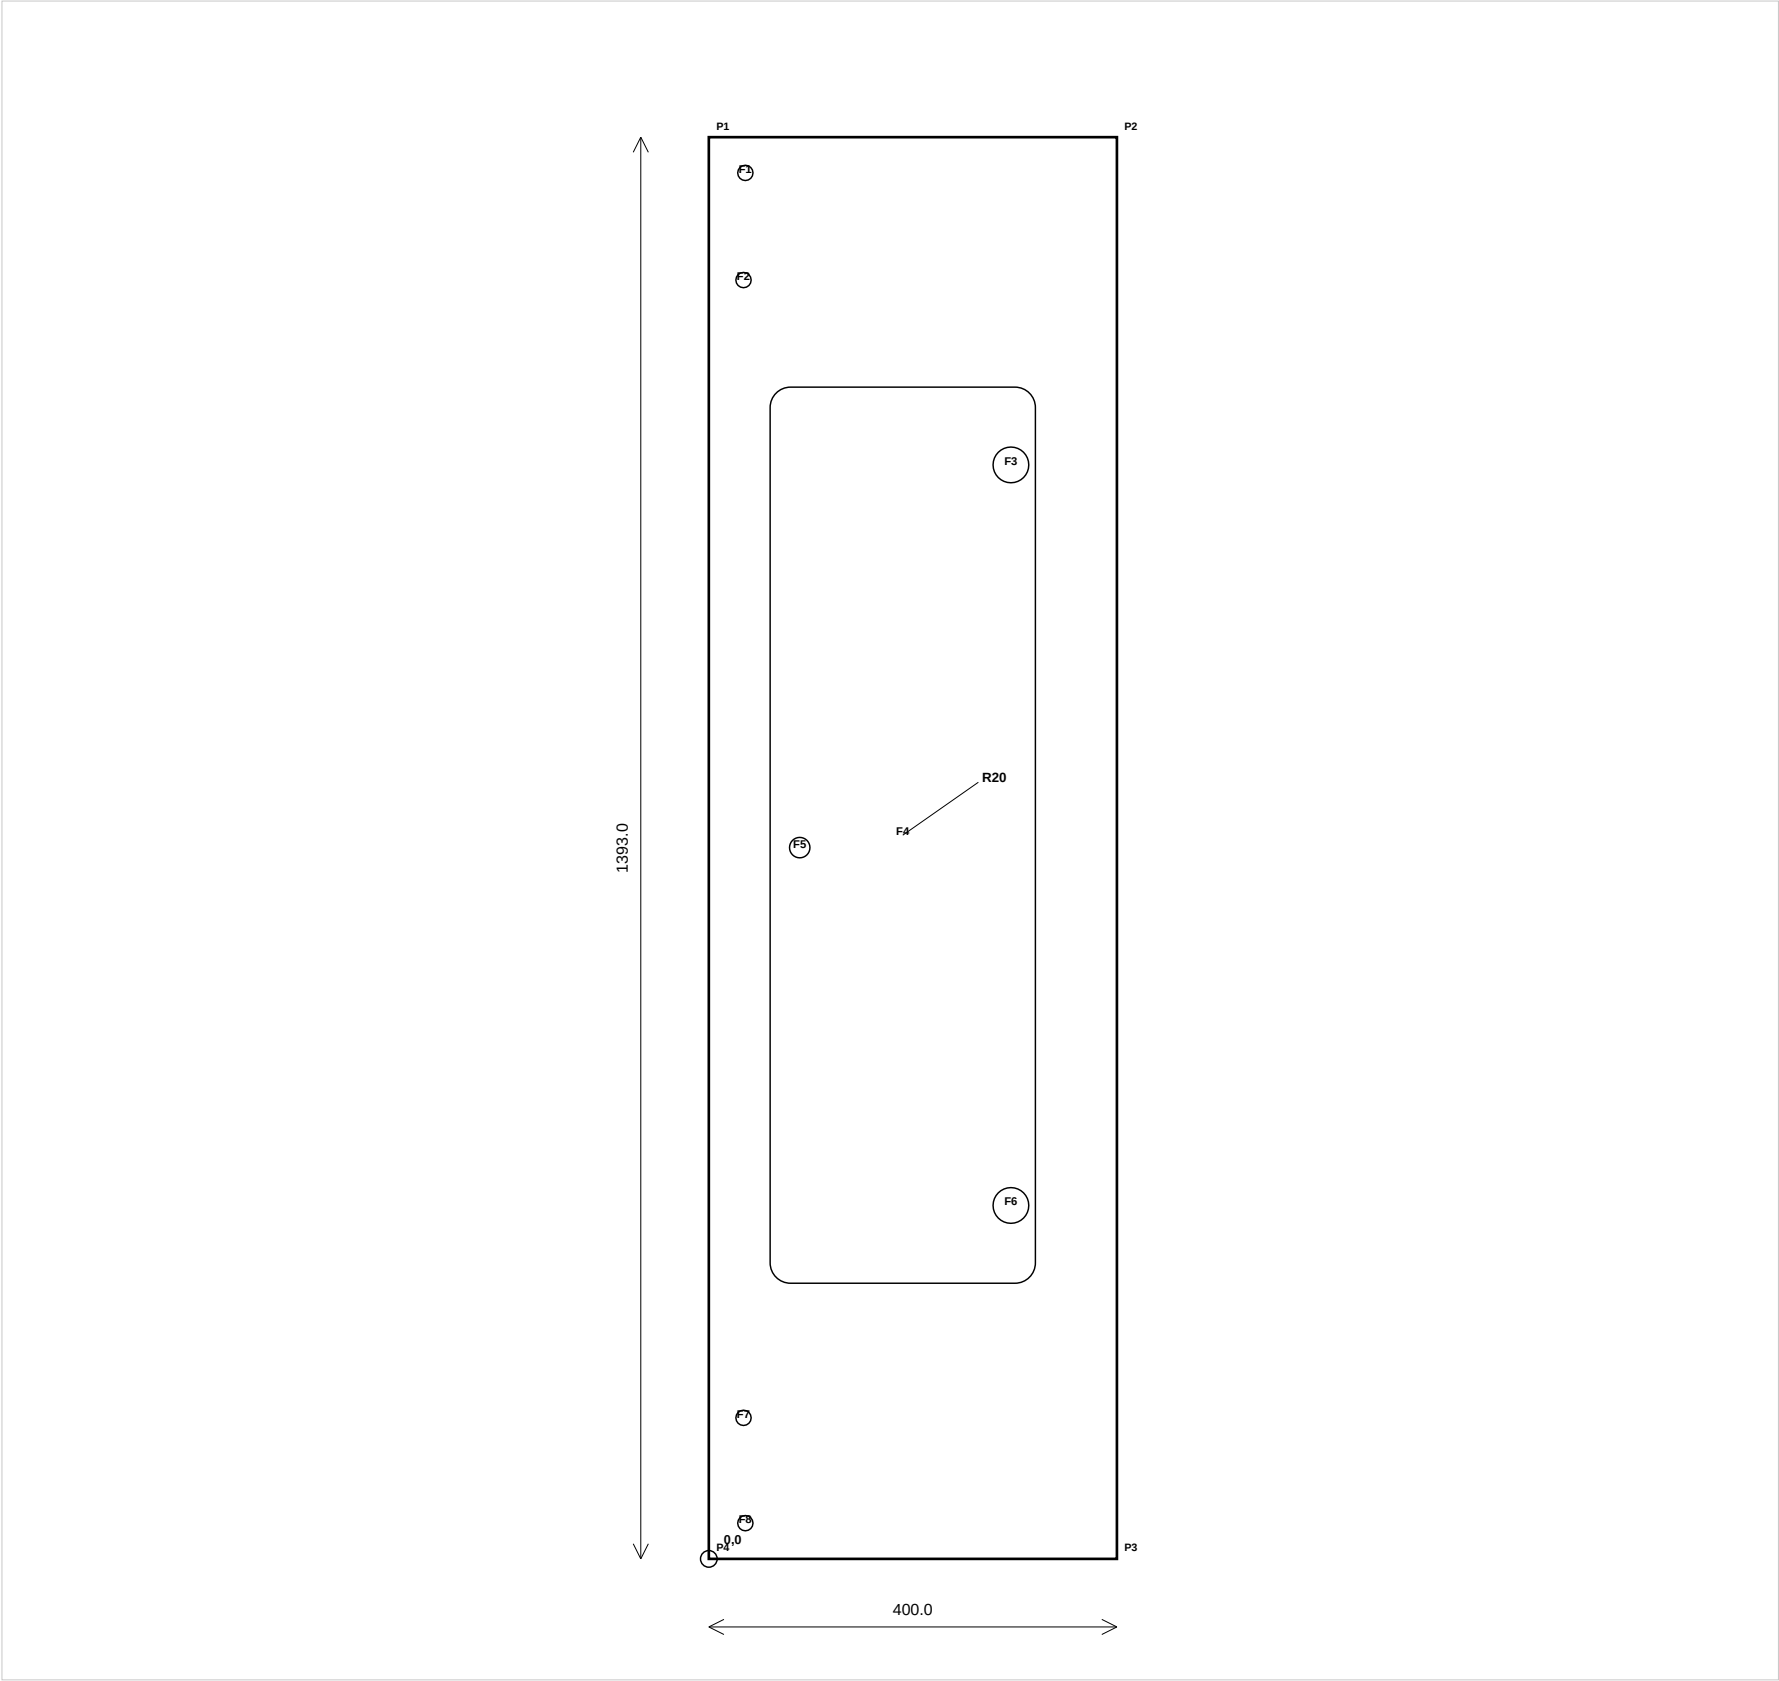

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 35.8 Y 1358.0
F2	Dia 15 x 14 deep	X 34.0 Y 1253.0
F3	Dia 35 x 13 deep	X 296.1 Y 1071.9
F4	cut-out 260.0 x 878.0, R20	X 190.1 Y 709.1
F5	Dia 20 THROUGH	X 89.1 Y 696.9
F6	Dia 35 x 13 deep	X 296.1 Y 346.3
F7	Dia 15 x 14 deep	X 34.0 Y 138.2
F8	Dia 15 x 14 deep	X 35.8 Y 35.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X400.0 Y1393.0	LINE
P2	X400.0 Y0.0	LINE
P3	X0.0 Y0.0	LINE
P4	X0.0 Y1393.0	LINE

S1-C - Part detail

Overall 533.7 x 1340.0 mm | 18 mm plywood | datum lower-left = X0 Y0

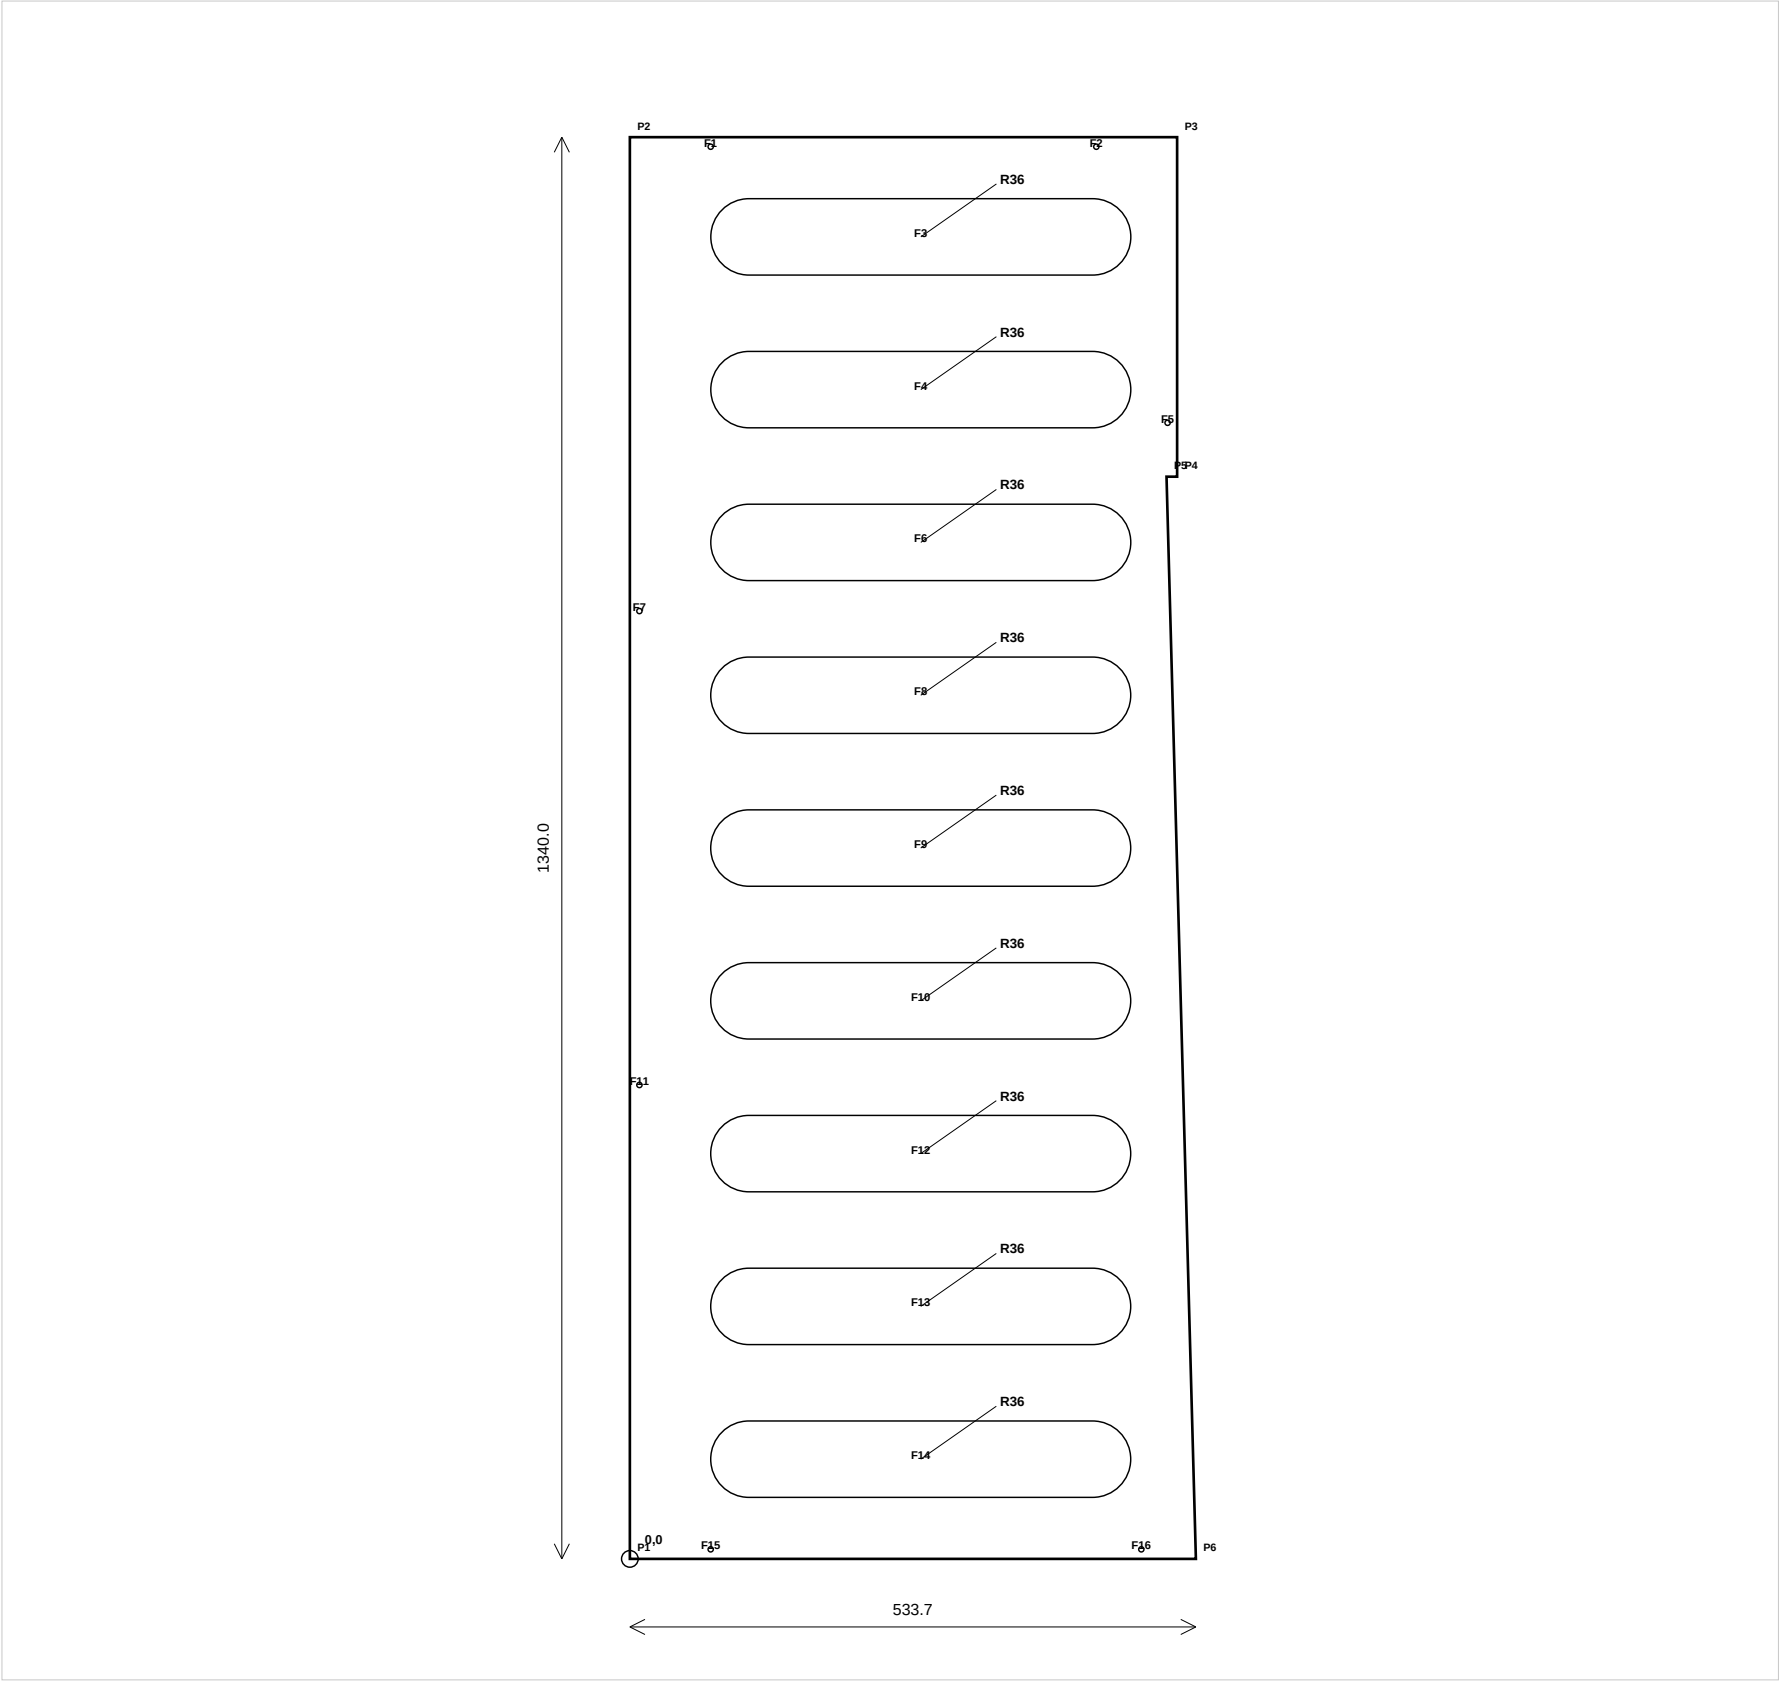

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 76.2 Y 1331.0
F2	Dia 5 x 11 deep	X 439.8 Y 1331.0
F3	cut-out 396.0 x 72.0, R36	X 274.3 Y 1246.0
F4	cut-out 396.0 x 72.0, R36	X 274.3 Y 1102.1
F5	Dia 5 x 11 deep	X 507.0 Y 1070.8
F6	cut-out 396.0 x 72.0, R36	X 274.3 Y 958.1
F7	Dia 5 x 11 deep	X 9.0 Y 893.3
F8	cut-out 396.0 x 72.0, R36	X 274.3 Y 814.0
F9	cut-out 396.0 x 72.0, R36	X 274.2 Y 670.0
F10	cut-out 396.0 x 72.0, R36	X 274.2 Y 526.0
F11	Dia 5 x 11 deep	X 9.0 Y 446.7
F12	cut-out 396.0 x 72.0, R36	X 274.2 Y 382.0
F13	cut-out 396.0 x 72.0, R36	X 274.2 Y 238.0
F14	cut-out 396.0 x 72.0, R36	X 274.2 Y 94.0
F15	Dia 5 x 11 deep	X 76.2 Y 9.0
F16	Dia 5 x 11 deep	X 482.2 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y1340.0	LINE
P2	X516.0 Y1340.0	LINE
P3	X516.0 Y1020.0	LINE
P4	X506.0 Y1020.0	LINE
P5	X533.7 Y0.0	LINE
P6	X0.0 Y0.0	LINE

S1-D - Part detail

Overall 40.0 x 1340.0 mm | 18 mm plywood | datum lower-left = X0 Y0

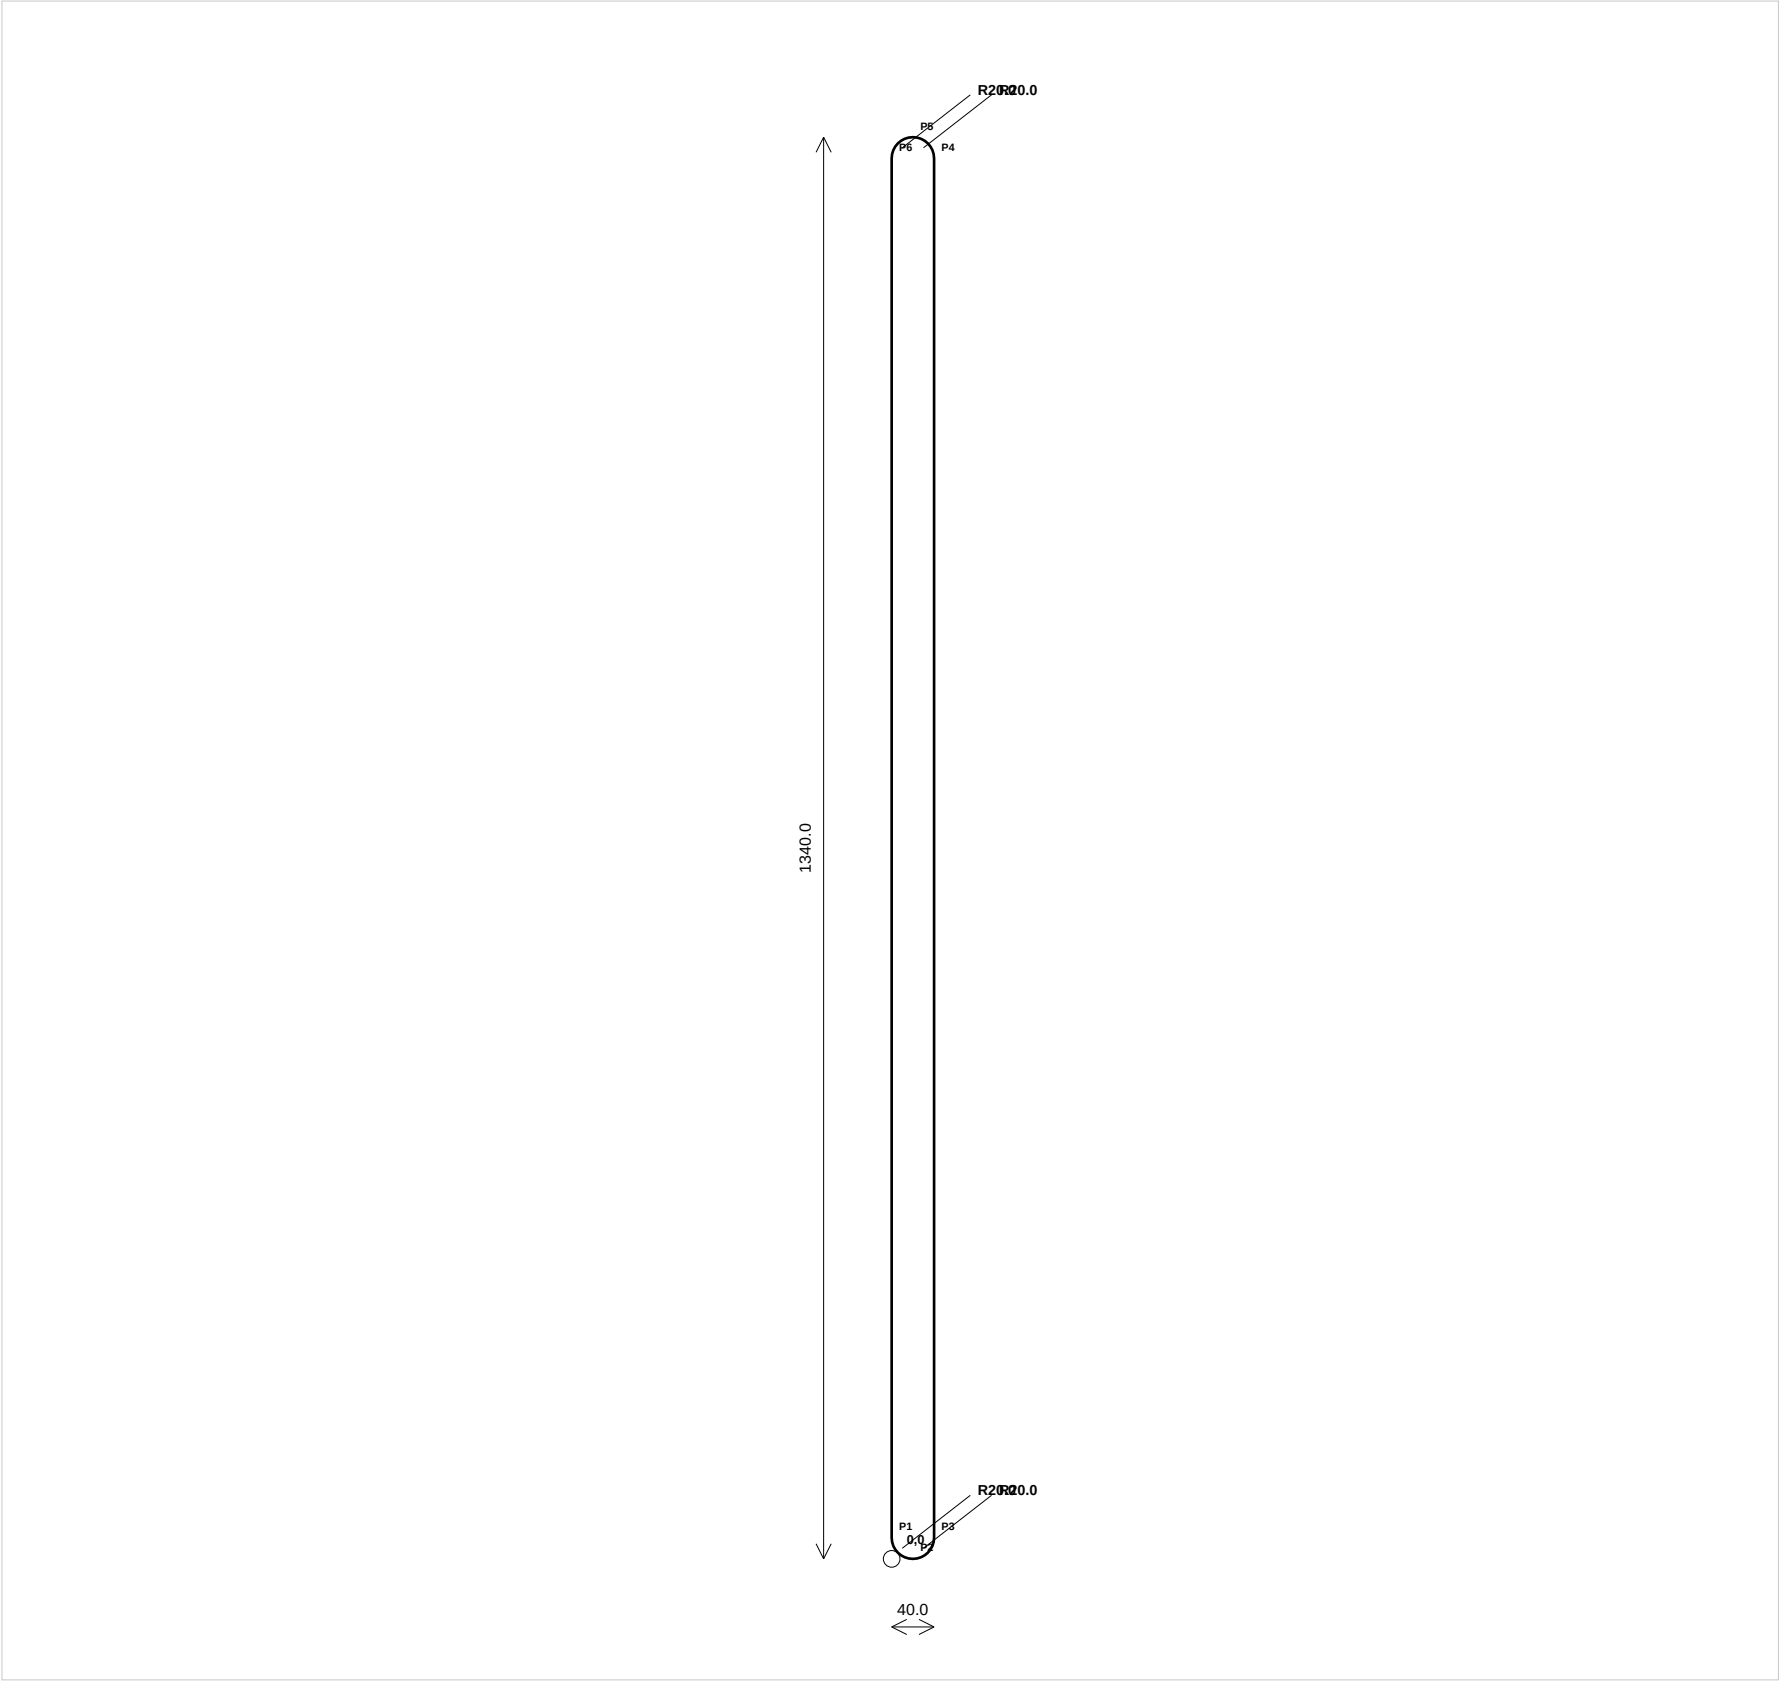

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X20.0 Y0.0	ARC R20.0 CCW
P2	X40.0 Y20.0	ARC R20.0 CCW
P3	X40.0 Y1320.0	LINE
P4	X20.0 Y1340.0	ARC R20.0 CCW
P5	X0.0 Y1320.0	ARC R20.0 CCW
P6	X0.0 Y20.0	LINE

S1-E - Part detail

Overall 40.0 x 1304.0 mm | 18 mm plywood | datum lower-left = X0 Y0

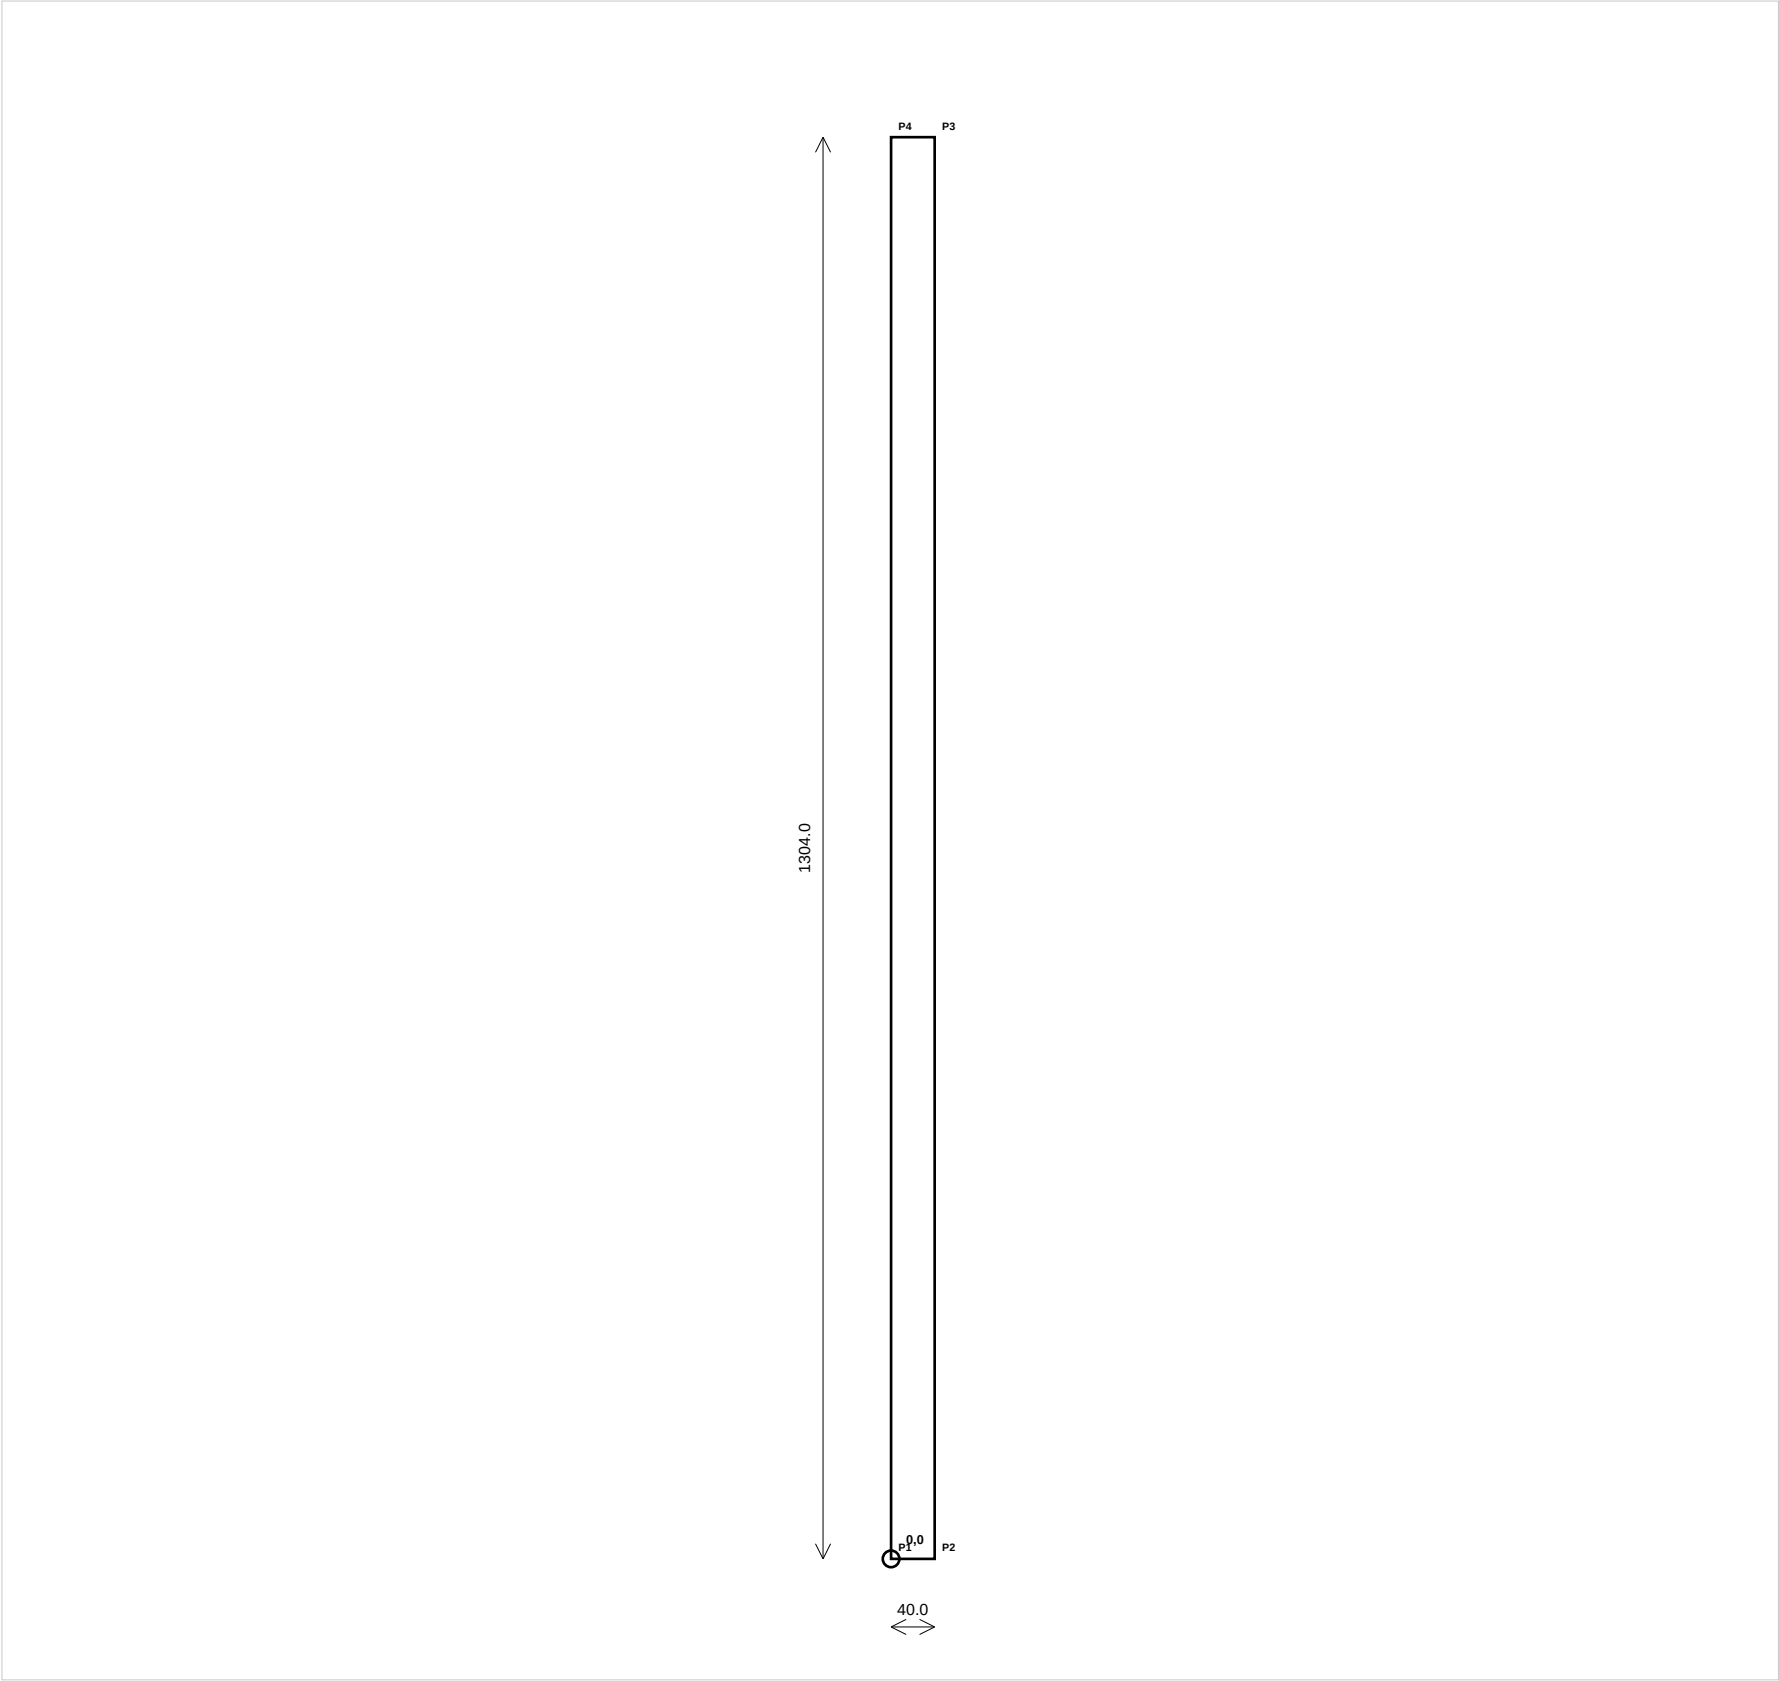

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X40.0 Y0.0	LINE
P2	X40.0 Y1304.0	LINE
P3	X0.0 Y1304.0	LINE
P4	X0.0 Y0.0	LINE

S1-F - Part detail

Overall 40.0 x 880.0 mm | 18 mm plywood | datum lower-left = X0 Y0

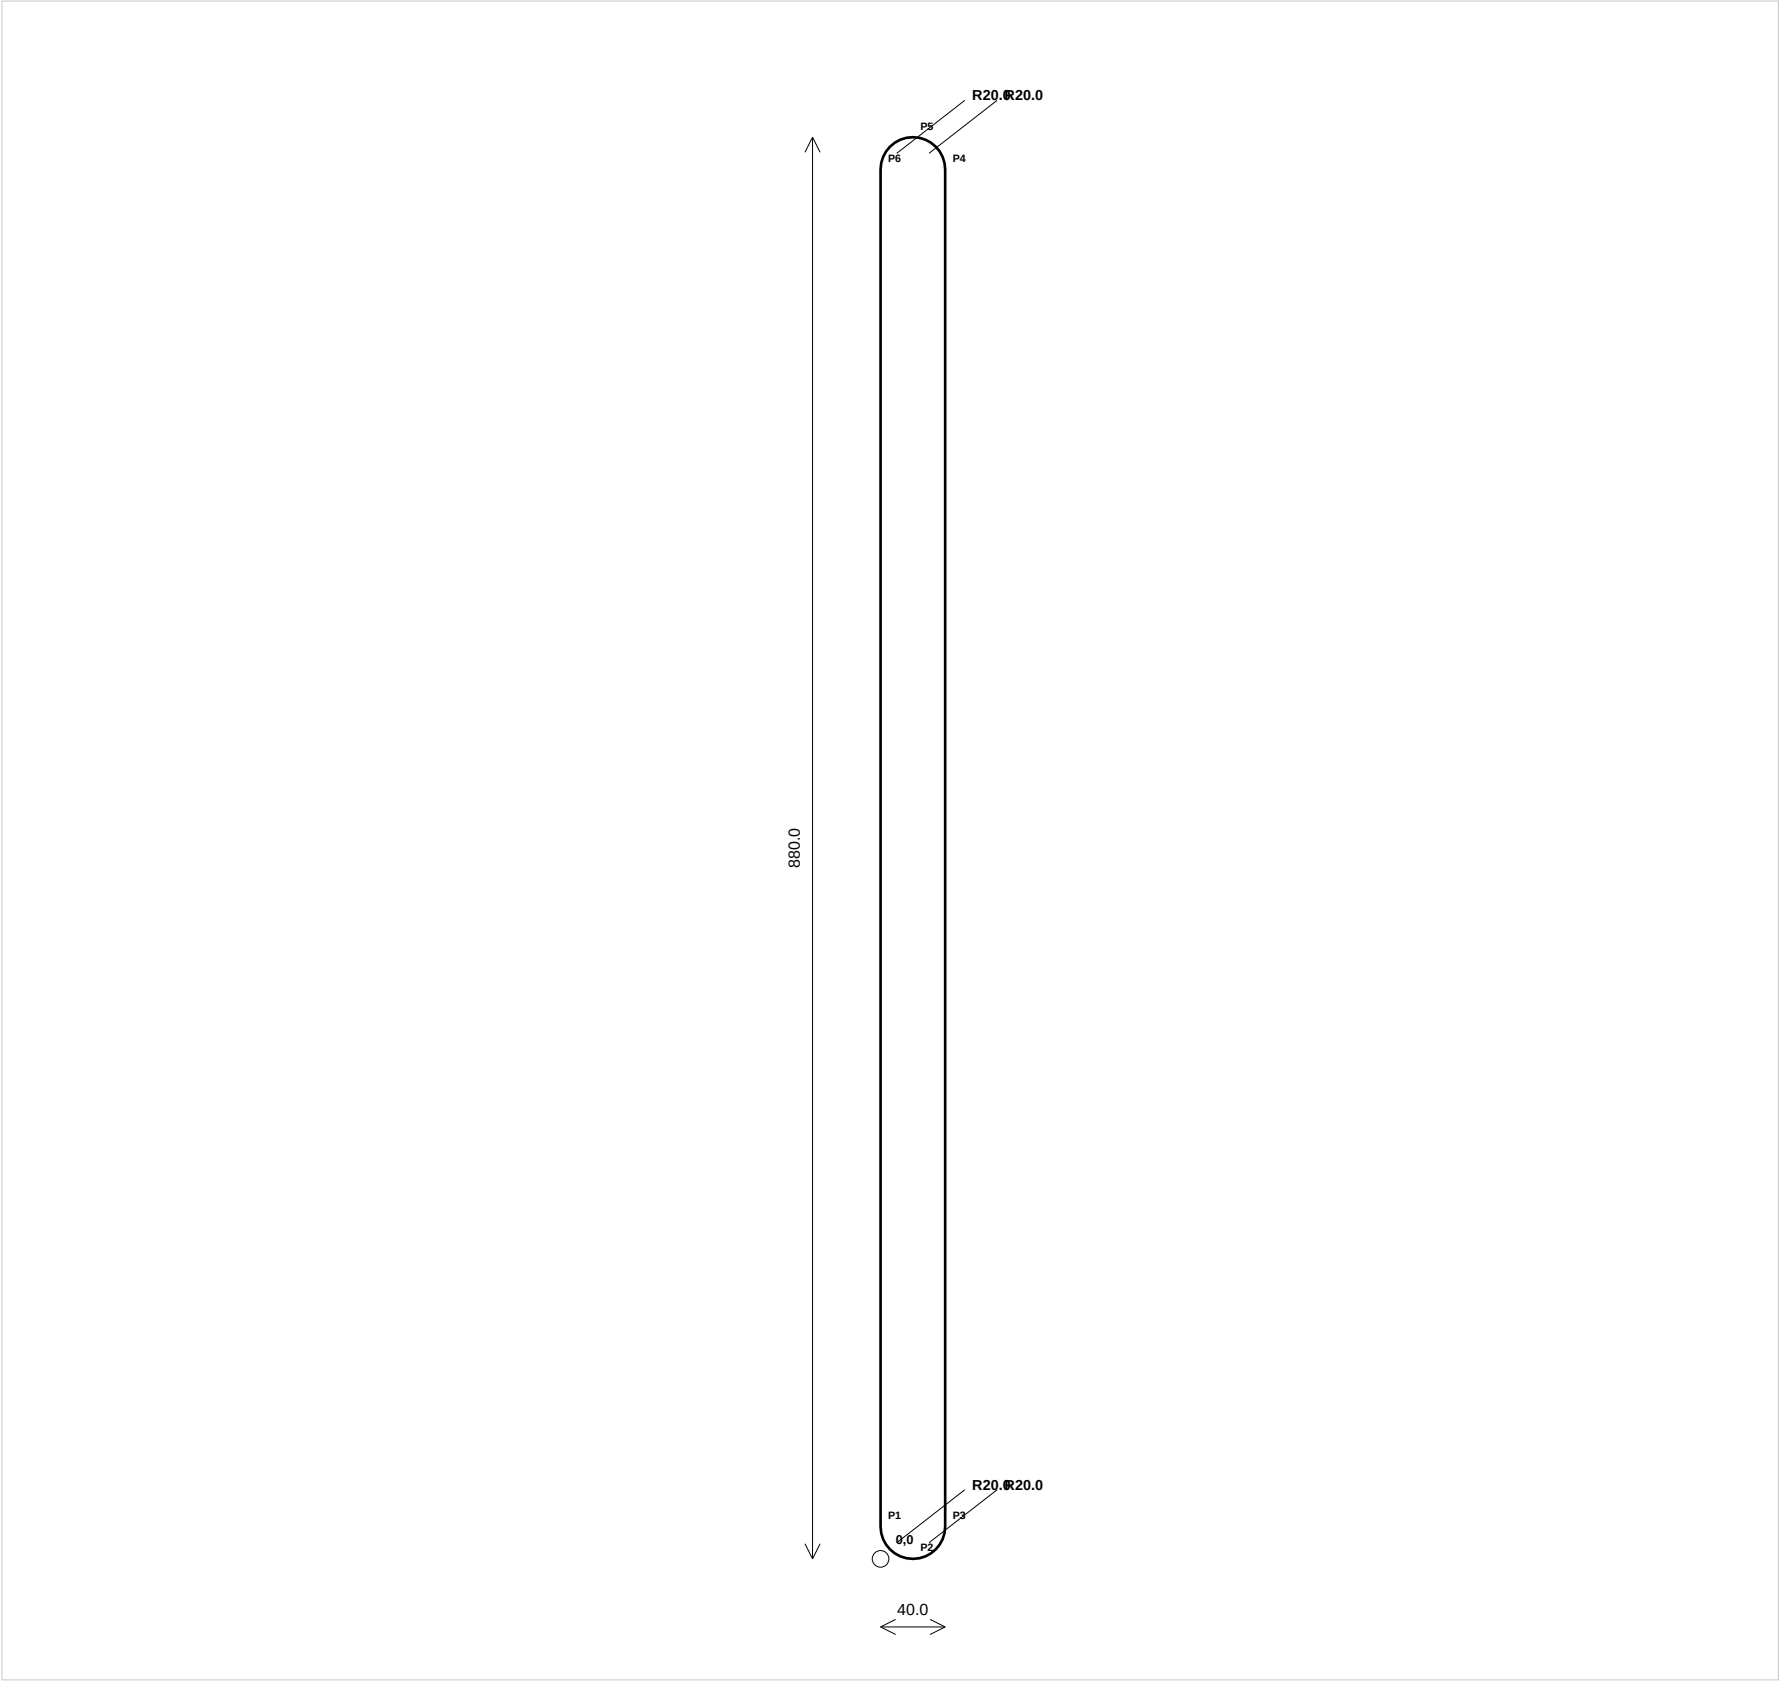

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X20.0 Y0.0	ARC R20.0 CCW
P2	X40.0 Y20.0	ARC R20.0 CCW
P3	X40.0 Y860.0	LINE
P4	X20.0 Y880.0	ARC R20.0 CCW
P5	X0.0 Y860.0	ARC R20.0 CCW
P6	X0.0 Y20.0	LINE

S1-G - Part detail

Overall 560.0 x 818.0 mm | 18 mm plywood | datum lower-left = X0 Y0

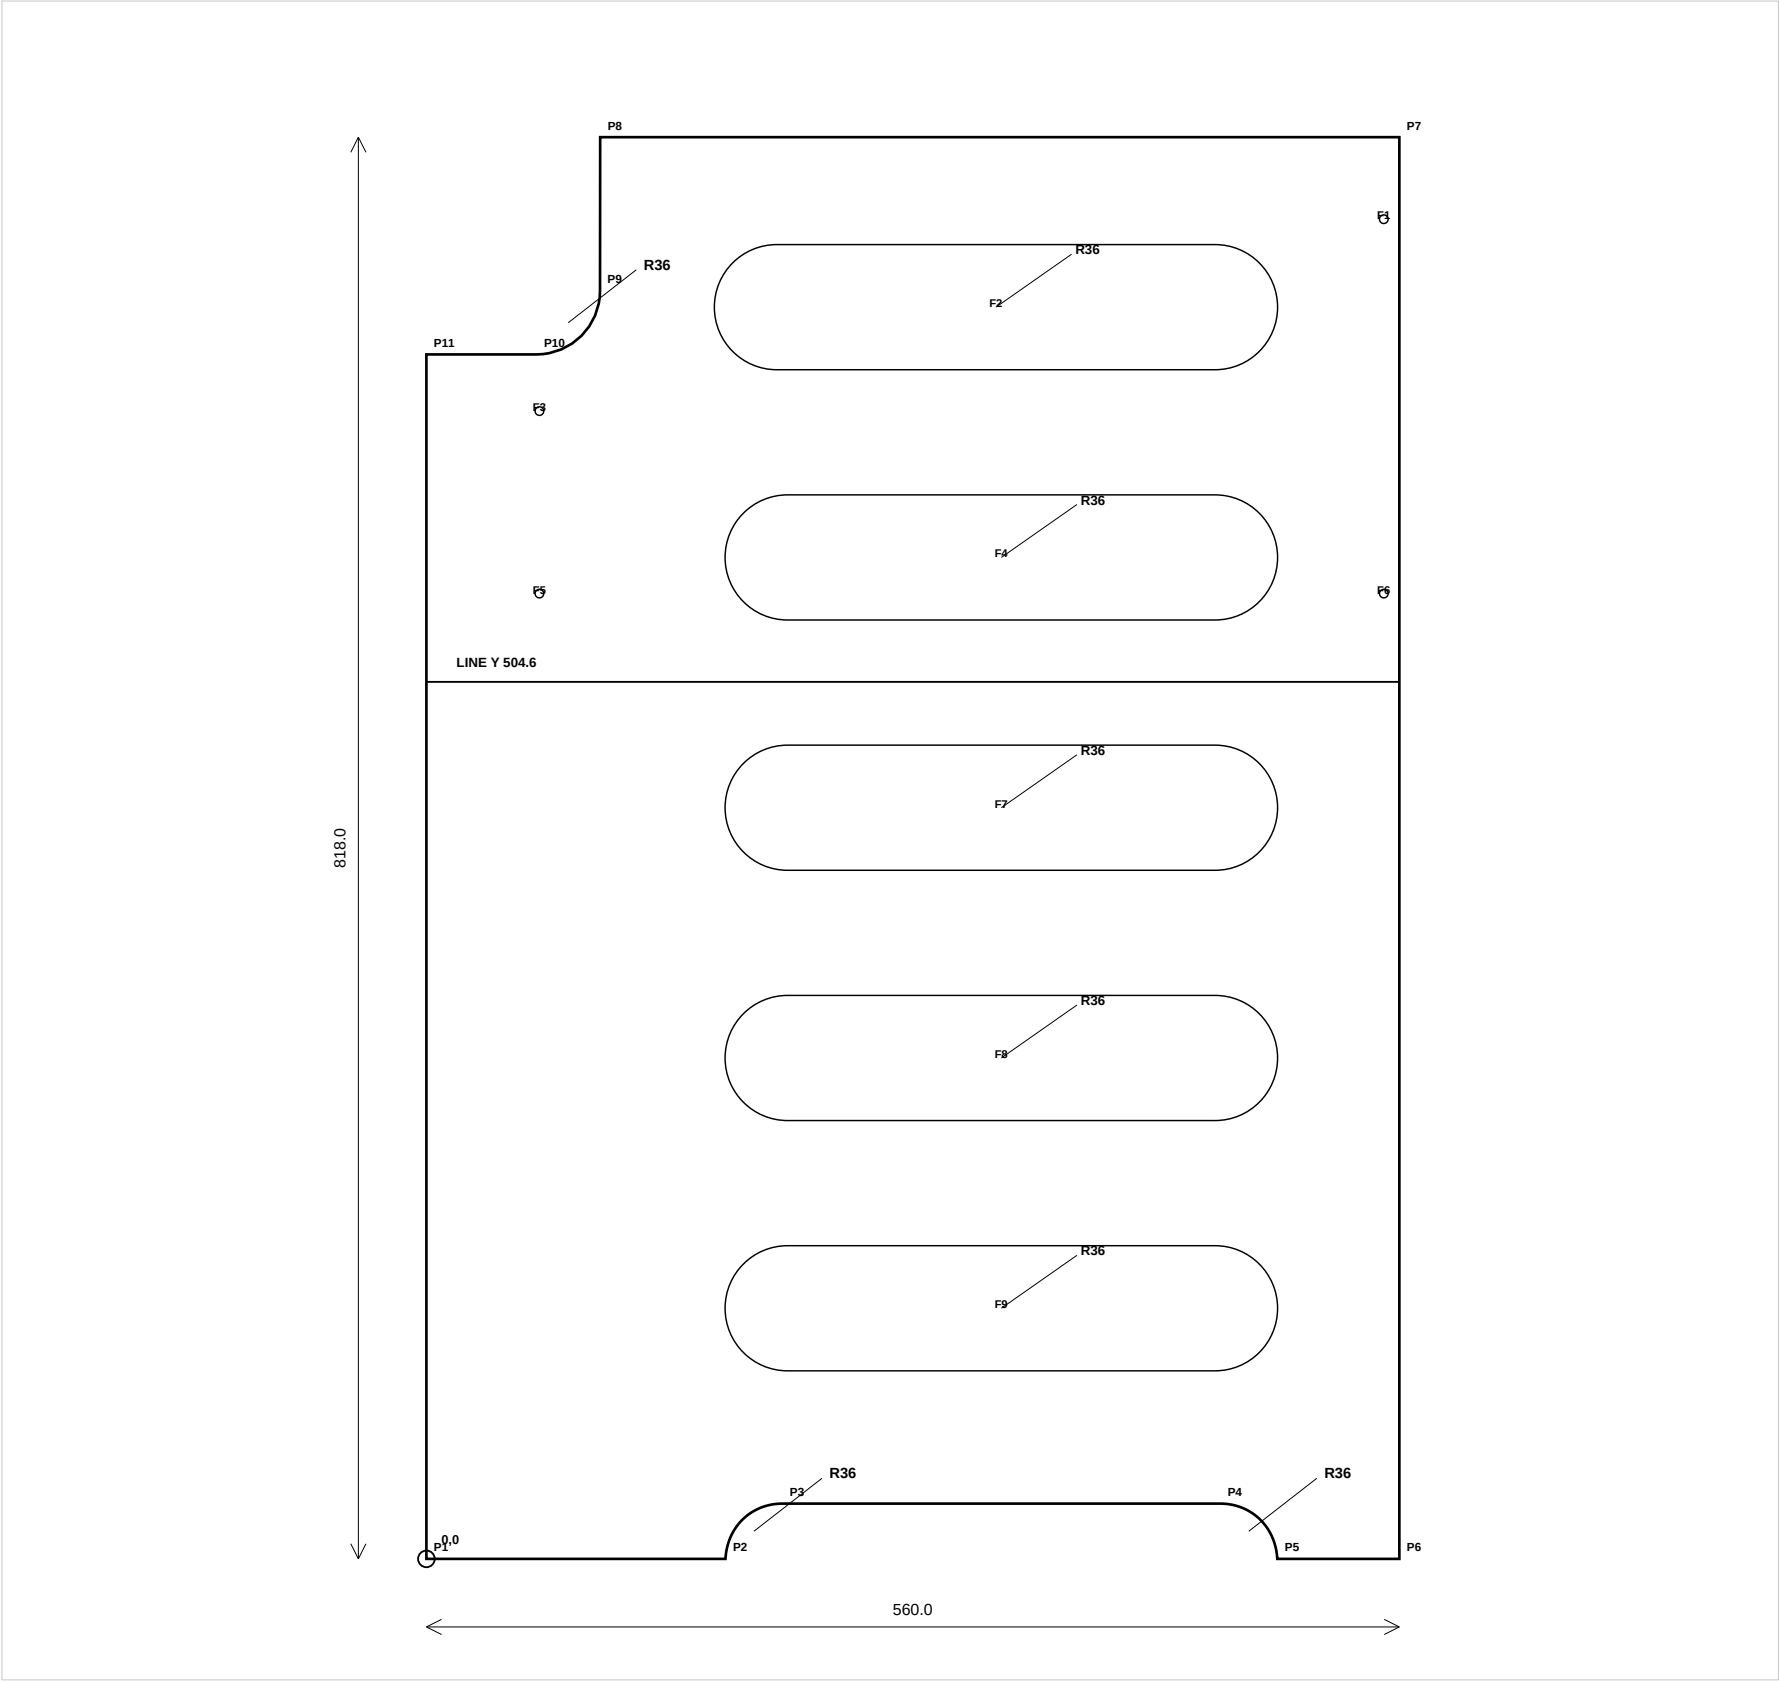

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 551.1 Y 770.8
F2	cut-out 324.2 x 72.0, R36	X 327.8 Y 720.2
F3	Dia 5 x 11 deep	X 65.0 Y 660.4
F4	cut-out 318.0 x 72.0, R36	X 330.9 Y 576.2
F5	Dia 5 x 11 deep	X 65.0 Y 555.4
F6	Dia 5 x 11 deep	X 551.1 Y 555.4
F7	cut-out 318.0 x 72.0, R36	X 330.9 Y 432.2
F8	cut-out 318.0 x 72.0, R36	X 330.9 Y 288.2
F9	cut-out 318.0 x 72.0, R36	X 330.9 Y 144.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X172.1 Y0.0	LINE
P2	X204.9 Y31.8	ARC R36
P3	X456.9 Y31.8	LINE
P4	X489.7 Y0.0	ARC R36
P5	X560.0 Y0.0	LINE
P6	X560.0 Y818.0	LINE
P7	X100.0 Y818.0	LINE
P8	X99.9 Y729.5	LINE
P9	X63.4 Y693.0	ARC R36
P10	X0.0 Y693.0	LINE
P11	X0.0 Y0.0	LINE

S1-H - Part detail

Overall 560.0 x 818.0 mm | 18 mm plywood | datum lower-left = X0 Y0

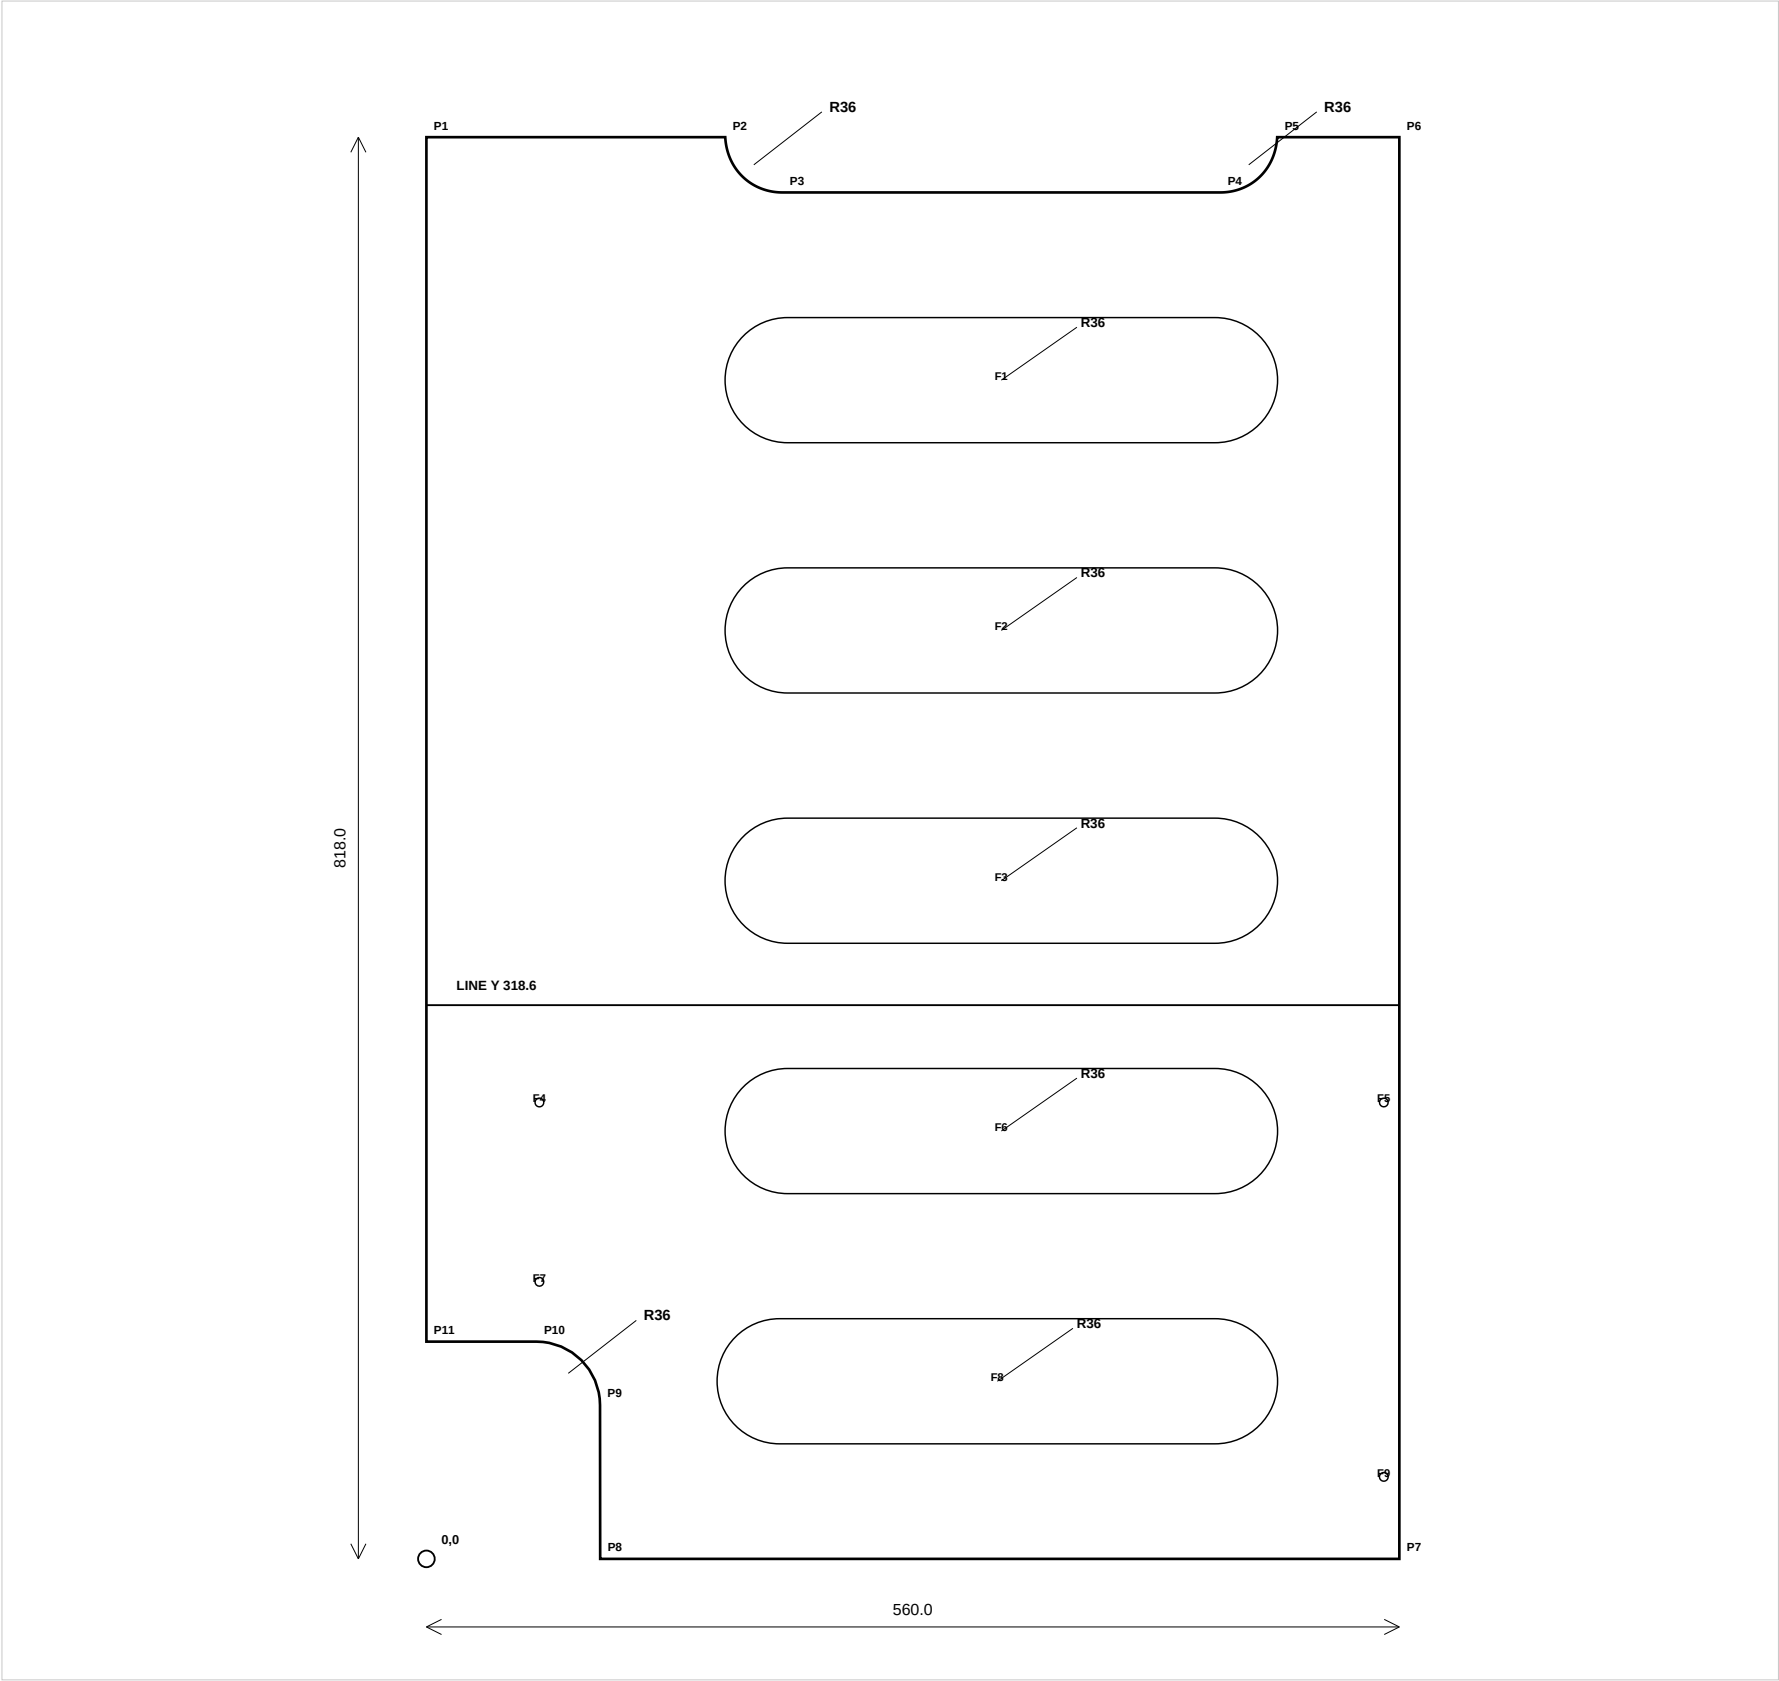

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	cut-out 318.0 x 72.0, R36	X 330.9 Y 678.2
F2	cut-out 318.0 x 72.0, R36	X 330.9 Y 534.2
F3	cut-out 318.0 x 72.0, R36	X 330.9 Y 390.2
F4	Dia 5 x 11 deep	X 65.0 Y 262.6
F5	Dia 5 x 11 deep	X 551.1 Y 262.6
F6	cut-out 318.0 x 72.0, R36	X 330.9 Y 246.2
F7	Dia 5 x 11 deep	X 65.0 Y 159.4
F8	cut-out 322.6 x 72.0, R36	X 328.6 Y 102.2
F9	Dia 5 x 11 deep	X 551.1 Y 47.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X172.0 Y818.0	LINE
P2	X204.9 Y786.2	ARC R36
P3	X456.9 Y786.2	LINE
P4	X489.7 Y818.0	ARC R36
P5	X560.0 Y818.0	LINE
P6	X560.0 Y0.0	LINE
P7	X100.0 Y0.0	LINE
P8	X99.9 Y88.5	LINE
P9	X63.4 Y125.0	ARC R36
P10	X0.0 Y125.0	LINE
P11	X0.0 Y818.0	LINE

S2-A - Part detail

Overall 546.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

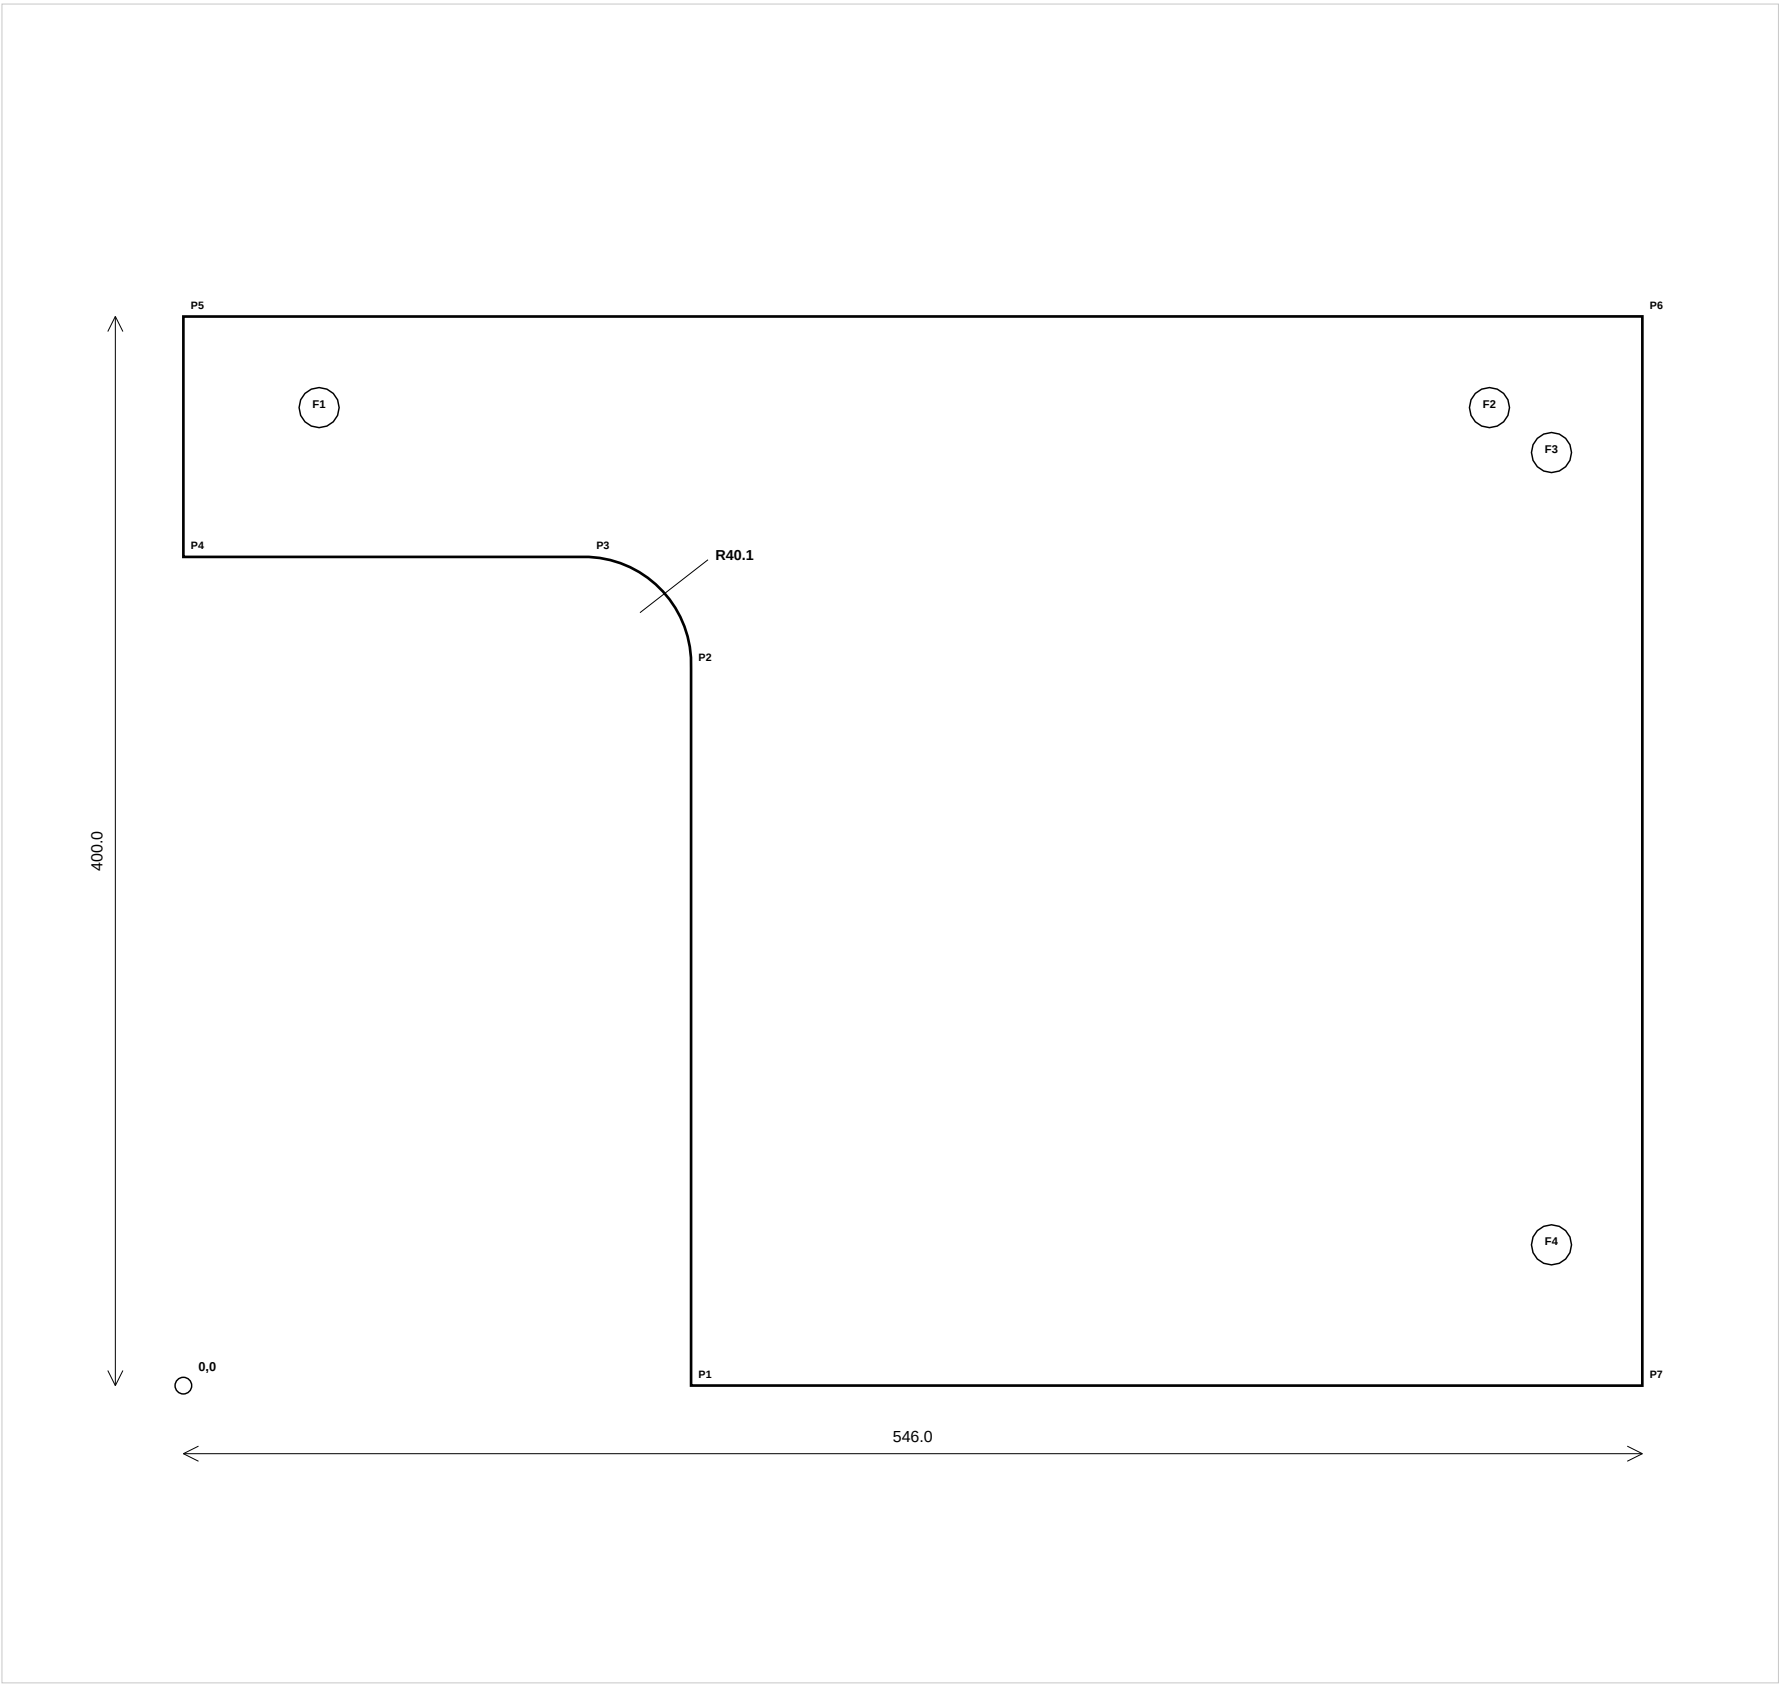

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 365.9
F2	Dia 15 x 14 deep	X 488.8 Y 365.9
F3	Dia 15 x 14 deep	X 512.0 Y 349.1
F4	Dia 15 x 14 deep	X 512.0 Y 52.7


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X190.0 Y268.3	LINE
P2	X151.8 Y310.0	ARC R40.1 CCW
P3	X0.0 Y310.0	LINE
P4	X0.0 Y400.0	LINE
P5	X546.0 Y400.0	LINE
P6	X546.0 Y0.0	LINE
P7	X190.0 Y0.0	LINE

S2-B - Part detail

Overall 317.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

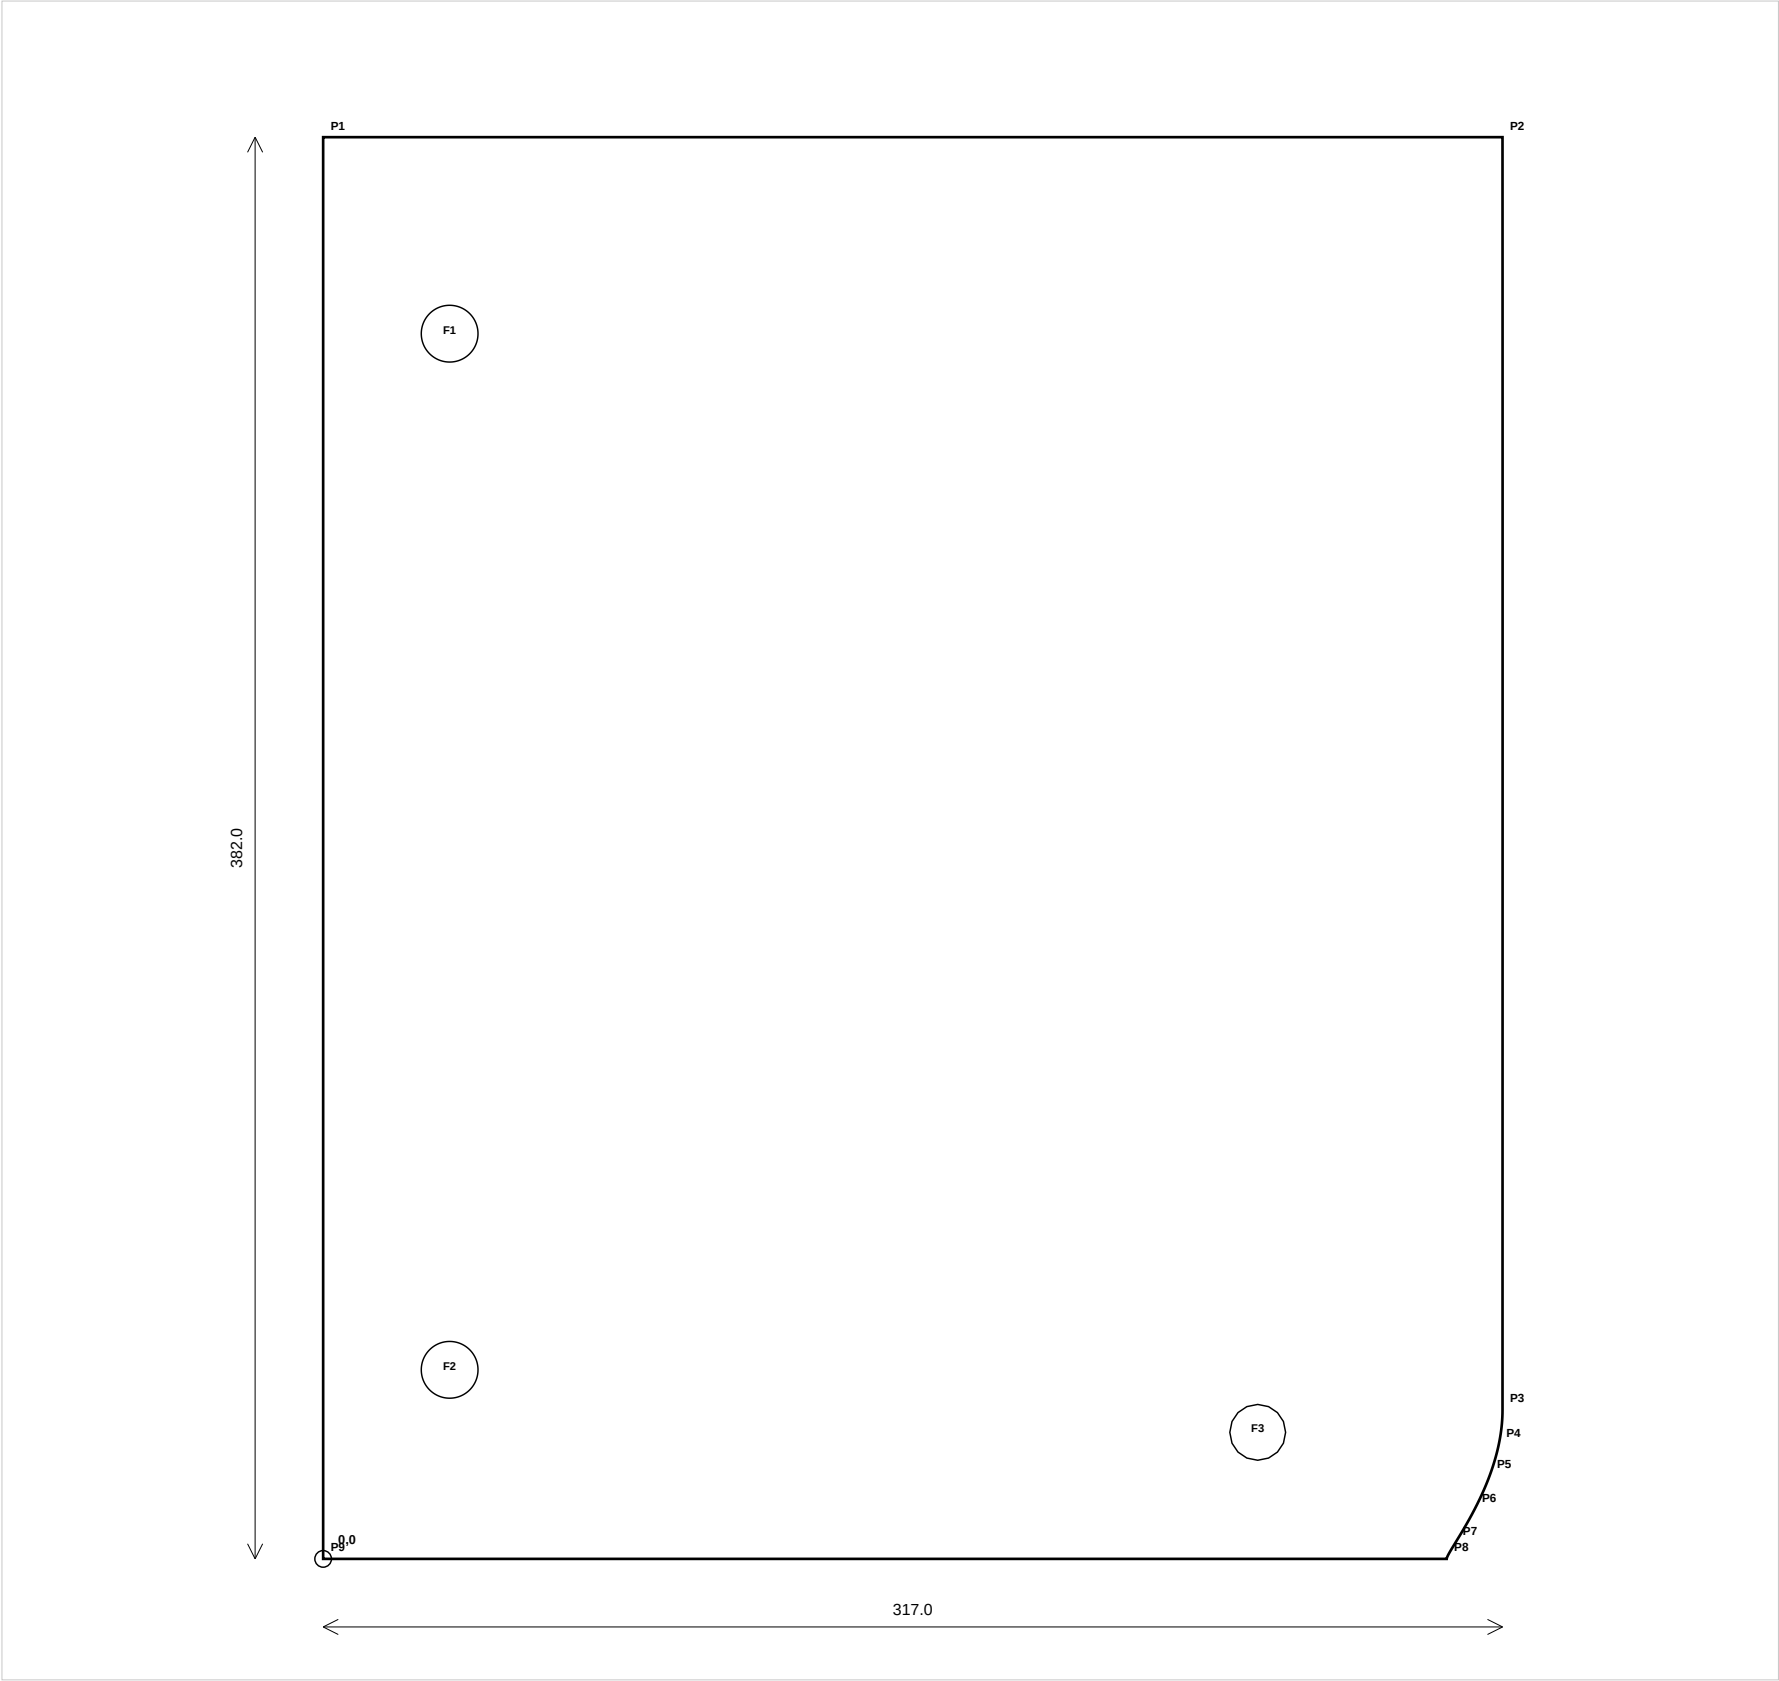

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 329.2
F2	Dia 15 x 14 deep	X 34.0 Y 50.8
F3	Dia 15 x 14 deep	X 251.2 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X317.0 Y382.0	LINE
P2	X317.0 Y40.0	LINE
P3	X316.0 Y30.8	SMOOTH CURVE
P4	X313.5 Y22.3	SMOOTH CURVE
P5	X309.5 Y13.3	SMOOTH CURVE
P6	X304.3 Y4.4	SMOOTH CURVE
P7	X302.0 Y0.0	SMOOTH CURVE
P8	X0.0 Y0.0	LINE
P9	X0.0 Y382.0	LINE

S2-C - Part detail

Overall 320.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

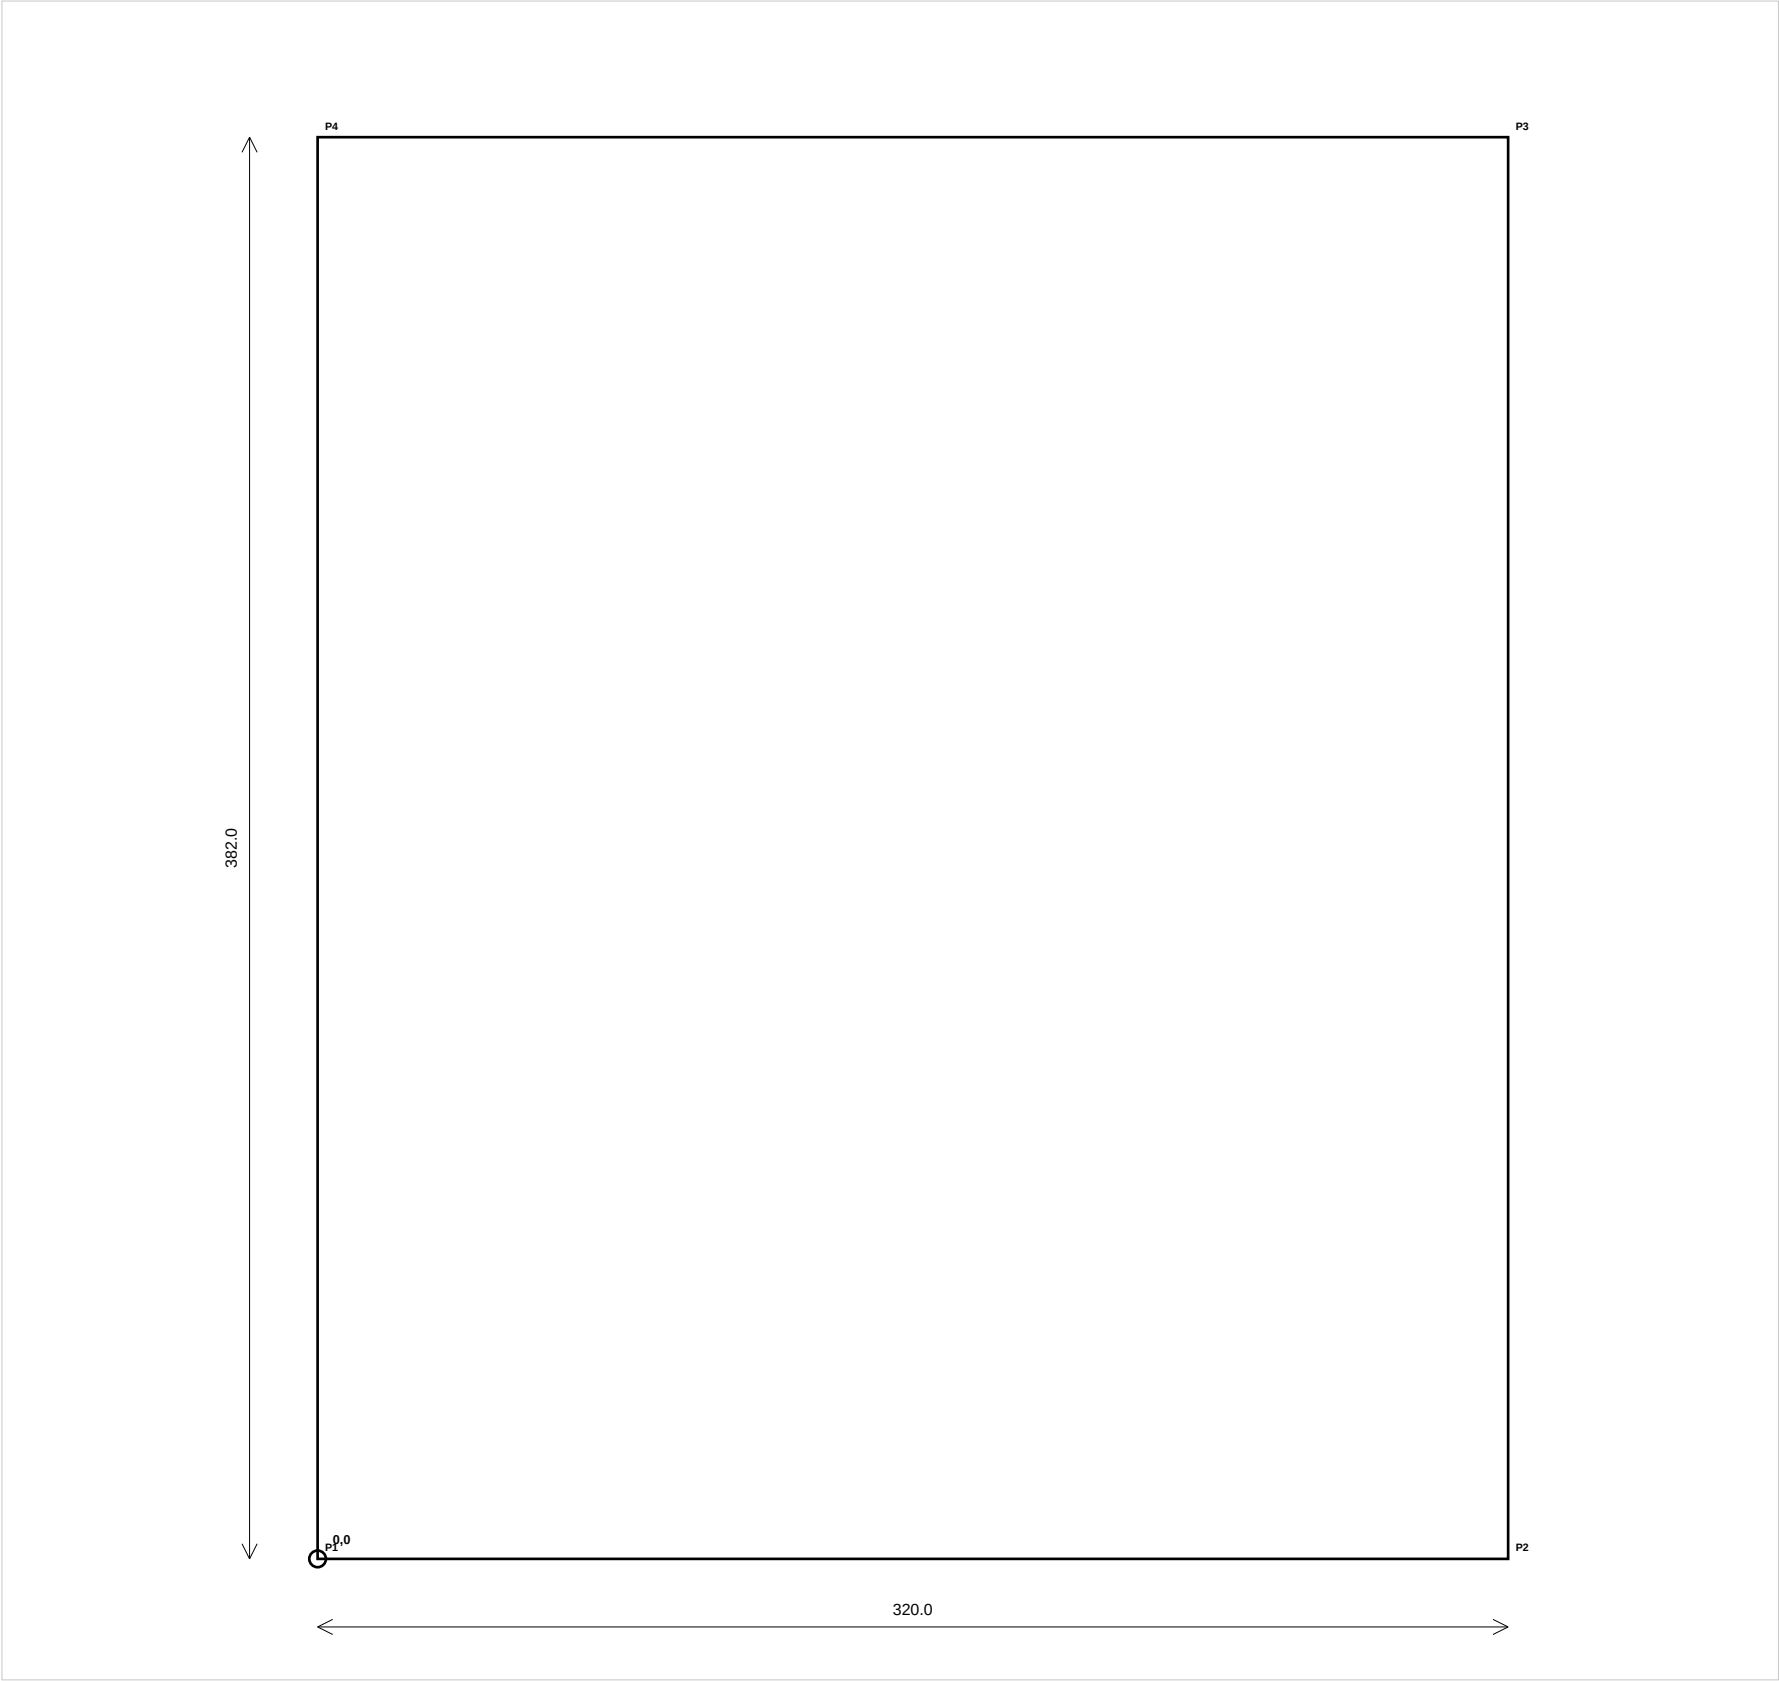

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X320.0 Y0.0	LINE
P2	X320.0 Y382.0	LINE
P3	X0.0 Y382.0	LINE
P4	X0.0 Y0.0	LINE

S2-D - Part detail

Overall 382.0 x 518.0 mm | 18 mm plywood | datum lower-left = X0 Y0

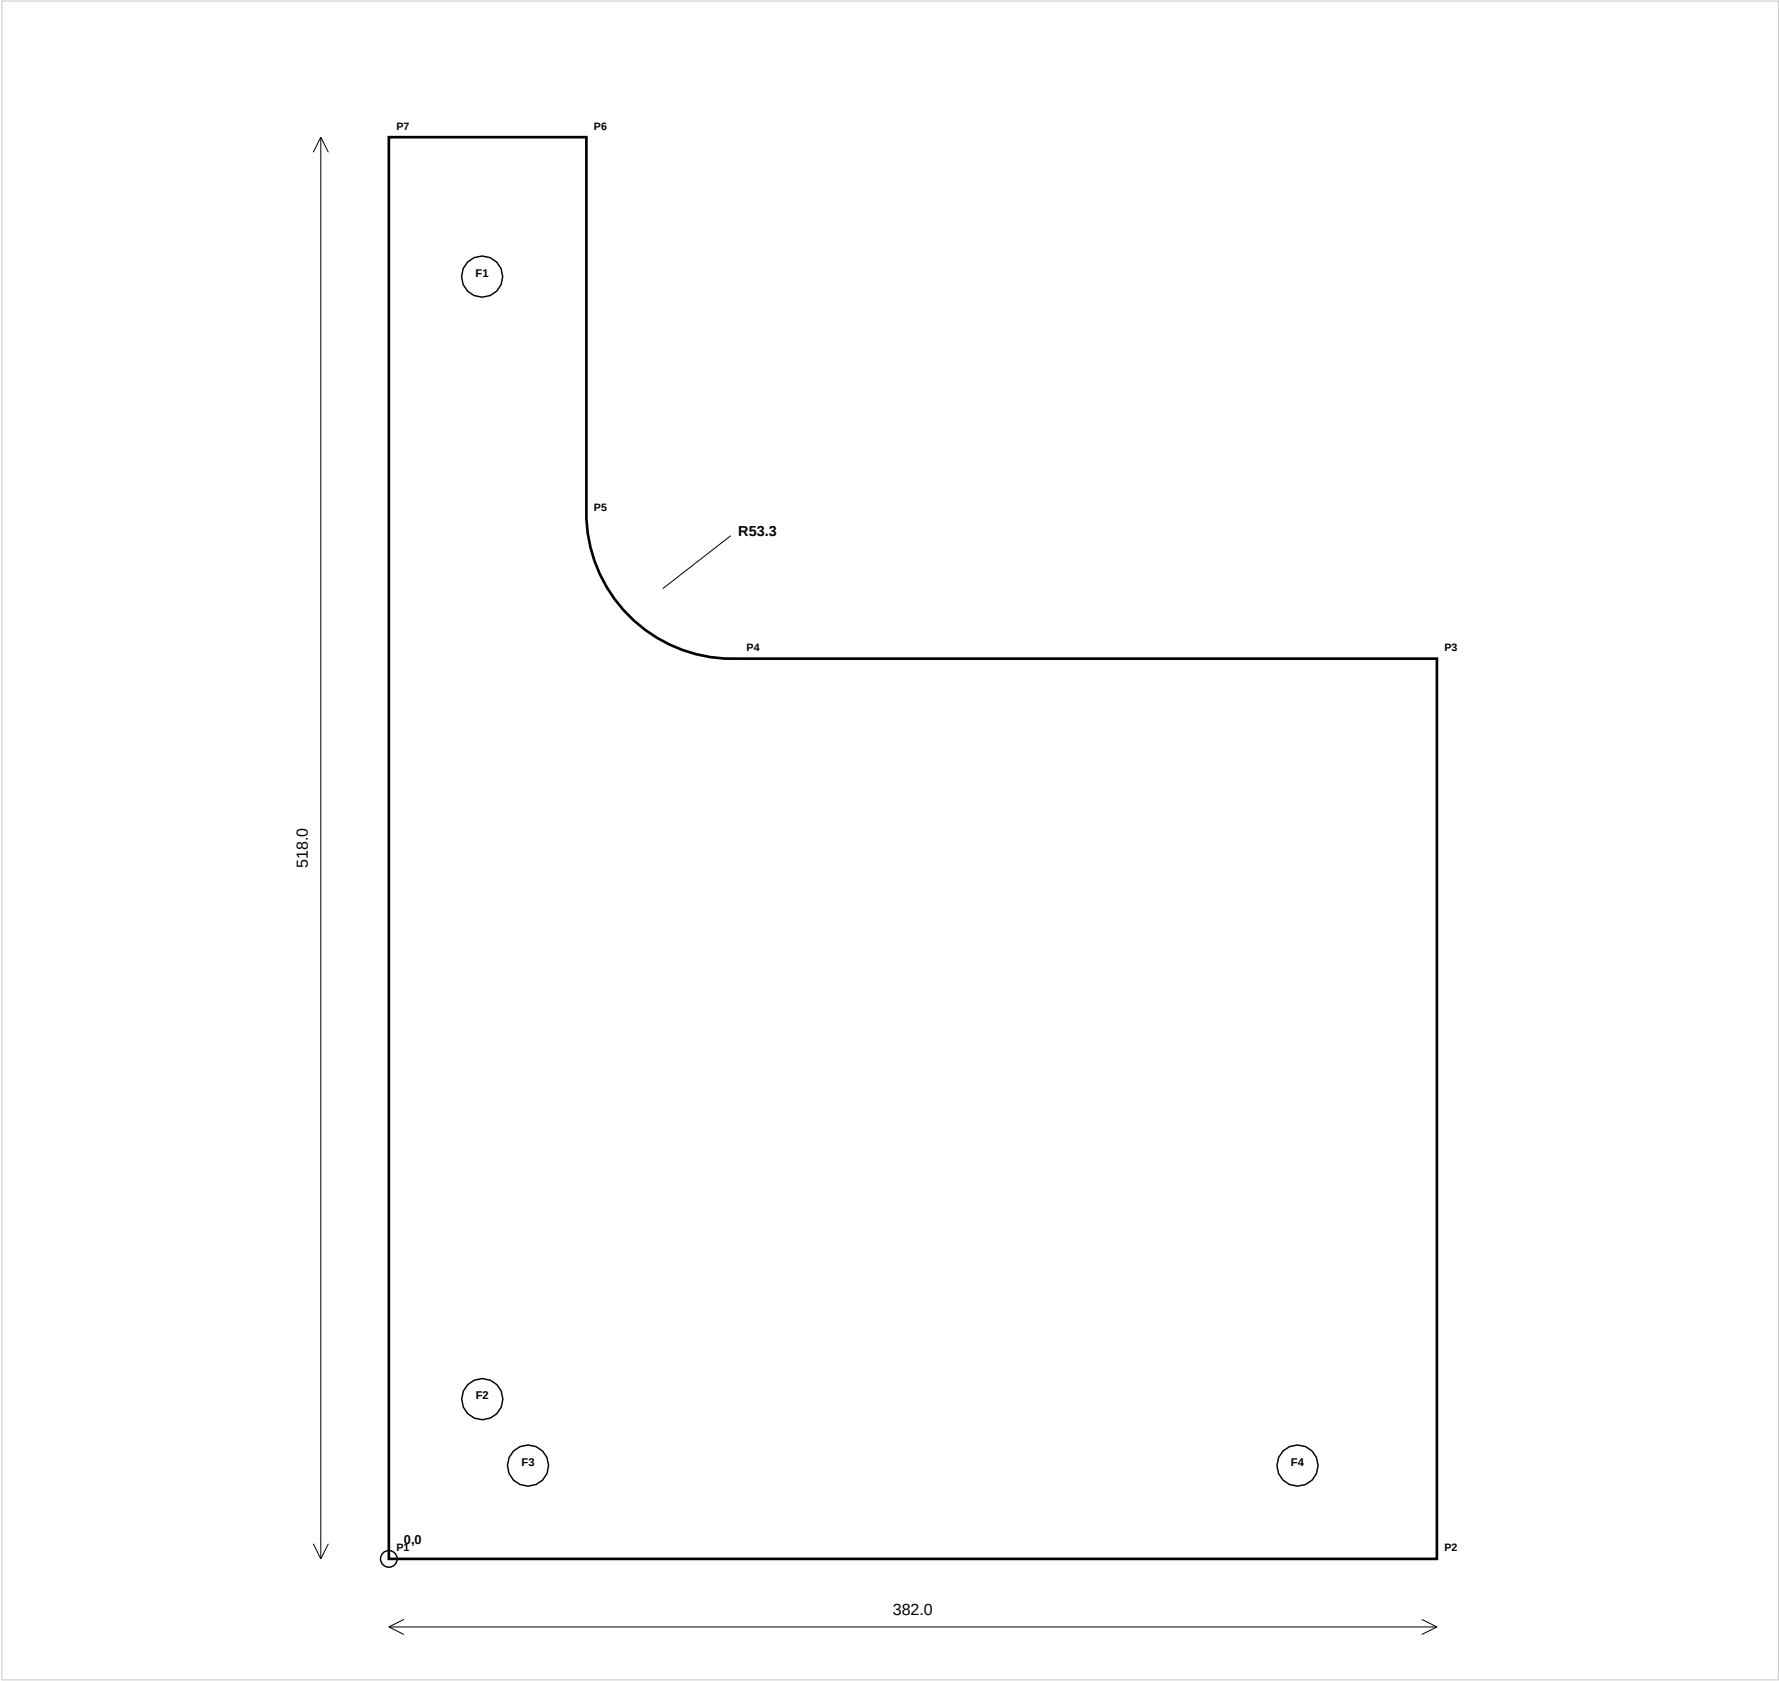

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 467.2
F2	Dia 15 x 14 deep	X 34.1 Y 58.2
F3	Dia 15 x 14 deep	X 50.7 Y 34.0
F4	Dia 15 x 14 deep	X 331.2 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X382.0 Y328.0	LINE
P3	X127.6 Y328.0	LINE
P4	X72.0 Y379.0	ARC R53.3 CW
P5	X72.0 Y518.0	LINE
P6	X0.0 Y518.0	LINE
P7	X0.0 Y0.0	LINE

S2-E - Part detail

Overall 400.0 x 880.0 mm | 18 mm plywood | datum lower-left = X0 Y0

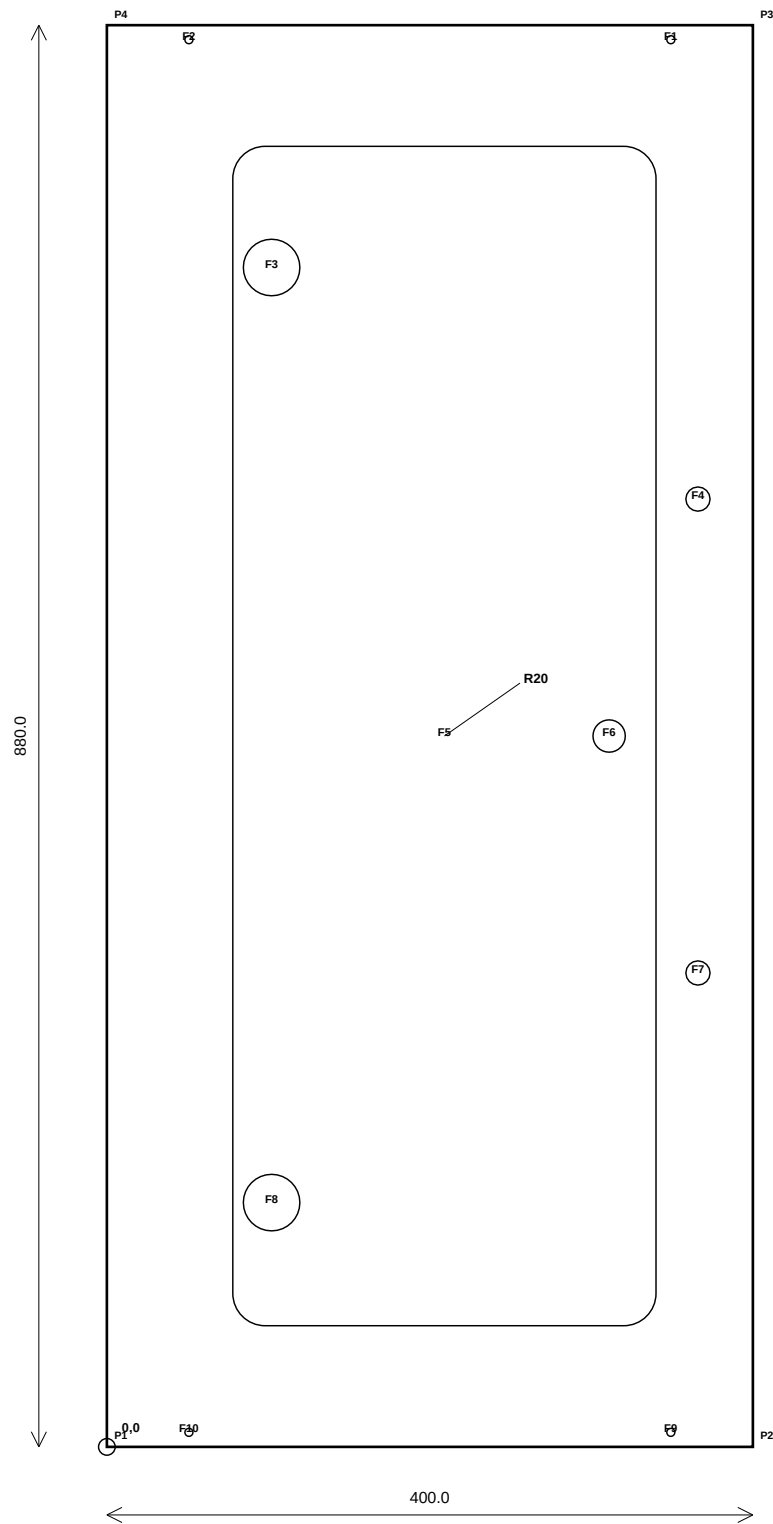

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 349.2 Y 871.0
F2	Dia 5 x 11 deep	X 50.8 Y 871.0
F3	Dia 35 x 13 deep	X 102.0 Y 730.0
F4	Dia 15 x 14 deep	X 366.0 Y 586.7
F5	cut-out 262.0 x 730.0, R20	X 209.0 Y 440.0
F6	Dia 20 THROUGH	X 311.0 Y 440.0
F7	Dia 15 x 14 deep	X 366.0 Y 293.3
F8	Dia 35 x 13 deep	X 102.0 Y 151.2
F9	Dia 5 x 11 deep	X 349.2 Y 9.0
F10	Dia 5 x 11 deep	X 50.8 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X400.0 Y0.0	LINE
P2	X400.0 Y880.0	LINE
P3	X0.0 Y880.0	LINE
P4	X0.0 Y0.0	LINE

S2-F - Part detail

Overall 400.0 x 1613.0 mm | 18 mm plywood | datum lower-left = X0 Y0

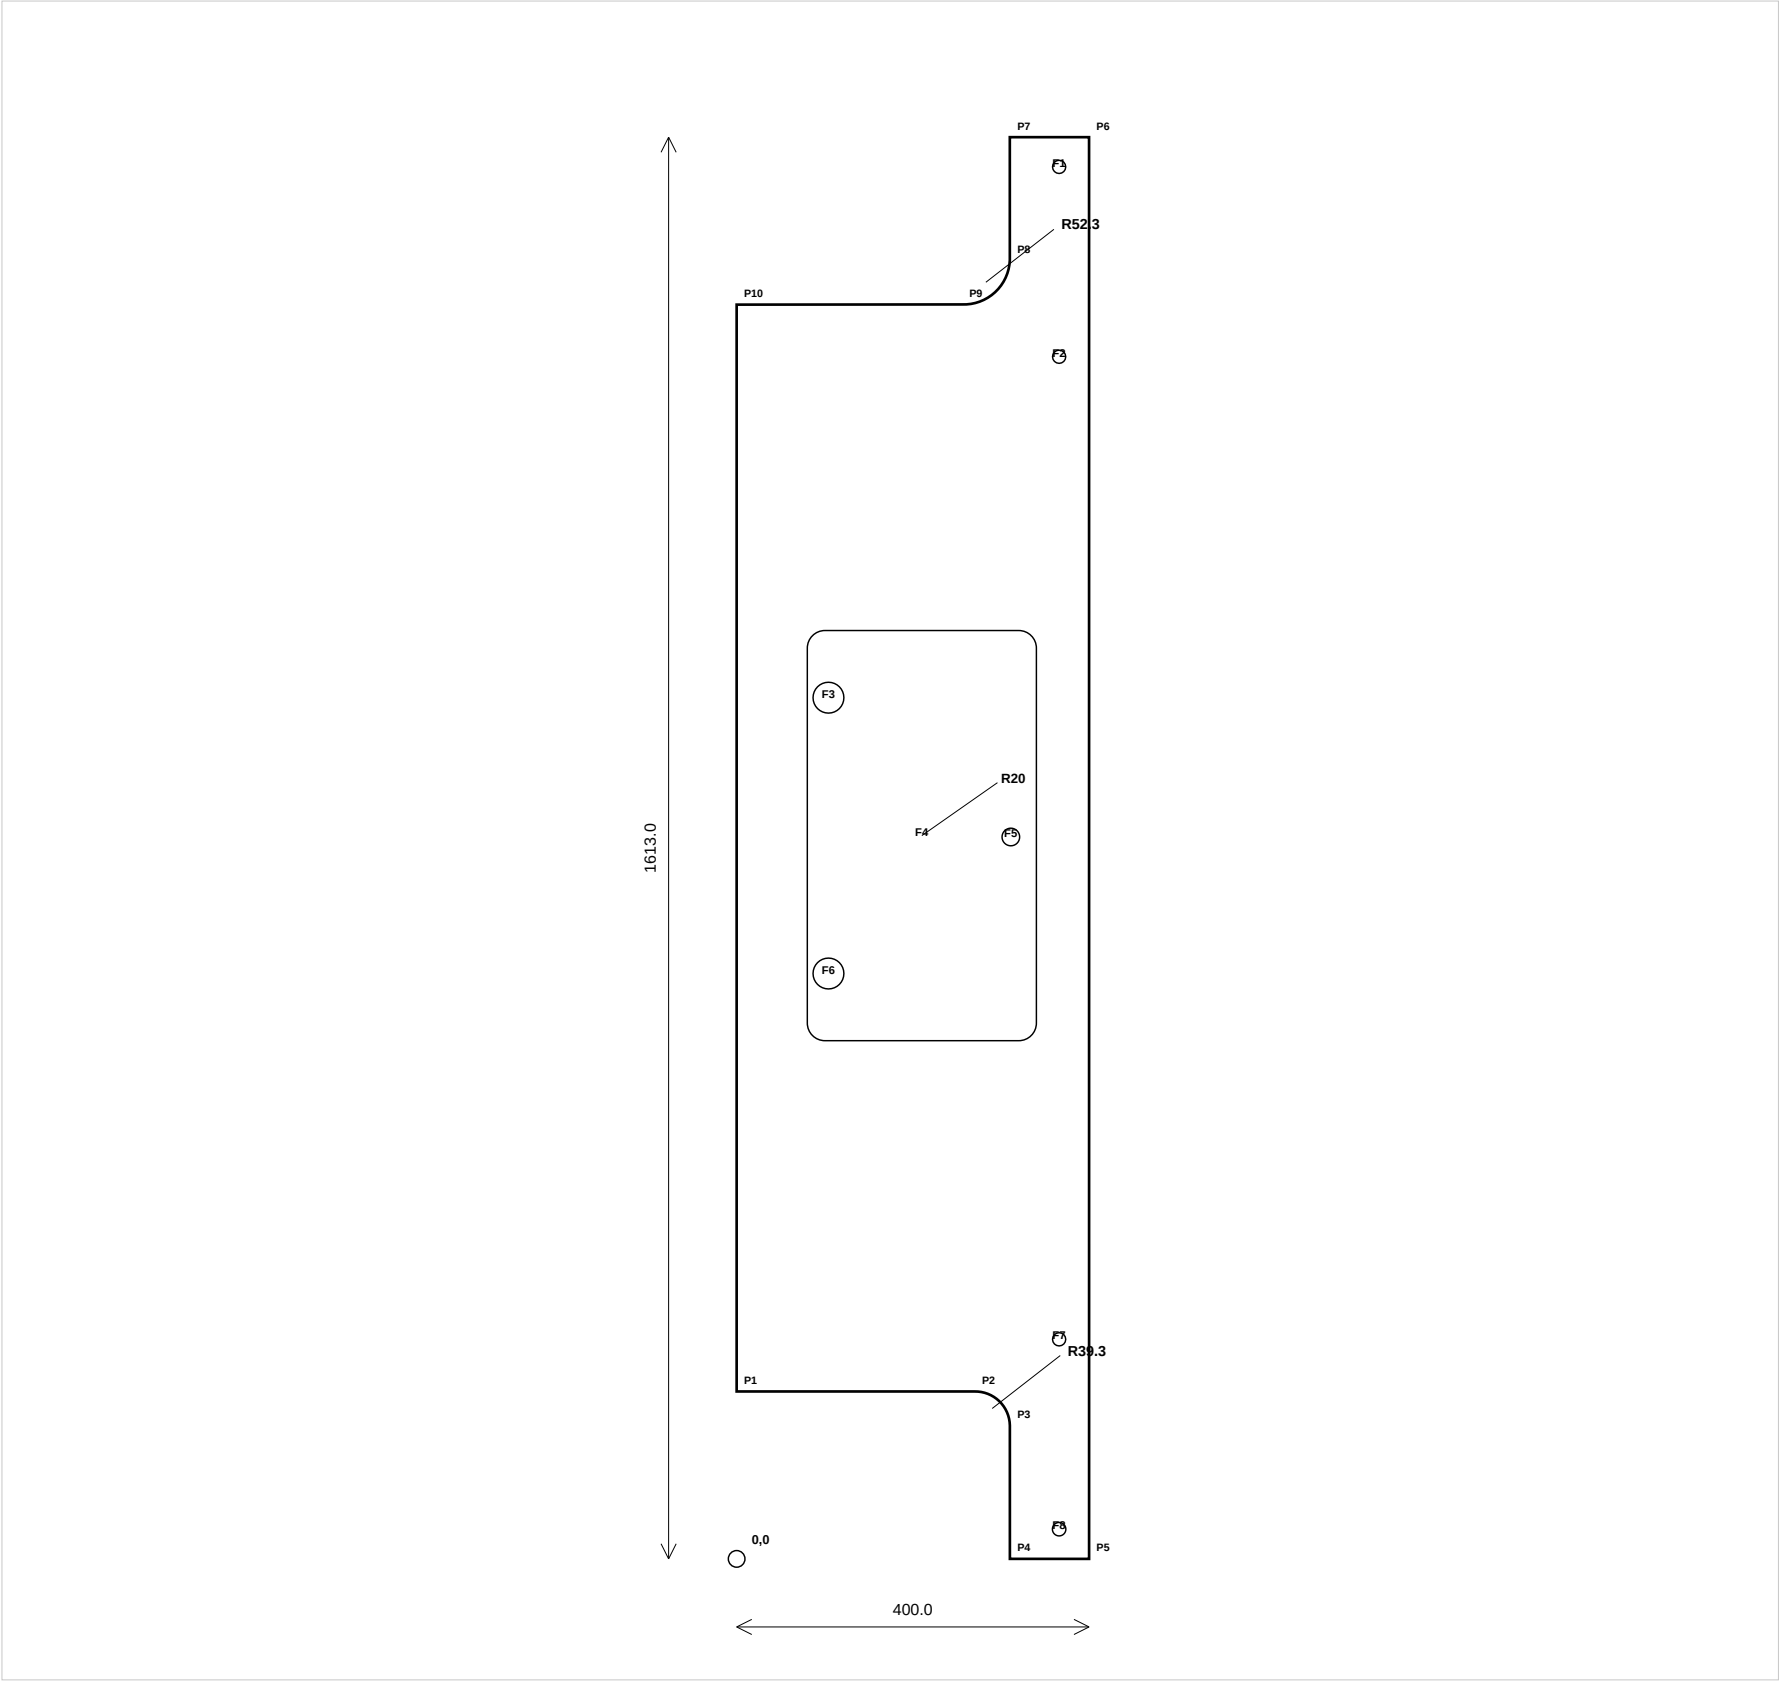

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 366.0 Y 1579.3
F2	Dia 15 x 14 deep	X 366.0 Y 1363.9
F3	Dia 35 x 13 deep	X 104.2 Y 977.1
F4	cut-out 260.0 x 465.3, R20	X 210.2 Y 820.6
F5	Dia 20 THROUGH	X 311.2 Y 819.0
F6	Dia 35 x 13 deep	X 104.2 Y 664.1
F7	Dia 15 x 14 deep	X 366.0 Y 249.1
F8	Dia 15 x 14 deep	X 366.0 Y 33.7


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X270.0 Y189.9	LINE
P2	X310.1 Y151.3	ARC R39.3 CW
P3	X310.1 Y0.0	LINE
P4	X400.0 Y0.0	LINE
P5	X400.0 Y1613.0	LINE
P6	X310.0 Y1613.0	LINE
P7	X310.0 Y1473.6	LINE
P8	X255.7 Y1423.2	ARC R52.3 CW
P9	X0.0 Y1423.0	LINE
P10	X0.0 Y189.9	LINE

S2-G - Part detail

Overall 400.0 x 532.0 mm | 18 mm plywood | datum lower-left = X0 Y0

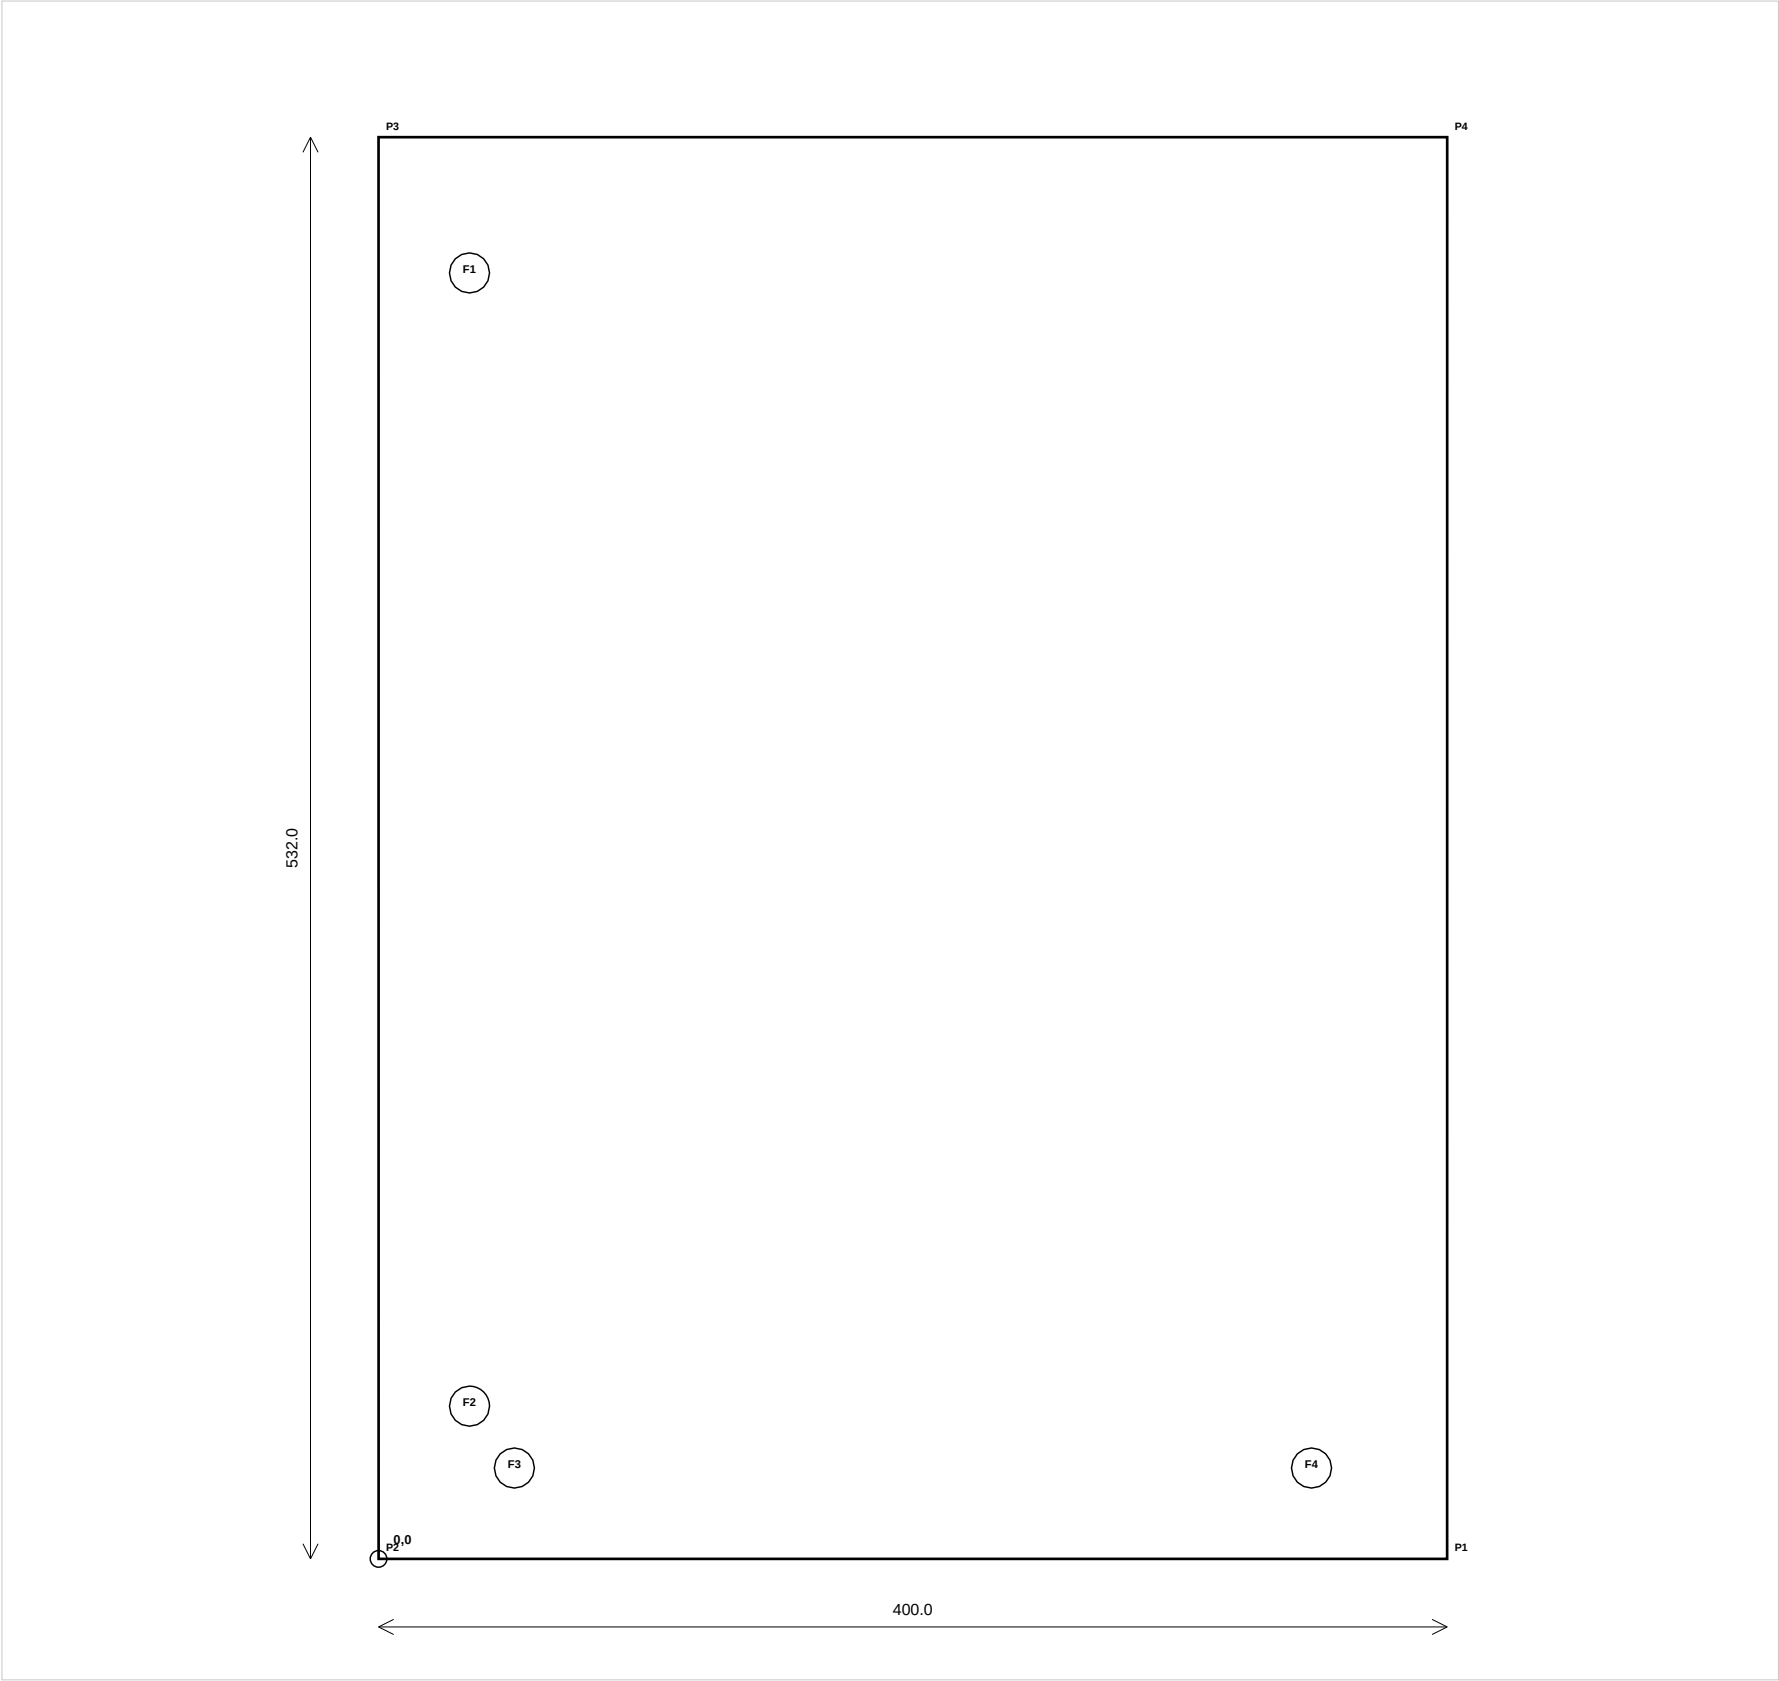

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.1 Y 481.2
F2	Dia 15 x 14 deep	X 34.1 Y 57.1
F3	Dia 15 x 14 deep	X 50.9 Y 34.0
F4	Dia 15 x 14 deep	X 349.3 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y532.0	LINE
P3	X400.0 Y532.0	LINE
P4	X400.0 Y0.0	LINE

S2-H - Part detail

Overall 576.3 x 880.0 mm | 18 mm plywood | datum lower-left = X0 Y0

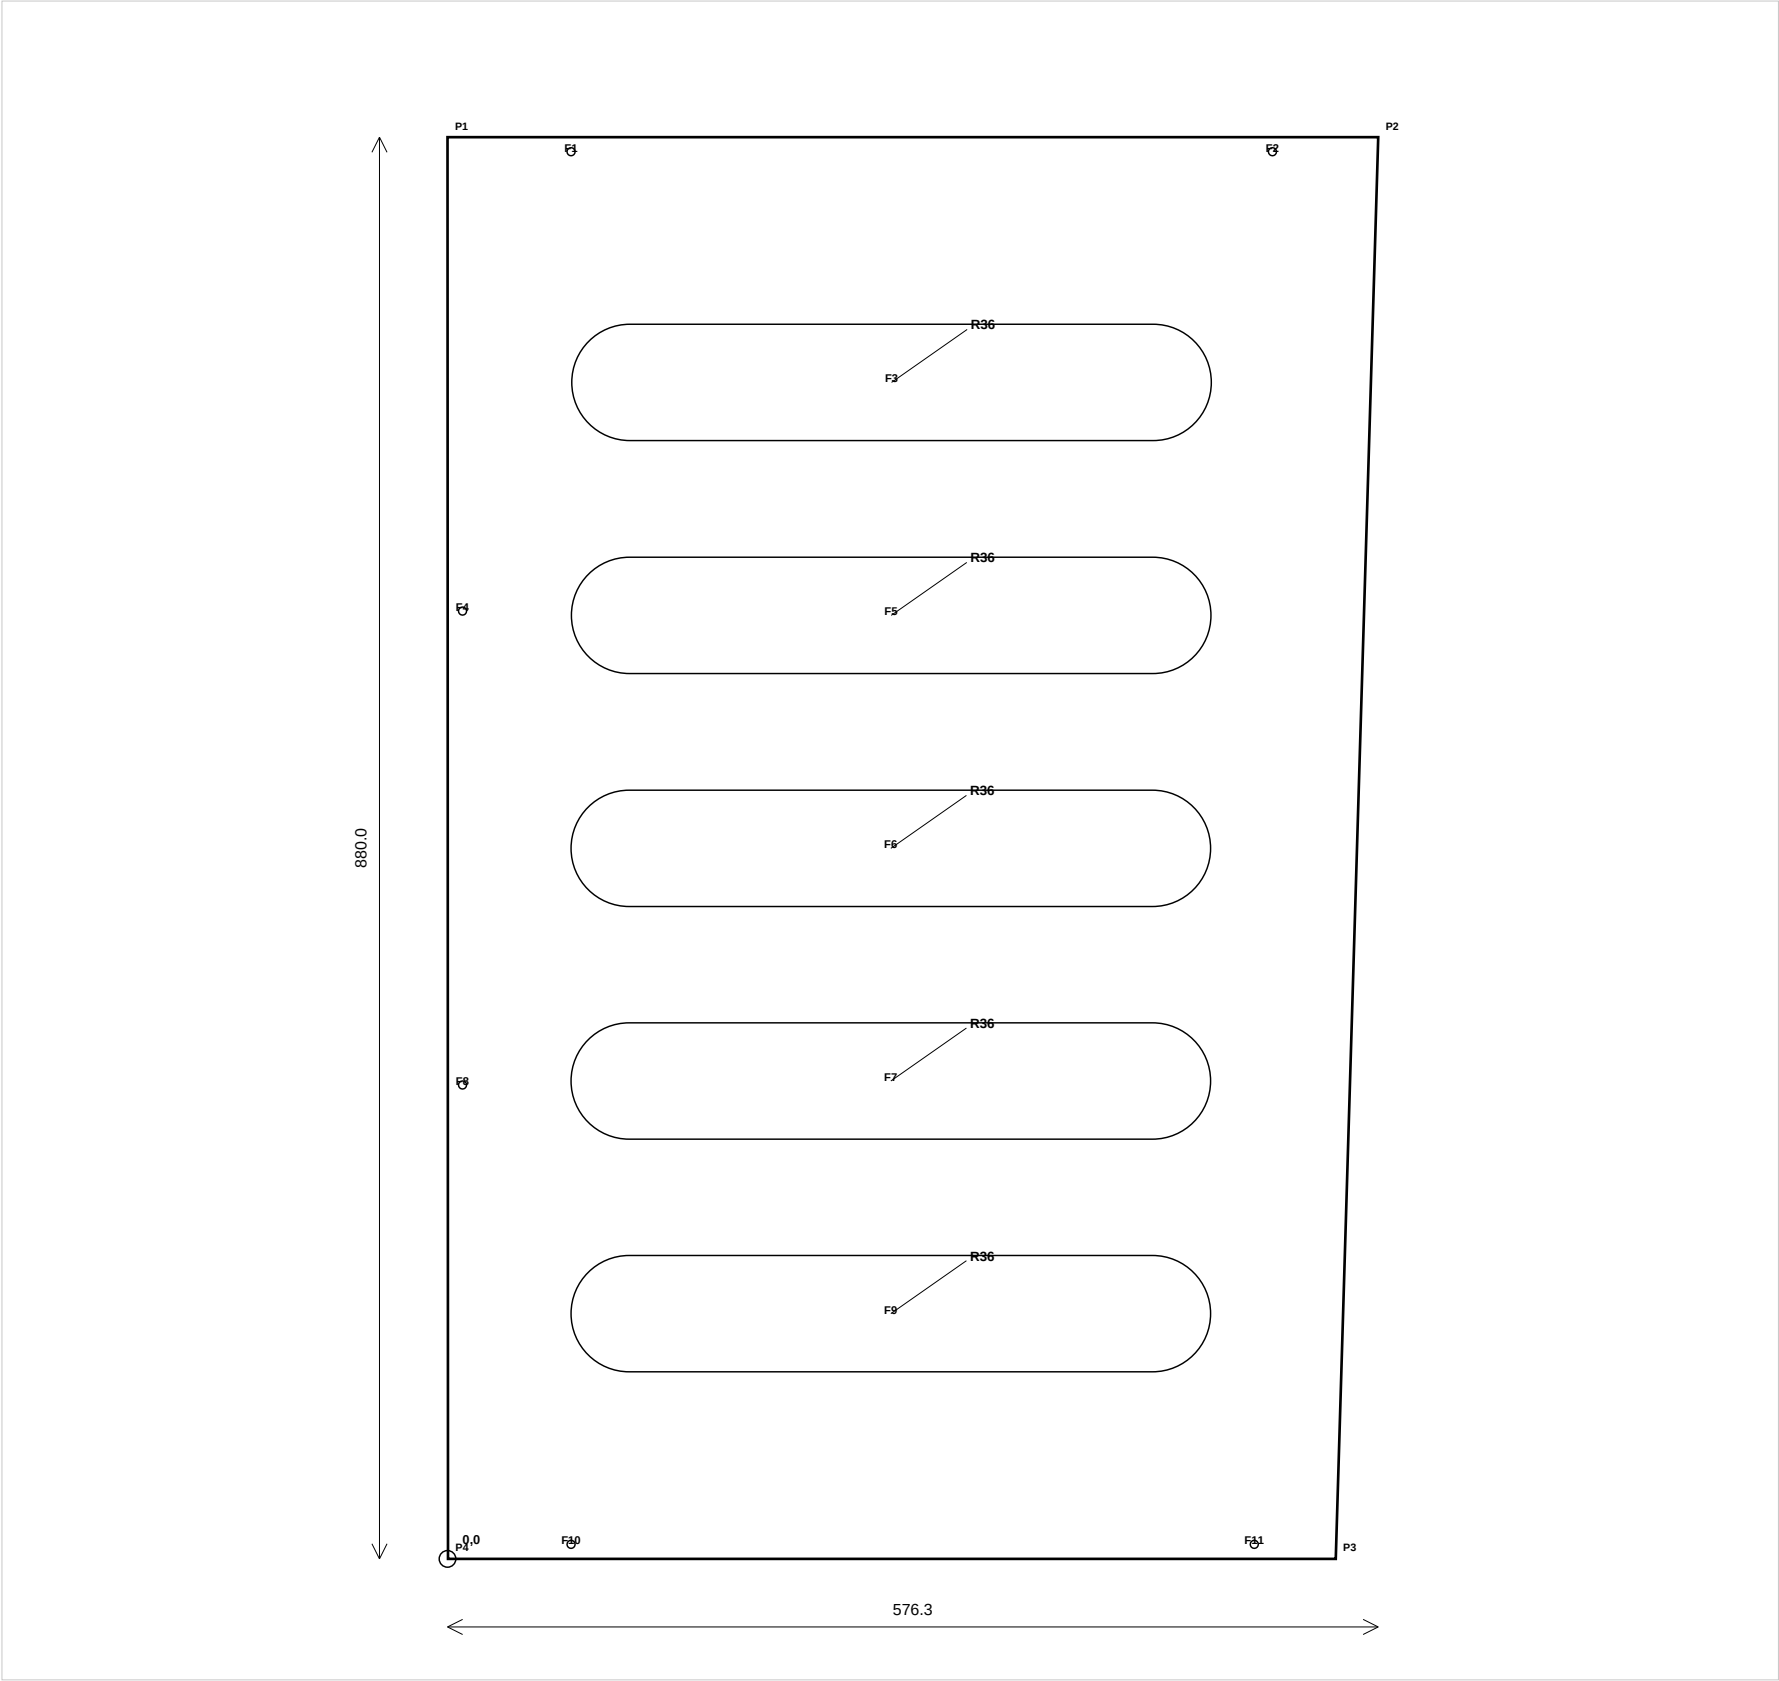

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 76.5 Y 871.0
F2	Dia 5 x 11 deep	X 510.8 Y 871.0
F3	cut-out 396.0 x 72.0, R36	X 274.9 Y 728.2
F4	Dia 5 x 11 deep	X 9.3 Y 586.7
F5	cut-out 396.0 x 72.0, R36	X 274.7 Y 584.0
F6	cut-out 396.0 x 72.0, R36	X 274.5 Y 439.8
F7	cut-out 396.0 x 72.0, R36	X 274.5 Y 295.8
F8	Dia 5 x 11 deep	X 9.3 Y 293.3
F9	cut-out 396.0 x 72.0, R36	X 274.5 Y 151.8
F10	Dia 5 x 11 deep	X 76.5 Y 9.0
F11	Dia 5 x 11 deep	X 499.5 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X576.3 Y880.0	LINE
P2	X550.0 Y0.0	LINE
P3	X0.3 Y0.0	LINE
P4	X0.0 Y880.0	LINE

S2-I - Part detail

Overall 382.1 x 498.0 mm | 18 mm plywood | datum lower-left = X0 Y0

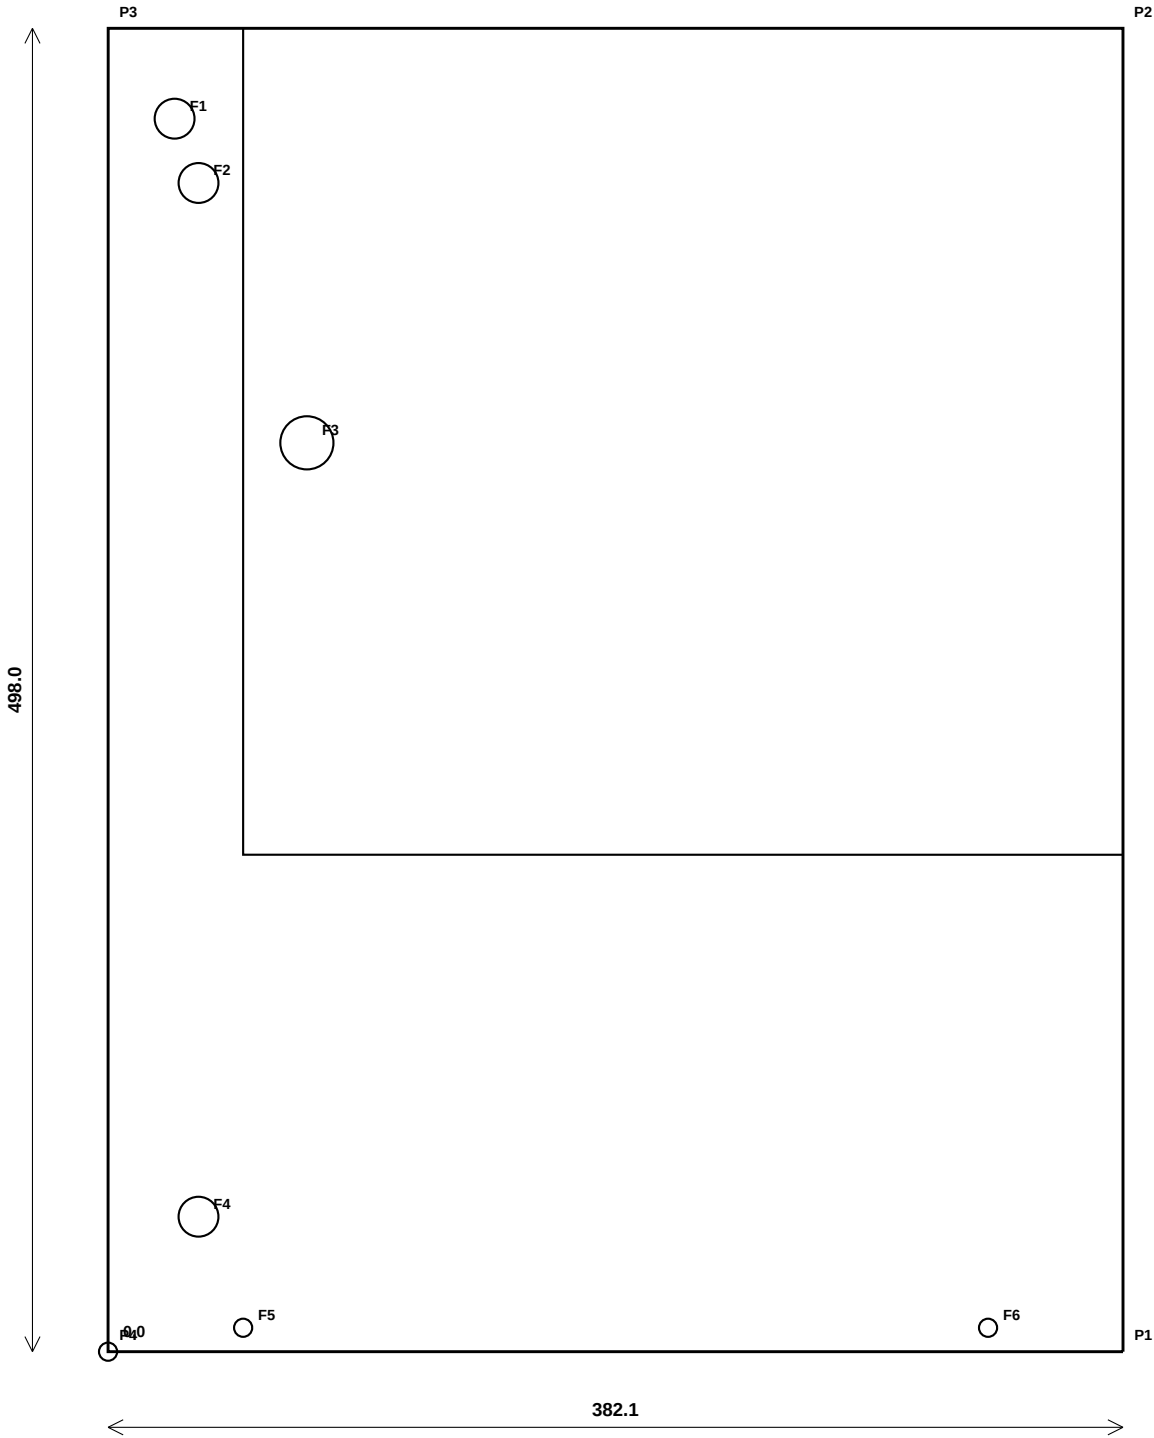

Machining features

F1	Dia 15 mm - 14 deep X 25.0 Y 464.0
F2	Dia 15 mm - 14 deep X 34.1 Y 439.8
F3	Dia 20 mm - THROUGH X 74.9 Y 342.0
F4	Dia 15 mm - 14 deep X 34.1 Y 50.8
F5	Dia 5 mm - 11 deep X 50.8 Y 9.0
F6	Dia 5 mm - 11 deep X 331.3 Y 9.0

Internal line


I1:	X 382.0 Y 187.0
I2:	X 50.9 Y 187.0
I3:	X 50.8 Y 498.0

Outer profile cuts

P1->P2	LINE 498.0 mm
P2->P3	LINE 382.0 mm
P3->P4	LINE 498.0 mm
P4->P1	LINE 382.1 mm

S3-A - Part detail

Overall 700.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

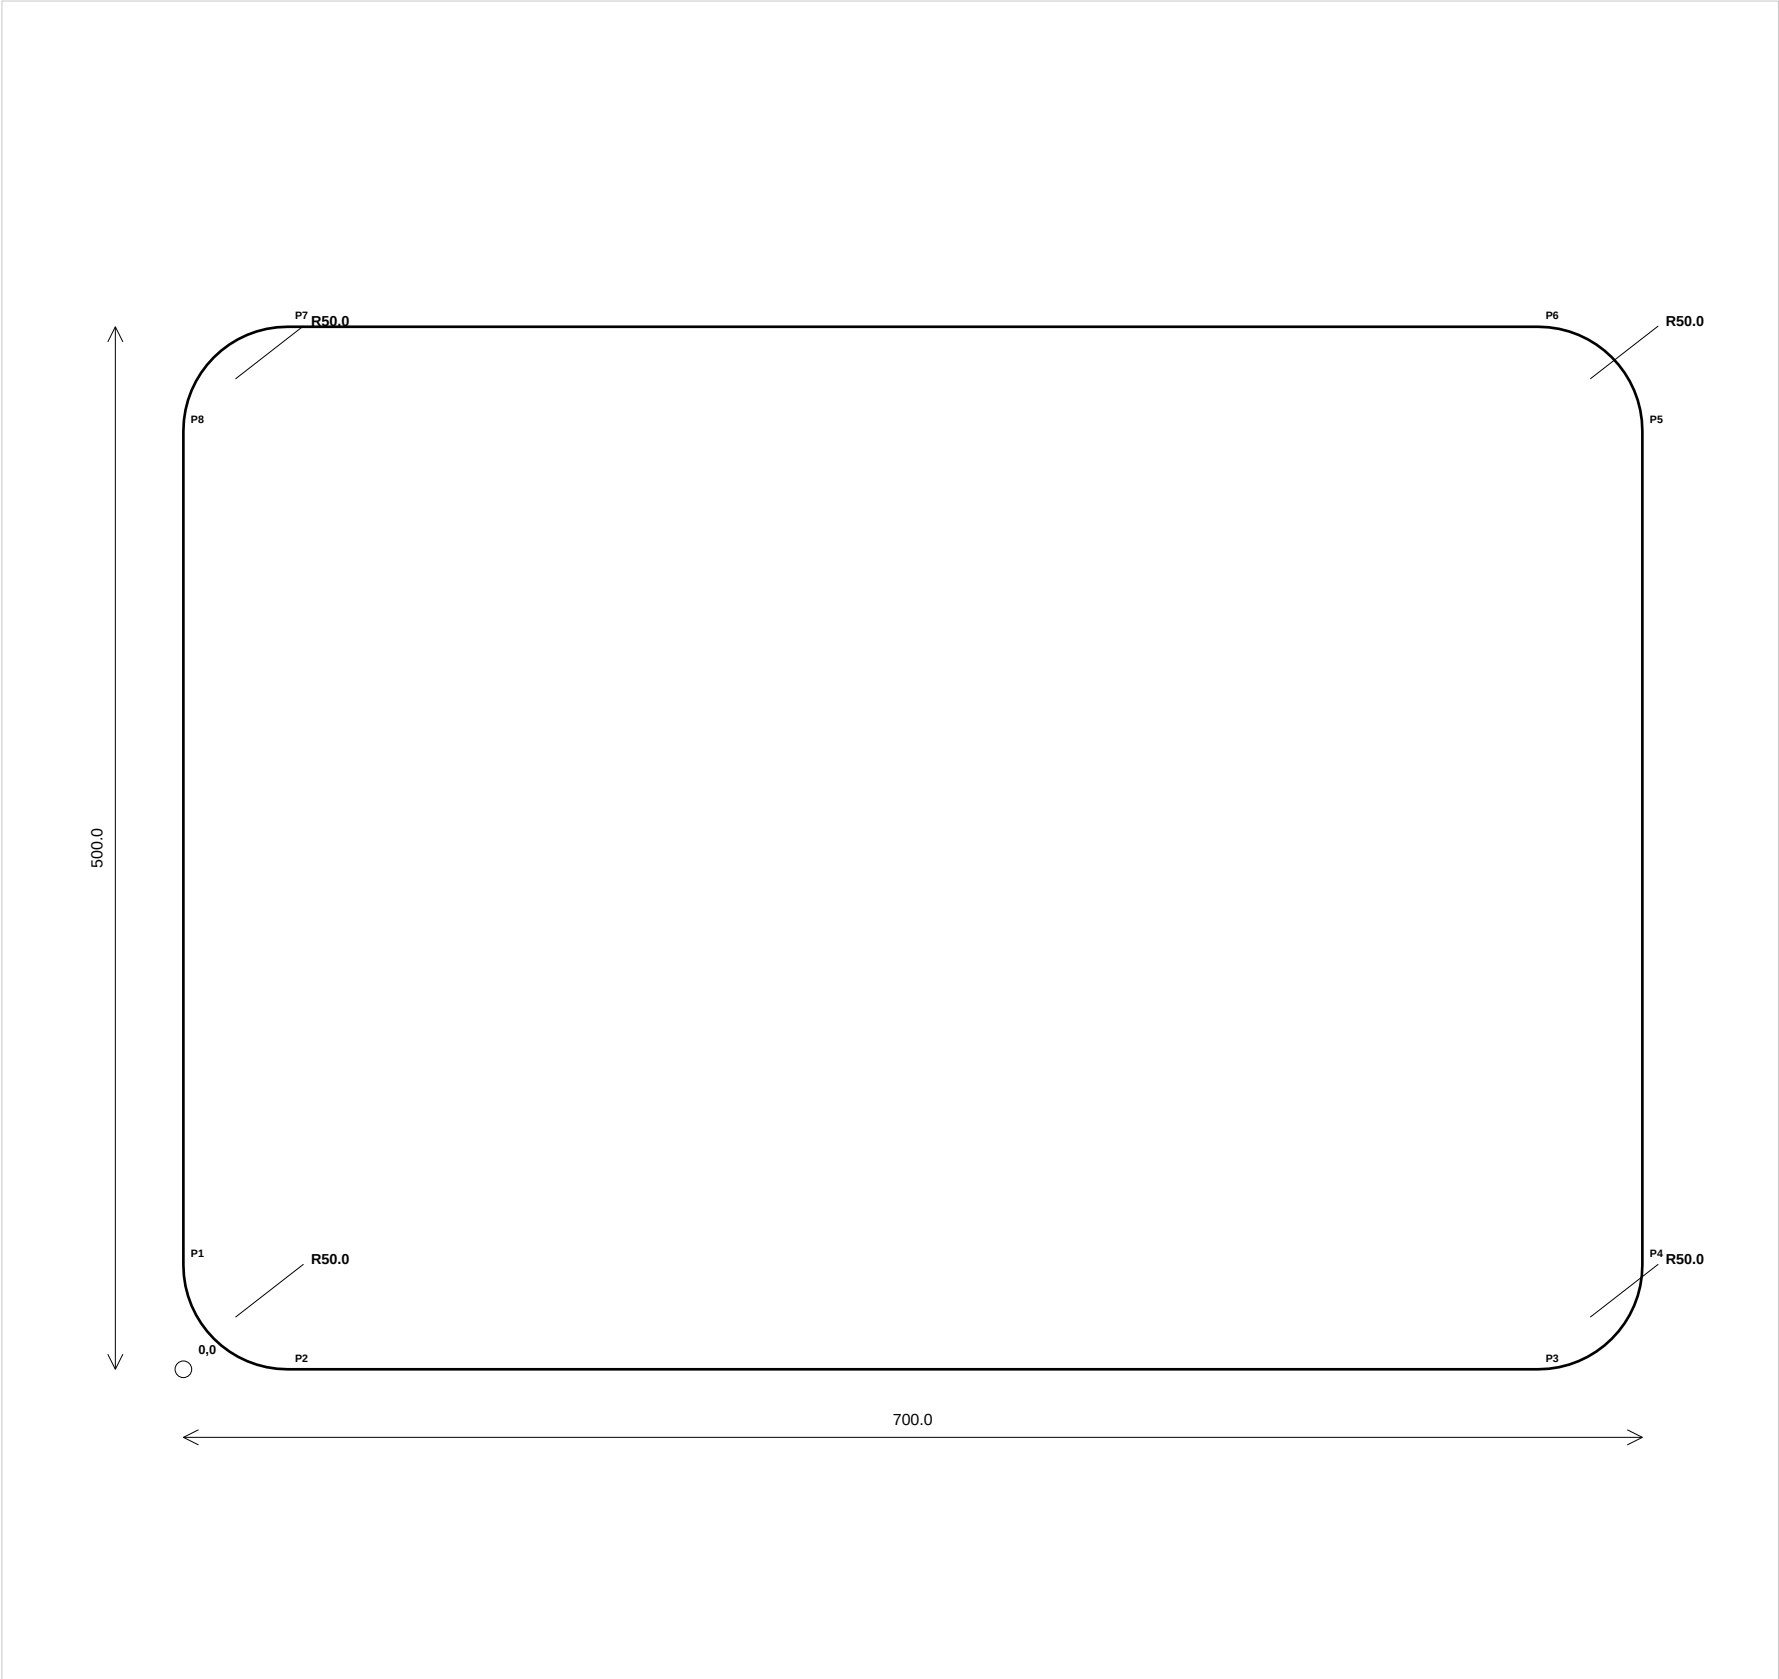

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X50.0 Y0.0	ARC R50.0 CCW
P2	X650.0 Y0.0	LINE
P3	X700.0 Y50.0	ARC R50.0 CCW
P4	X700.0 Y450.0	LINE
P5	X650.0 Y500.0	ARC R50.0 CCW
P6	X50.0 Y500.0	LINE
P7	X0.0 Y450.0	ARC R50.0 CCW
P8	X0.0 Y50.0	LINE

S3-B - Part detail

Overall 382.0 x 1340.0 mm | 18 mm plywood | datum lower-left = X0 Y0

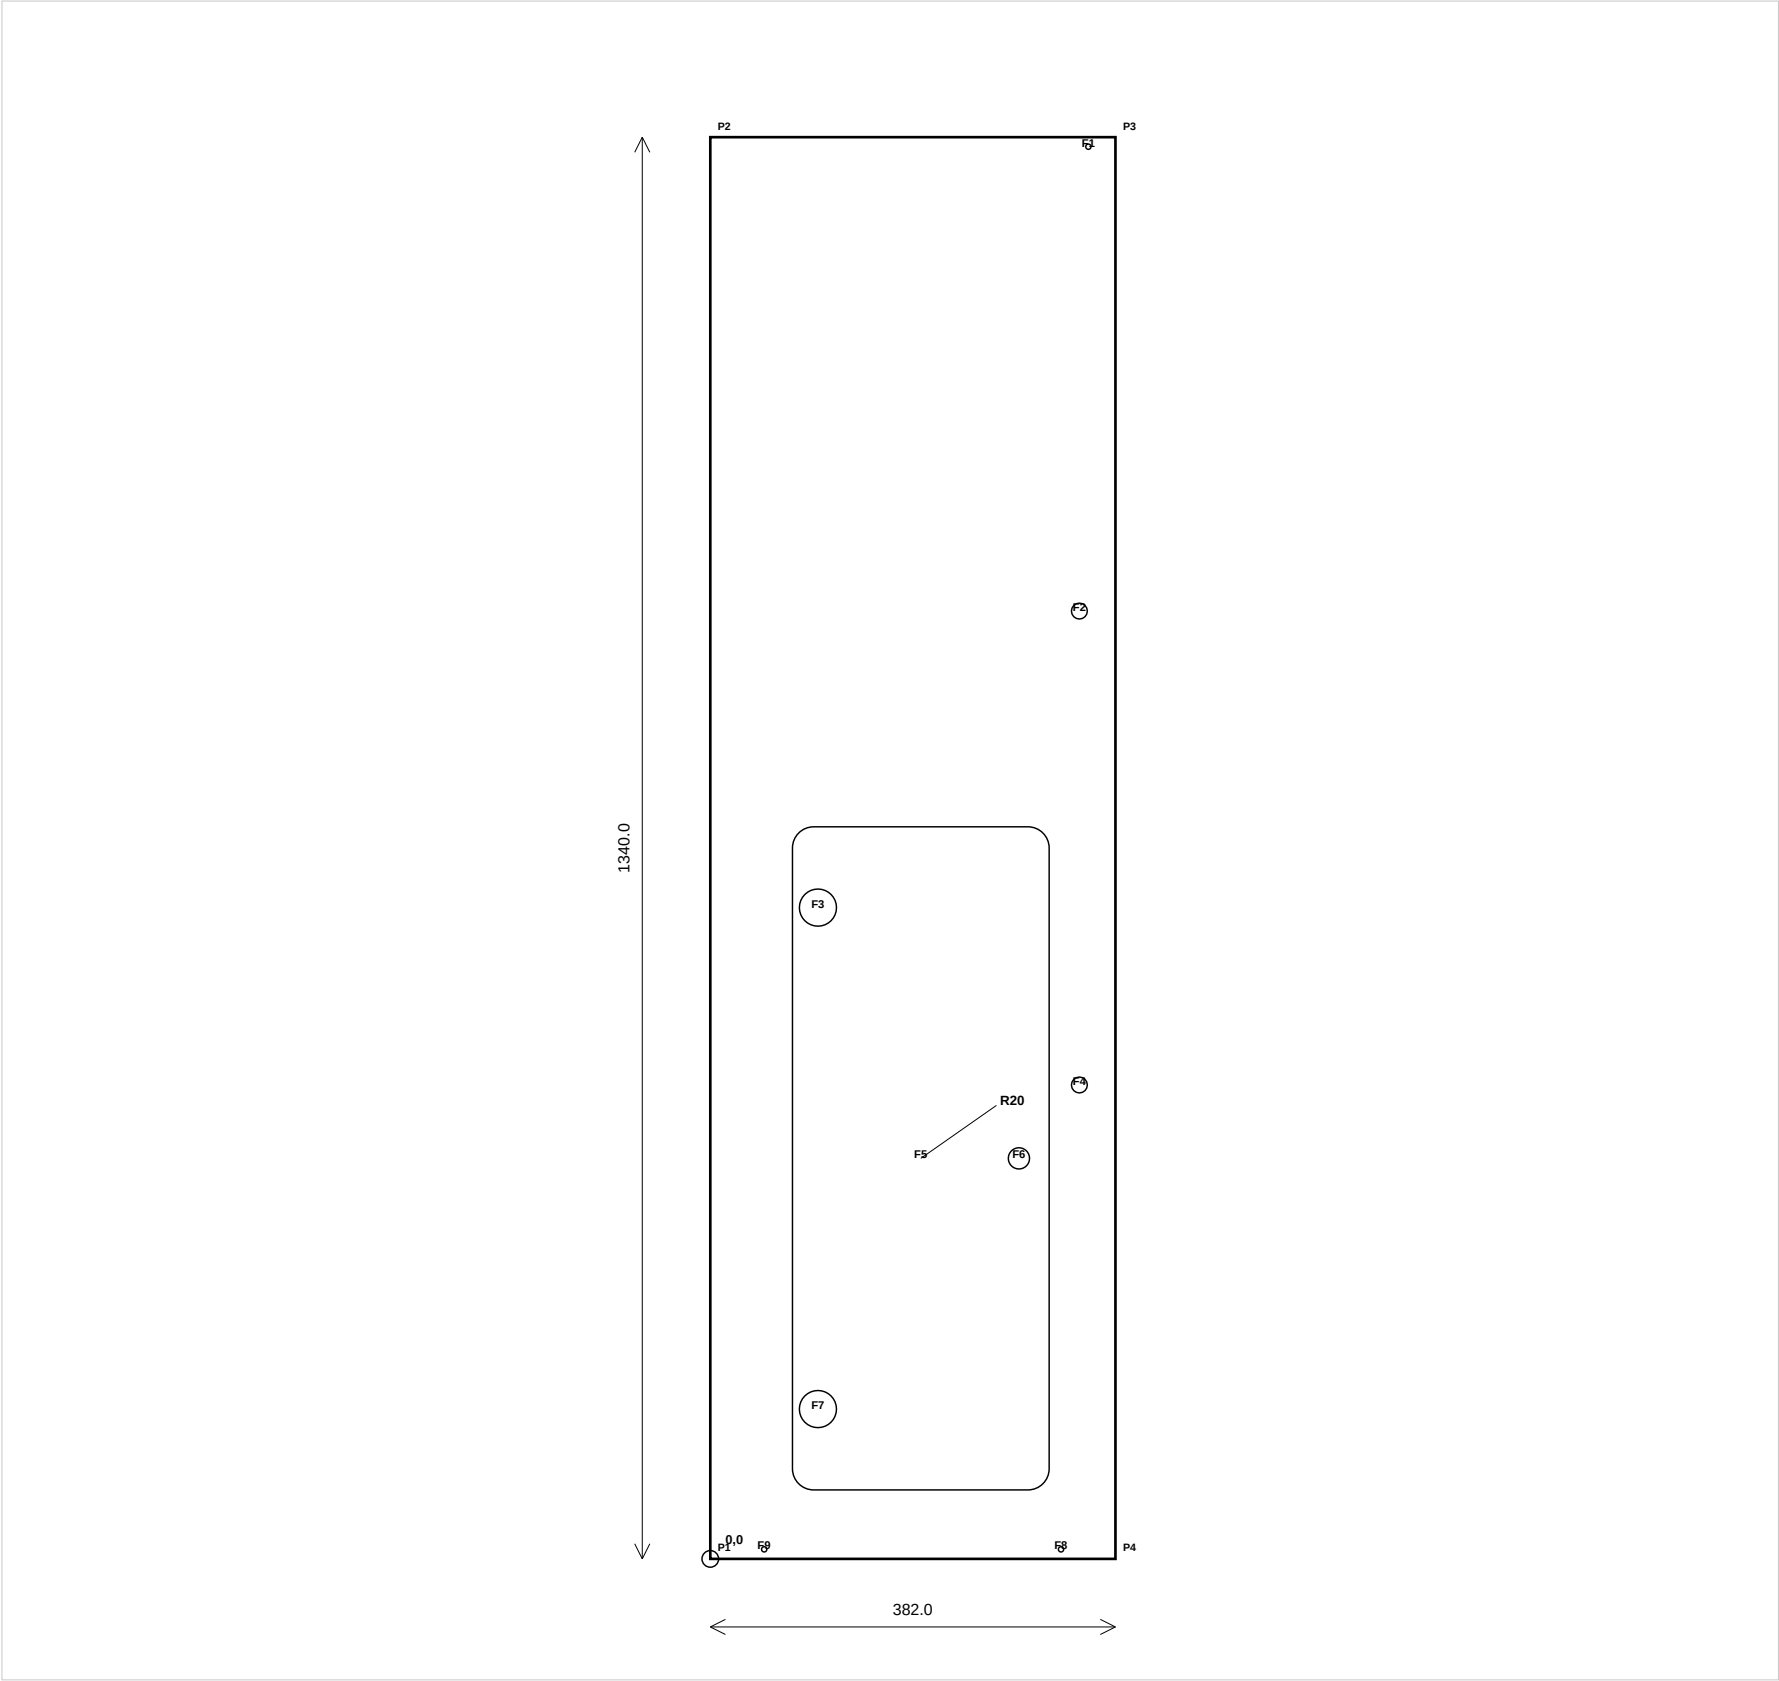

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 356.5 Y 1331.0
F2	Dia 15 x 14 deep	X 348.0 Y 893.3
F3	Dia 35 x 13 deep	X 101.5 Y 613.9
F4	Dia 15 x 14 deep	X 348.0 Y 446.7
F5	cut-out 242.0 x 625.0, R20	X 198.5 Y 377.5
F6	Dia 20 THROUGH	X 291.0 Y 377.5
F7	Dia 35 x 13 deep	X 101.5 Y 141.2
F8	Dia 5 x 11 deep	X 330.7 Y 9.0
F9	Dia 5 x 11 deep	X 50.8 Y 9.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y1340.0	LINE
P2	X382.0 Y1340.0	LINE
P3	X382.0 Y0.0	LINE
P4	X0.0 Y0.0	LINE

S3-C - Part detail

Overall 506.0 x 1338.1 mm | 18 mm plywood | datum lower-left = X0 Y0

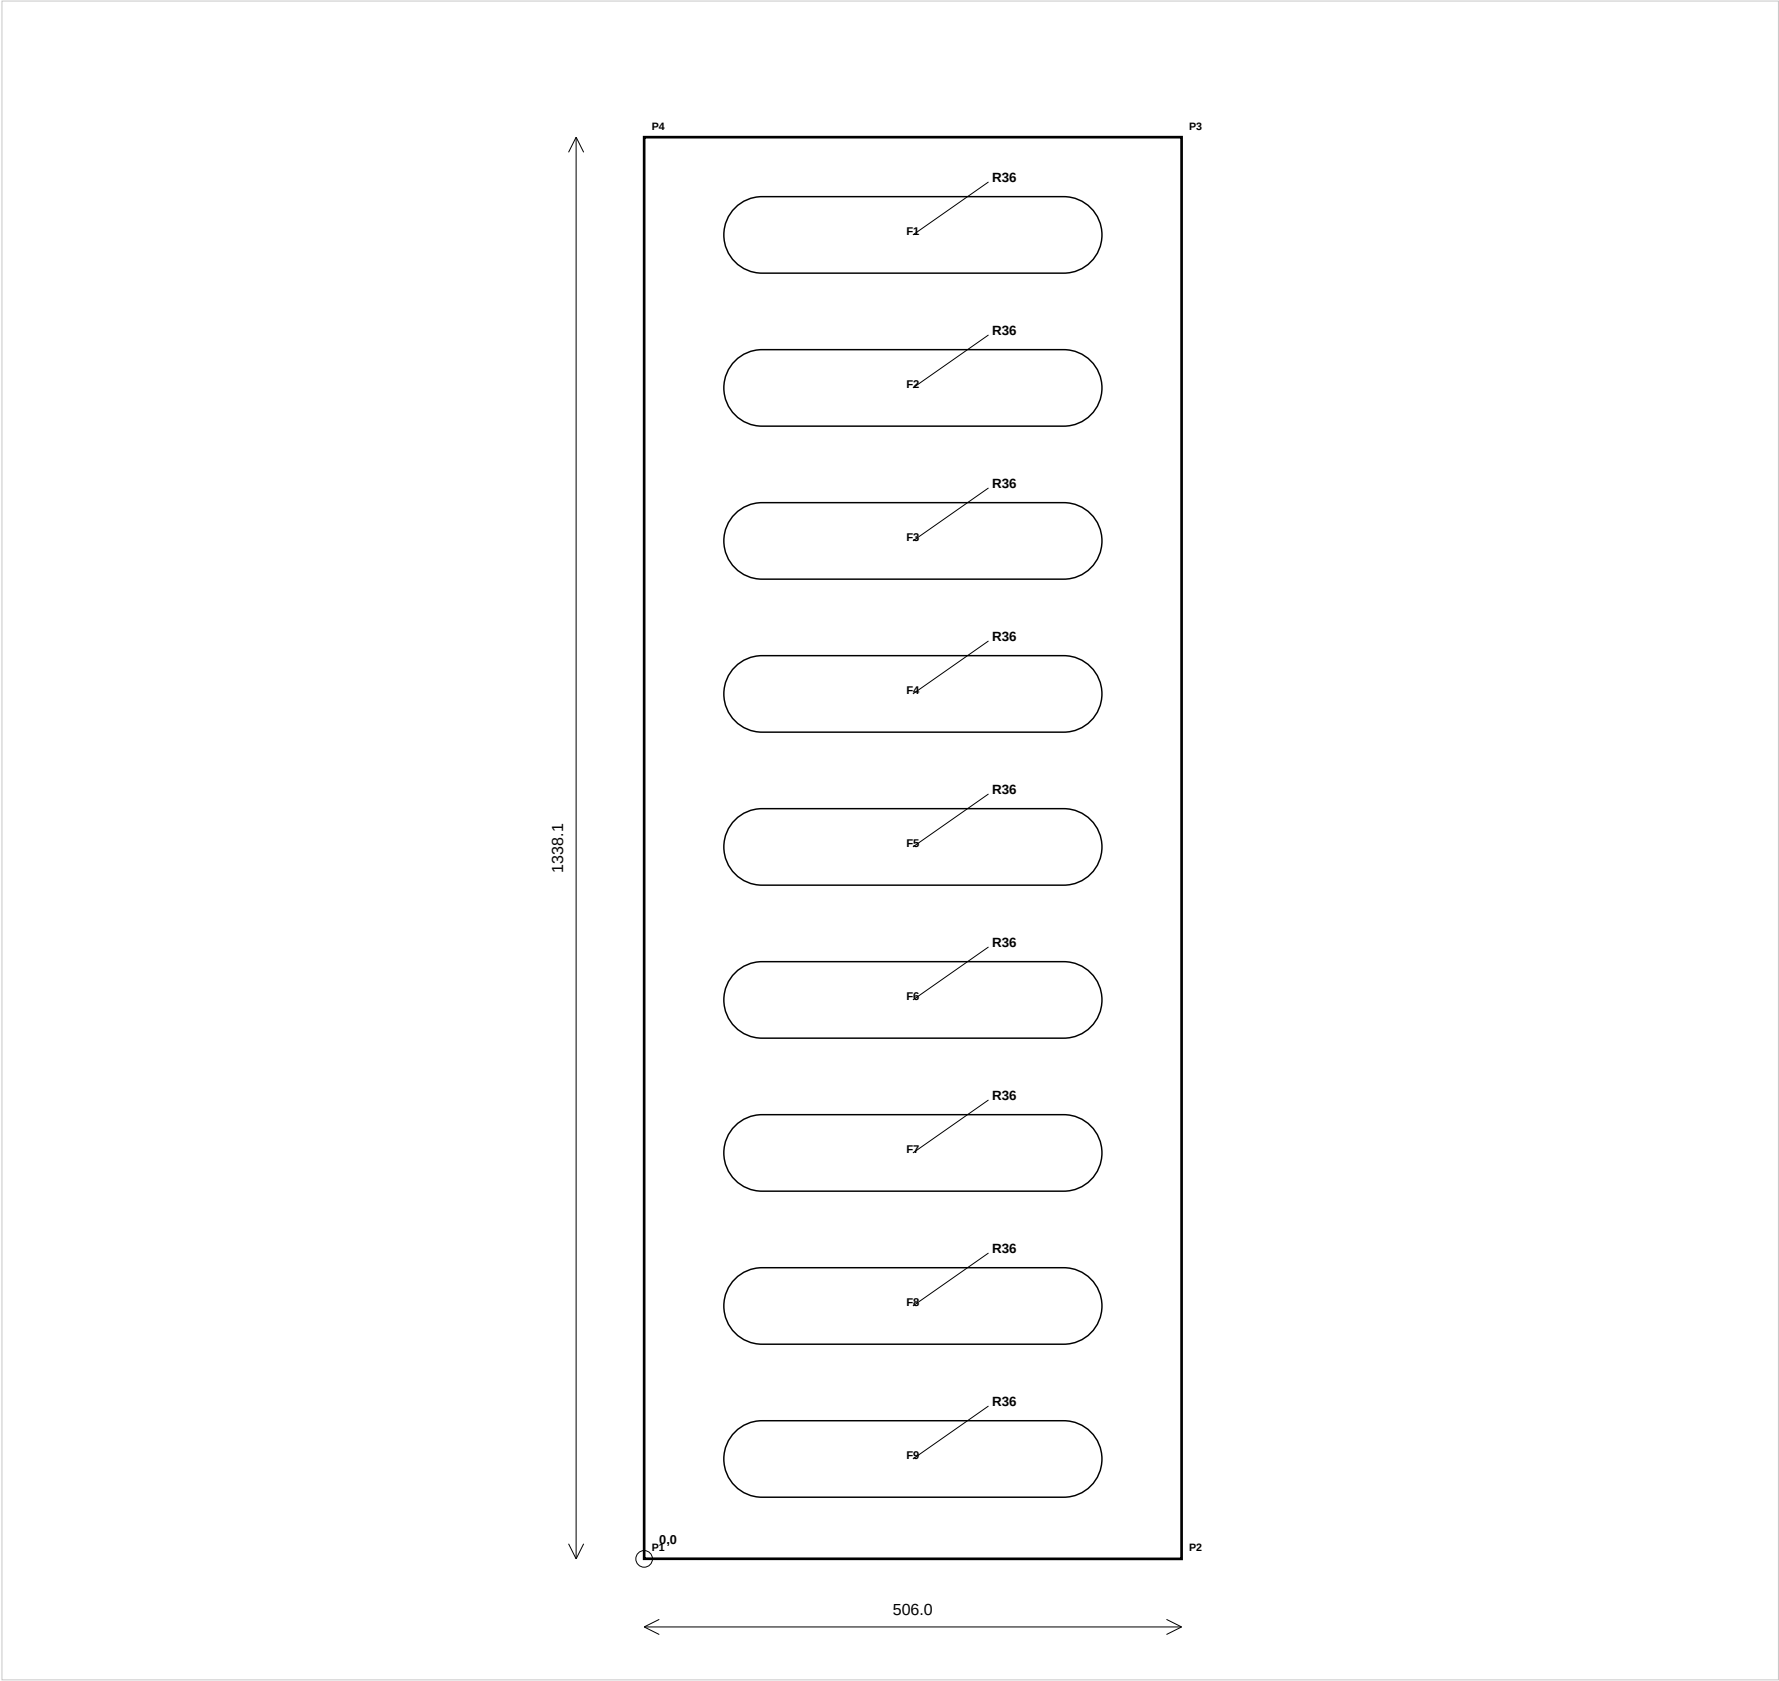

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	cut-out 356.0 x 72.0, R36	X 253.0 Y 1246.1
F2	cut-out 356.0 x 72.0, R36	X 253.0 Y 1102.1
F3	cut-out 356.0 x 72.0, R36	X 253.0 Y 958.1
F4	cut-out 356.0 x 72.0, R36	X 253.0 Y 814.1
F5	cut-out 356.0 x 72.0, R36	X 253.0 Y 670.1
F6	cut-out 356.0 x 72.0, R36	X 253.0 Y 526.1
F7	cut-out 356.0 x 72.0, R36	X 253.0 Y 382.1
F8	cut-out 356.0 x 72.0, R36	X 253.0 Y 238.0
F9	cut-out 356.0 x 72.0, R36	X 253.0 Y 94.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X506.0 Y0.0	LINE
P2	X506.0 Y1338.1	LINE
P3	X0.0 Y1338.1	LINE
P4	X0.0 Y0.1	LINE

S3-D - Part detail

Overall 600.0 x 284.1 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 591.0 Y 233.2
F2	Dia 5 x 11 deep	X 591.0 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X600.0 Y0.0	LINE
P2	X600.0 Y284.0	LINE
P3	X579.3 Y284.0	LINE
P4	X549.2 Y254.0	ARC R30.0 CCW
P5	X549.2 Y80.9	LINE
P6	X519.2 Y50.8	ARC R30.0 CW
P7	X363.0 Y50.8	LINE
P8	X355.5 Y52.8	SMOOTH CURVE
P9	X350.5 Y57.4	SMOOTH CURVE
P10	X348.1 Y64.5	SMOOTH CURVE
P11	X331.6 Y256.7	LINE
P12	X301.7 Y284.0	ARC R30.0 CCW
P13	X298.4 Y284.0	LINE
P14	X268.4 Y256.6	ARC R30.0 CCW
P15	X251.9 Y64.5	LINE
P16	X249.4 Y57.2	SMOOTH CURVE
P17	X244.3 Y52.7	SMOOTH CURVE
P18	X237.0 Y50.8	SMOOTH CURVE
P19	X80.9 Y50.8	LINE
P20	X50.8 Y80.8	ARC R30.0 CW
P21	X50.8 Y253.9	LINE
P22	X20.8 Y284.0	ARC R30.0 CCW
P23	X0.0 Y284.0	LINE
P24	X0.0 Y0.0	LINE

Internal cut-outs

- C1: 18.5 x 50.8 mm LL X 9.0 Y 182.4
- C2: 18.5 x 50.8 mm LL X 9.0 Y 50.8
- C3: 18.5 x 50.8 mm LL X 290.7 Y 50.8
- C4: 18.5 x 50.8 mm LL X 290.8 Y 182.4
- C5: 50.8 x 18.5 mm LL X 498.4 Y 18.0
- C6: 58.5 x 18.5 mm LL X 270.7 Y 18.0
- C7: 50.8 x 18.5 mm LL X 50.8 Y 18.0

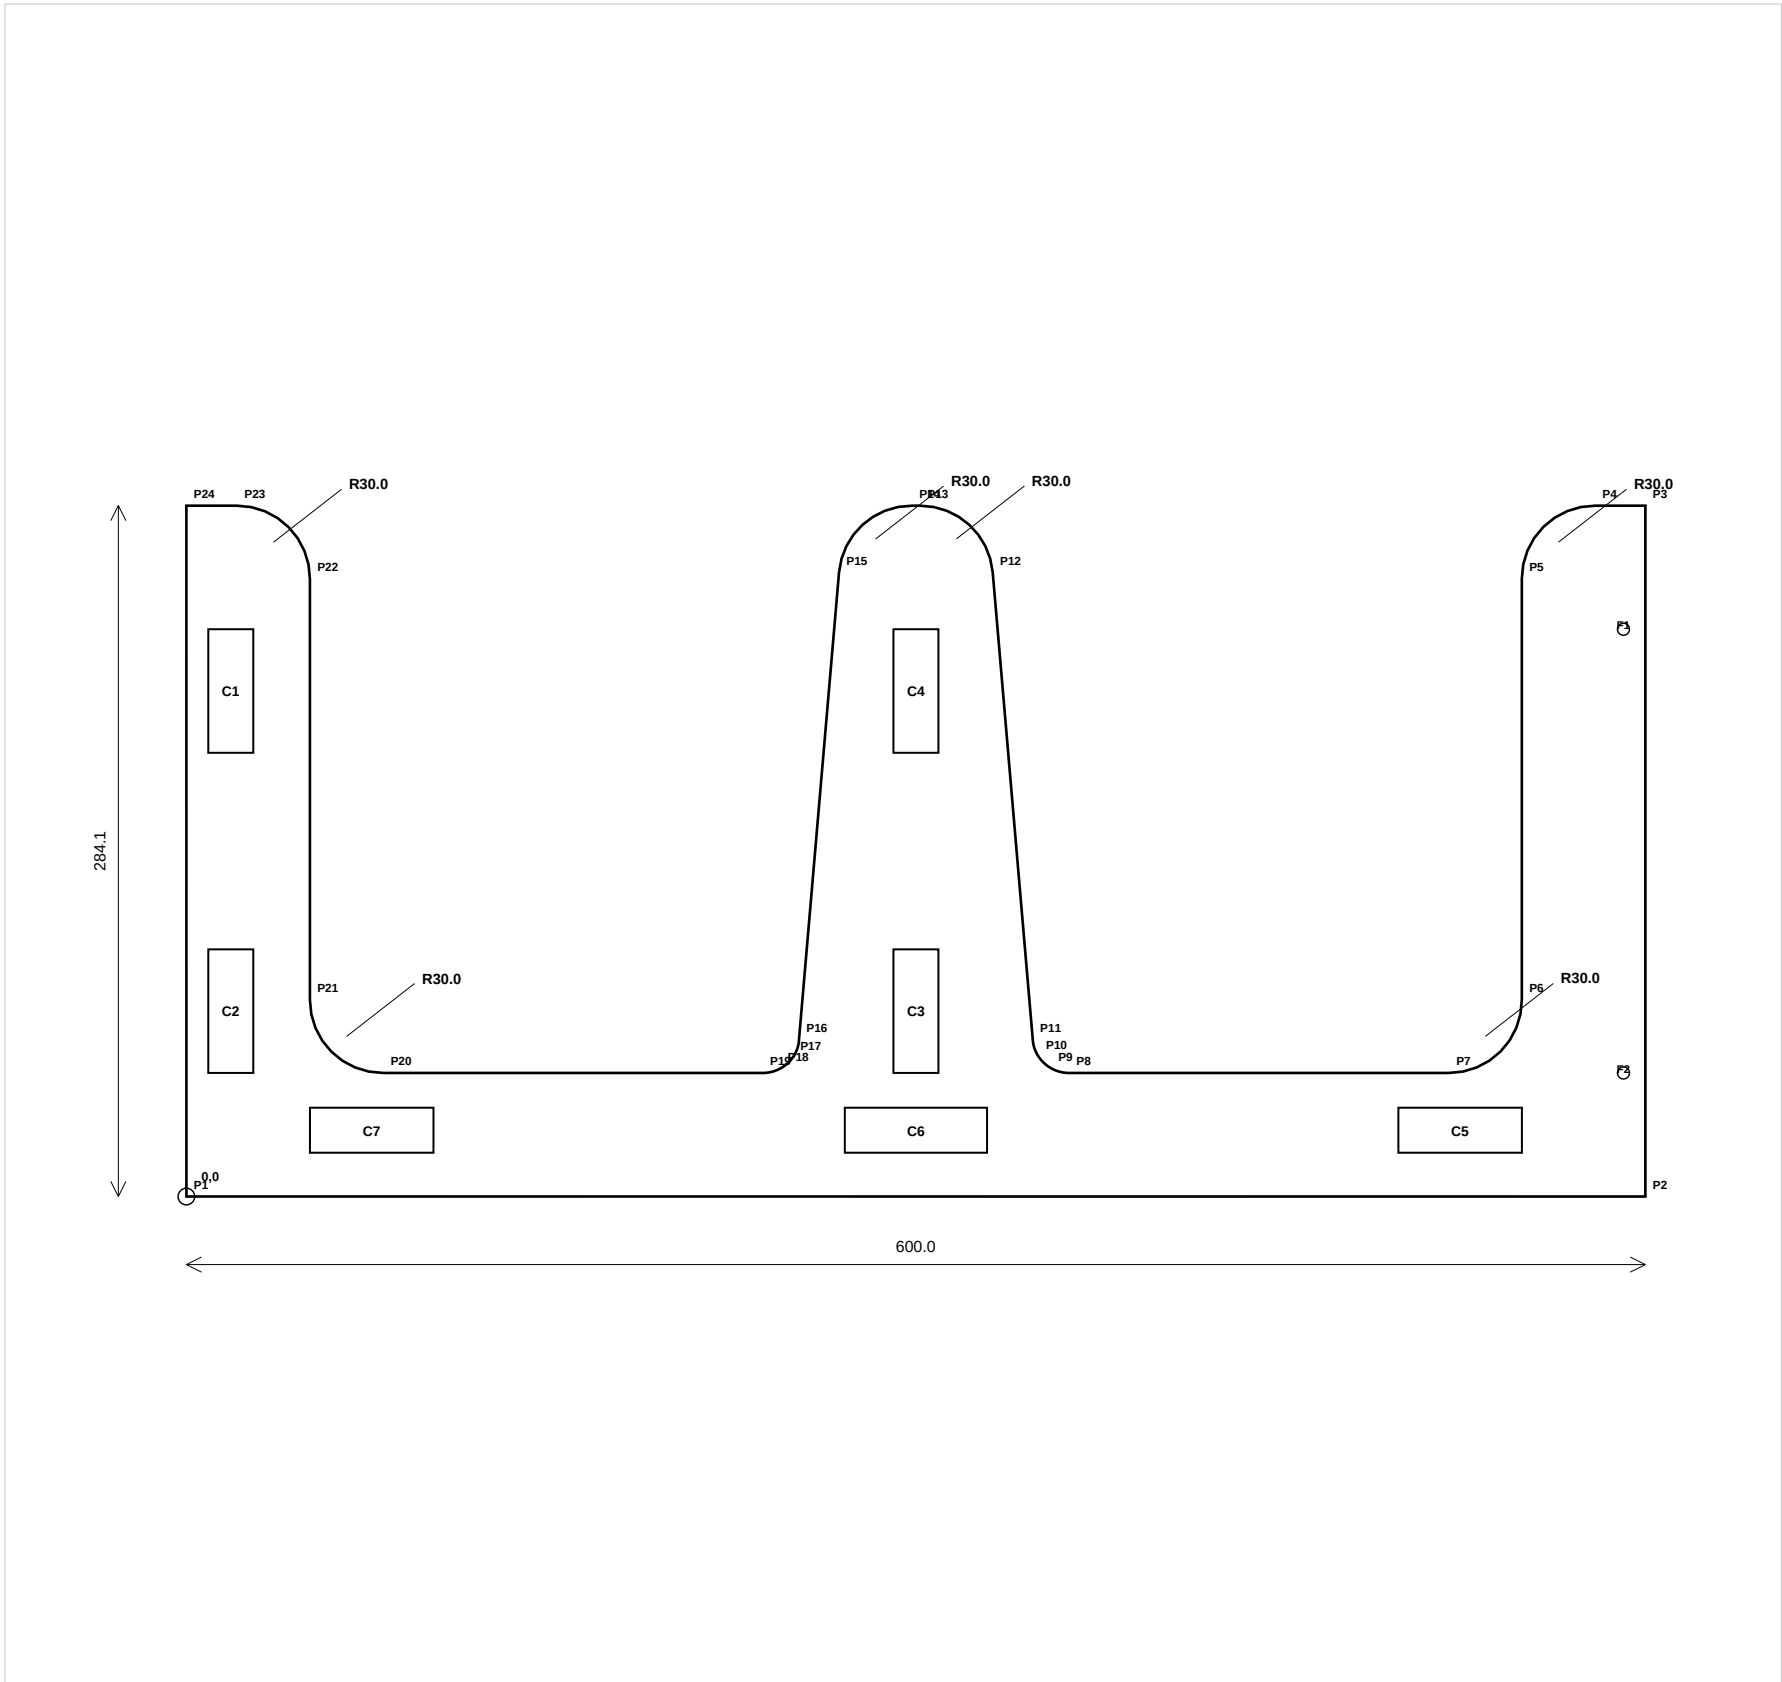

S3-E - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 9.0 Y 233.2
F2	Dia 5 x 11 deep	X 9.0 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y284.0	LINE
P2	X600.0 Y284.0	LINE
P3	X600.0 Y0.0	LINE
P4	X0.0 Y0.0	LINE

Internal cut-outs

- C1: 18.5 x 50.8 mm LL X 572.9 Y 182.4
- C2: 18.5 x 50.8 mm LL X 291.2 Y 50.8
- C3: 50.8 x 18.5 mm LL X 498.8 Y 18.0
- C4: 58.5 x 18.5 mm LL X 271.2 Y 18.0
- C5: 50.8 x 18.5 mm LL X 51.2 Y 18.0
- C6: 18.5 x 50.8 mm LL X 291.2 Y 182.4
- C7: 18.5 x 50.8 mm LL X 572.9 Y 50.8

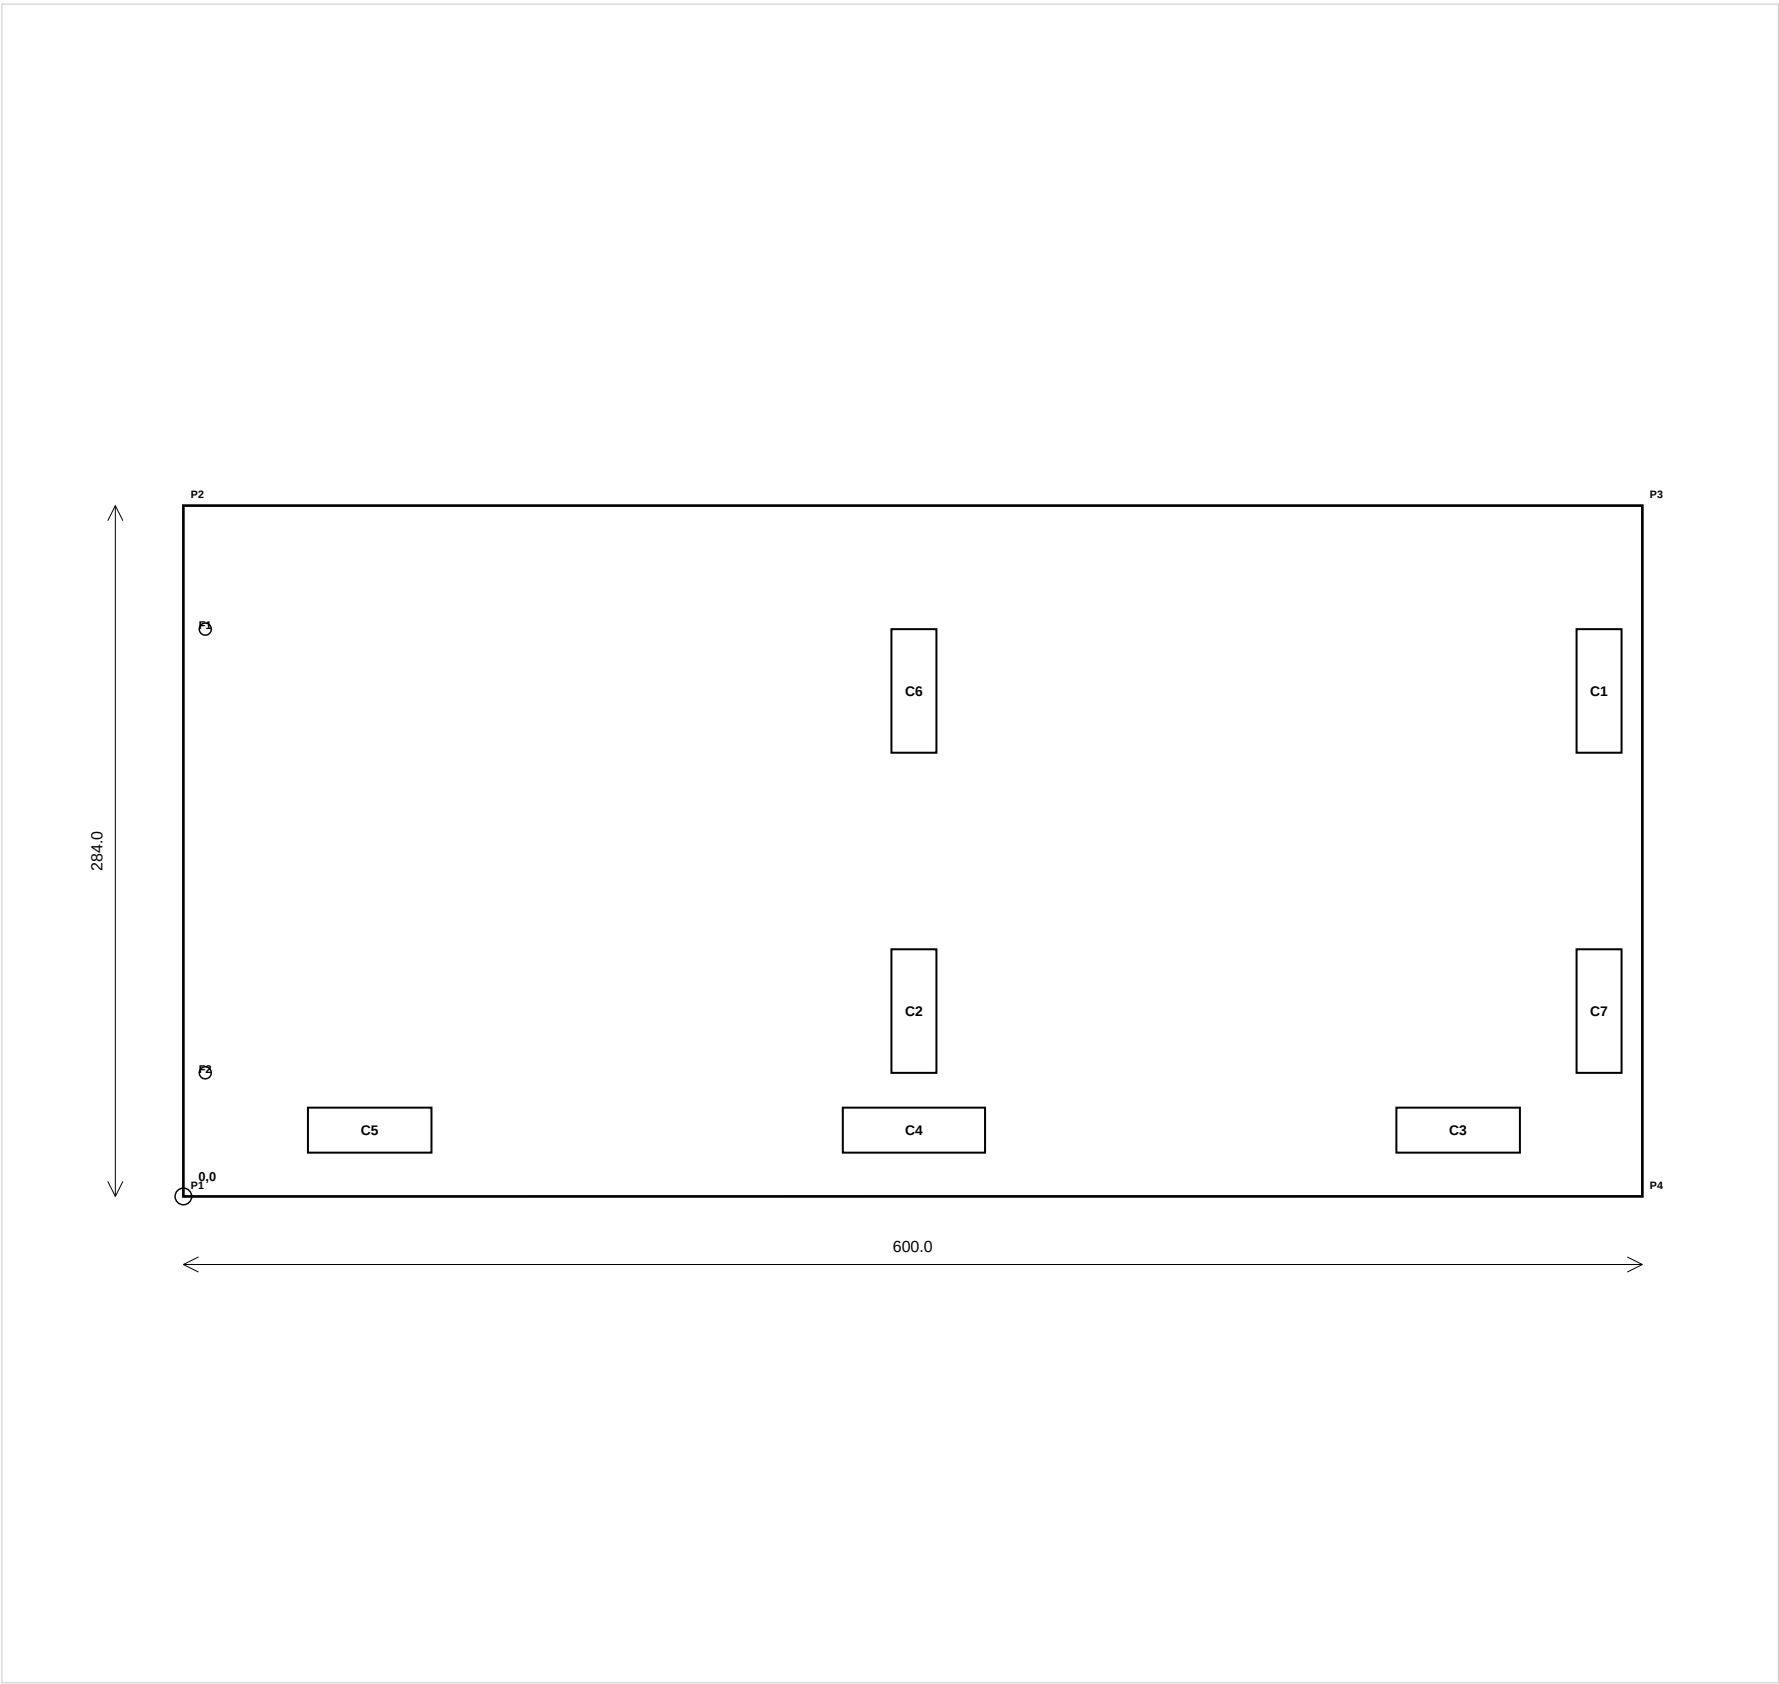

S3-F - Part detail

Overall 582.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge


Machining features

No internal machining features.

Outer profile cuts


P points are labelled on the drawing. Join each point to the next as shown.

P1	X33.2 Y18.0	LINE
P2	X0.0 Y18.0	LINE
P3	X0.0 Y266.0	LINE
P4	X33.2 Y266.0	LINE
P5	X33.2 Y284.0	LINE
P6	X84.1 Y284.0	LINE
P7	X84.1 Y266.0	LINE
P8	X253.2 Y266.0	LINE
P9	X253.2 Y284.0	LINE
P10	X311.7 Y284.0	LINE
P11	X311.7 Y266.0	LINE
P12	X480.9 Y266.0	LINE
P13	X480.9 Y284.0	LINE
P14	X531.7 Y284.0	LINE
P15	X531.7 Y266.0	LINE
P16	X582.0 Y266.4	LINE
P17	X582.0 Y18.0	LINE
P18	X531.7 Y18.0	LINE
P19	X531.7 Y0.0	LINE
P20	X480.9 Y0.0	LINE
P21	X480.9 Y18.0	LINE
P22	X311.7 Y18.0	LINE
P23	X311.7 Y0.0	LINE
P24	X253.2 Y0.0	LINE
P25	X253.2 Y18.0	LINE
P26	X84.1 Y18.0	LINE
P27	X84.1 Y0.0	LINE
P28	X33.2 Y0.0	LINE

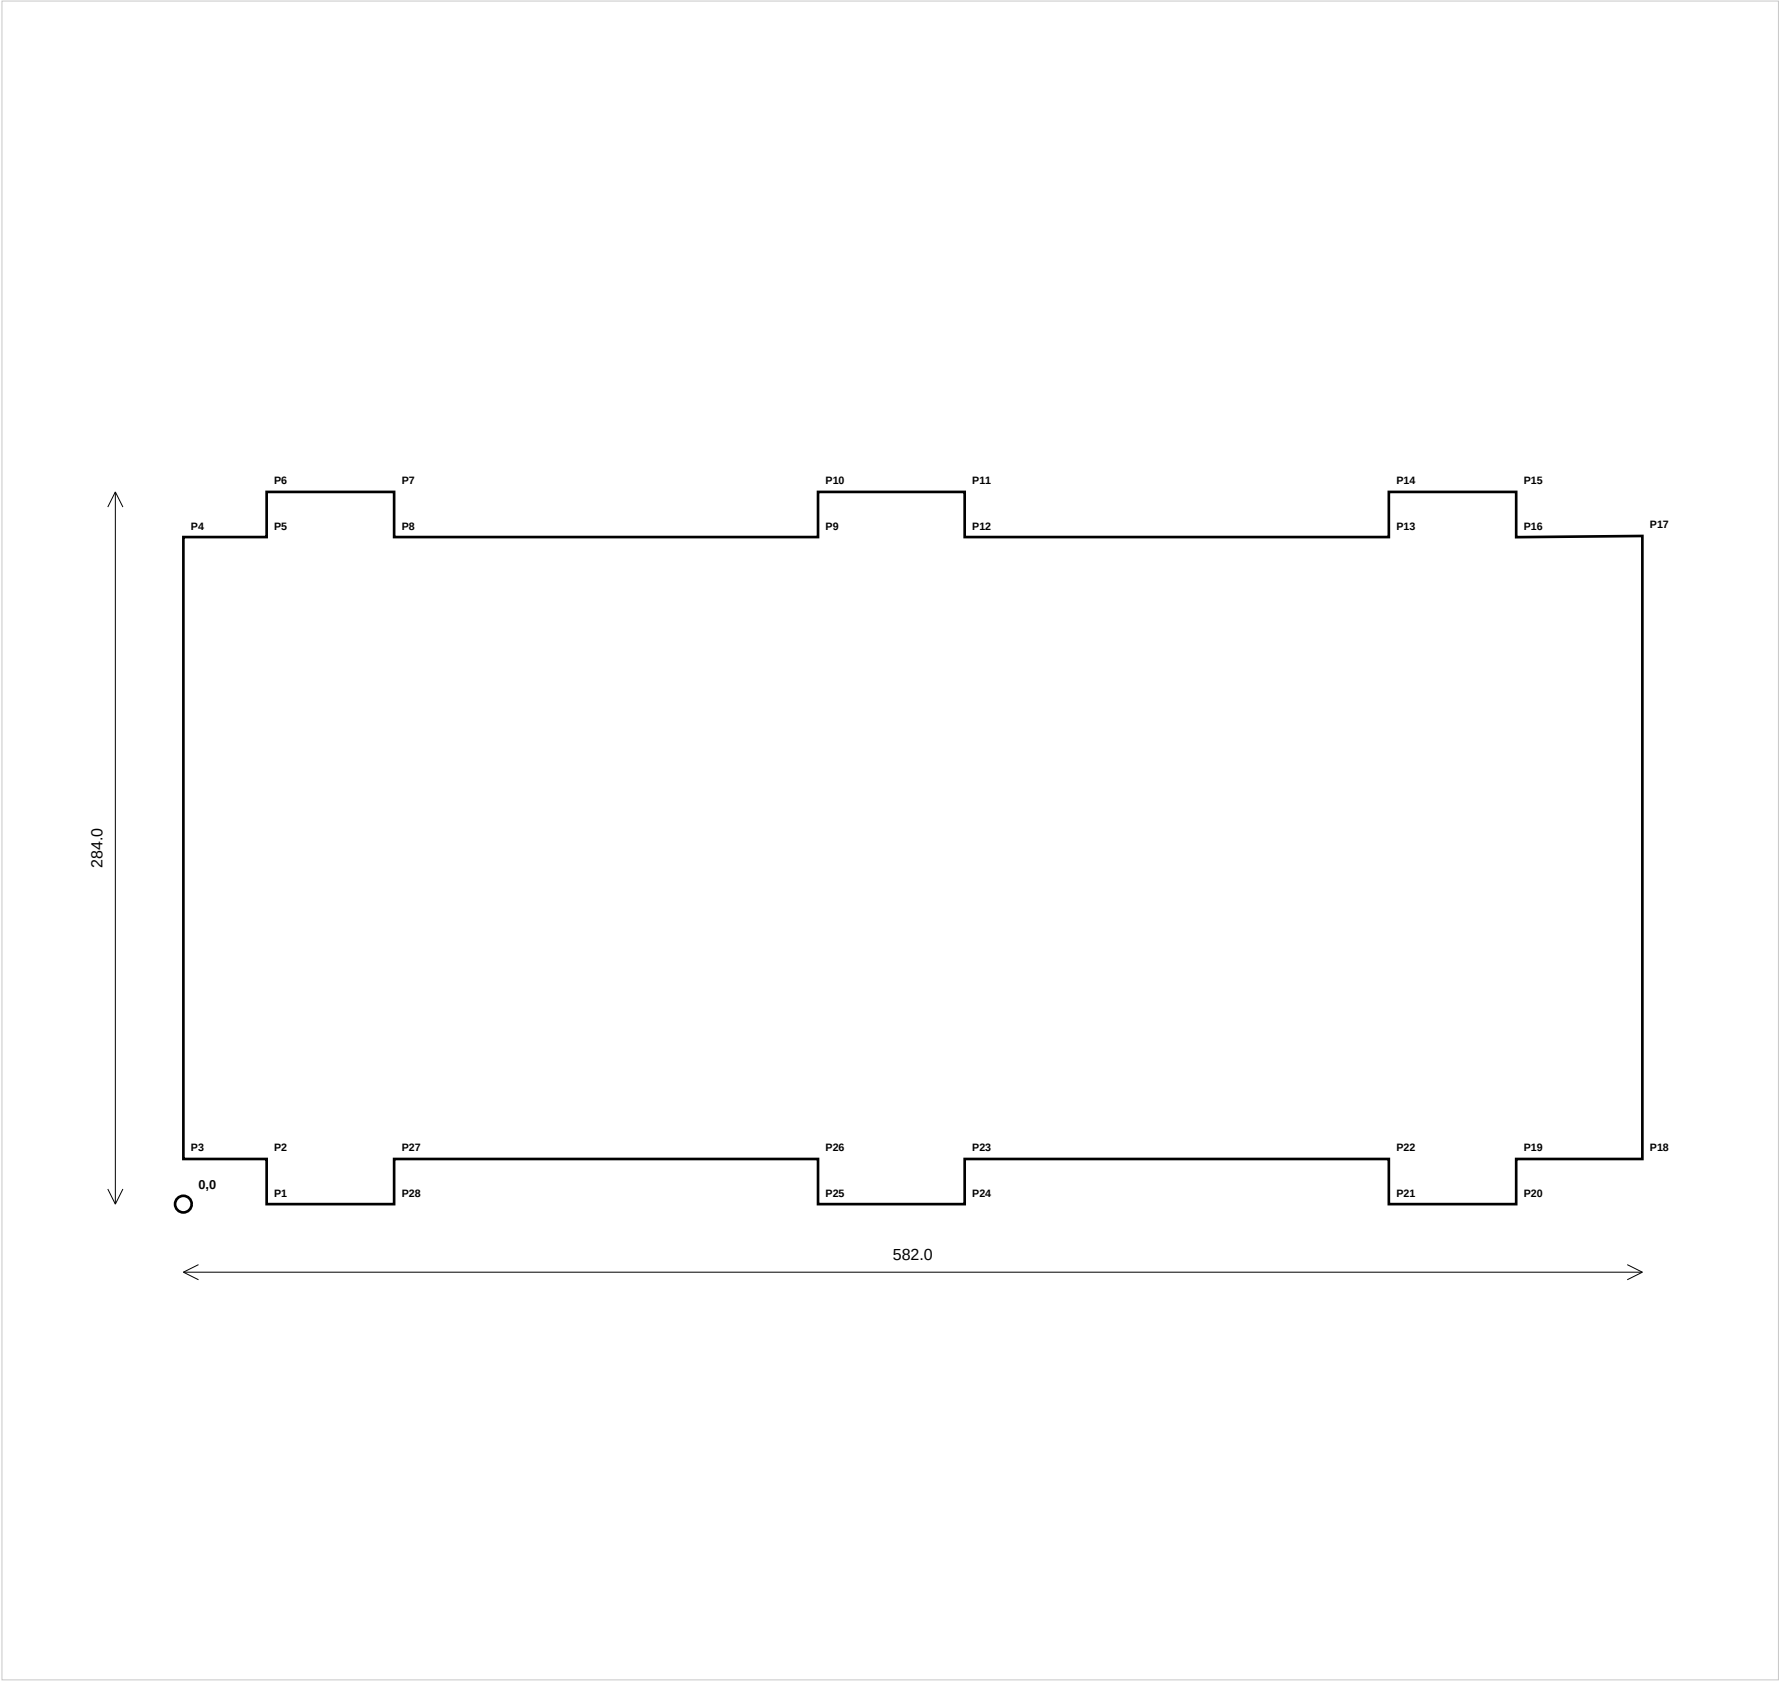

S3-G - Part detail

Overall 284.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

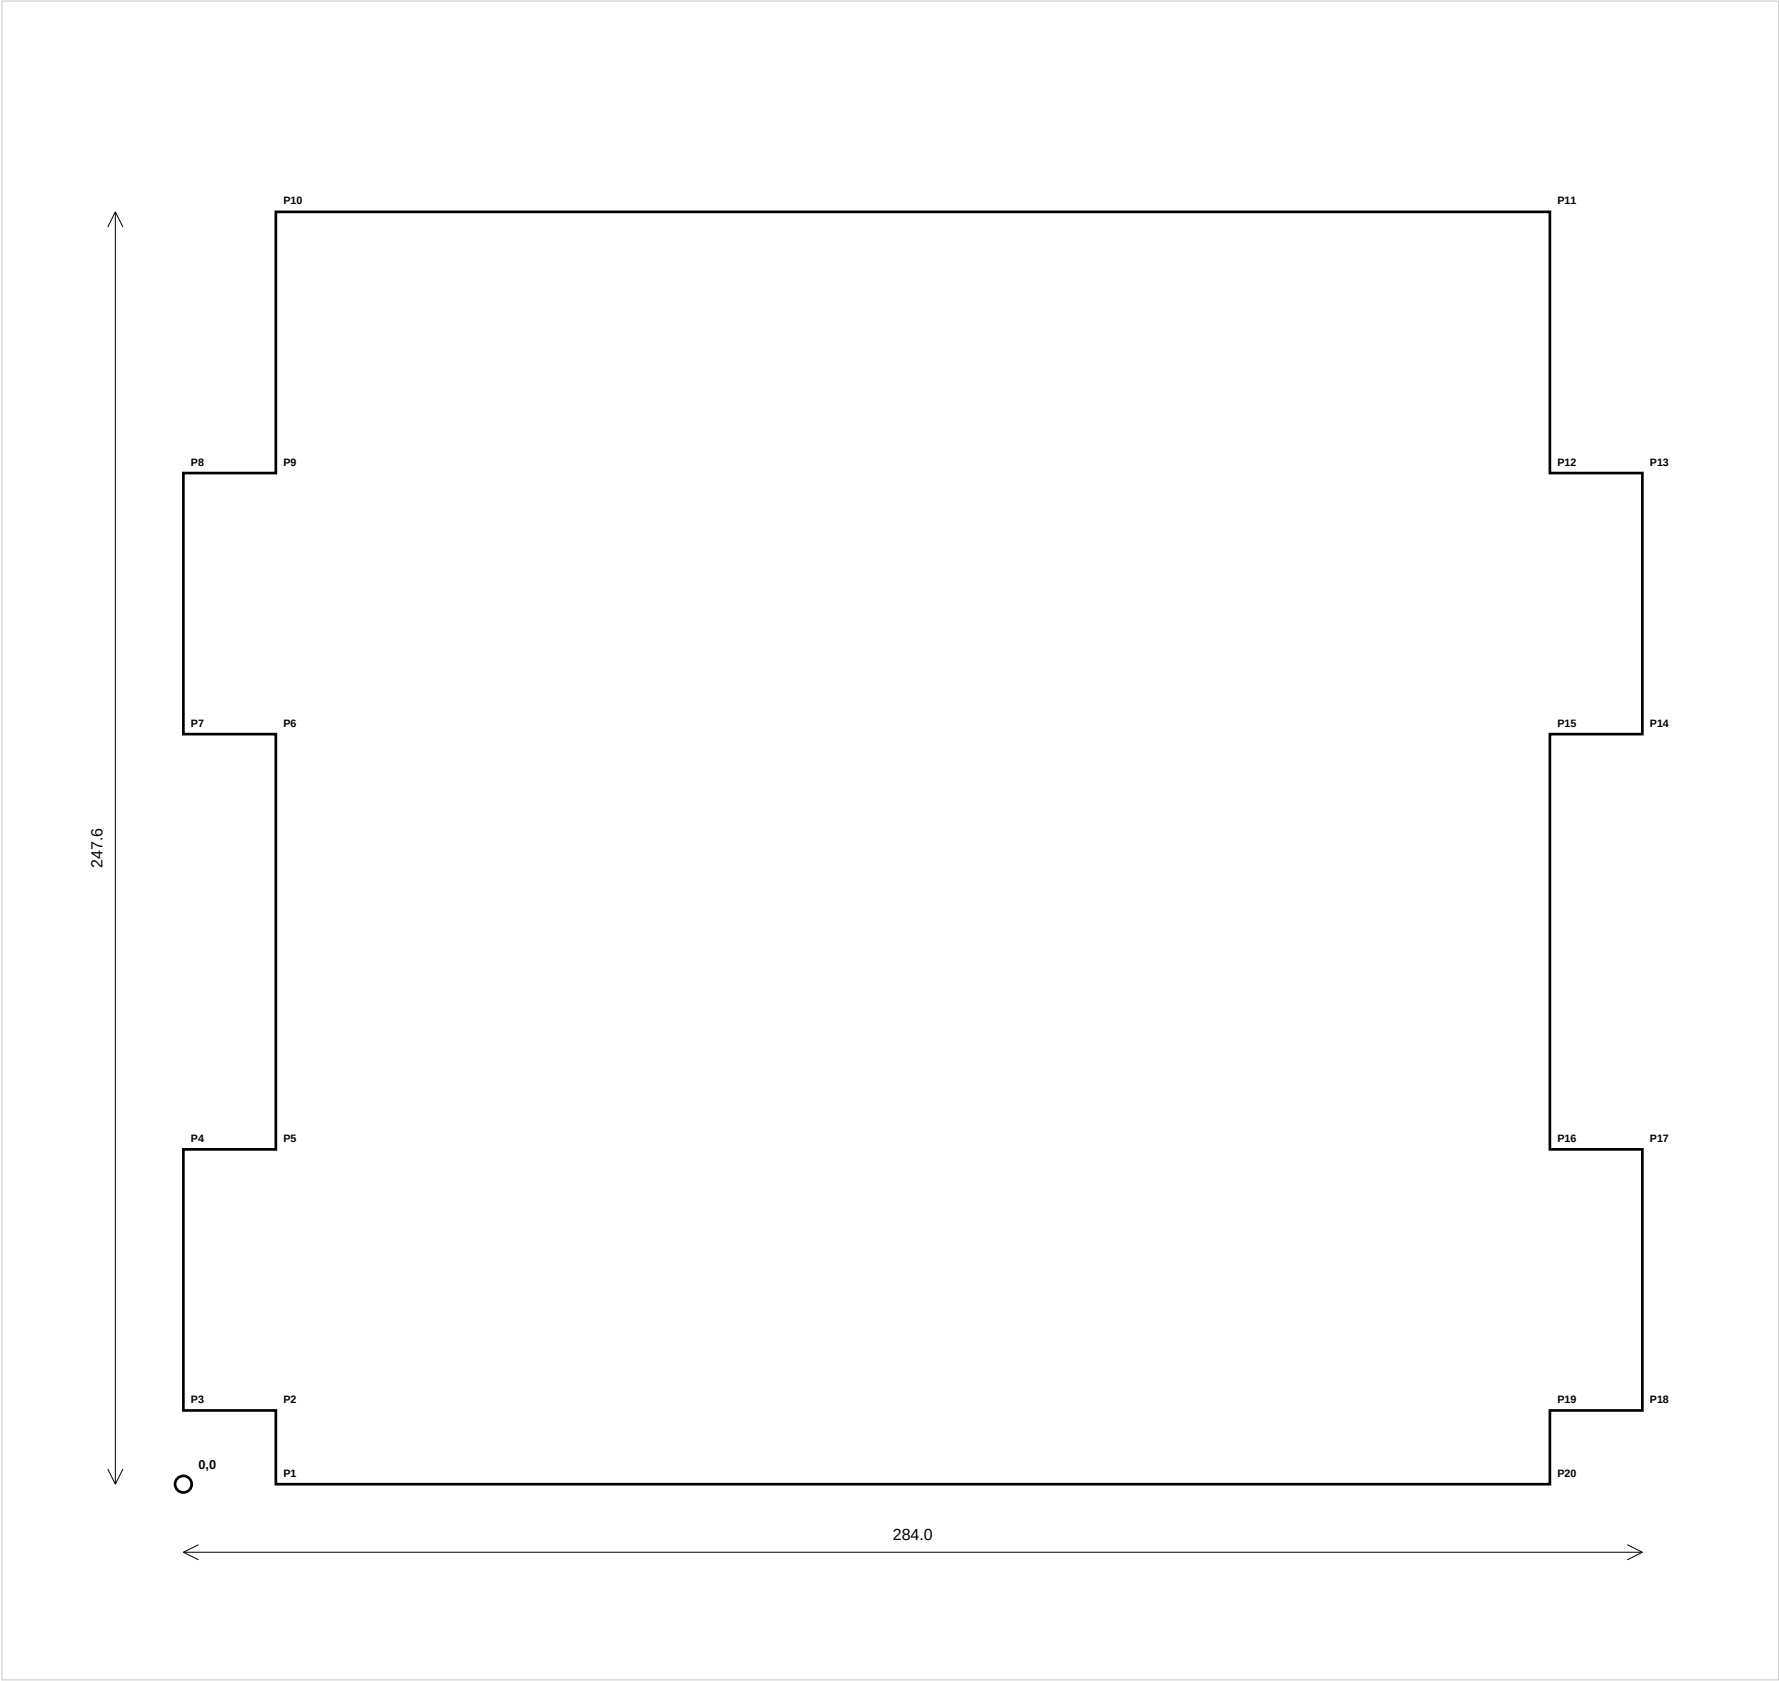

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X18.0 Y14.3	LINE
P2	X0.0 Y14.3	LINE
P3	X0.0 Y65.1	LINE
P4	X18.0 Y65.2	LINE
P5	X18.0 Y146.0	LINE
P6	X0.0 Y145.9	LINE
P7	X0.0 Y196.7	LINE
P8	X18.0 Y196.7	LINE
P9	X18.0 Y247.6	LINE
P10	X266.0 Y247.6	LINE
P11	X266.0 Y196.8	LINE
P12	X284.0 Y196.7	LINE
P13	X284.0 Y145.9	LINE
P14	X266.0 Y146.0	LINE
P15	X266.0 Y65.1	LINE
P16	X284.0 Y65.1	LINE
P17	X284.0 Y14.3	LINE
P18	X266.0 Y14.4	LINE
P19	X266.0 Y0.0	LINE
P20	X18.0 Y0.0	LINE

S3-H - Part detail

Overall 284.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

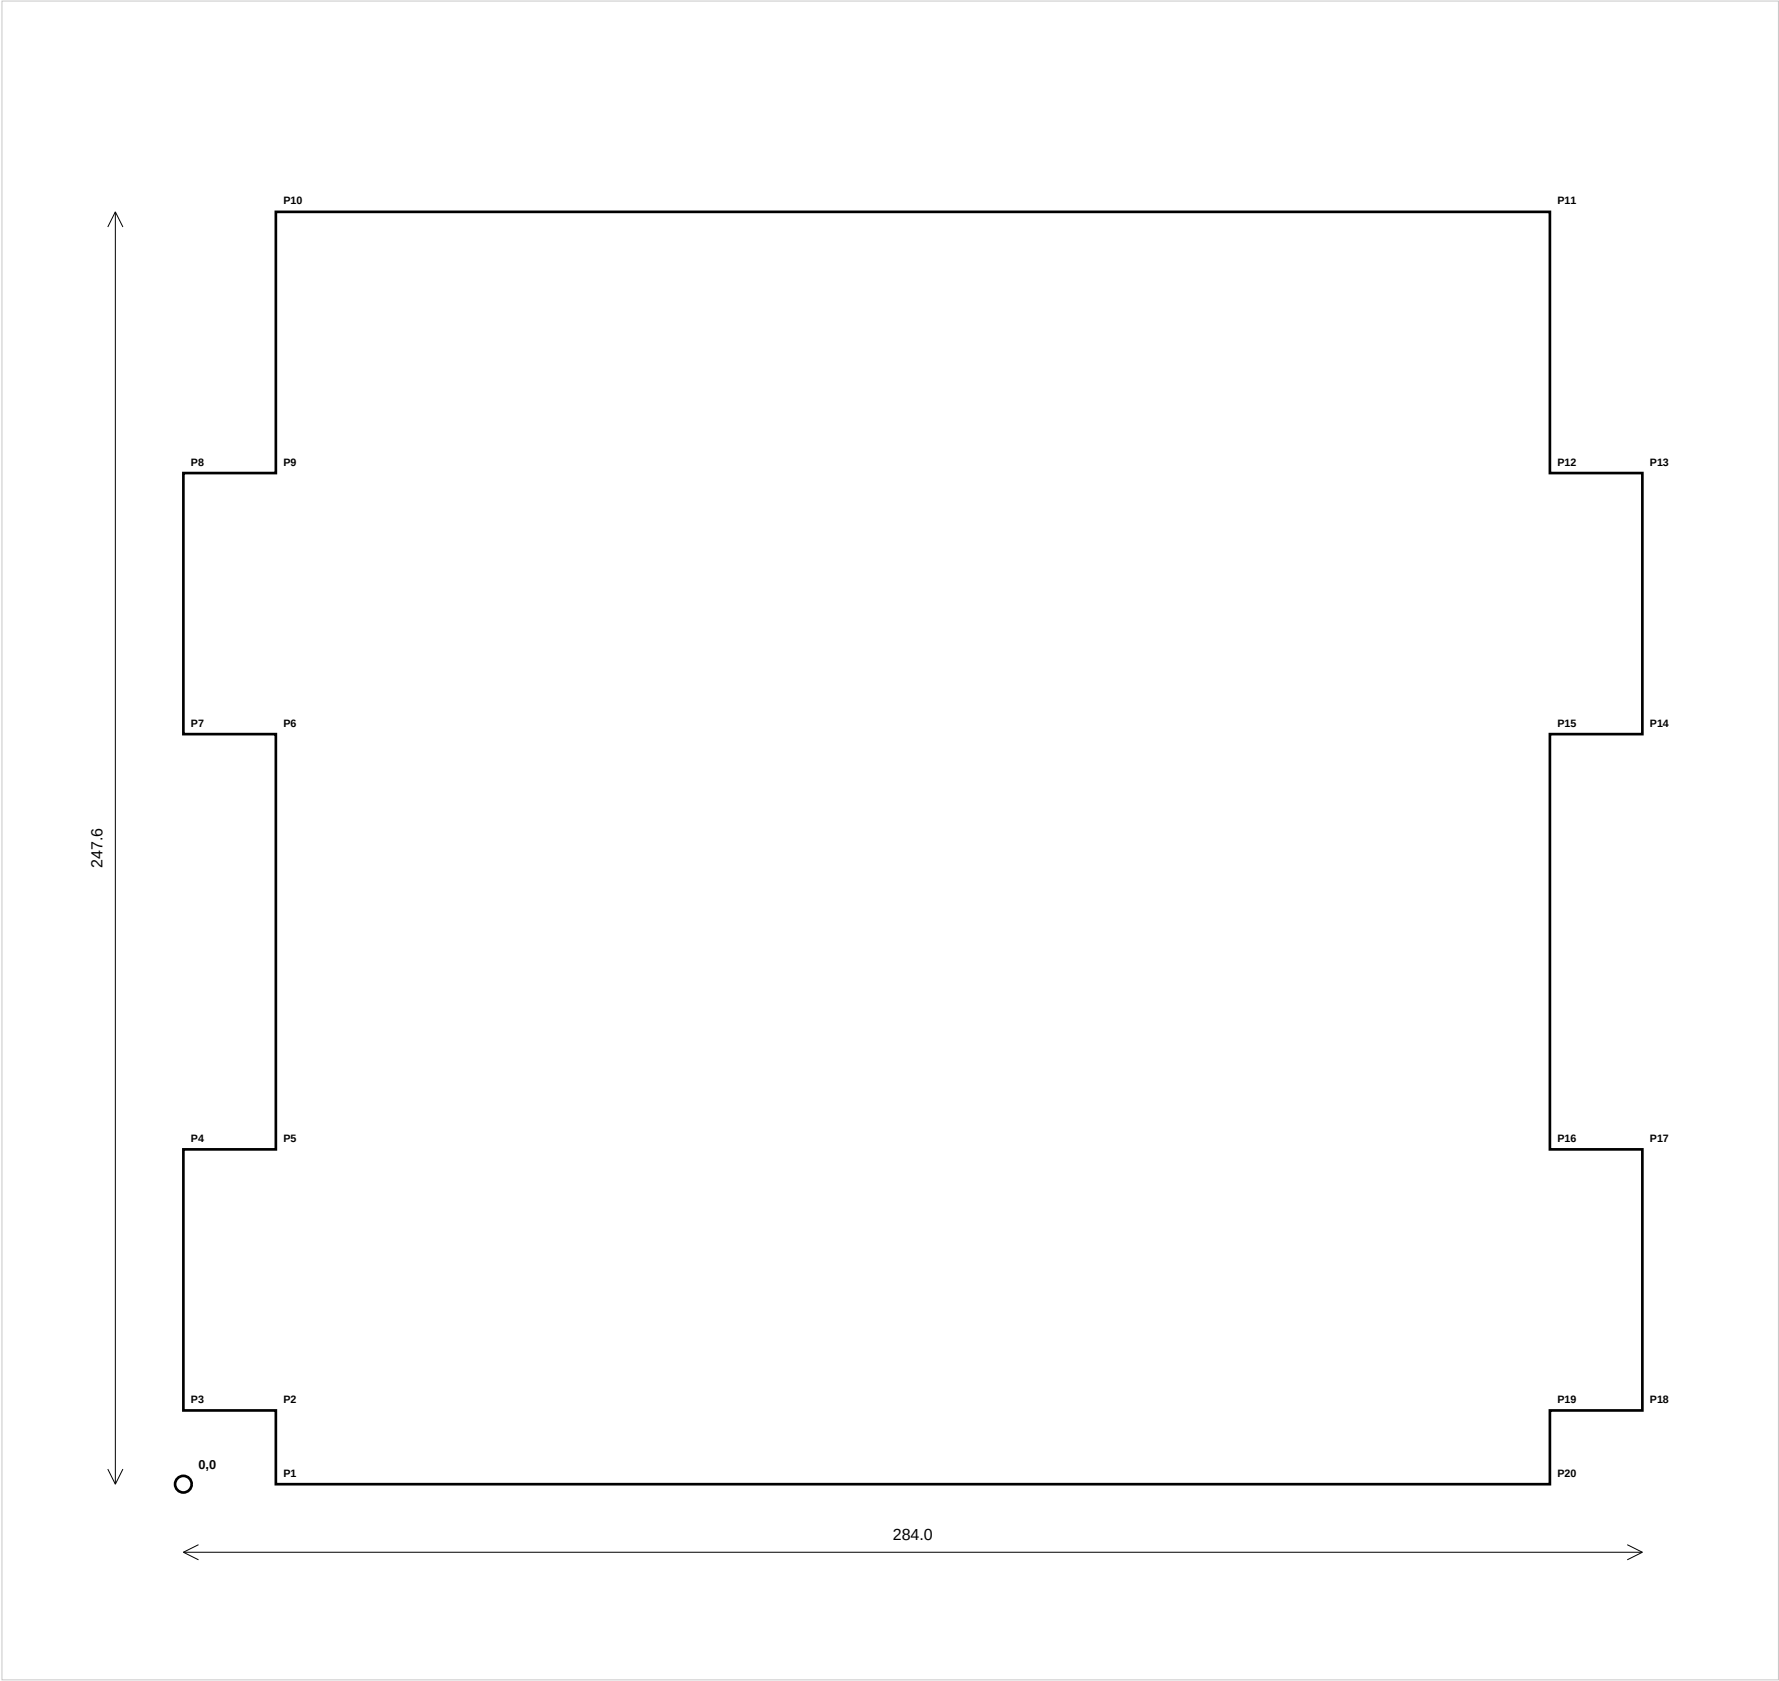

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X18.0 Y14.4	LINE
P2	X0.0 Y14.3	LINE
P3	X0.0 Y65.1	LINE
P4	X18.0 Y65.2	LINE
P5	X18.0 Y145.9	LINE
P6	X0.0 Y145.9	LINE
P7	X0.0 Y196.7	LINE
P8	X18.0 Y196.8	LINE
P9	X18.0 Y247.6	LINE
P10	X266.0 Y247.6	LINE
P11	X266.0 Y196.8	LINE
P12	X284.0 Y196.7	LINE
P13	X284.0 Y145.9	LINE
P14	X266.0 Y146.0	LINE
P15	X266.0 Y65.2	LINE
P16	X284.0 Y65.1	LINE
P17	X284.0 Y14.3	LINE
P18	X266.0 Y14.4	LINE
P19	X266.0 Y0.0	LINE
P20	X18.0 Y0.0	LINE

S4-A - Part detail

Overall 539.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y382.0	LINE
P3	X539.0 Y382.0	LINE
P4	X539.0 Y0.0	LINE

S4-B - Part detail

Overall 539.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

No internal machining features.


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y382.0	LINE
P3	X539.0 Y382.0	LINE
P4	X539.0 Y0.0	LINE

S4-C - Part detail

Overall 382.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

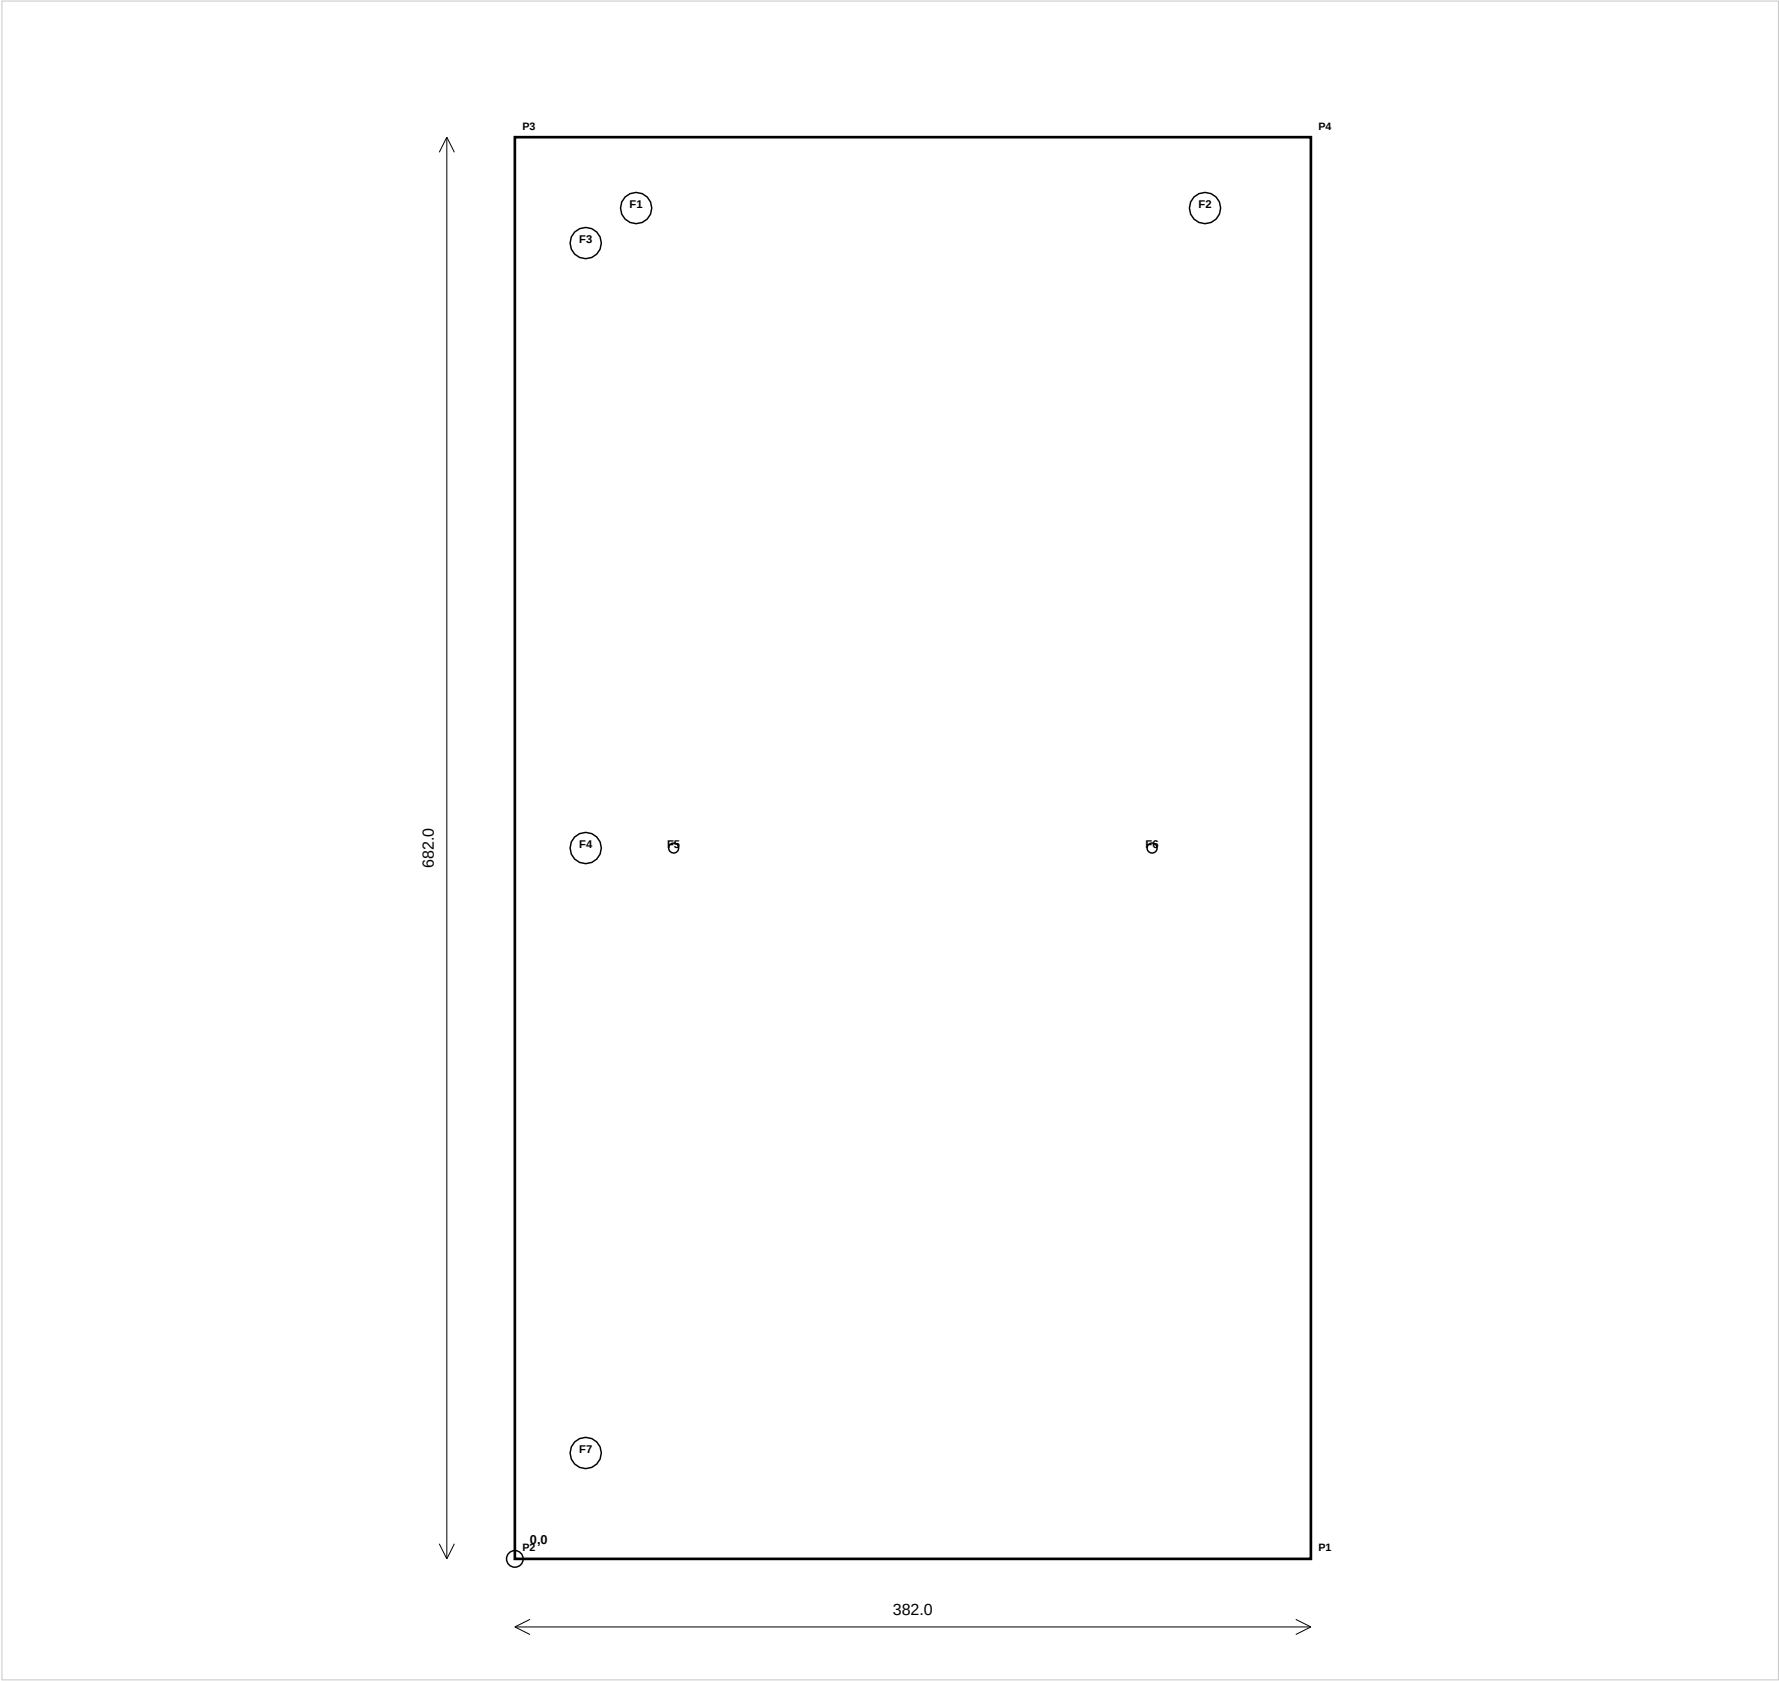

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 58.2 Y 648.0
F2	Dia 15 x 14 deep	X 331.2 Y 648.0
F3	Dia 15 x 14 deep	X 34.0 Y 631.2
F4	Dia 15 x 14 deep	X 34.0 Y 341.0
F5	Dia 5 x 11 deep	X 76.2 Y 341.0
F6	Dia 5 x 11 deep	X 305.8 Y 341.0
F7	Dia 15 x 14 deep	X 34.0 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y682.0	LINE
P3	X382.0 Y682.0	LINE
P4	X382.0 Y0.0	LINE

S4-D - Part detail

Overall 382.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

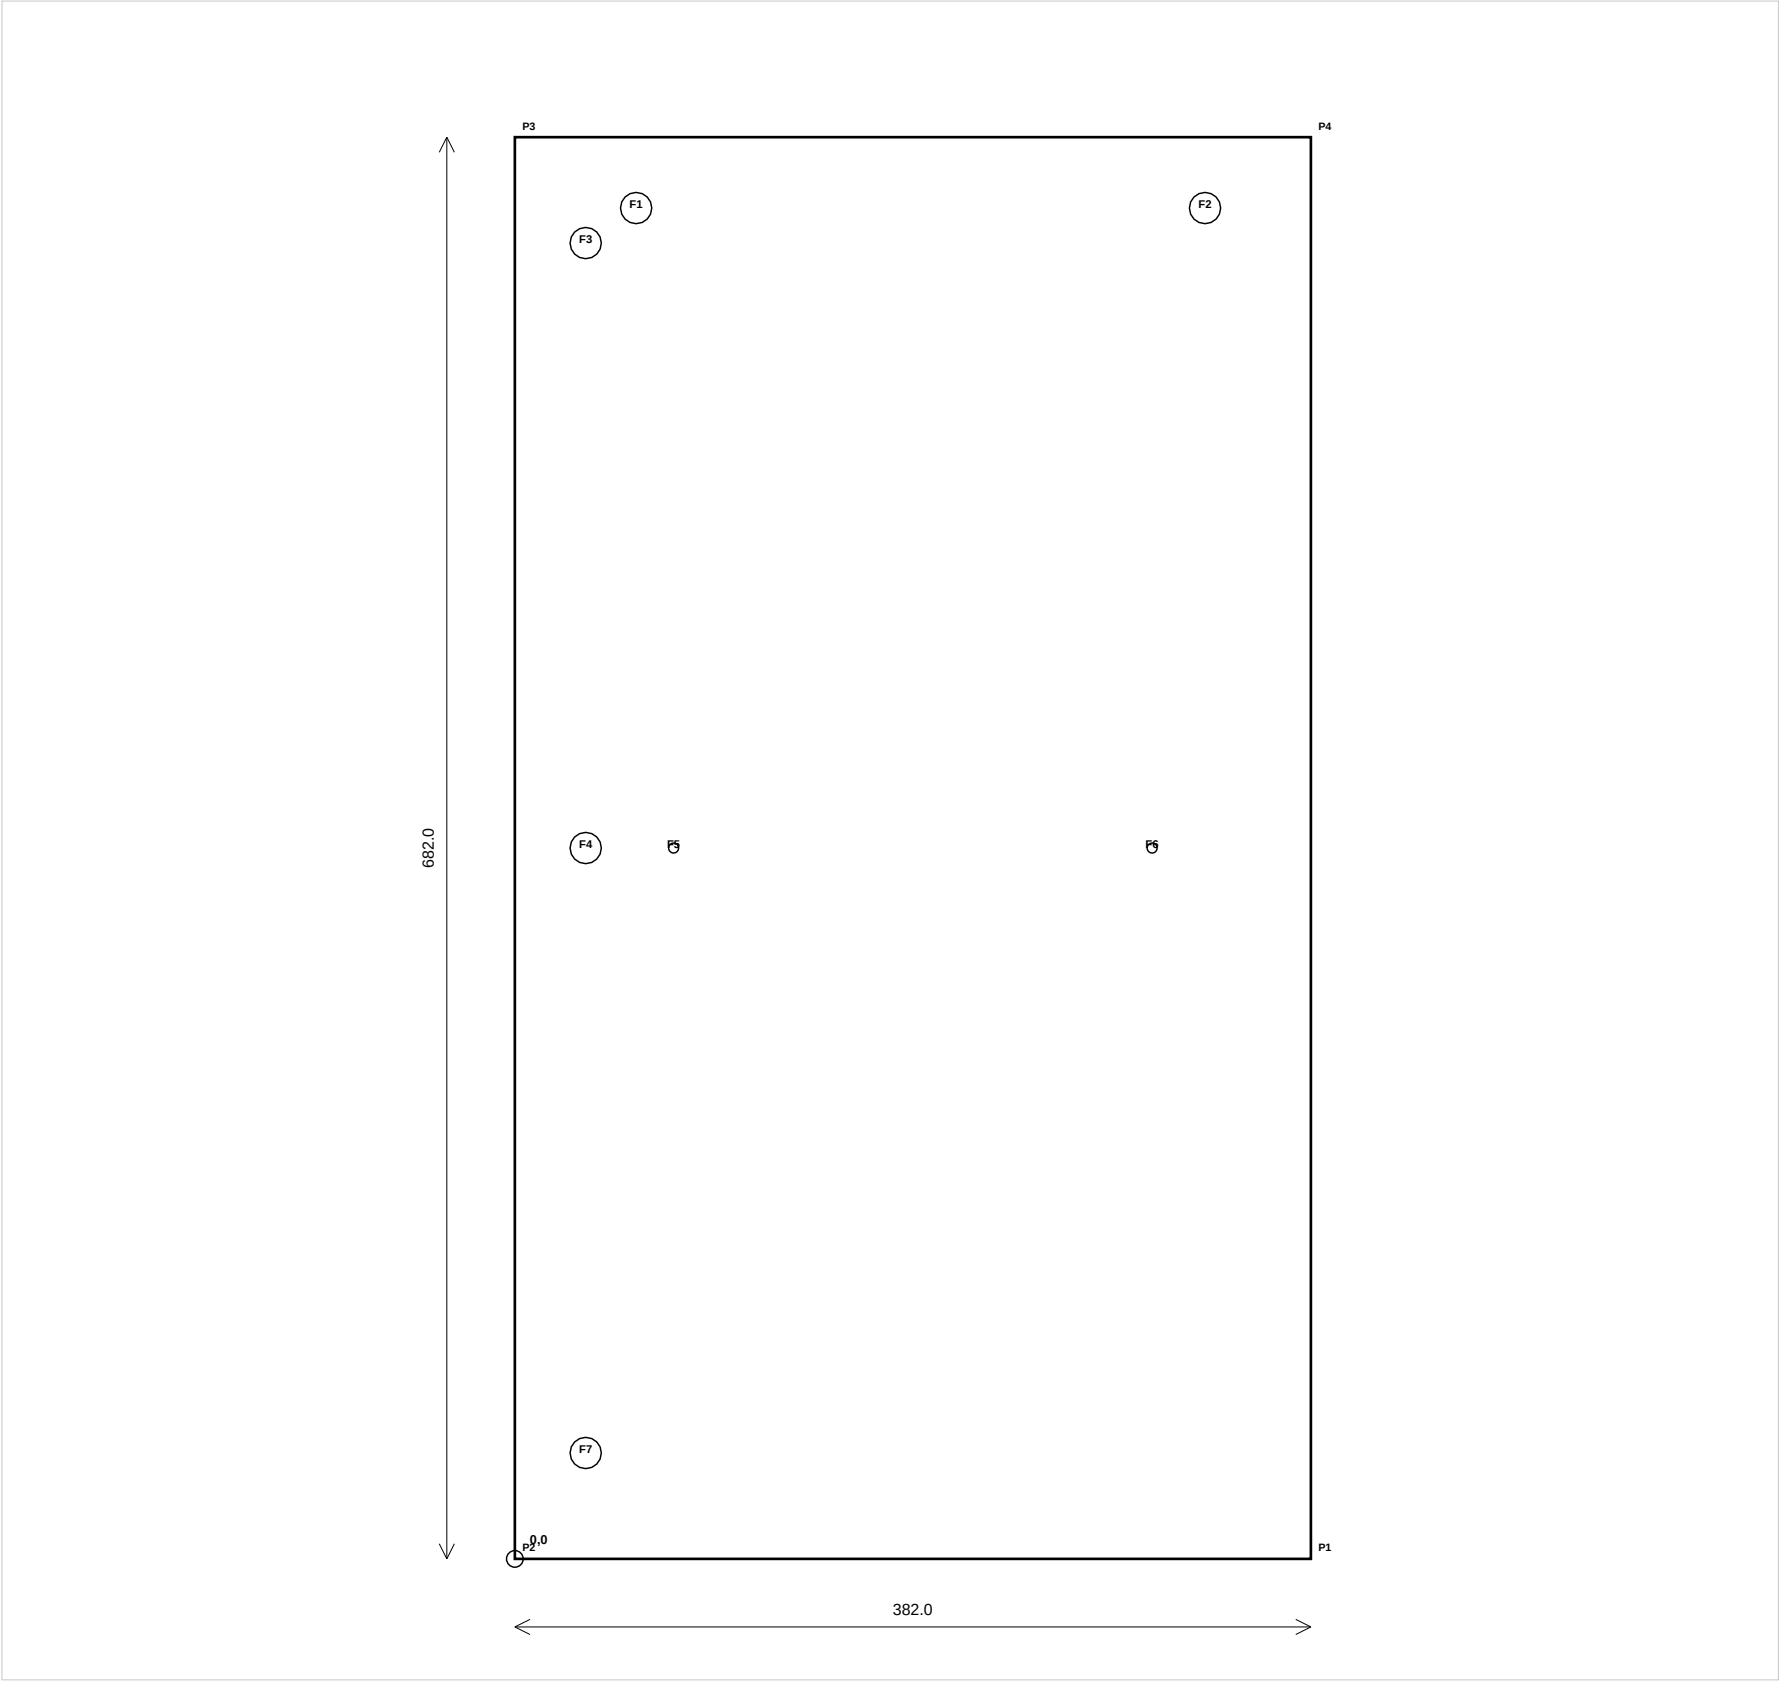

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 58.2 Y 648.0
F2	Dia 15 x 14 deep	X 331.2 Y 648.0
F3	Dia 15 x 14 deep	X 34.0 Y 631.2
F4	Dia 15 x 14 deep	X 34.0 Y 341.0
F5	Dia 5 x 11 deep	X 76.2 Y 341.0
F6	Dia 5 x 11 deep	X 305.8 Y 341.0
F7	Dia 15 x 14 deep	X 34.0 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y682.0	LINE
P3	X382.0 Y682.0	LINE
P4	X382.0 Y0.0	LINE

S4-E - Part detail

Overall 382.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

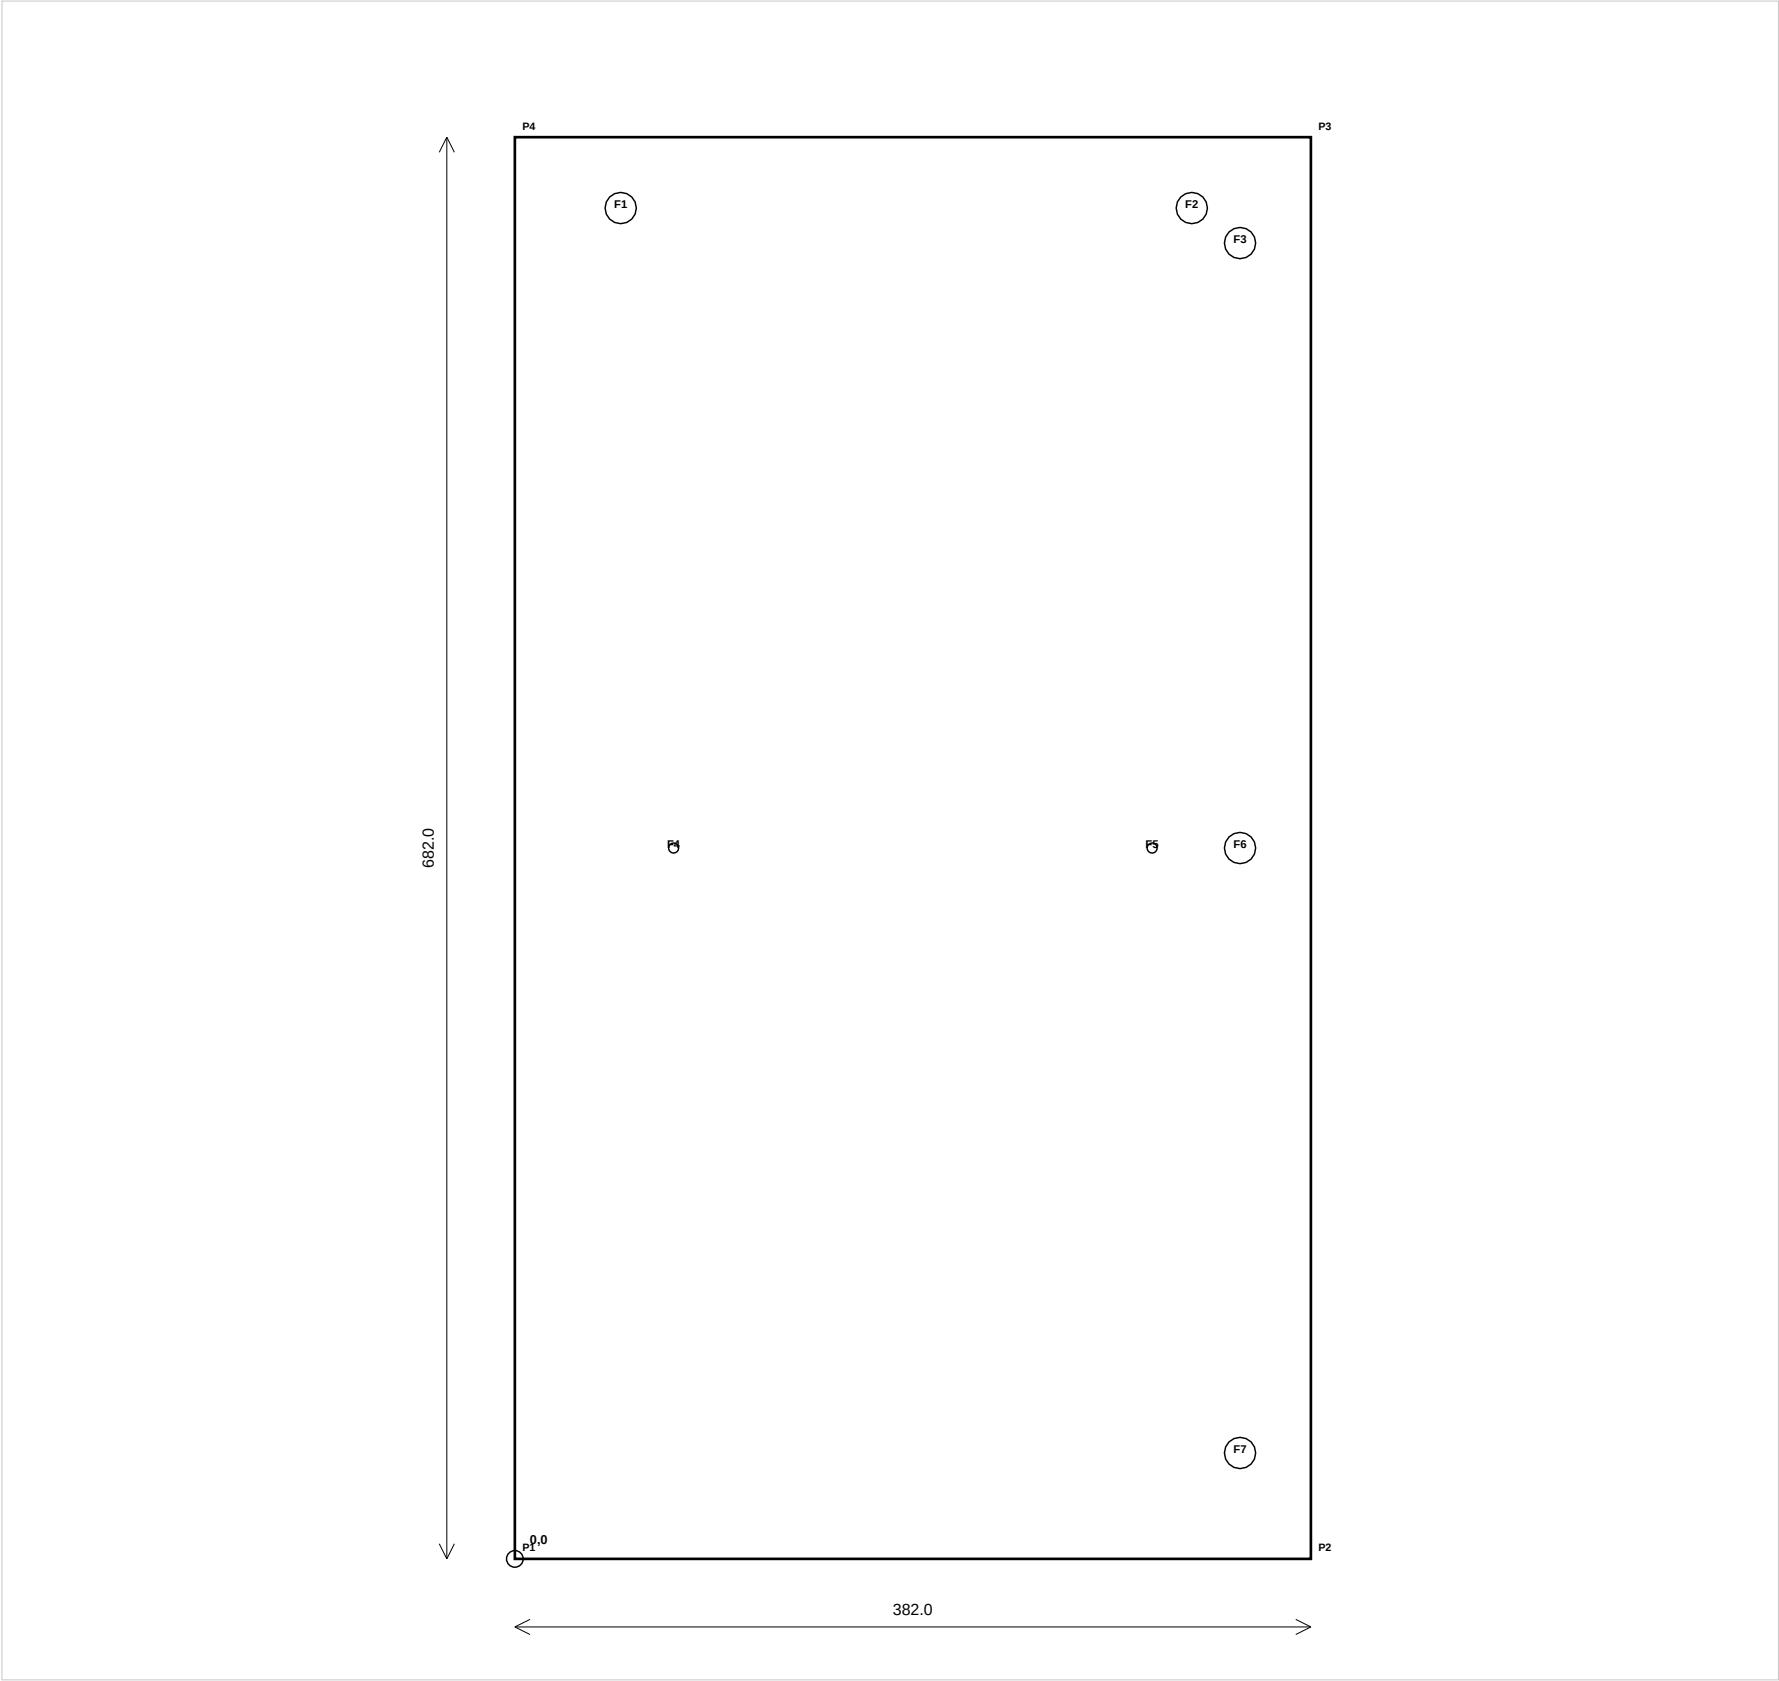

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 648.0
F2	Dia 15 x 14 deep	X 324.8 Y 648.0
F3	Dia 15 x 14 deep	X 348.0 Y 631.2
F4	Dia 5 x 11 deep	X 76.2 Y 341.0
F5	Dia 5 x 11 deep	X 305.8 Y 341.0
F6	Dia 15 x 14 deep	X 348.0 Y 341.0
F7	Dia 15 x 14 deep	X 348.0 Y 50.8

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X382.0 Y682.0	LINE
P3	X0.0 Y682.0	LINE
P4	X0.0 Y0.0	LINE

S4-F - Part detail

Overall 1120.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge


Machining features

F1	Dia 5 x 11 deep	X 9.0 Y 349.2
F2	Dia 5 x 11 deep	X 560.0 Y 349.2
F3	Dia 5 x 11 deep	X 1111.0 Y 349.2
F4	Dia 5 x 11 deep	X 9.0 Y 76.2
F5	Dia 5 x 11 deep	X 560.0 Y 76.2
F6	Dia 5 x 11 deep	X 1111.0 Y 76.2
F7	Dia 5 x 11 deep	X 373.3 Y 9.0
F8	Dia 5 x 11 deep	X 746.7 Y 9.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X0.0 Y400.0	LINE
P3	X1120.0 Y400.0	LINE
P4	X1120.0 Y0.0	LINE

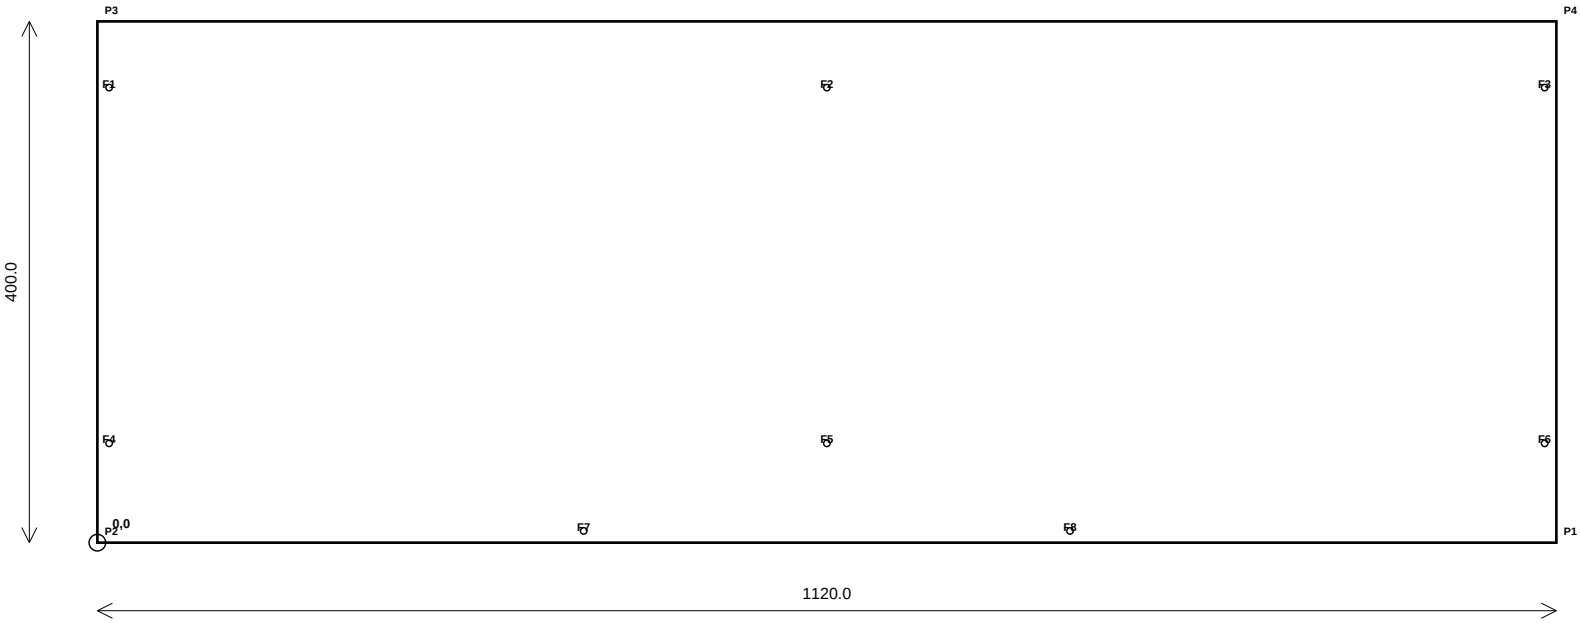

S4-G - Part detail

Overall 1120.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 373.3 Y 648.0
F2	Dia 15 x 14 deep	X 746.7 Y 648.0
F3	Dia 5 x 11 deep	X 1111.0 Y 631.2
F4	Dia 5 x 11 deep	X 9.0 Y 631.2
F5	Dia 5 x 11 deep	X 560.0 Y 631.2
F6	Dia 35 x 13 deep	X 124.0 Y 505.8
F7	Dia 35 x 13 deep	X 996.0 Y 505.8
F8	Dia 20 THROUGH	X 481.0 Y 419.9
F9	Dia 20 THROUGH	X 639.0 Y 419.9
F10	Dia 5 x 11 deep	X 9.0 Y 341.0
F11	Dia 5 x 11 deep	X 560.0 Y 341.0
F12	Dia 5 x 11 deep	X 1111.0 Y 341.0
F13	cut-out 410.0 x 482.0, R20	X 305.0 Y 341.0
F14	cut-out 410.0 x 482.0, R20	X 815.0 Y 341.0
F15	Dia 35 x 13 deep	X 996.0 Y 176.2
F16	Dia 35 x 13 deep	X 124.0 Y 176.2
F17	Dia 5 x 11 deep	X 560.0 Y 50.8
F18	Dia 5 x 11 deep	X 1111.0 Y 50.8
F19	Dia 5 x 11 deep	X 9.0 Y 50.8

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X1120.0 Y682.0	LINE
P2	X0.0 Y682.0	LINE
P3	X0.0 Y0.0	LINE
P4	X1120.0 Y0.0	LINE

