

FORD-TRANSIT-CUSTOM-SWB-2-DOOR-KITCHEN

Coordinate system

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Example: X100 / Y50 = 100 mm right from the left edge, then 50 mm up from the bottom.

Sheet structure

Sheet 1: 7 panels

Sheet 2: 7 panels

Sheet 3: 8 panels

Sheet 4: 7 panels

Total: 29 panels

Rules

- 18 mm plywood
- Dia 5 = 11 mm deep; nominal 8.8/8.9 edge positions shown as 9 mm
- Dia 15 = 14 mm deep
- Dia 20 = THROUGH
- Dia 35 = 13 mm deep
- Radius of a rounded slot/cut-out = half its narrow width
- Door cut-outs use R20
- 5 mm / 15 mm fixing holes may be omitted when using L-brackets or timber blocks.


8 mm cam-fitting edge holes

Where a 15 mm cam-lock hole is shown, drill an 8 mm hole centrally through the edge of the mating side panel using a self-centring jig with an 8 mm guide.

Align the 8 mm hole with the centre of the 15 mm cam-lock bore.


Sheet 1 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

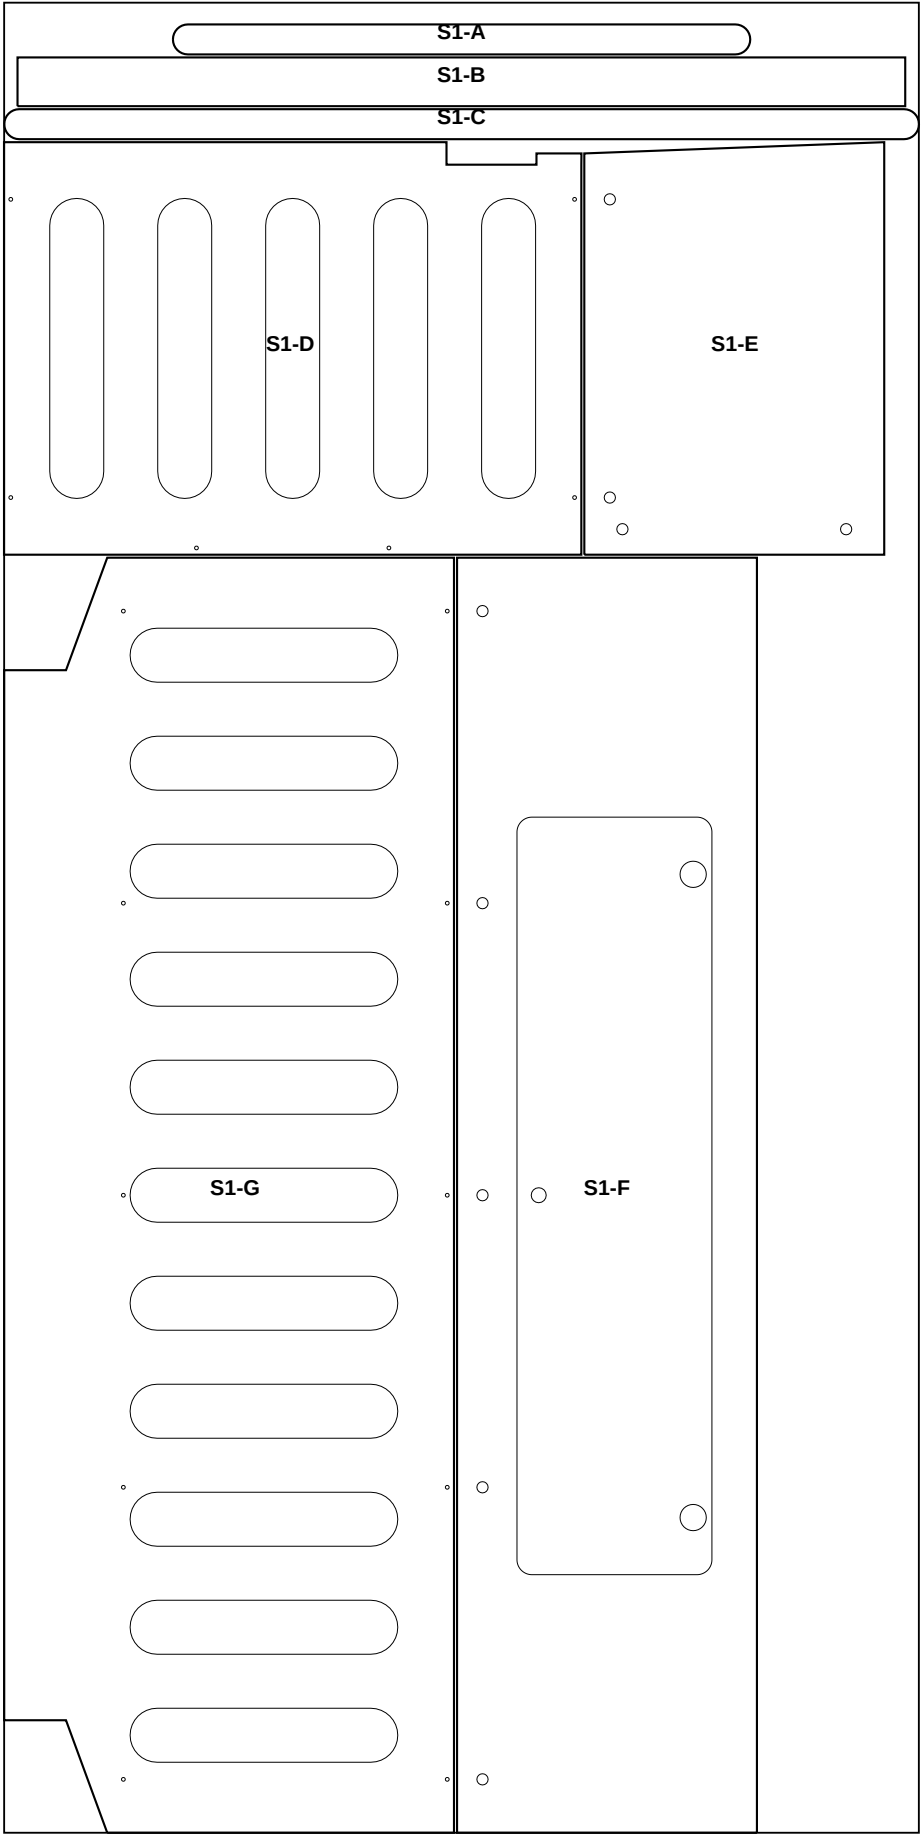


Sheet 2 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

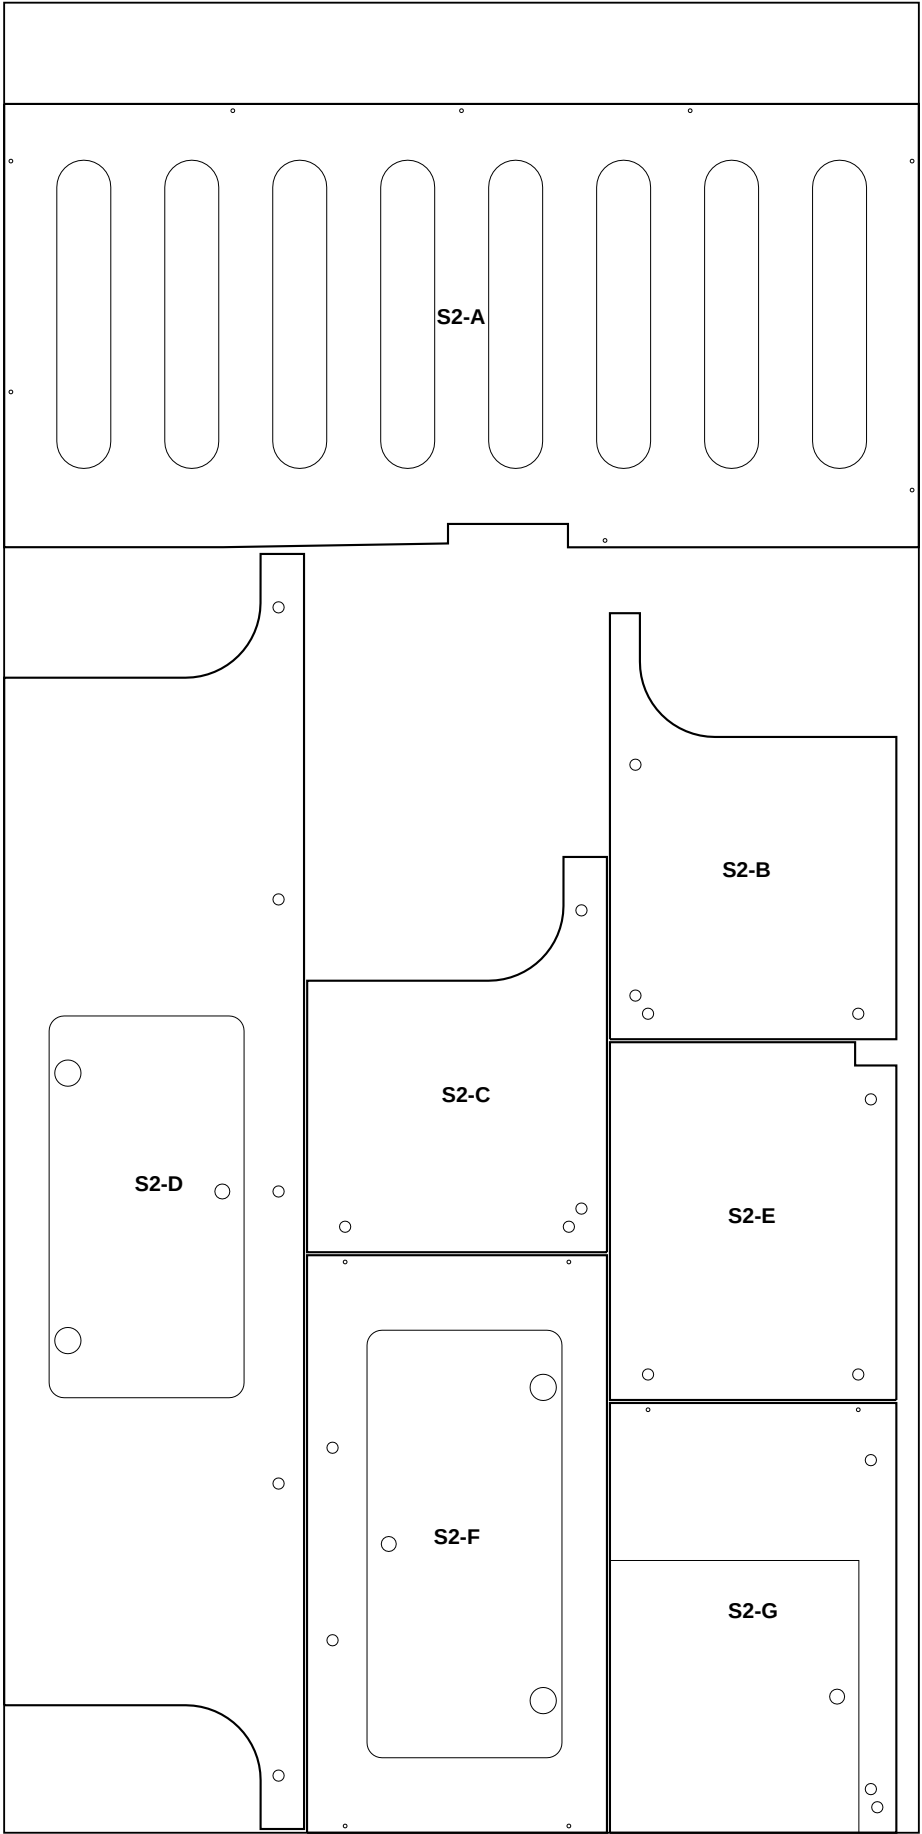


Sheet 3 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

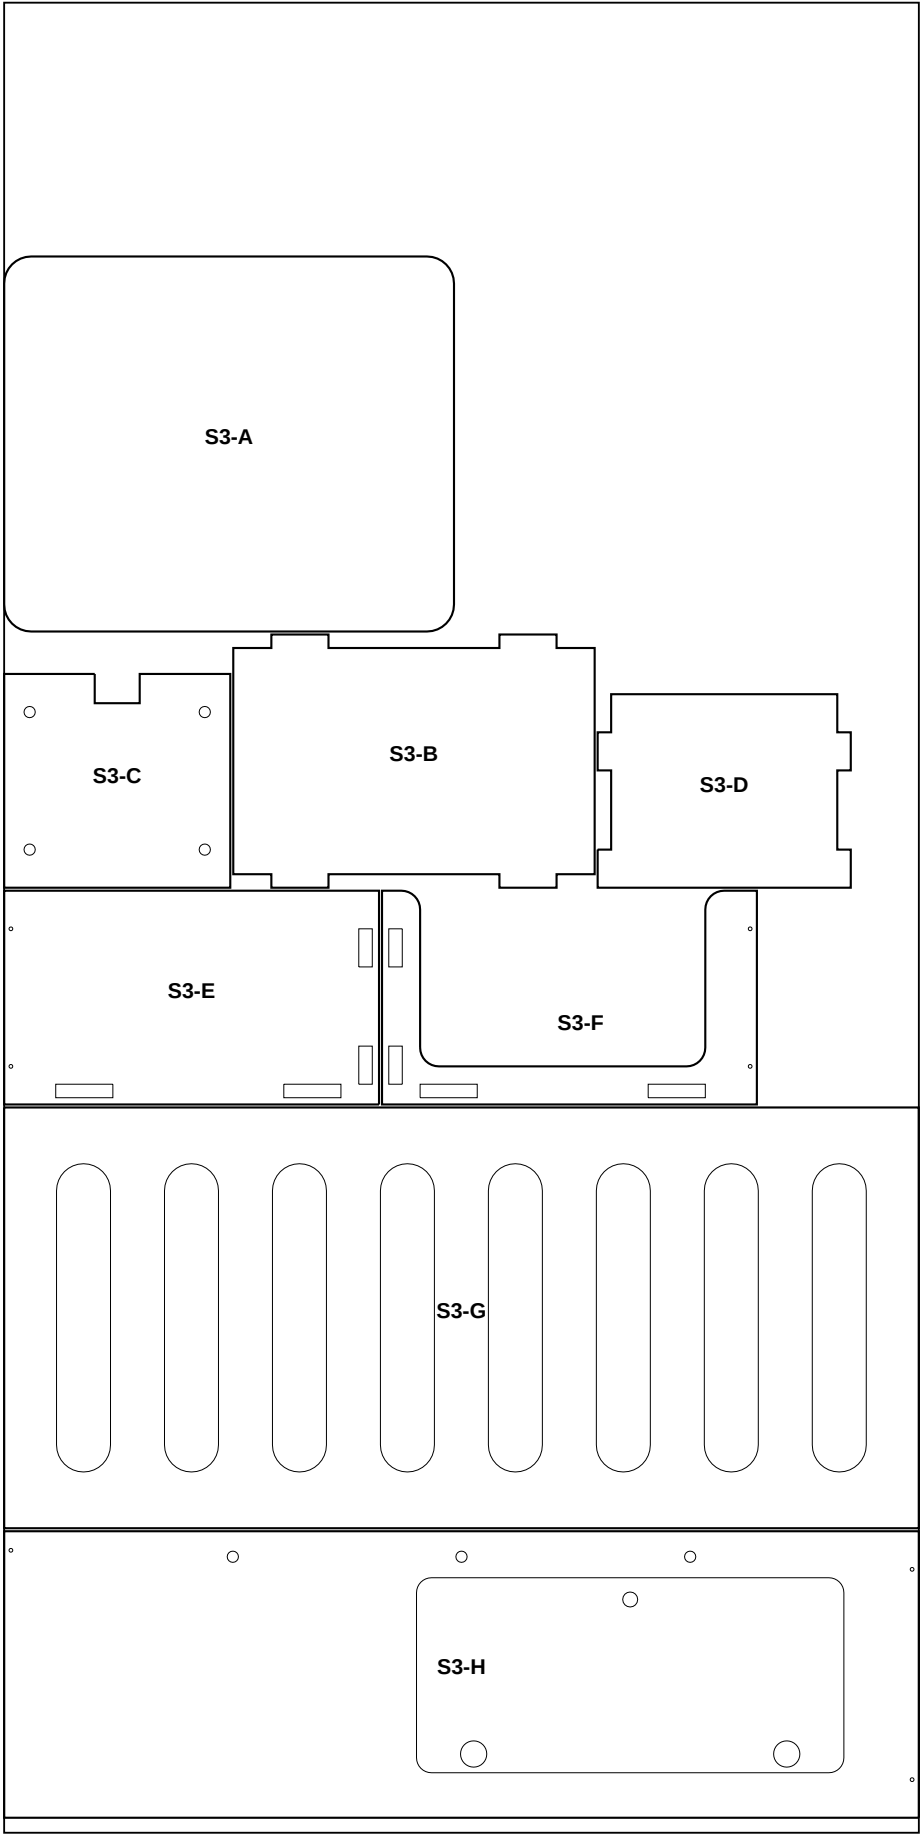

Sheet 4 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

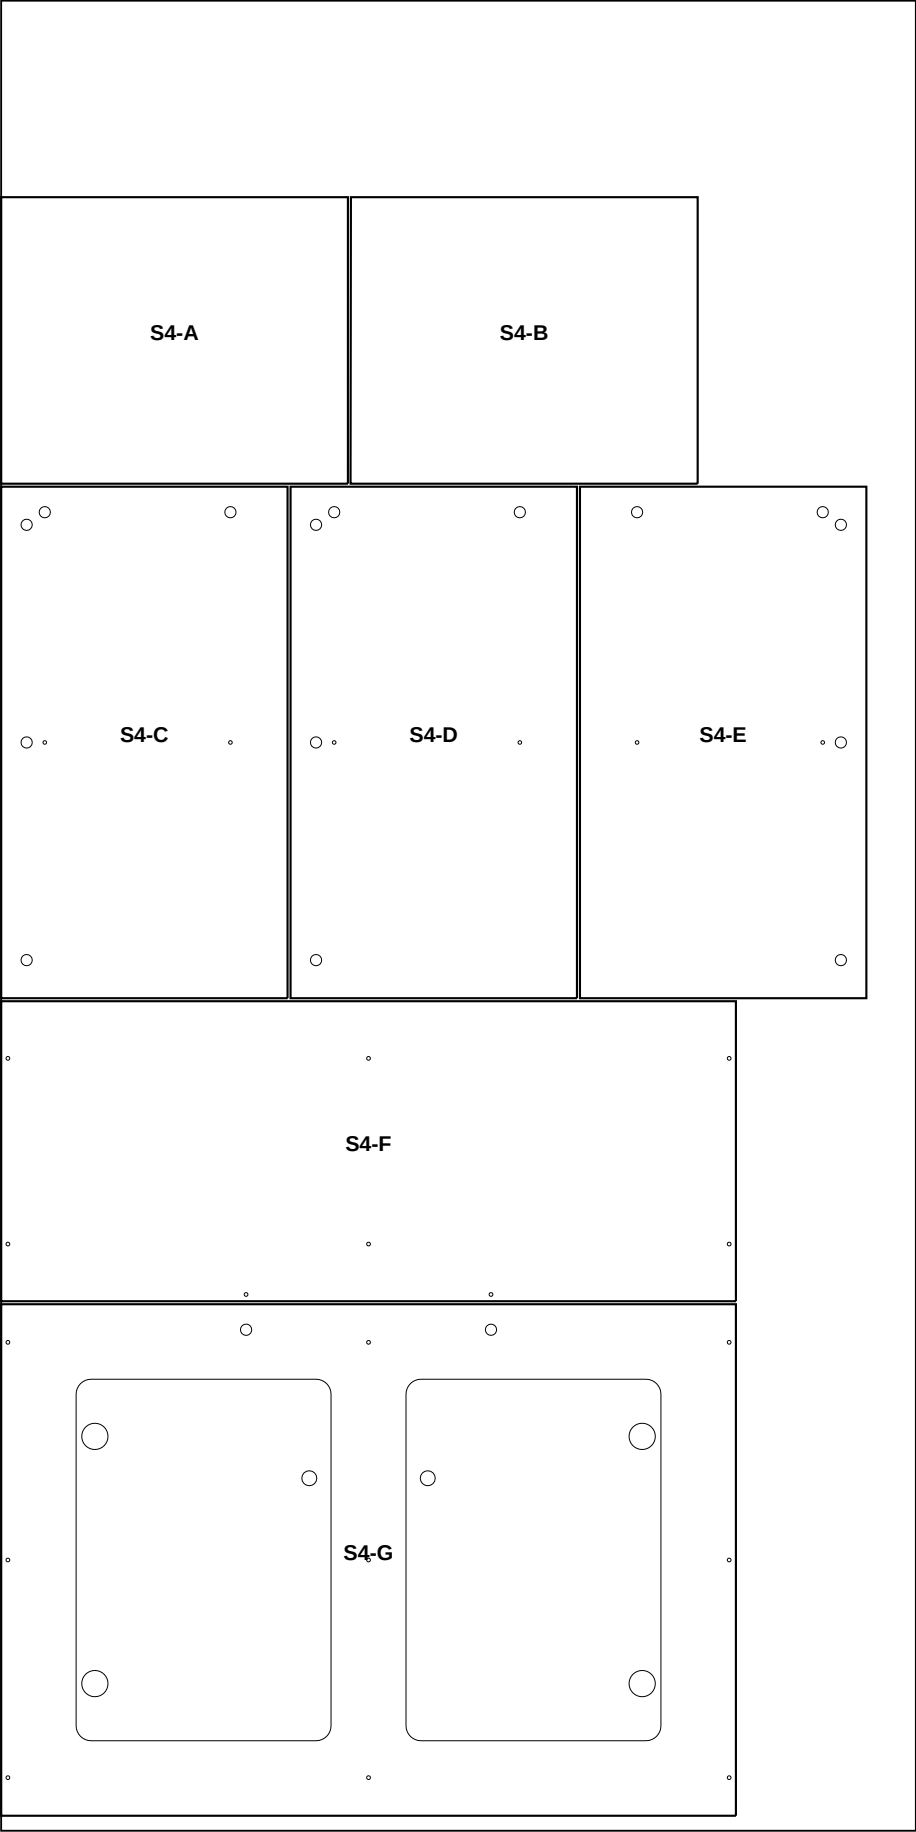


S1-A - Part detail

Overall 770.0 x 40.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

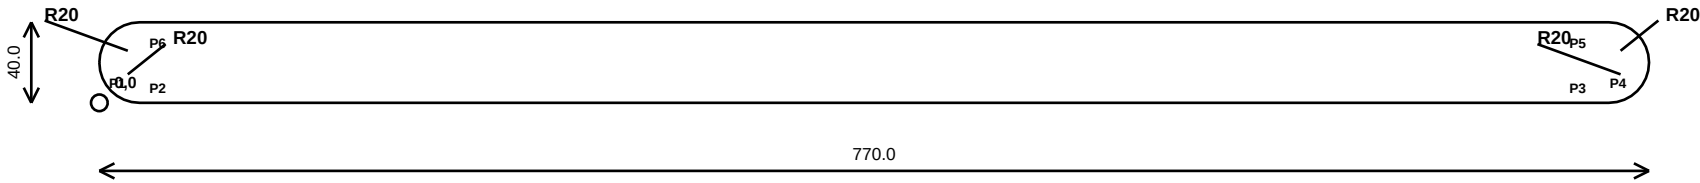


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y20.0	ARC R20 CCW
P2	X20.0 Y0.0	LINE
P3	X750.0 Y0.0	ARC R20 CCW
P4	X770.0 Y20.0	ARC R20 CCW
P5	X750.0 Y40.0	LINE
P6	X20.0 Y40.0	ARC R20 CCW

S1-B - Part detail

Overall 1184.0 x 65.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X1184.0 Y0.0	LINE
P3	X1184.0 Y65.0	LINE
P4	X0.0 Y65.0	LINE

S1-C - Part detail

Overall 1220.0 x 40.0 mm | 18 mm plywood | datum lower-left = X0 Y0

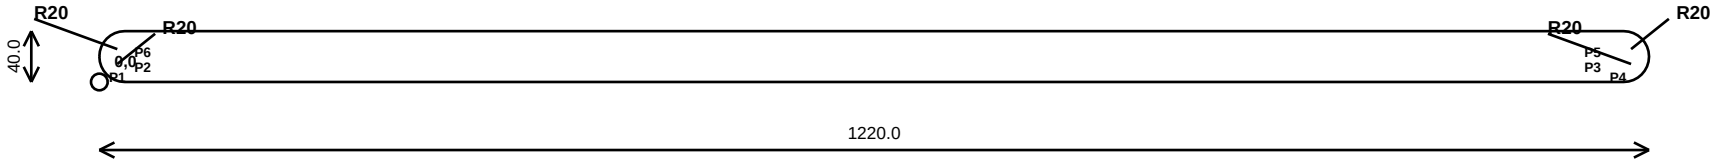

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y20.0	ARC R20 CCW
P2	X20.0 Y0.0	LINE
P3	X1200.0 Y0.0	ARC R20 CCW
P4	X1220.0 Y20.0	ARC R20 CCW
P5	X1200.0 Y40.0	LINE
P6	X20.0 Y40.0	ARC R20 CCW

S1-D - Part detail

Overall 770.2 x 550.0 mm | 18 mm plywood | datum lower-left = X0 Y0

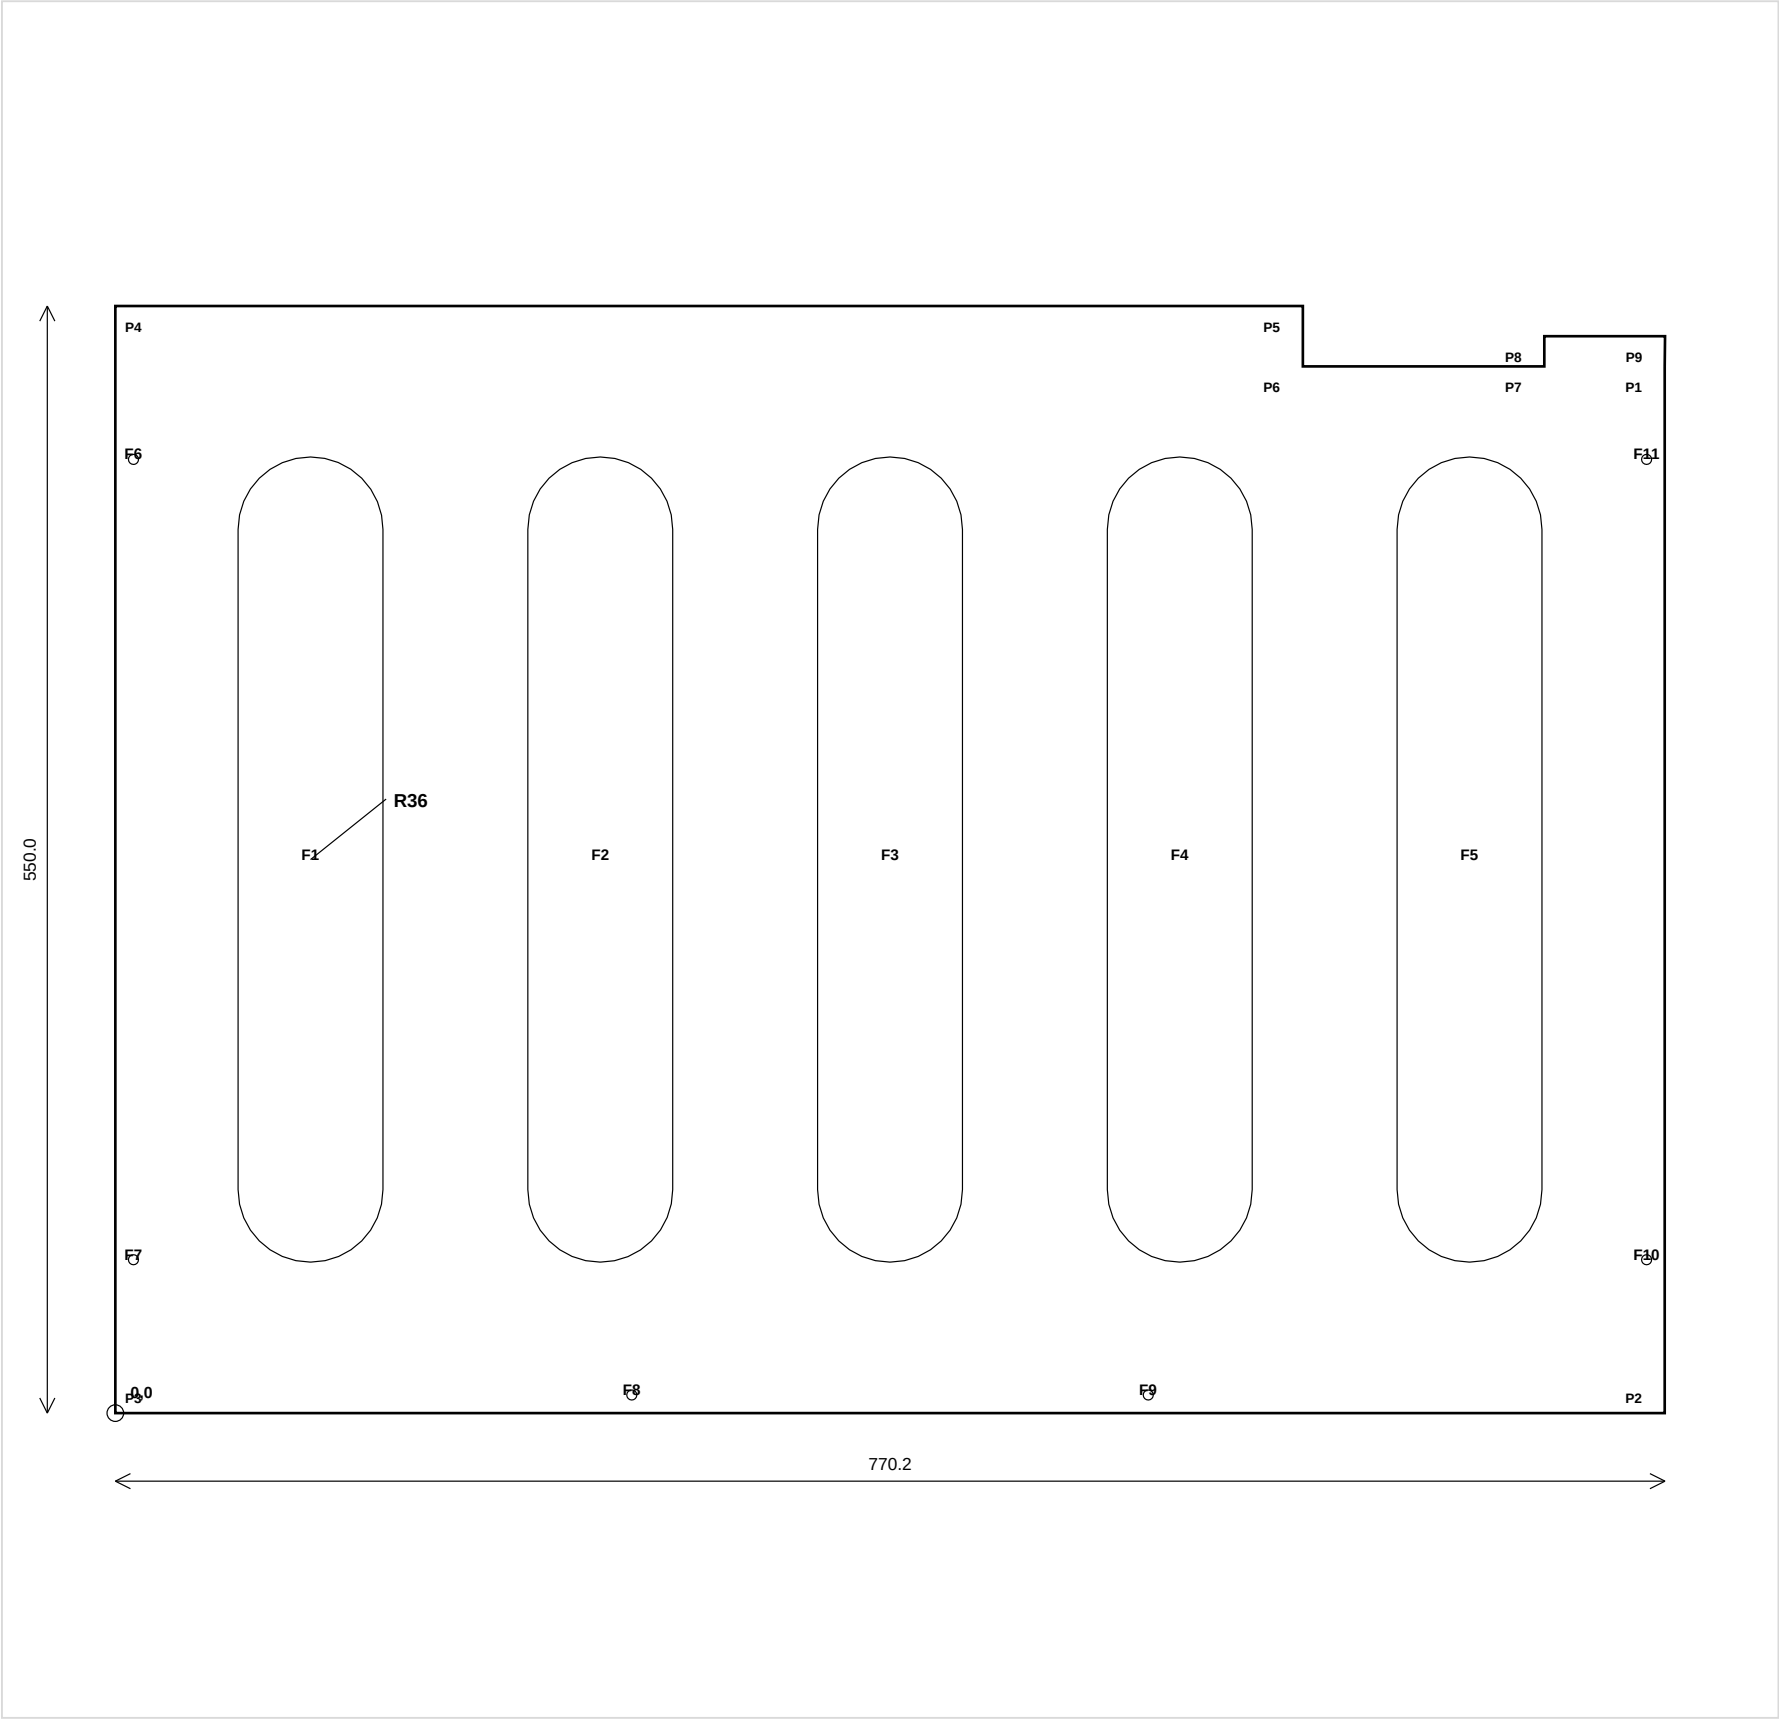

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 72.0 x 400.0, R36	X 97.0 Y 275.0
F2	slot 72.0 x 400.0, R36	X 241.0 Y 275.0
F3	slot 72.0 x 400.0, R36	X 385.0 Y 275.0
F4	slot 72.0 x 400.0, R36	X 529.0 Y 275.0
F5	slot 72.0 x 400.0, R36	X 673.0 Y 275.0
F6	Dia 5 x 11 deep	X 9.0 Y 474.0
F7	Dia 5 x 11 deep	X 9.0 Y 76.0
F8	Dia 5 x 11 deep	X 256.7 Y 9.0
F9	Dia 5 x 11 deep	X 513.2 Y 9.0
F10	Dia 5 x 11 deep	X 761.0 Y 76.0
F11	Dia 5 x 11 deep	X 761.0 Y 474.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X770.0 Y520.0	LINE
P2	X770.0 Y0.0	LINE
P3	X0.0 Y0.0	LINE
P4	X0.0 Y550.0	LINE
P5	X590.2 Y550.0	LINE
P6	X590.2 Y520.0	LINE
P7	X710.2 Y520.0	LINE
P8	X710.2 Y535.0	LINE
P9	X770.2 Y535.0	LINE

S1-E - Part detail

Overall 400.0 x 550.0 mm | 18 mm plywood | datum lower-left = X0 Y0

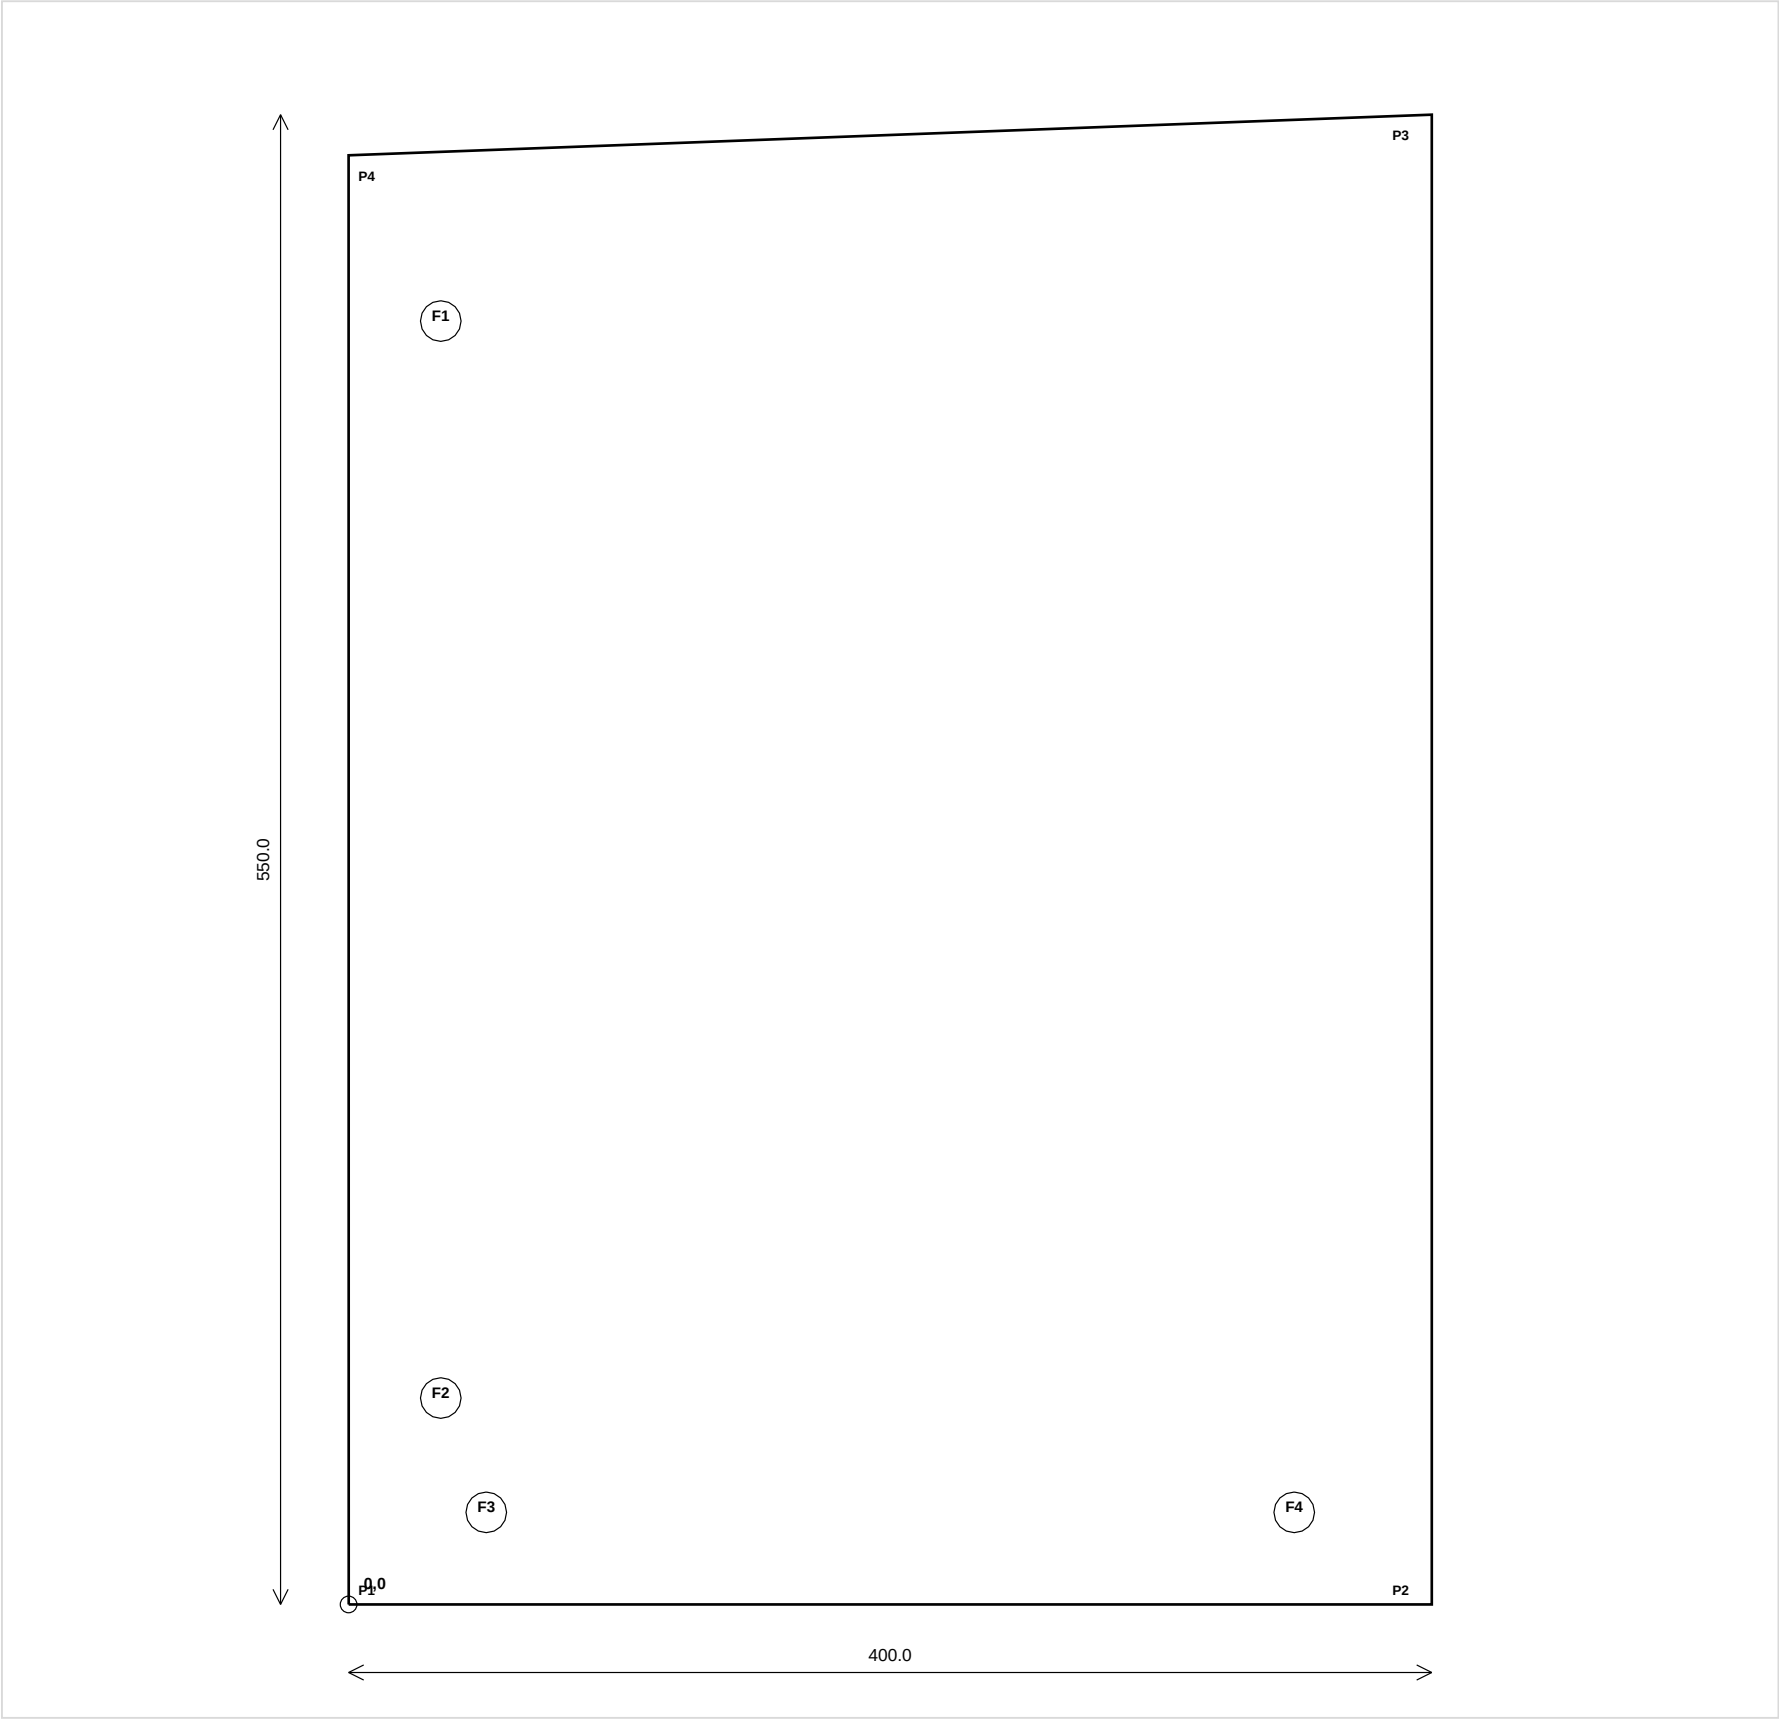

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 473.8
F2	Dia 15 x 14 deep	X 34.0 Y 76.2
F3	Dia 15 x 14 deep	X 50.8 Y 34.0
F4	Dia 15 x 14 deep	X 349.2 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X400.0 Y0.0	LINE
P3	X400.0 Y550.0	LINE
P4	X0.0 Y535.0	LINE

S1-F - Part detail

Overall 400.0 x 1700.0 mm | 18 mm plywood | datum lower-left = X0 Y0

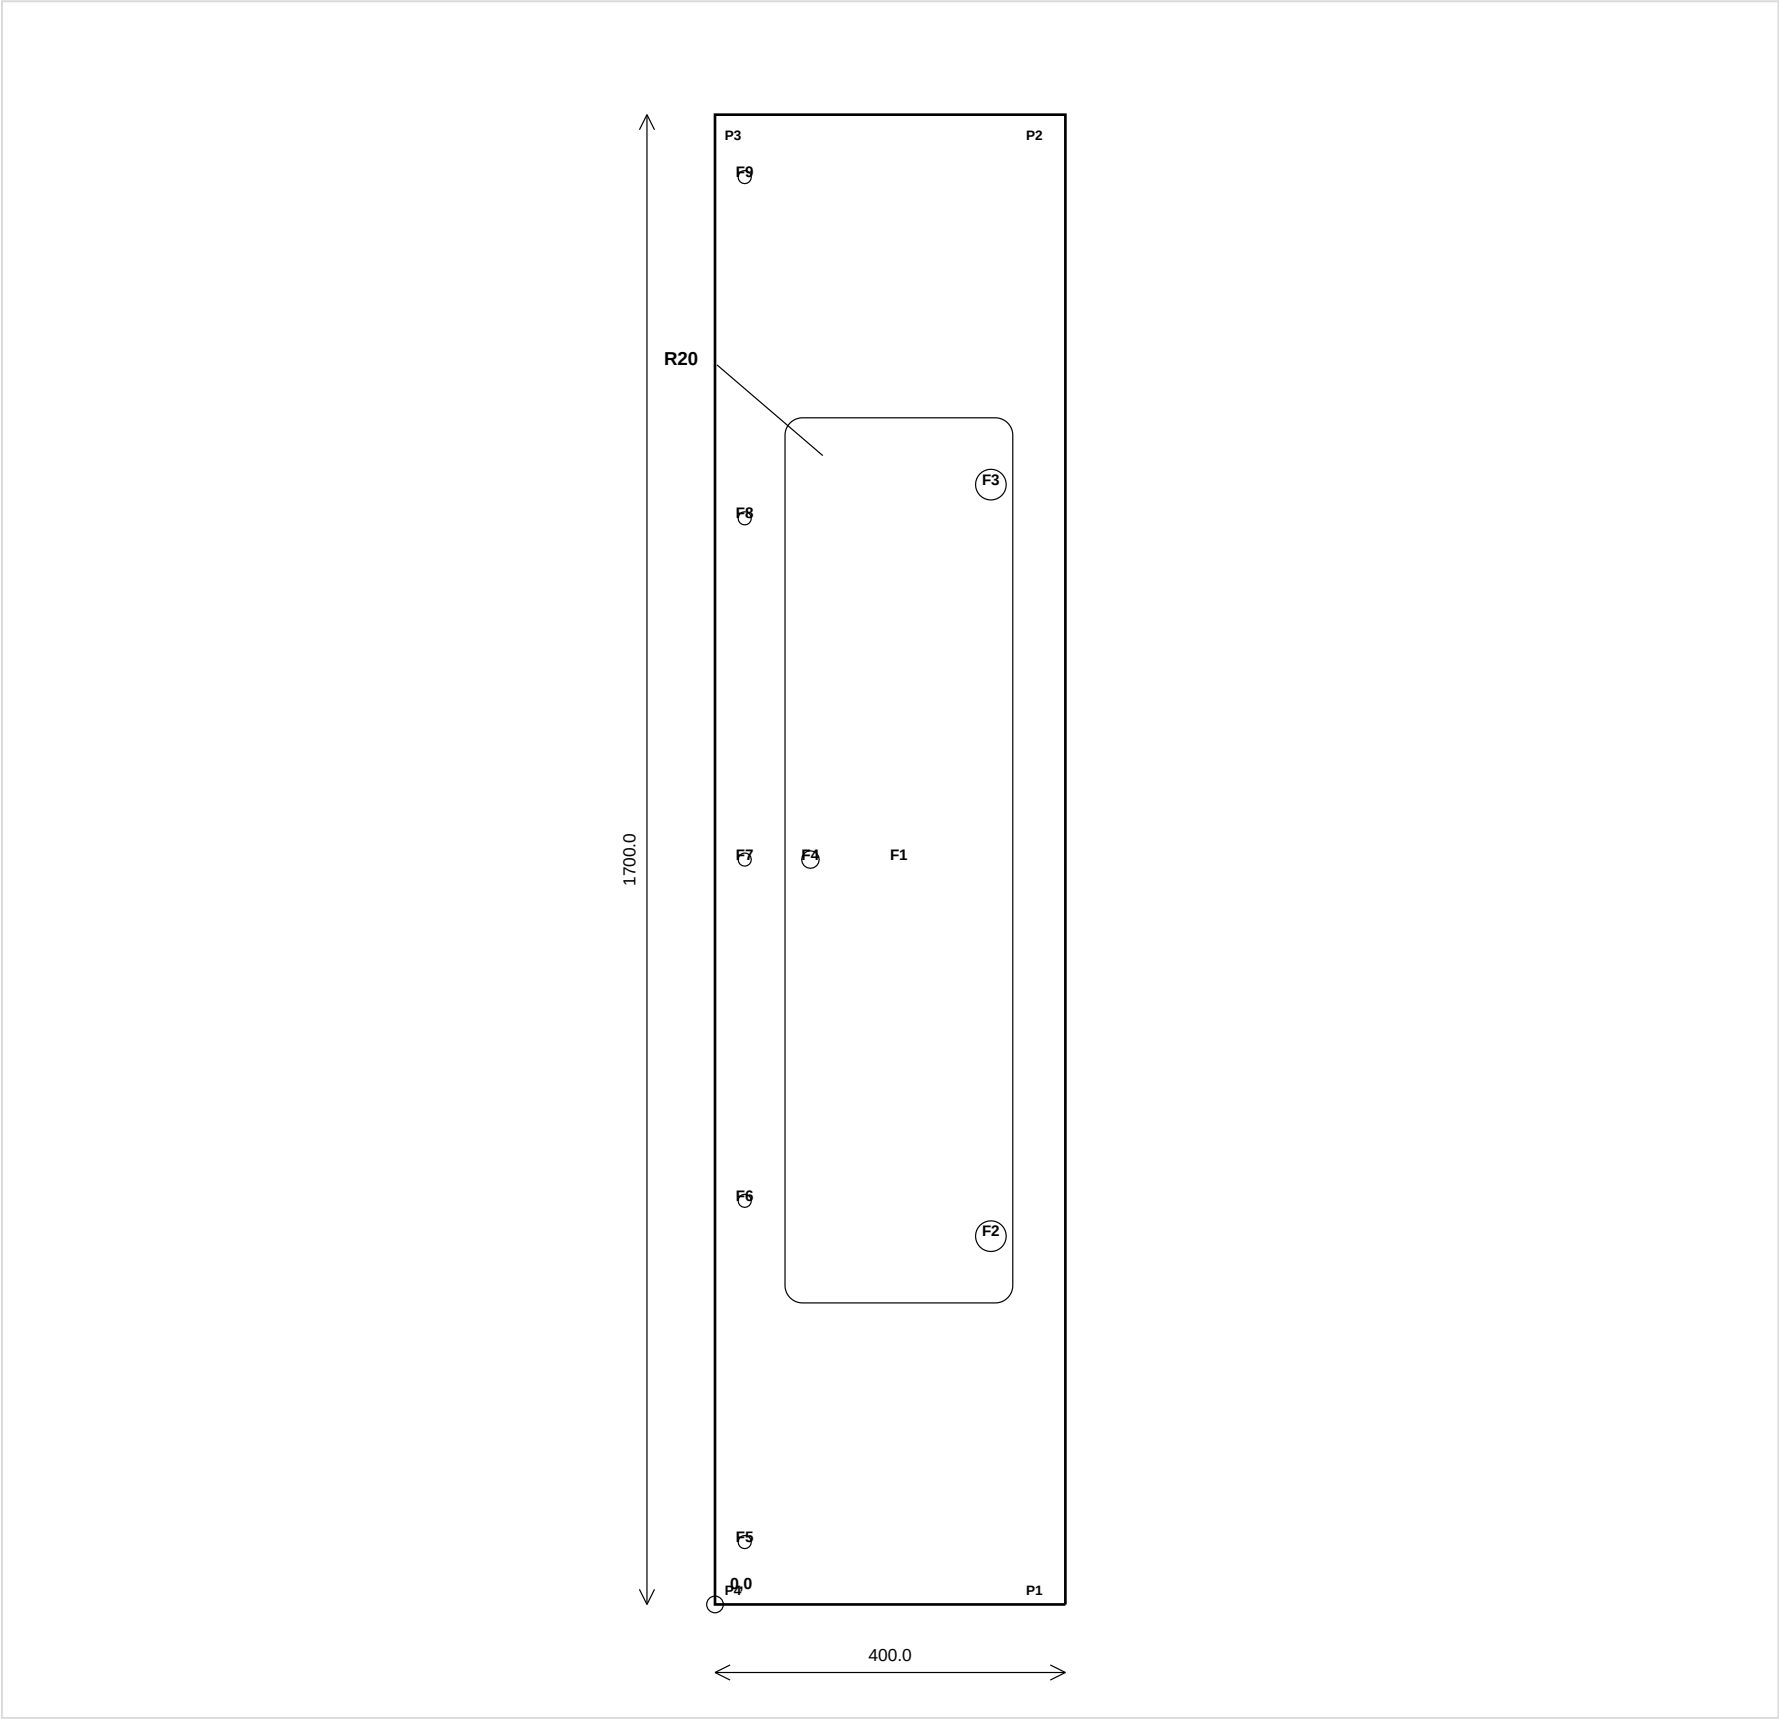

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 1010.0, R20	X 209.9 Y 849.1
F2	Dia 35 x 13 deep	X 314.9 Y 420.2
F3	Dia 35 x 13 deep	X 314.9 Y 1277.8
F4	Dia 20 THROUGH	X 108.9 Y 850.0
F5	Dia 15 x 14 deep	X 33.9 Y 71.2
F6	Dia 15 x 14 deep	X 33.9 Y 460.6
F7	Dia 15 x 14 deep	X 33.9 Y 850.0
F8	Dia 15 x 14 deep	X 33.9 Y 1239.4
F9	Dia 15 x 14 deep	X 33.9 Y 1628.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X400.0 Y0.0	LINE
P2	X400.0 Y1700.0	LINE
P3	X0.0 Y1700.0	LINE
P4	X0.0 Y0.0	LINE

S1-G - Part detail

Overall 600.0 x 1700.0 mm | 18 mm plywood | datum lower-left = X0 Y0

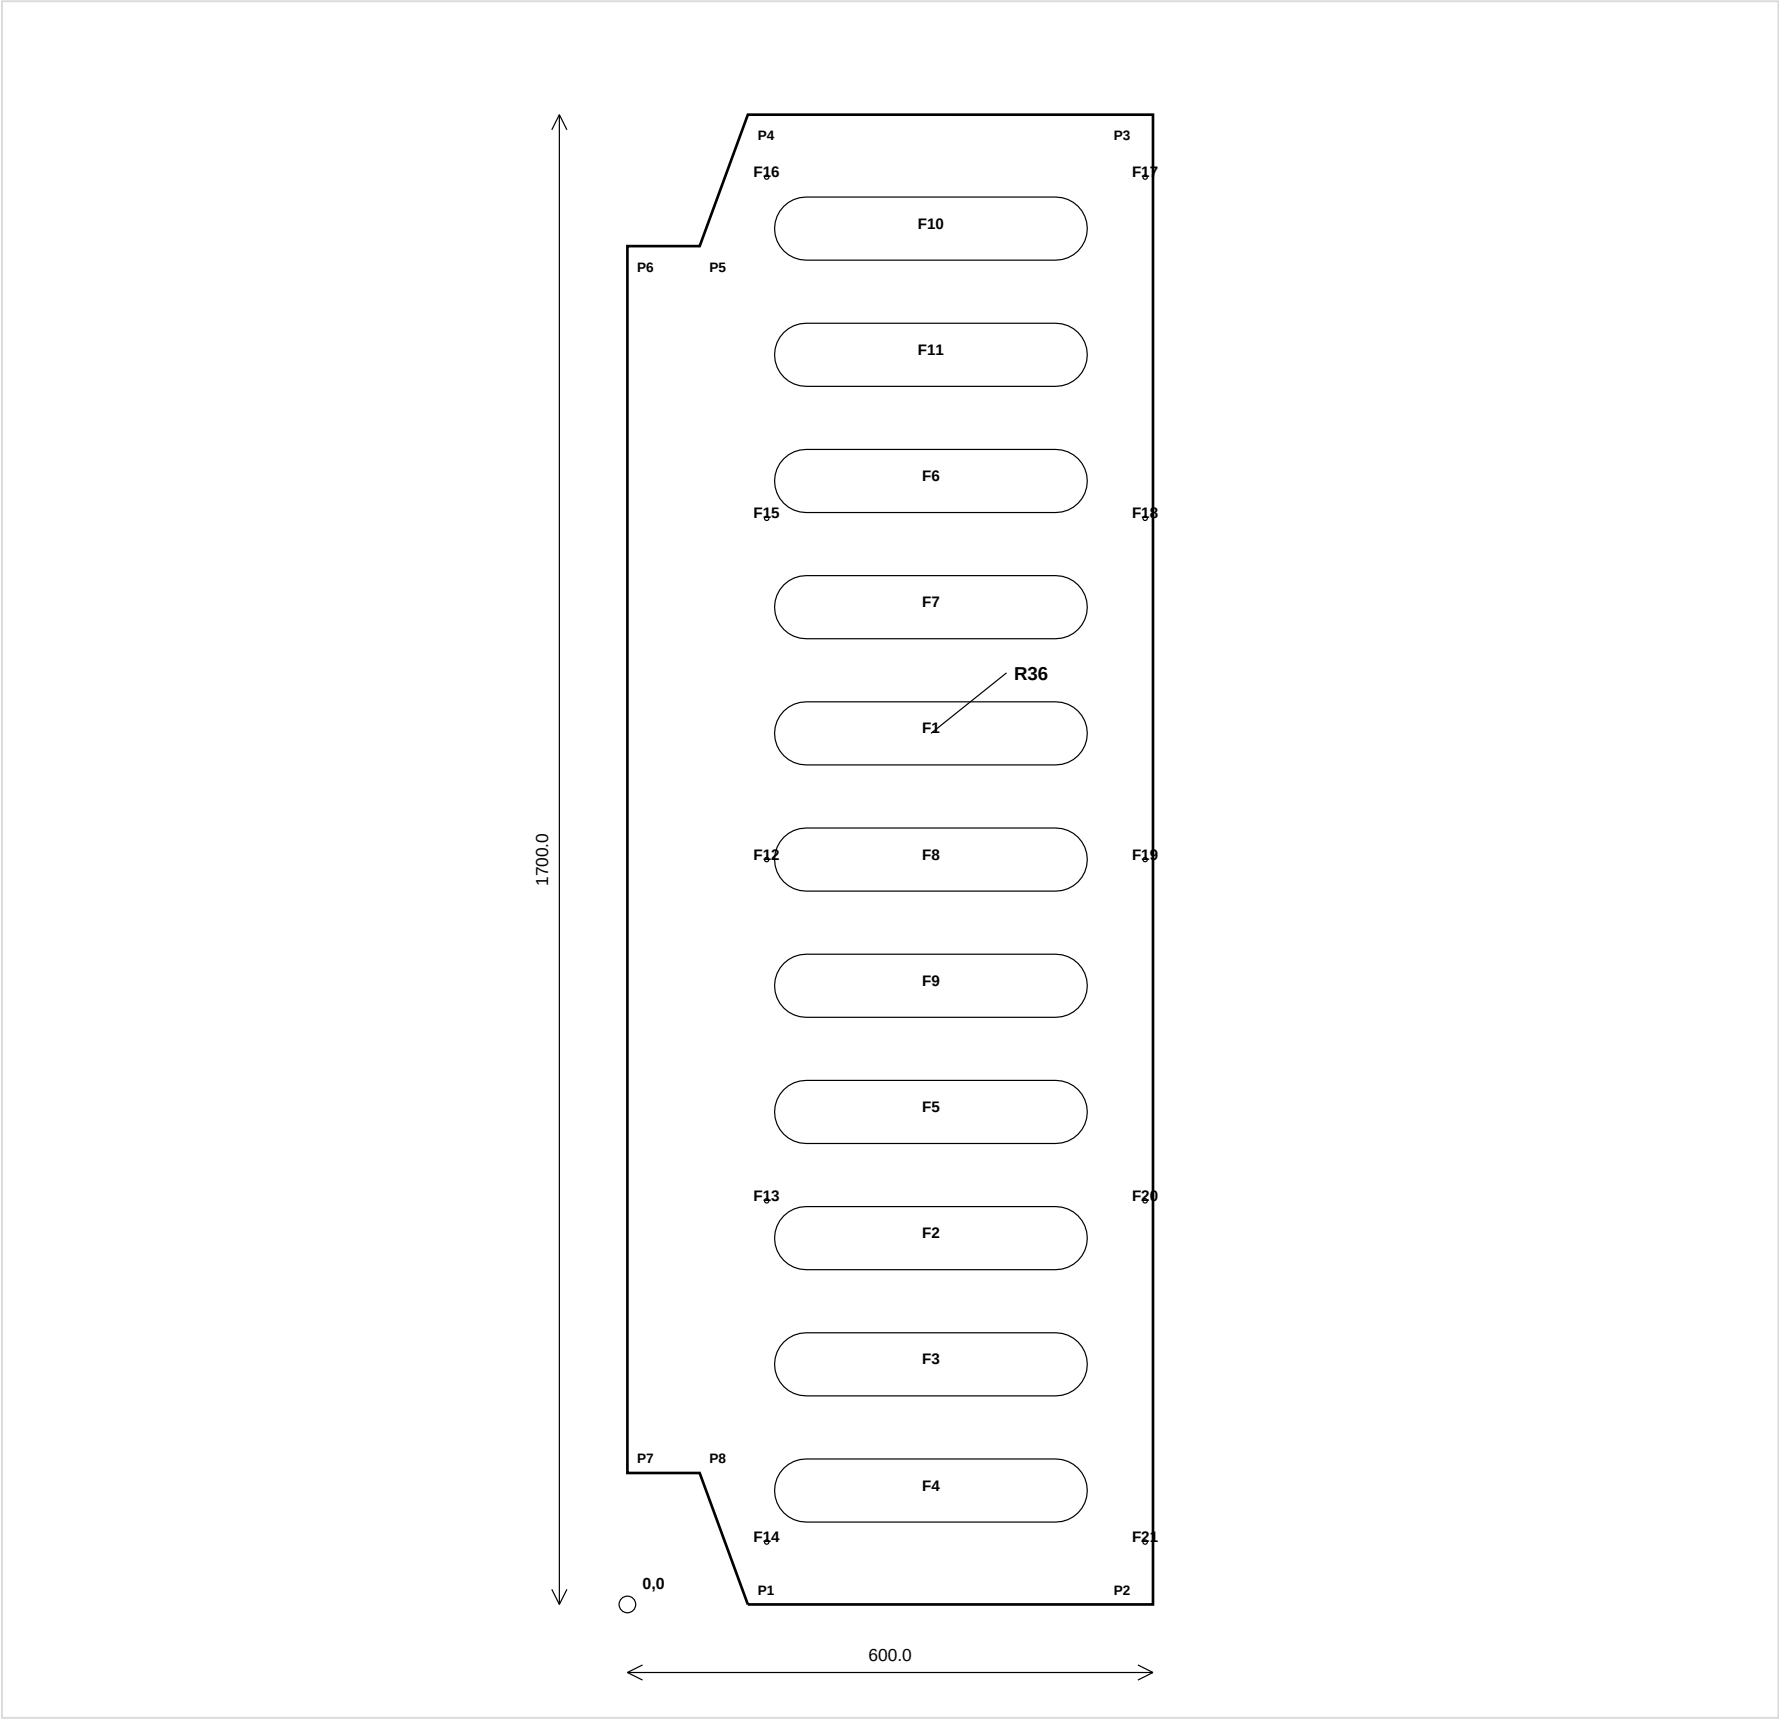

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 357.0 x 72.0, R36	X 346.5 Y 994.0
F2	slot 357.0 x 72.0, R36	X 346.5 Y 418.0
F3	slot 357.0 x 72.0, R36	X 346.5 Y 274.0
F4	slot 357.0 x 72.0, R36	X 346.5 Y 130.0
F5	slot 357.0 x 72.0, R36	X 346.5 Y 562.0
F6	slot 357.0 x 72.0, R36	X 346.5 Y 1282.0
F7	slot 357.0 x 72.0, R36	X 346.5 Y 1138.0
F8	slot 357.0 x 72.0, R36	X 346.5 Y 850.0
F9	slot 357.0 x 72.0, R36	X 346.5 Y 706.0
F10	slot 357.0 x 72.0, R36	X 346.5 Y 1570.0
F11	slot 357.0 x 72.0, R36	X 346.5 Y 1426.0
F12	Dia 5 x 11 deep	X 159.0 Y 850.0
F13	Dia 5 x 11 deep	X 159.0 Y 460.6
F14	Dia 5 x 11 deep	X 159.0 Y 71.0
F15	Dia 5 x 11 deep	X 159.0 Y 1239.4
F16	Dia 5 x 11 deep	X 159.0 Y 1629.0
F17	Dia 5 x 11 deep	X 591.0 Y 1629.0
F18	Dia 5 x 11 deep	X 591.0 Y 1239.4

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.


P1	X137.5 Y0.0	LINE
P2	X600.0 Y0.0	LINE
P3	X600.0 Y1700.0	LINE
P4	X137.5 Y1700.0	LINE
P5	X82.5 Y1550.0	LINE
P6	X0.0 Y1550.0	LINE
P7	X0.0 Y150.0	LINE
P8	X82.5 Y150.0	LINE

Machining features - continued

F19	Dia 5 x 11 deep	X 591.0 Y 850.0
F20	Dia 5 x 11 deep	X 591.0 Y 460.6
F21	Dia 5 x 11 deep	X 591.0 Y 71.0

S2-A - Part detail

Overall 1220.0 x 591.1 mm | 18 mm plywood | datum lower-left = X0 Y0

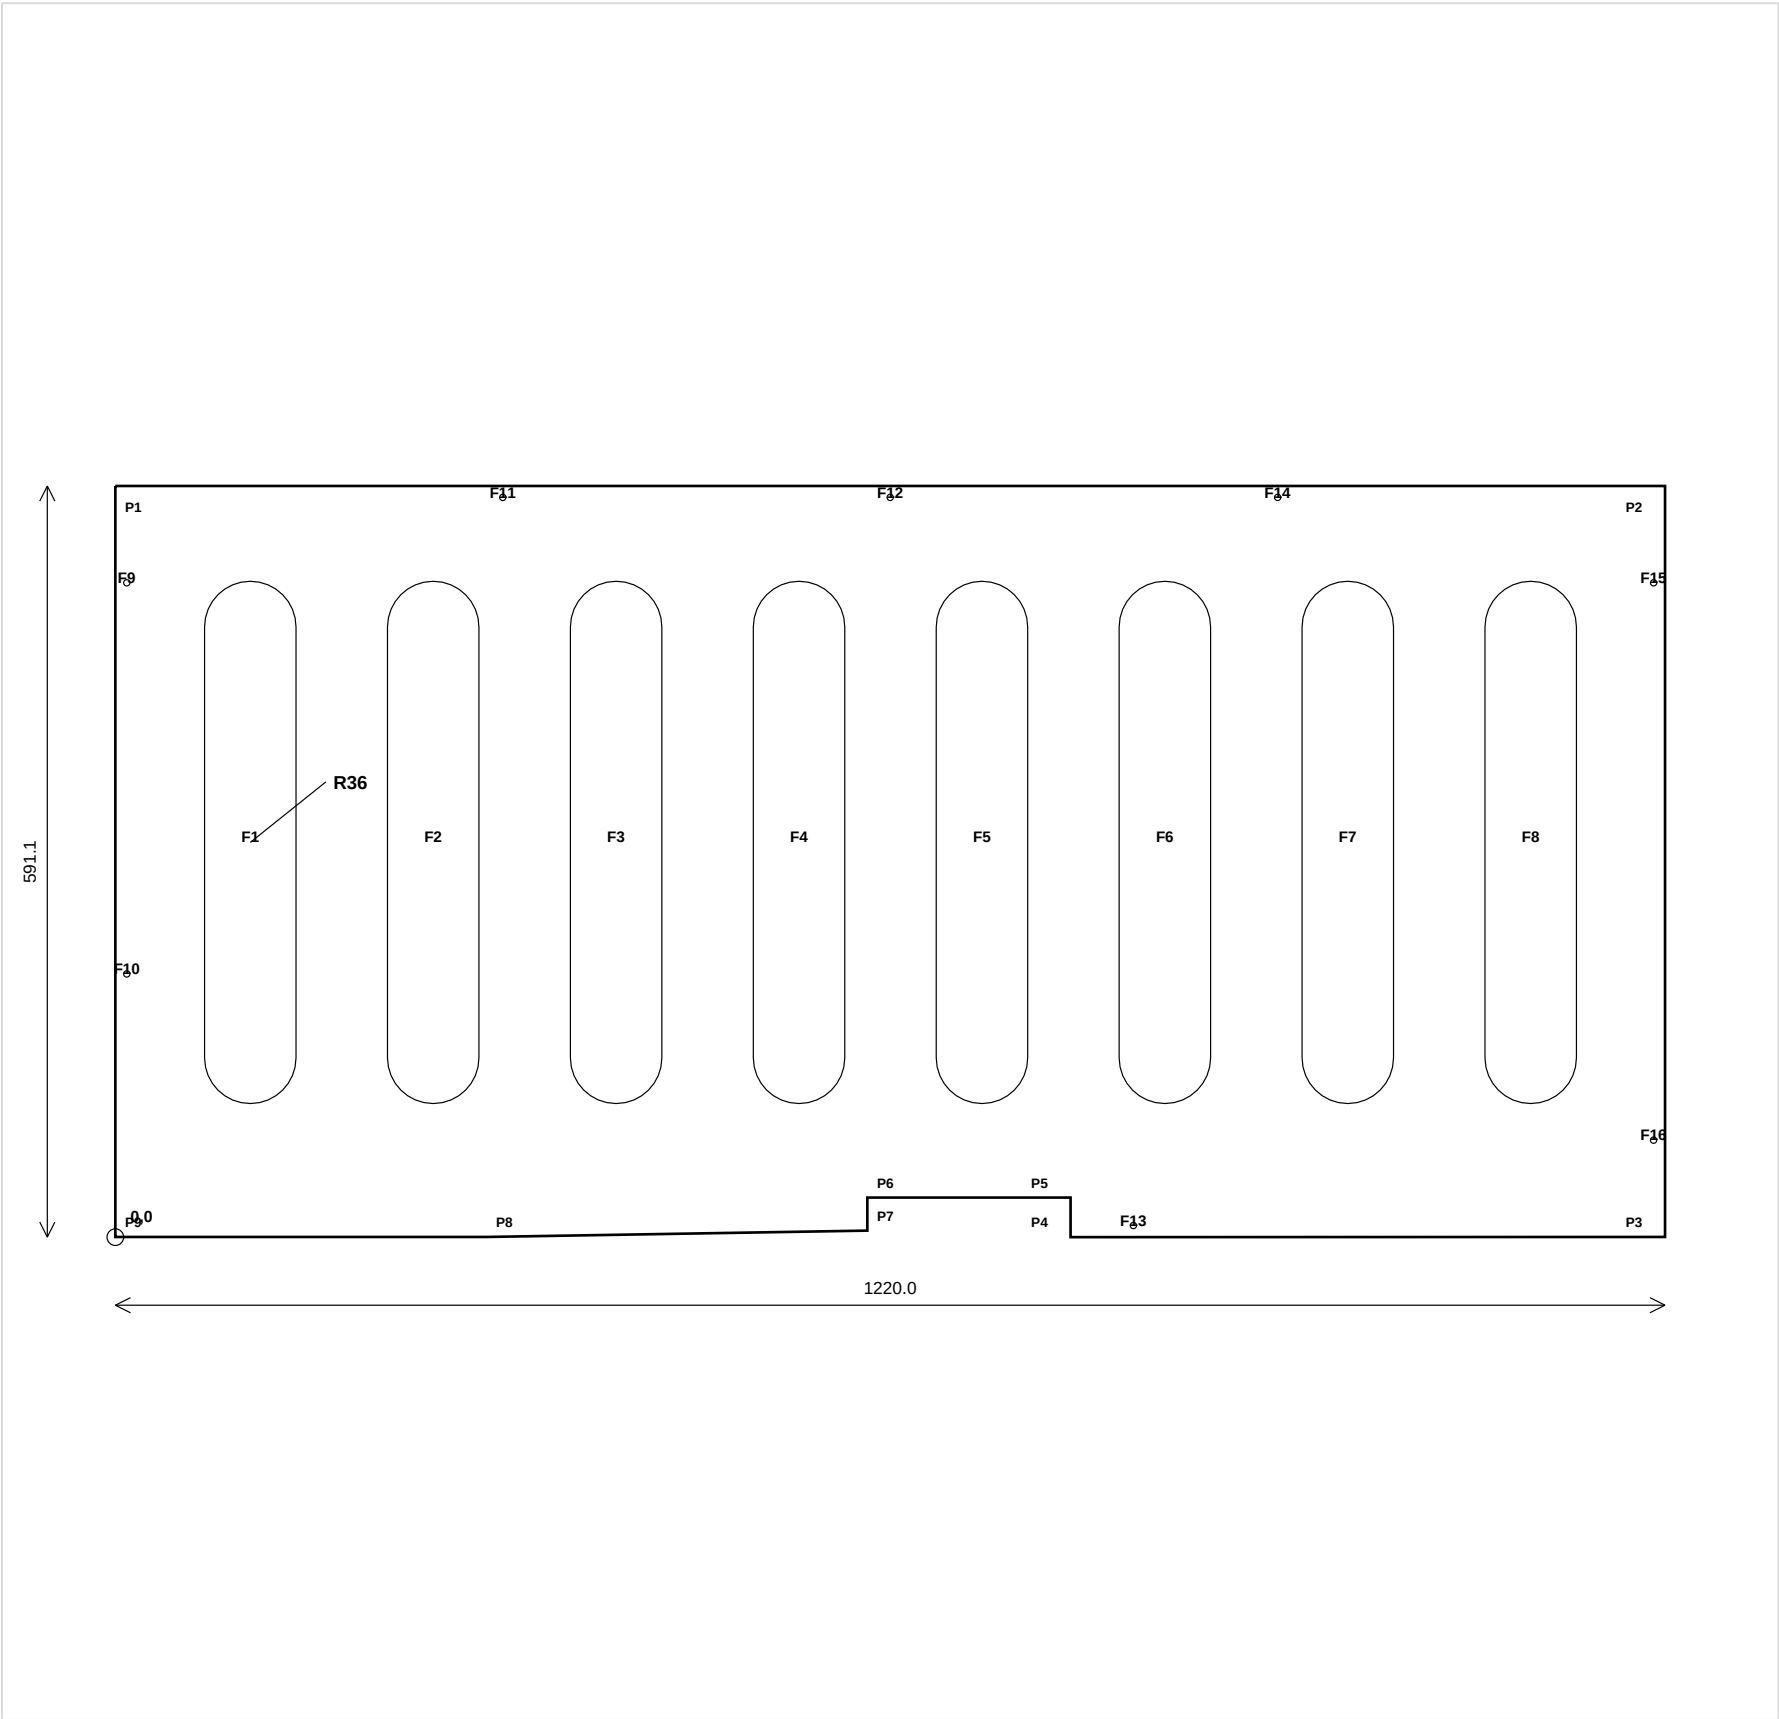

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 72.0 x 411.0, R36	X 106.2 Y 310.6
F2	slot 72.0 x 411.0, R36	X 250.2 Y 310.6
F3	slot 72.0 x 411.0, R36	X 394.2 Y 310.6
F4	slot 72.0 x 411.0, R36	X 538.2 Y 310.6
F5	slot 72.0 x 411.0, R36	X 682.2 Y 310.6
F6	slot 72.0 x 411.0, R36	X 826.2 Y 310.6
F7	slot 72.0 x 411.0, R36	X 970.2 Y 310.6
F8	slot 72.0 x 411.0, R36	X 1114.2 Y 310.6
F9	Dia 5 x 11 deep	X 9.0 Y 515.0
F10	Dia 5 x 11 deep	X 9.0 Y 207.0
F11	Dia 5 x 11 deep	X 305.0 Y 582.0
F12	Dia 5 x 11 deep	X 610.0 Y 582.0
F13	Dia 5 x 11 deep	X 801.4 Y 9.0
F14	Dia 5 x 11 deep	X 915.0 Y 582.0
F15	Dia 5 x 11 deep	X 1211.0 Y 515.0
F16	Dia 5 x 11 deep	X 1211.0 Y 76.1


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y591.1	LINE
P2	X1220.0 Y591.1	LINE
P3	X1220.0 Y0.1	LINE
P4	X752.0 Y0.0	LINE
P5	X752.0 Y31.1	LINE
P6	X592.0 Y31.1	LINE
P7	X592.0 Y5.1	LINE
P8	X292.0 Y0.1	LINE
P9	X0.0 Y0.1	LINE

S2-B - Part detail

Overall 382.0 x 568.0 mm | 18 mm plywood | datum lower-left = X0 Y0

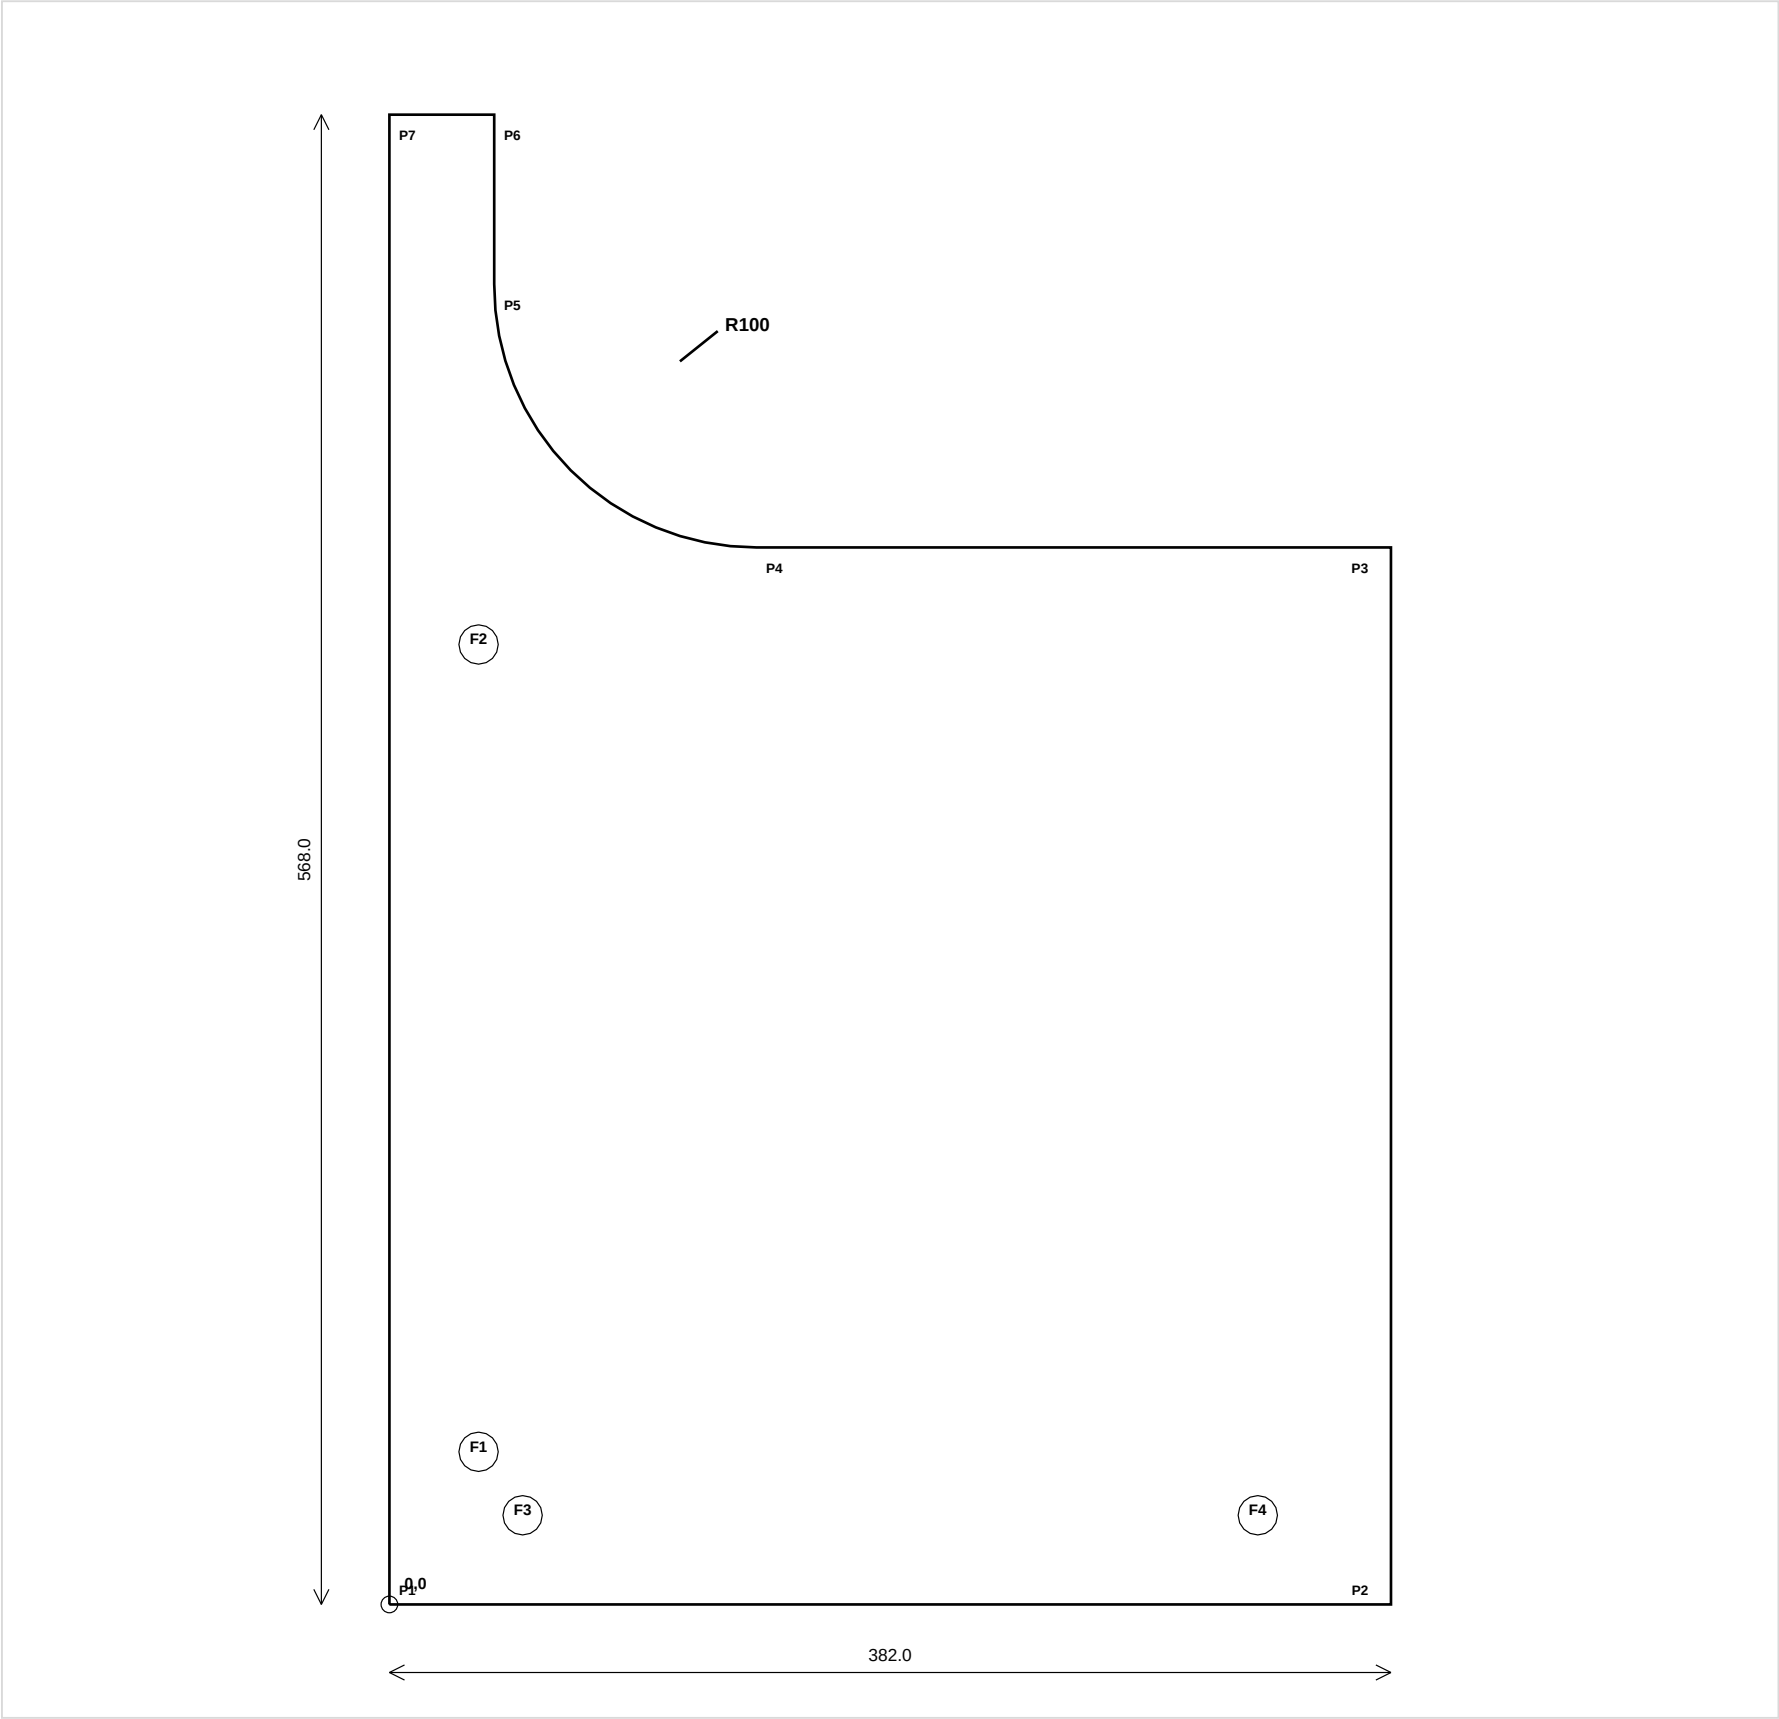

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 58.2
F2	Dia 15 x 14 deep	X 34.0 Y 366.0
F3	Dia 15 x 14 deep	X 50.8 Y 34.0
F4	Dia 15 x 14 deep	X 331.2 Y 34.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X382.0 Y0.0	LINE
P3	X382.0 Y403.0	LINE
P4	X140.0 Y403.0	ARC R100 CW
P5	X40.0 Y503.4	LINE
P6	X40.0 Y568.0	LINE
P7	X0.0 Y568.0	LINE

S2-C - Part detail

Overall 400.0 x 527.0 mm | 18 mm plywood | datum lower-left = X0 Y0

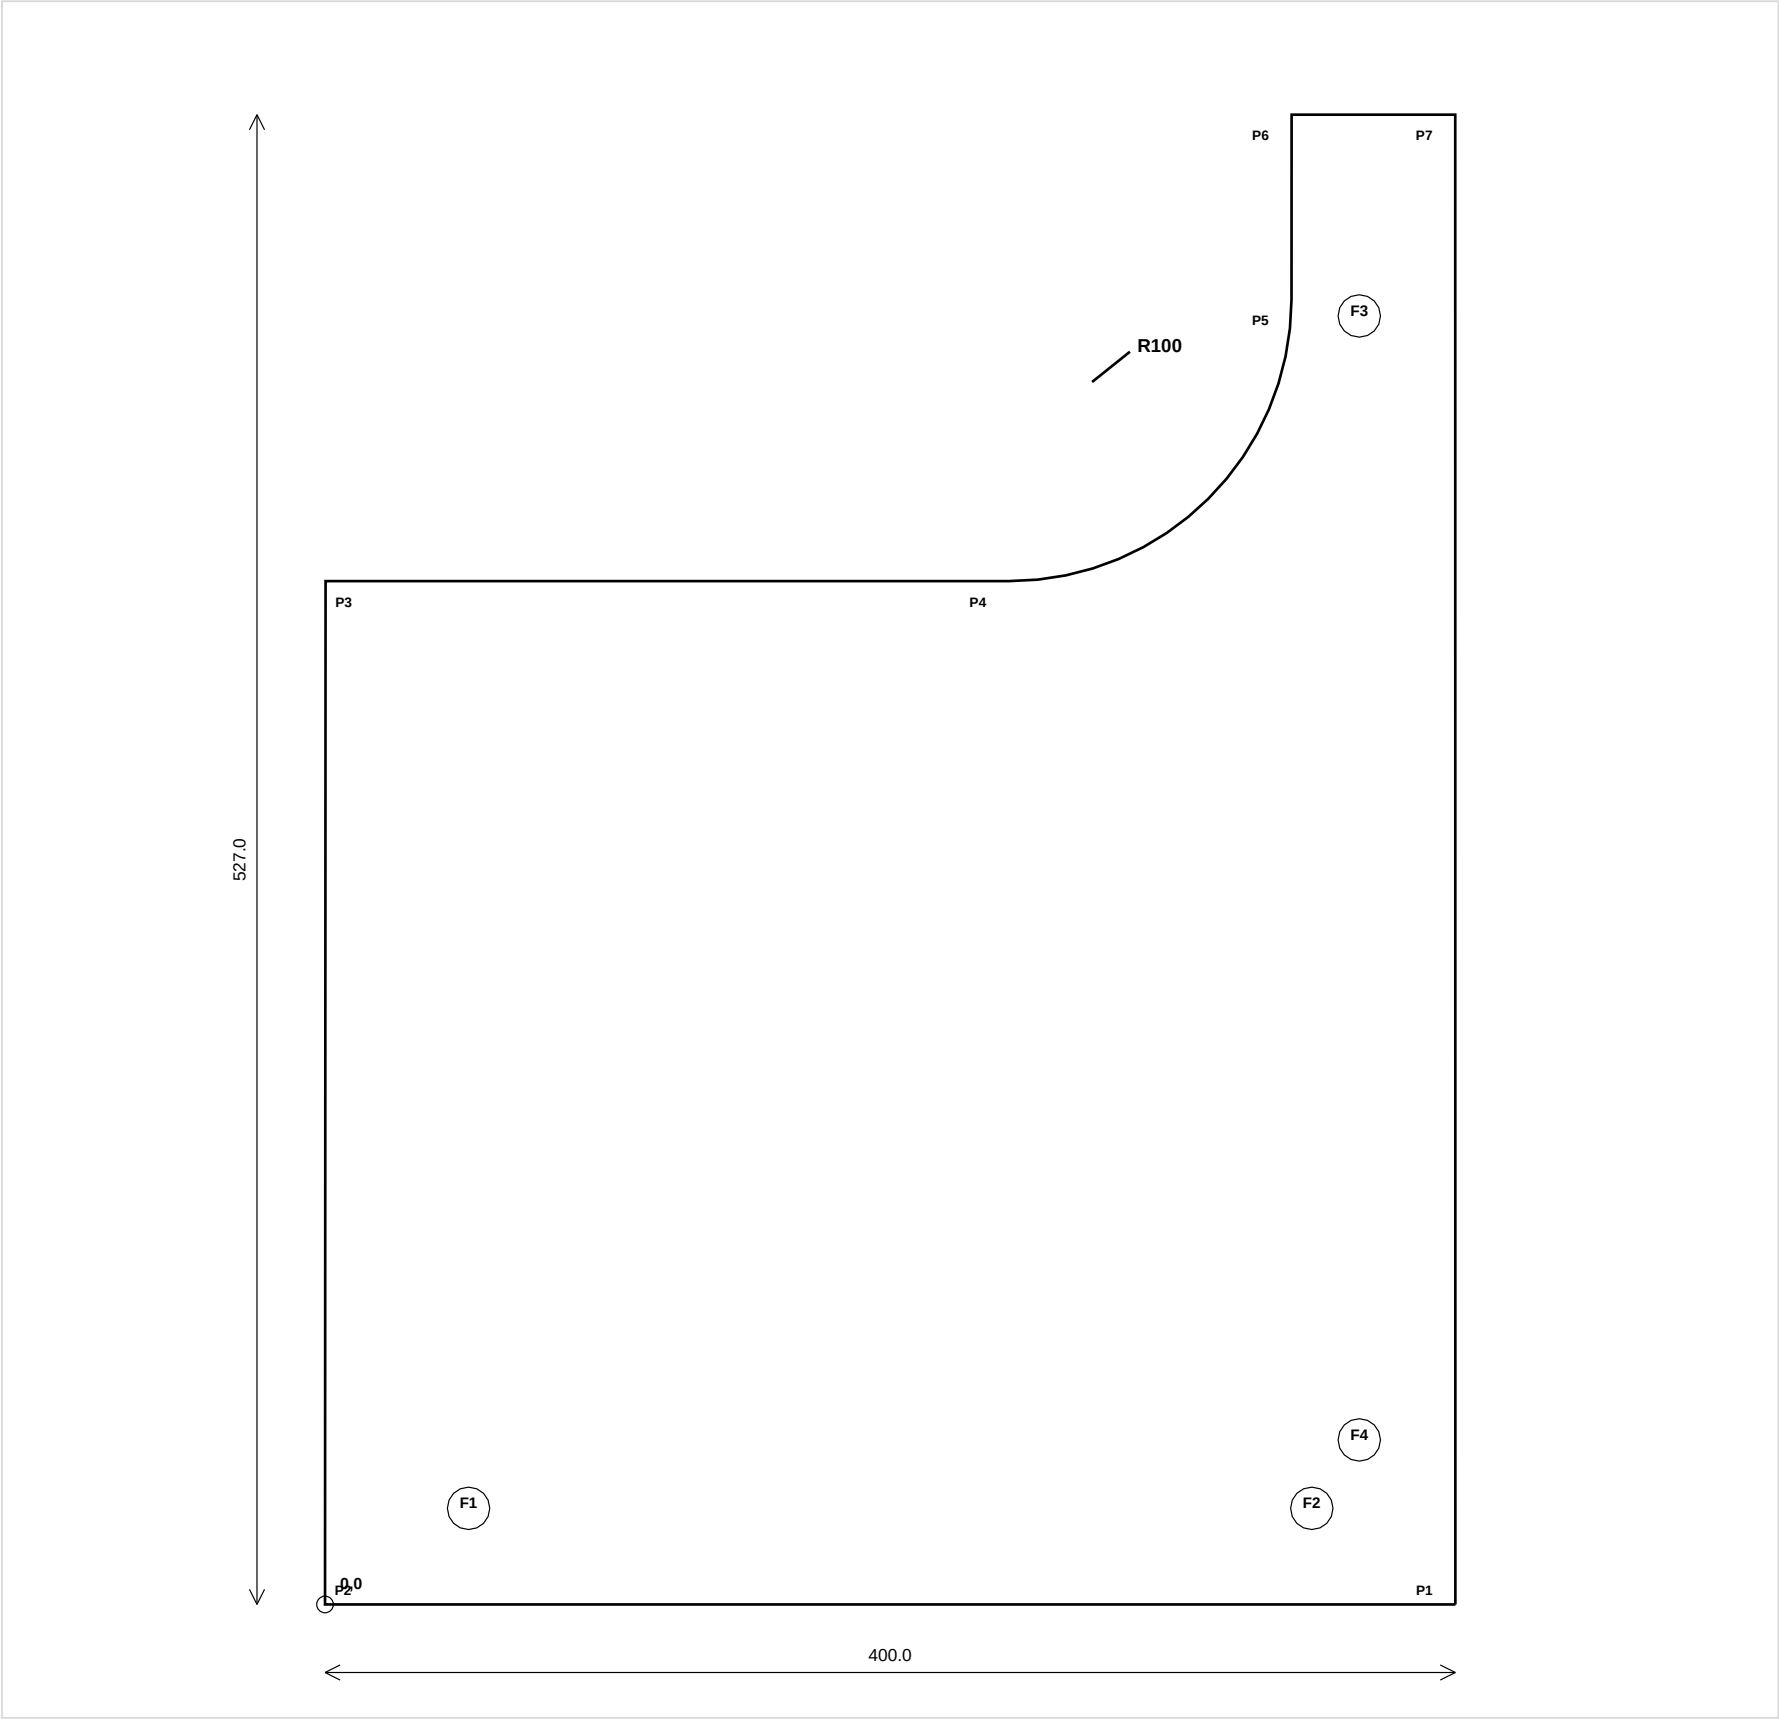

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 34.0
F2	Dia 15 x 14 deep	X 349.2 Y 34.0
F3	Dia 15 x 14 deep	X 366.0 Y 455.8
F4	Dia 15 x 14 deep	X 366.0 Y 58.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X400.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.2 Y362.0	LINE
P4	X242.0 Y362.0	ARC R100 CCW
P5	X342.0 Y461.6	LINE
P6	X342.0 Y527.0	LINE
P7	X400.0 Y527.0	LINE

S2-D - Part detail

Overall 400.0 x 1700.0 mm | 18 mm plywood | datum lower-left = X0 Y0

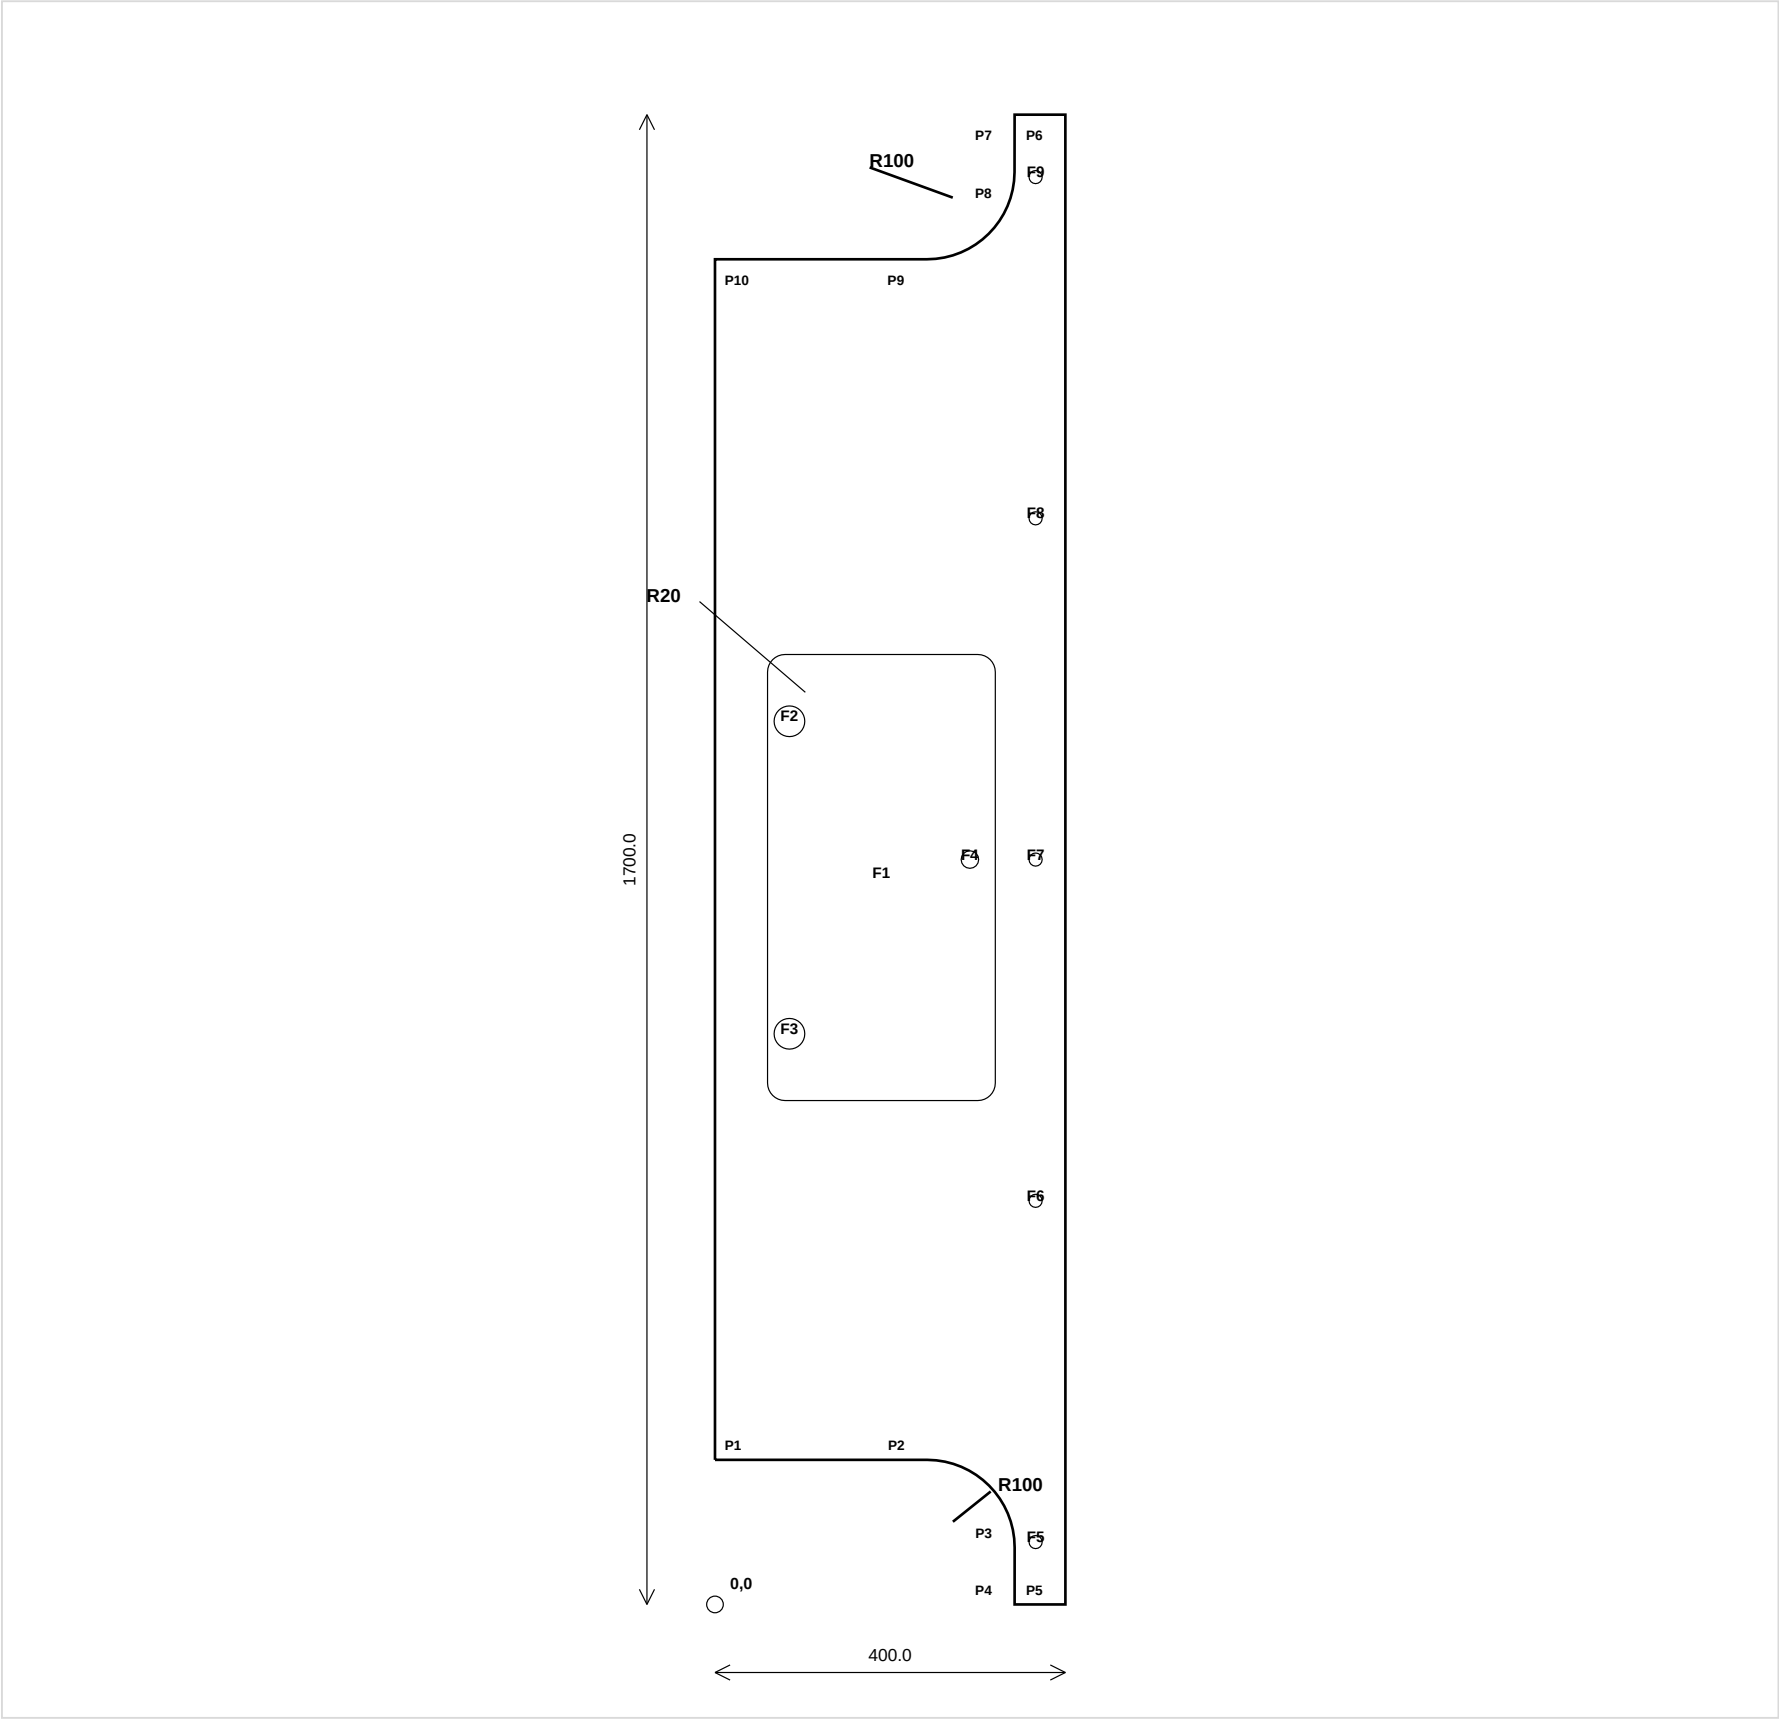

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 509.0, R20	X 190.0 Y 829.5
F2	Dia 35 x 13 deep	X 85.0 Y 1007.8
F3	Dia 35 x 13 deep	X 85.0 Y 651.2
F4	Dia 20 THROUGH	X 291.0 Y 850.0
F5	Dia 15 x 14 deep	X 366.0 Y 71.2
F6	Dia 15 x 14 deep	X 366.0 Y 460.6
F7	Dia 15 x 14 deep	X 366.0 Y 850.0
F8	Dia 15 x 14 deep	X 366.0 Y 1239.4
F9	Dia 15 x 14 deep	X 366.0 Y 1628.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y165.0	LINE
P2	X242.5 Y165.0	ARC R100 CW
P3	X342.1 Y64.9	LINE
P4	X342.0 Y0.0	LINE
P5	X400.0 Y0.0	LINE
P6	X400.0 Y1700.0	LINE
P7	X342.0 Y1700.0	LINE
P8	X342.0 Y1634.4	ARC R100 CW
P9	X242.0 Y1535.0	LINE
P10	X0.0 Y1535.0	LINE

S2-E - Part detail

Overall 382.0 x 477.0 mm | 18 mm plywood | datum lower-left = X0 Y0

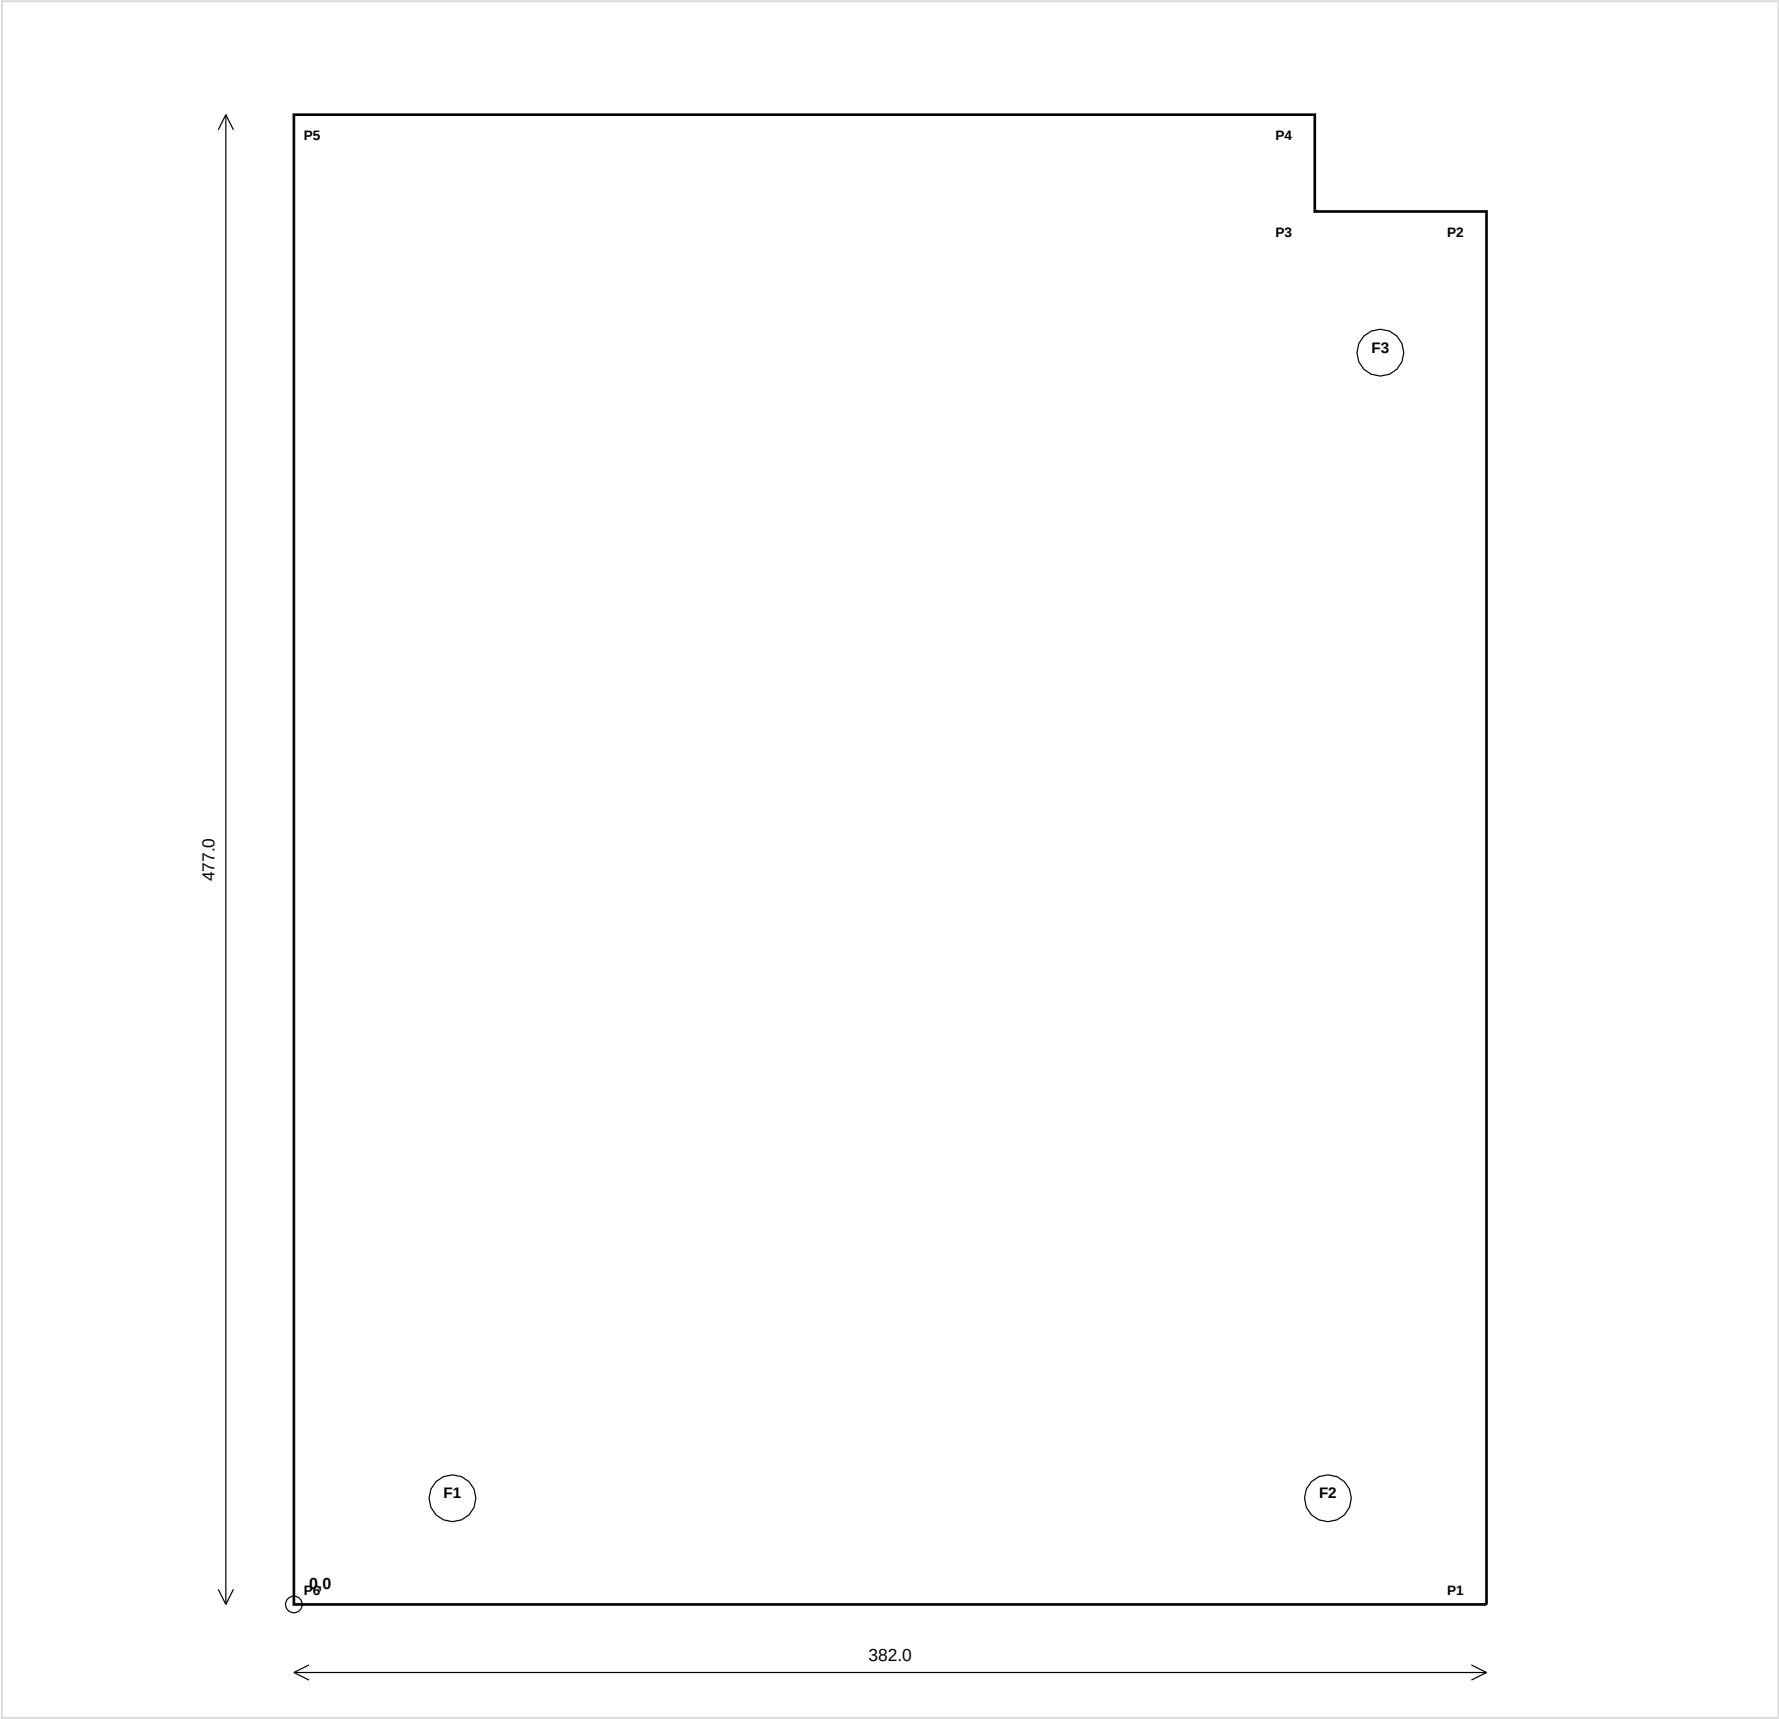

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 50.8 Y 34.0
F2	Dia 15 x 14 deep	X 331.2 Y 34.0
F3	Dia 15 x 14 deep	X 348.0 Y 400.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X382.0 Y446.0	LINE
P3	X327.0 Y446.0	LINE
P4	X327.0 Y477.0	LINE
P5	X0.0 Y477.0	LINE
P6	X0.0 Y0.0	LINE

S2-F - Part detail

Overall 400.0 x 770.0 mm | 18 mm plywood | datum lower-left = X0 Y0

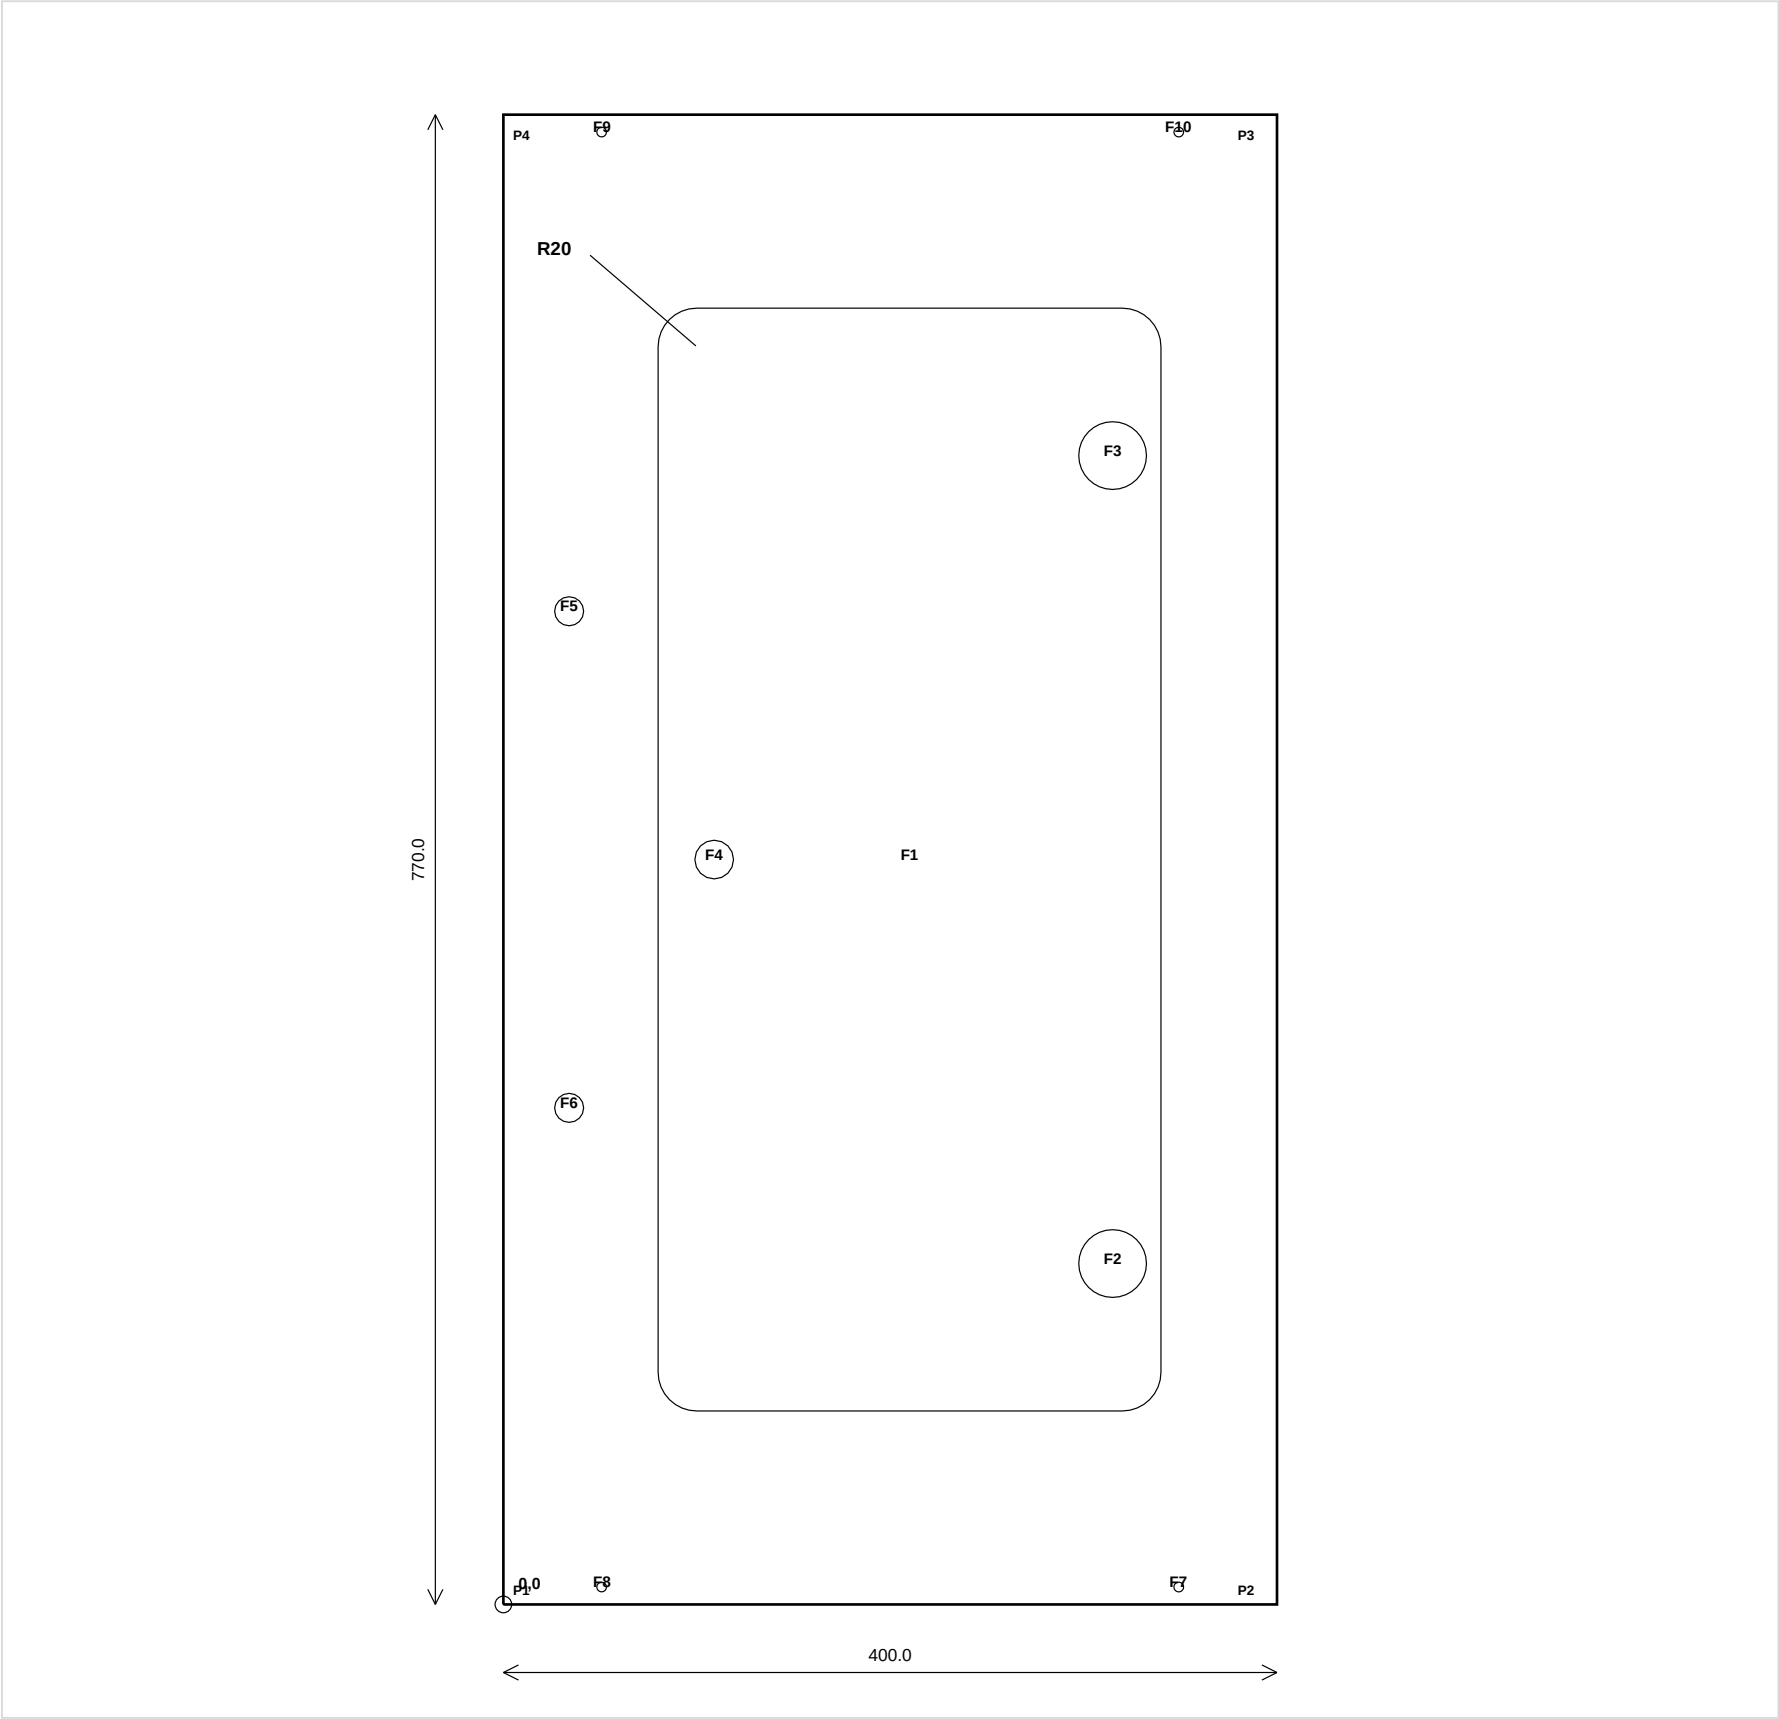

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 260.0 x 570.0, R20	X 210.0 Y 385.0
F2	Dia 35 x 13 deep	X 315.0 Y 176.2
F3	Dia 35 x 13 deep	X 315.0 Y 593.8
F4	Dia 20 THROUGH	X 109.0 Y 385.0
F5	Dia 15 x 14 deep	X 34.0 Y 513.3
F6	Dia 15 x 14 deep	X 34.0 Y 256.7
F7	Dia 5 x 11 deep	X 349.0 Y 9.0
F8	Dia 5 x 11 deep	X 51.0 Y 9.0
F9	Dia 5 x 11 deep	X 51.0 Y 761.0
F10	Dia 5 x 11 deep	X 349.0 Y 761.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X400.0 Y0.0	LINE
P3	X400.0 Y770.0	LINE
P4	X0.0 Y770.0	LINE

S2-G - Part detail

Overall 382.0 x 573.0 mm | 18 mm plywood | datum lower-left = X0 Y0

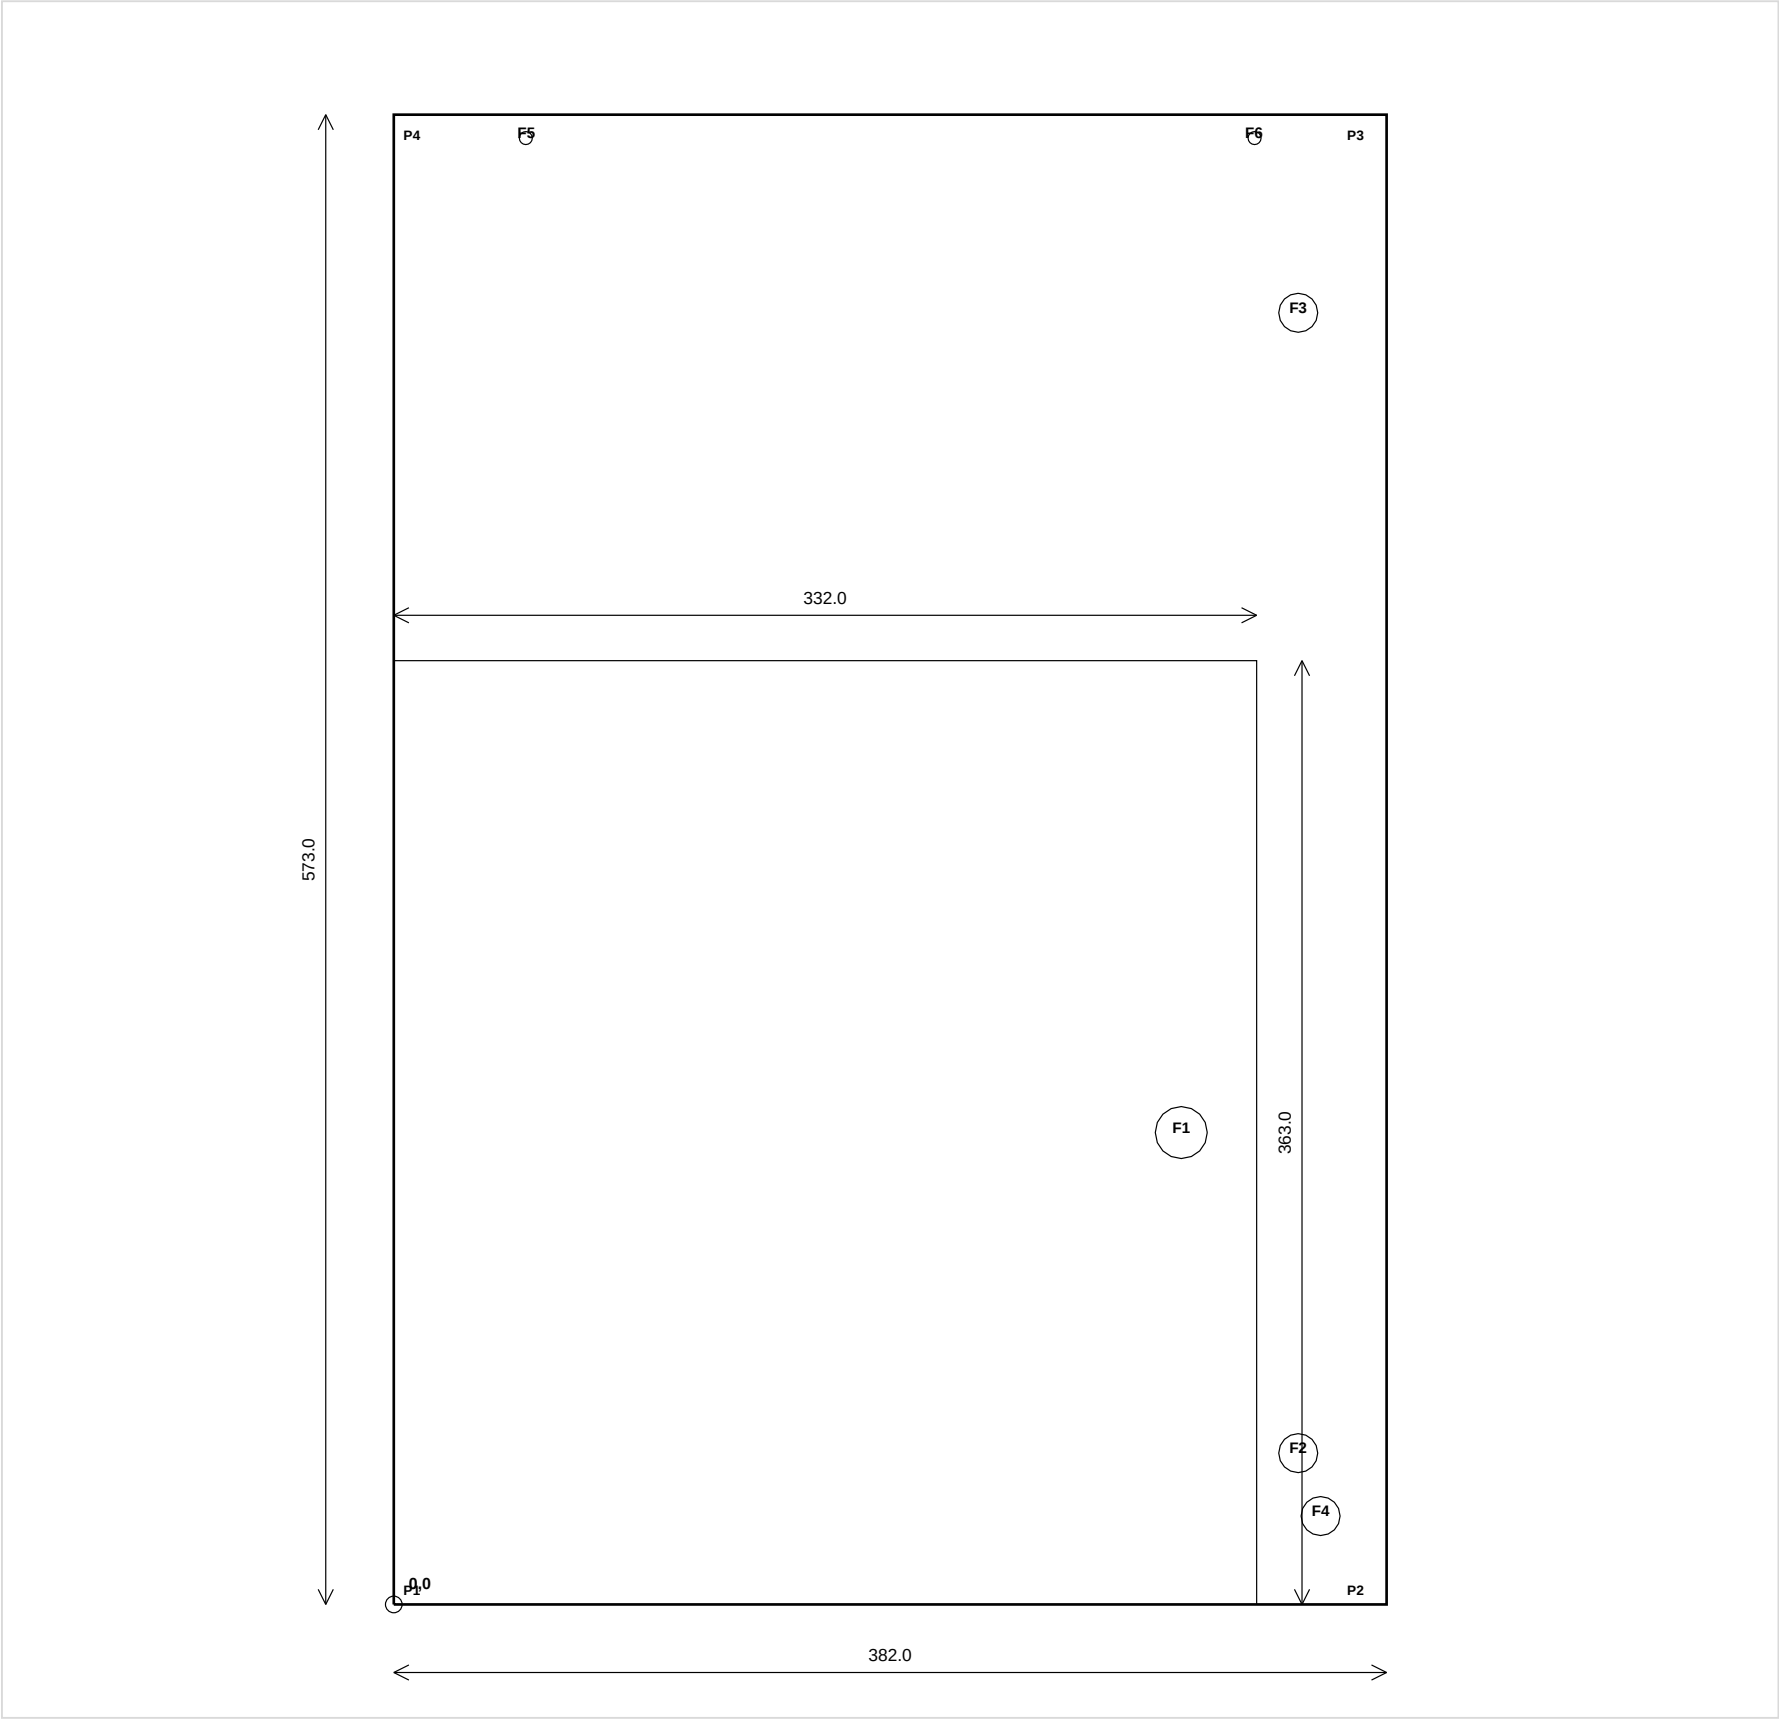

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 20 THROUGH	X 303.0 Y 181.5
F2	Dia 15 x 14 deep	X 348.0 Y 58.2
F3	Dia 15 x 14 deep	X 348.0 Y 496.8
F4	Dia 15 x 14 deep	X 356.6 Y 34.0
F5	Dia 5 x 11 deep	X 51.0 Y 564.0
F6	Dia 5 x 11 deep	X 331.0 Y 564.0
F7	drawer/door cut: horizontal 332.0 mm, then vertical 363.0 mm	


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y0.0	LINE
P2	X382.0 Y0.0	LINE
P3	X382.0 Y573.0	LINE
P4	X0.0 Y573.0	LINE

S3-A - Part detail

Overall 600.0 x 500.0 mm | 18 mm plywood | datum lower-left = X0 Y0

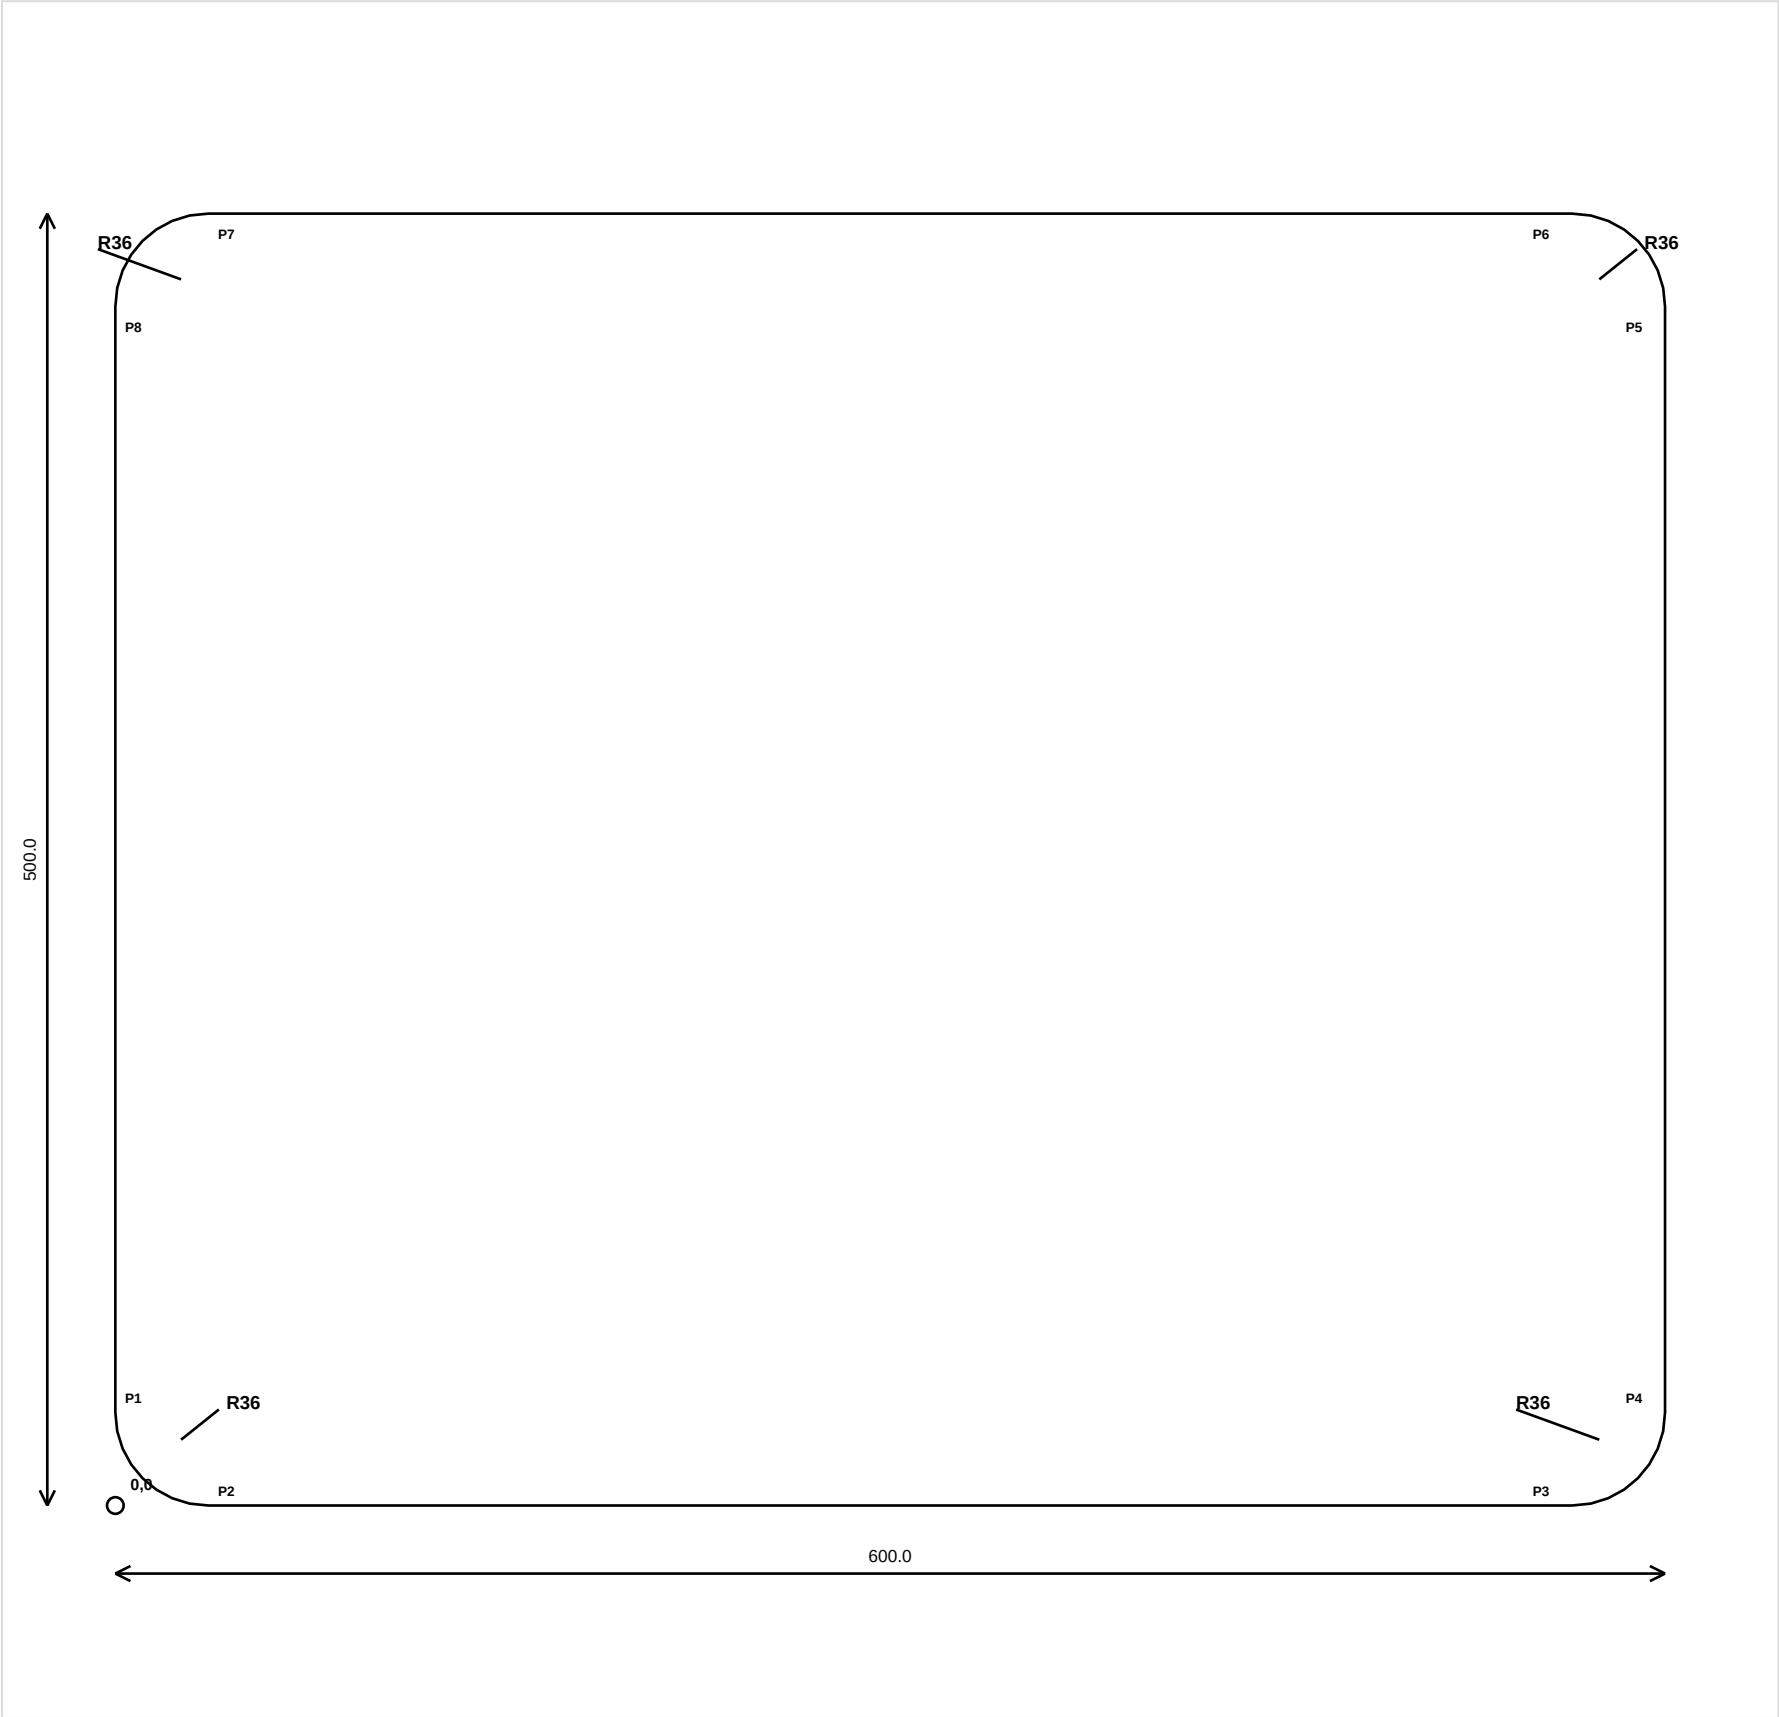

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y36.0	ARC R36 CCW
P2	X36.0 Y0.0	LINE
P3	X564.0 Y0.0	ARC R36 CCW
P4	X600.0 Y36.0	LINE
P5	X600.0 Y464.0	ARC R36 CCW
P6	X564.0 Y500.0	LINE
P7	X36.0 Y500.0	ARC R36 CCW
P8	X0.0 Y464.0	LINE

S3-B - Part detail

Overall 482.0 x 337.6 mm | 18 mm plywood | datum lower-left = X0 Y0

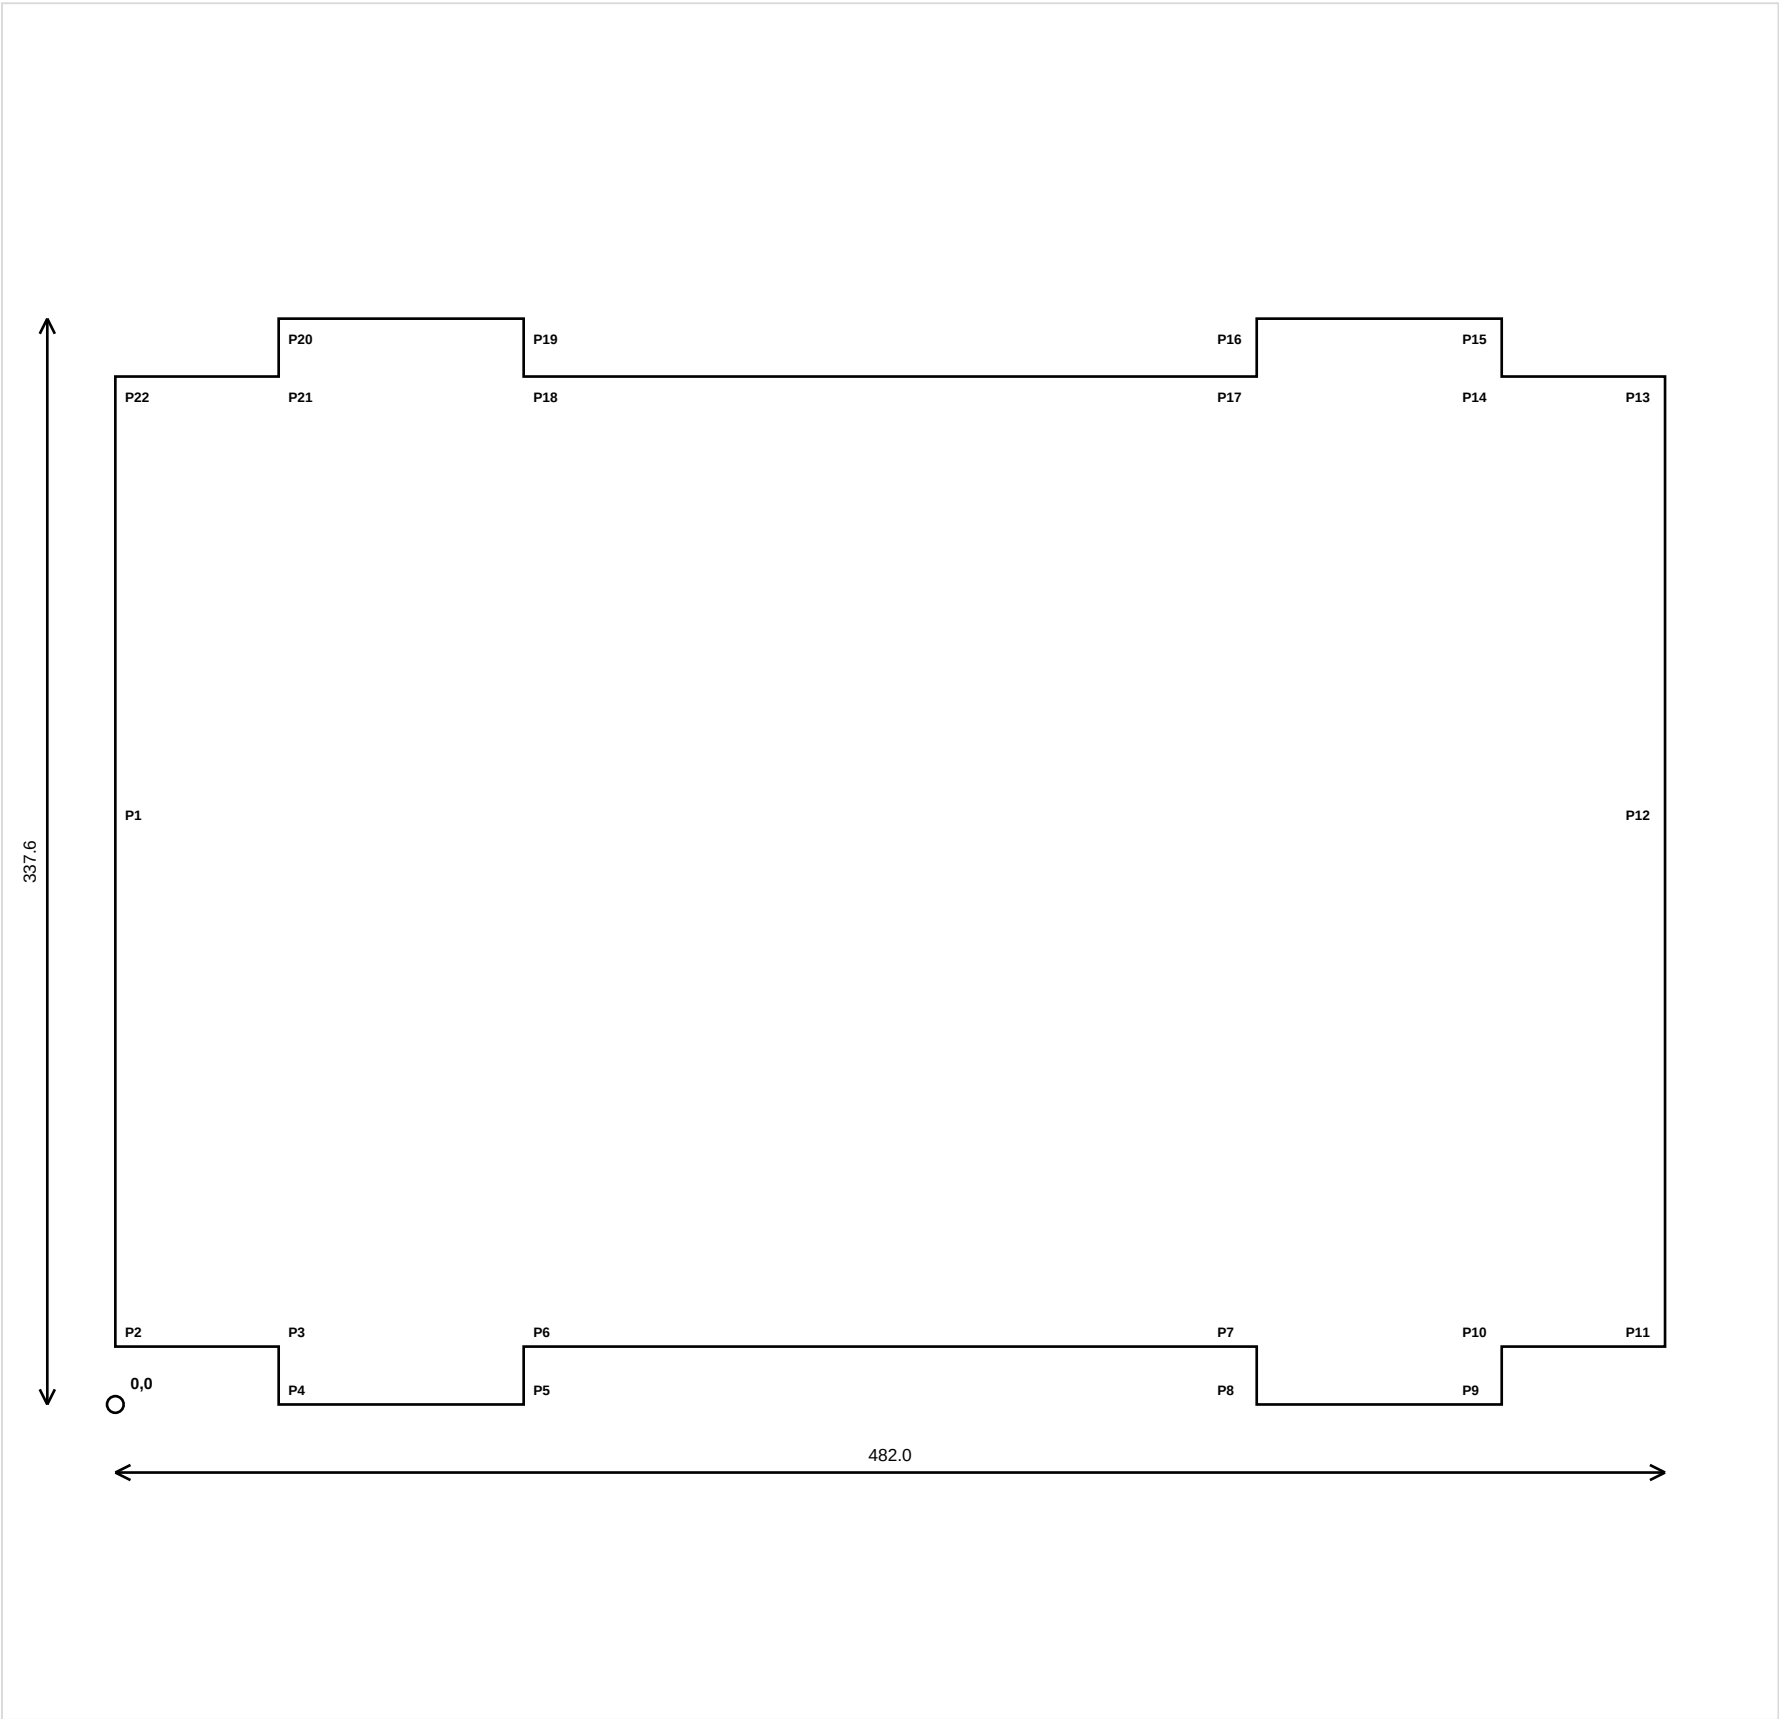

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y189.8	LINE	P17	X355.0 Y319.6	LINE
P2	X0.0 Y18.0	LINE	P18	X127.0 Y319.6	LINE
P3	X50.8 Y18.0	LINE	P19	X127.0 Y337.6	LINE
P4	X50.8 Y0.0	LINE	P20	X50.8 Y337.6	LINE
P5	X127.0 Y0.0	LINE	P21	X50.8 Y319.6	LINE
P6	X127.0 Y18.0	LINE	P22	X0.0 Y319.6	LINE
P7	X355.0 Y18.0	LINE			
P8	X355.0 Y0.0	LINE			
P9	X431.2 Y0.0	LINE			
P10	X431.2 Y18.0	LINE			
P11	X482.0 Y18.0	LINE			
P12	X482.0 Y189.8	LINE			
P13	X482.0 Y319.6	LINE			
P14	X431.2 Y319.6	LINE			
P15	X431.2 Y337.6	LINE			
P16	X355.0 Y337.6	LINE			

S3-C - Part detail

Overall 301.6 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

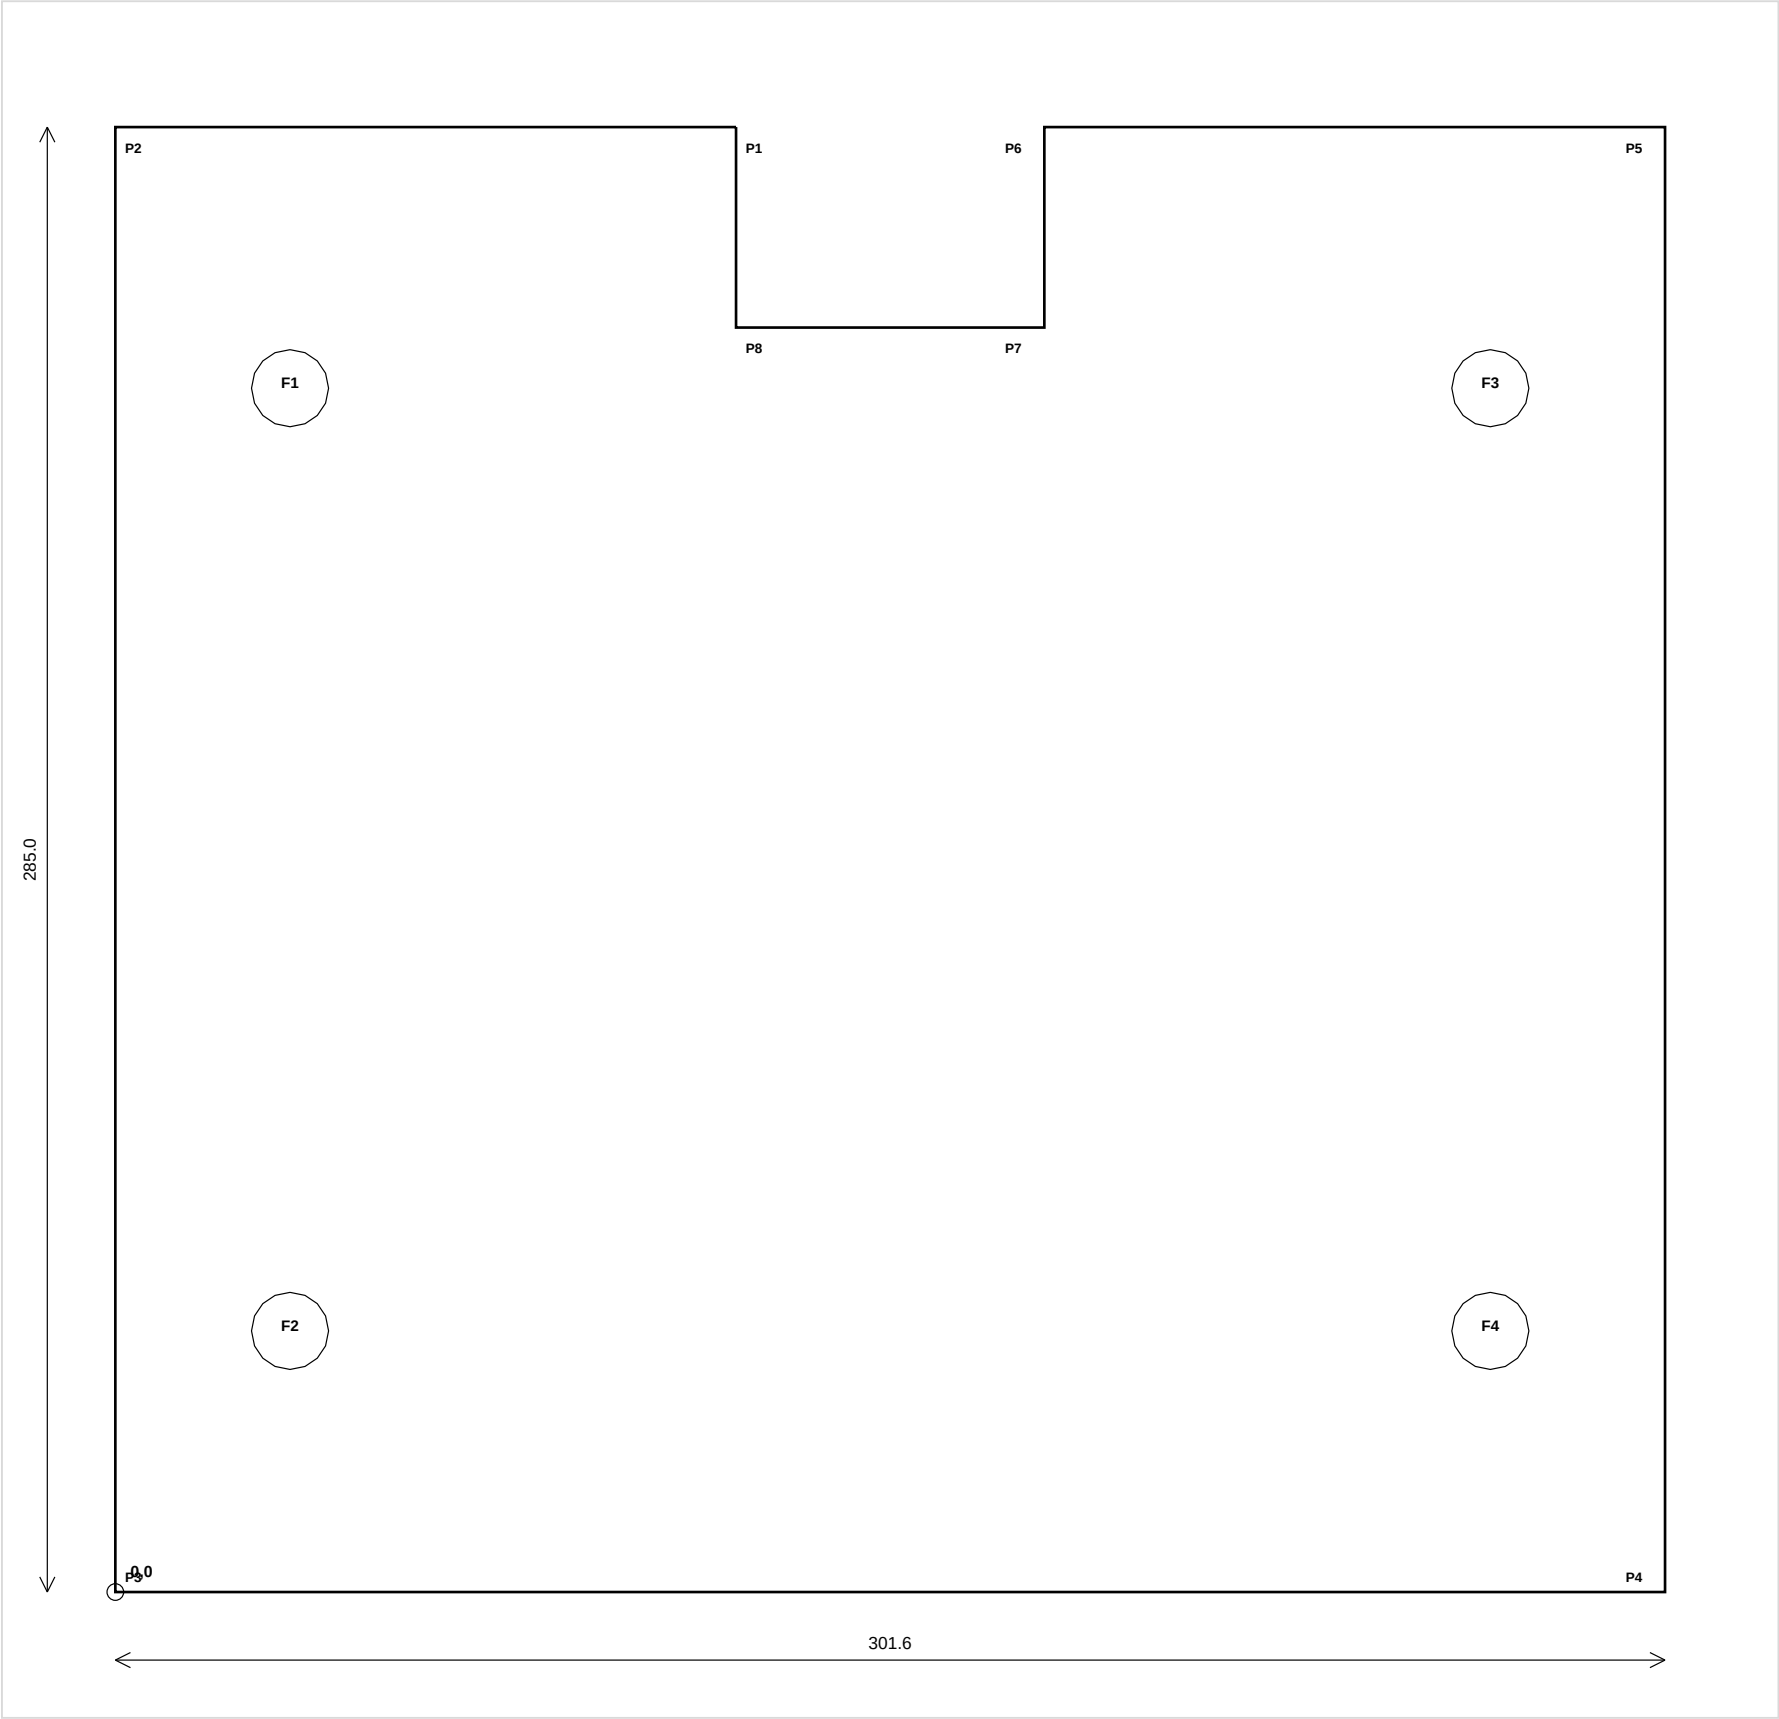

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 234.2
F2	Dia 15 x 14 deep	X 34.0 Y 50.8
F3	Dia 15 x 14 deep	X 267.6 Y 234.2
F4	Dia 15 x 14 deep	X 267.6 Y 50.8


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X120.8 Y285.0	LINE
P2	X0.0 Y285.0	LINE
P3	X0.0 Y0.0	LINE
P4	X301.6 Y0.0	LINE
P5	X301.6 Y285.0	LINE
P6	X180.8 Y285.0	LINE
P7	X180.8 Y246.0	LINE
P8	X120.8 Y246.0	LINE

S3-D - Part detail

Overall 337.6 x 258.0 mm | 18 mm plywood | datum lower-left = X0 Y0

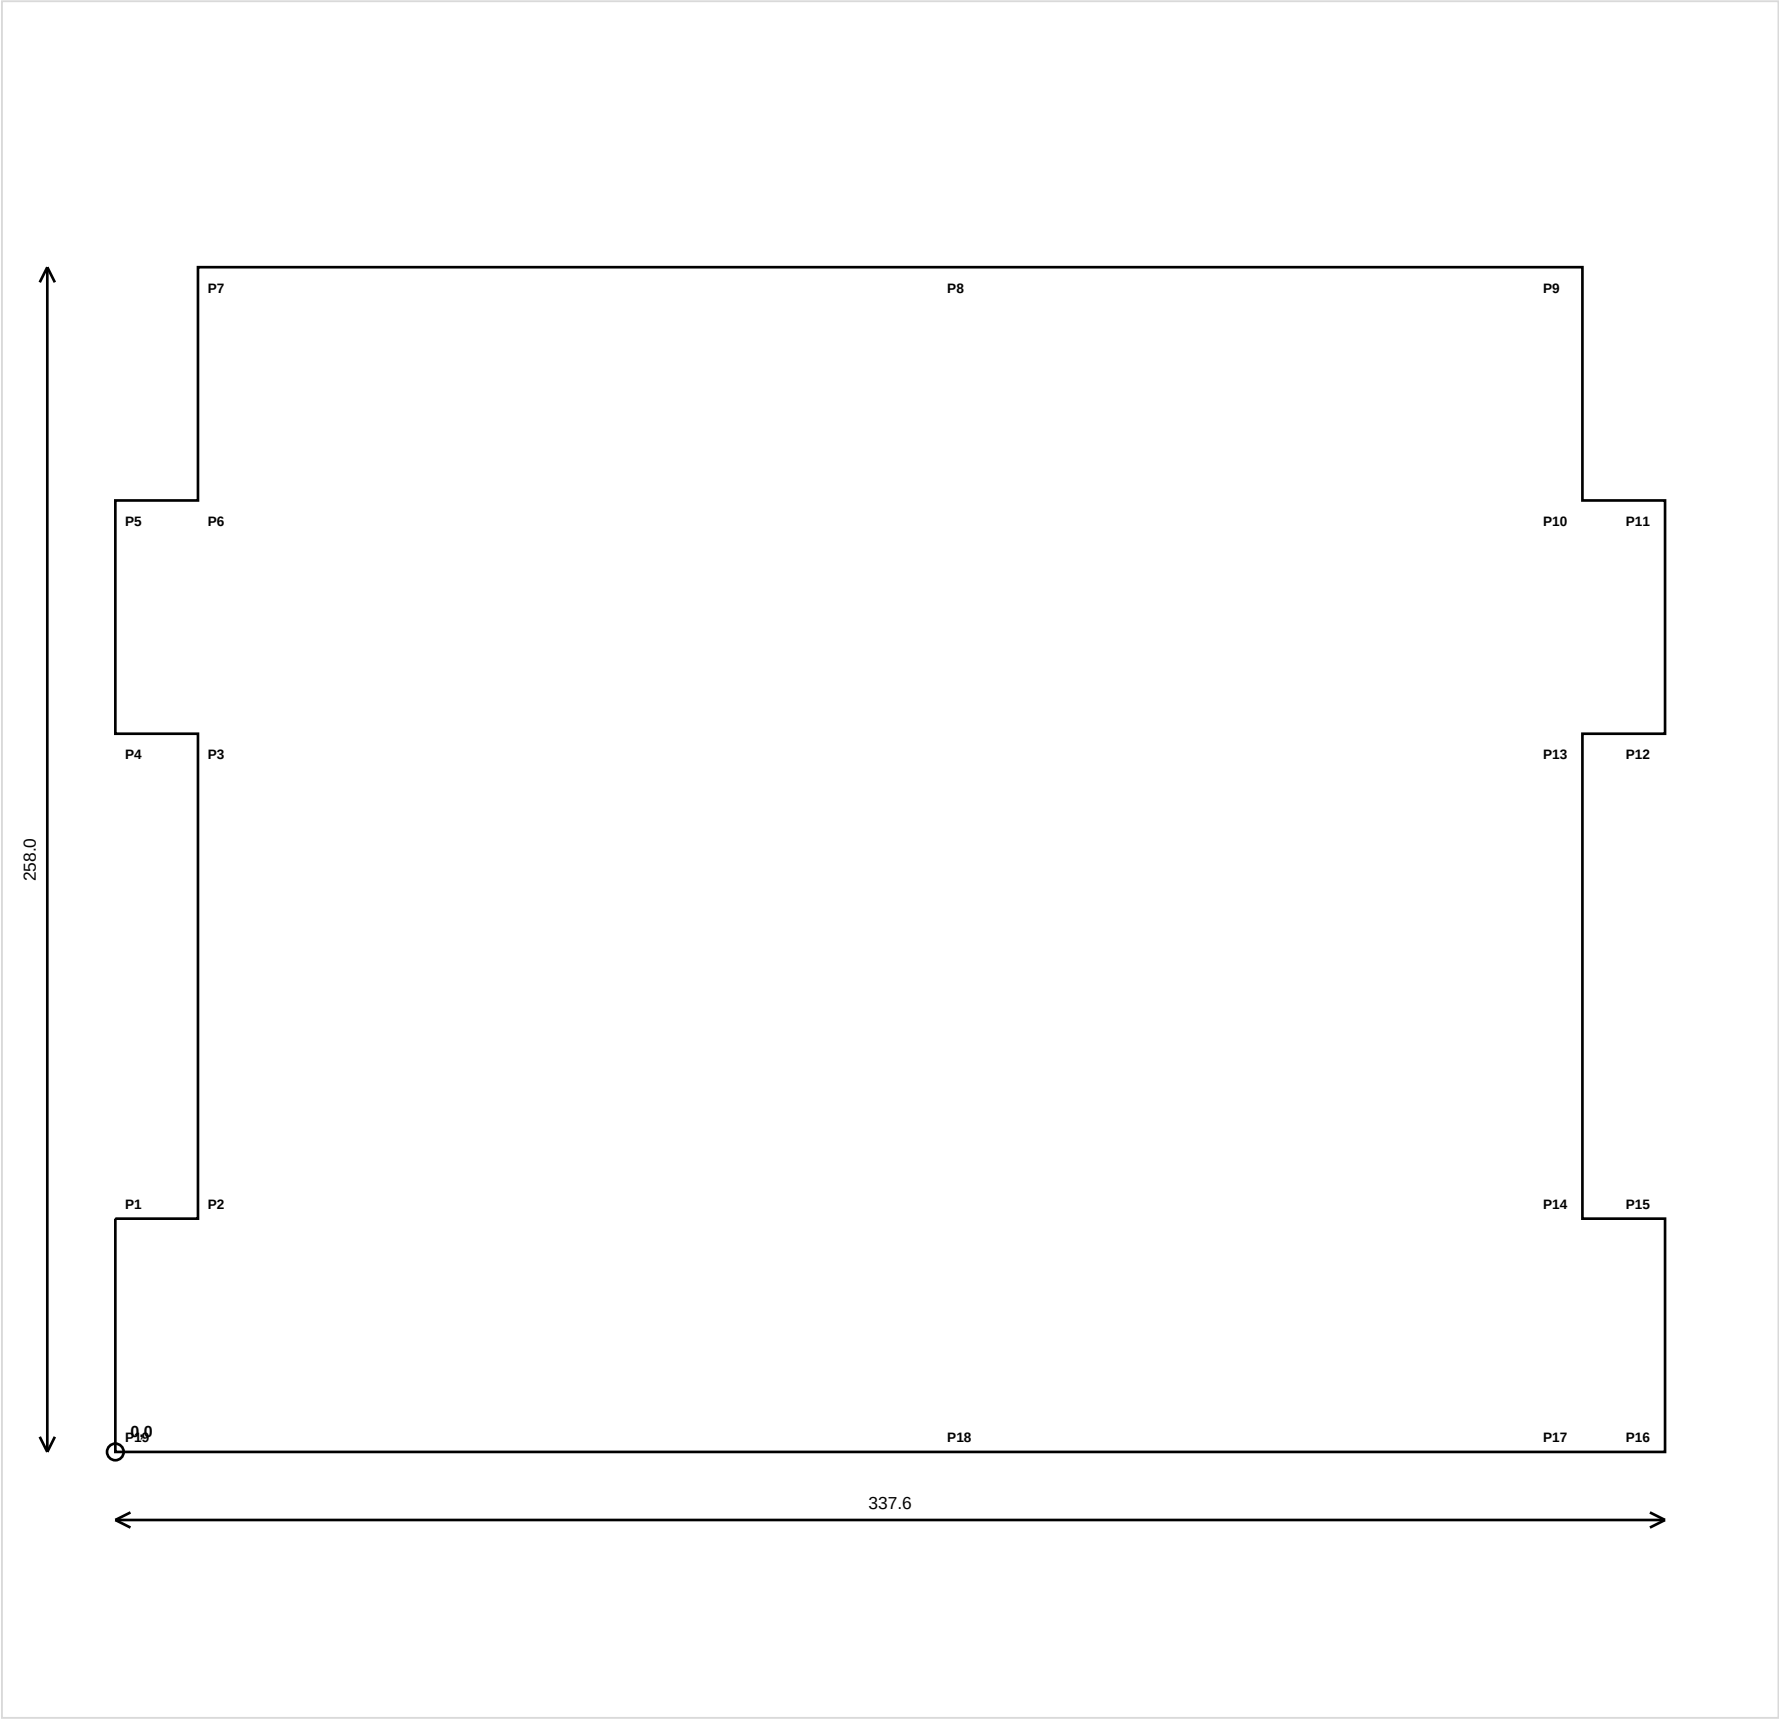

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y50.8	LINE	P17	X319.6 Y0.0	LINE
P2	X18.0 Y50.8	LINE	P18	X189.8 Y0.0	LINE
P3	X18.0 Y156.4	LINE	P19	X0.0 Y0.0	LINE
P4	X0.0 Y156.4	LINE			
P5	X0.0 Y207.2	LINE			
P6	X18.0 Y207.2	LINE			
P7	X18.0 Y258.0	LINE			
P8	X189.8 Y258.0	LINE			
P9	X319.6 Y258.0	LINE			
P10	X319.6 Y207.2	LINE			
P11	X337.6 Y207.2	LINE			
P12	X337.6 Y156.4	LINE			
P13	X319.6 Y156.4	LINE			
P14	X319.6 Y50.8	LINE			
P15	X337.6 Y50.8	LINE			
P16	X337.6 Y0.0	LINE			

S3-E - Part detail

Overall 500.0 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

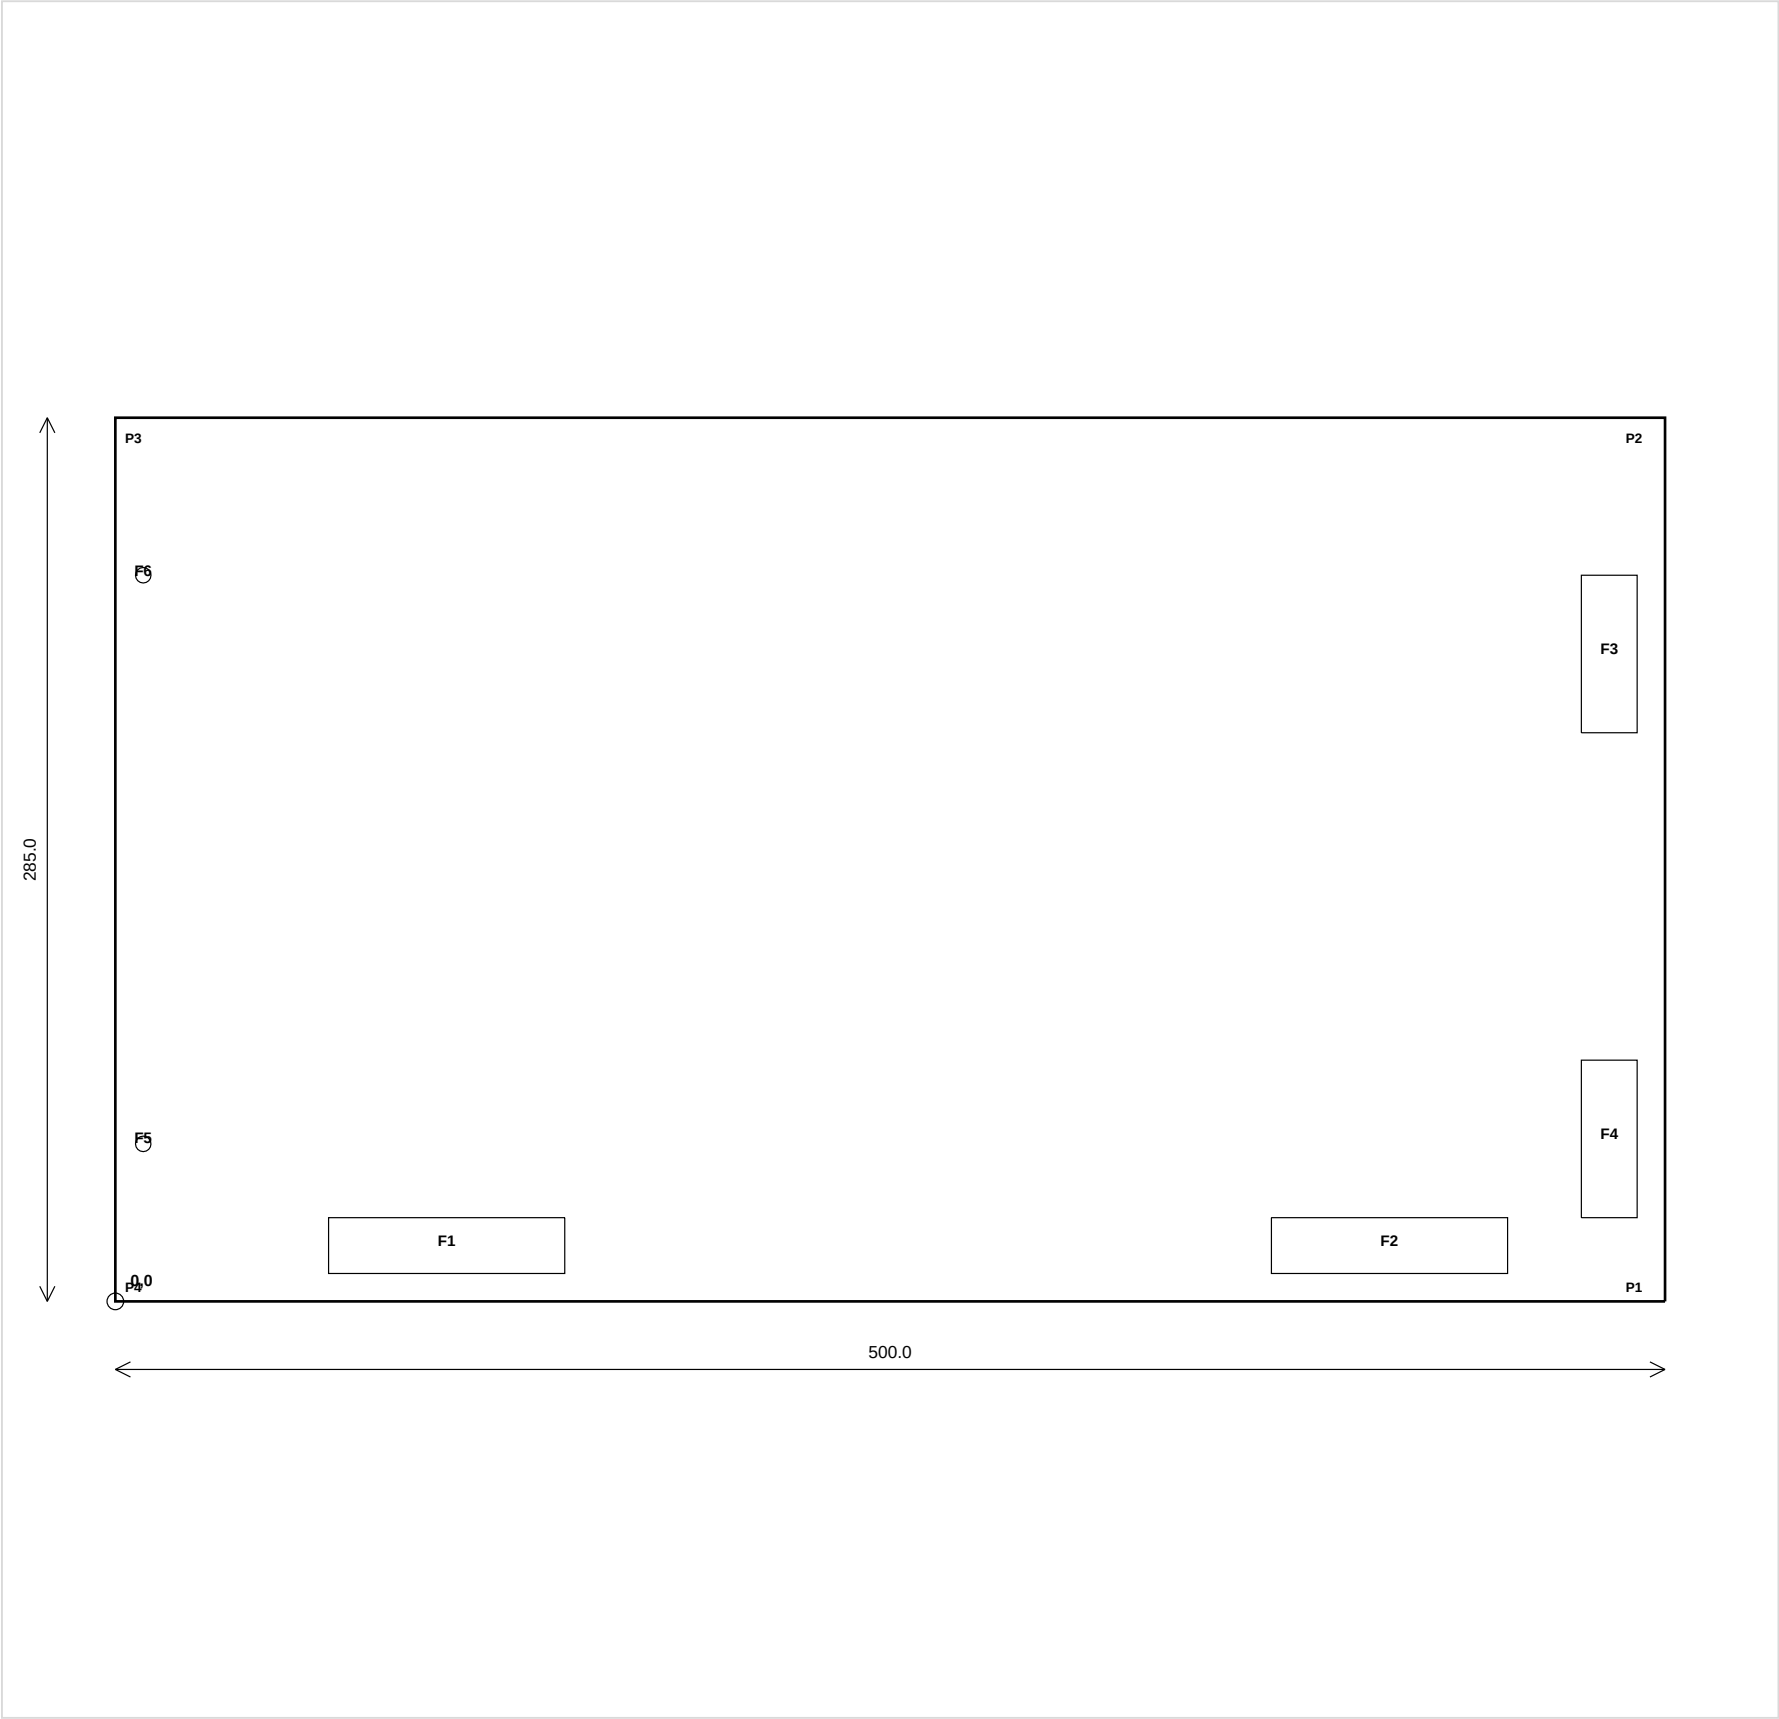

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	rectangular cut-out 76.2 x 18.0	X 106.9 Y 18.0
F2	rectangular cut-out 76.2 x 18.0	X 411.1 Y 18.0
F3	rectangular cut-out 18.0 x 50.8	X 482.0 Y 208.8
F4	rectangular cut-out 18.0 x 50.8	X 482.0 Y 52.4
F5	Dia 5 x 11 deep	X 9.0 Y 51.0
F6	Dia 5 x 11 deep	X 9.0 Y 234.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X500.0 Y0.0	LINE
P2	X500.0 Y285.0	LINE
P3	X0.0 Y285.0	LINE
P4	X0.0 Y0.0	LINE

S3-F - Part detail

Overall 500.0 x 285.0 mm | 18 mm plywood | datum lower-left = X0 Y0

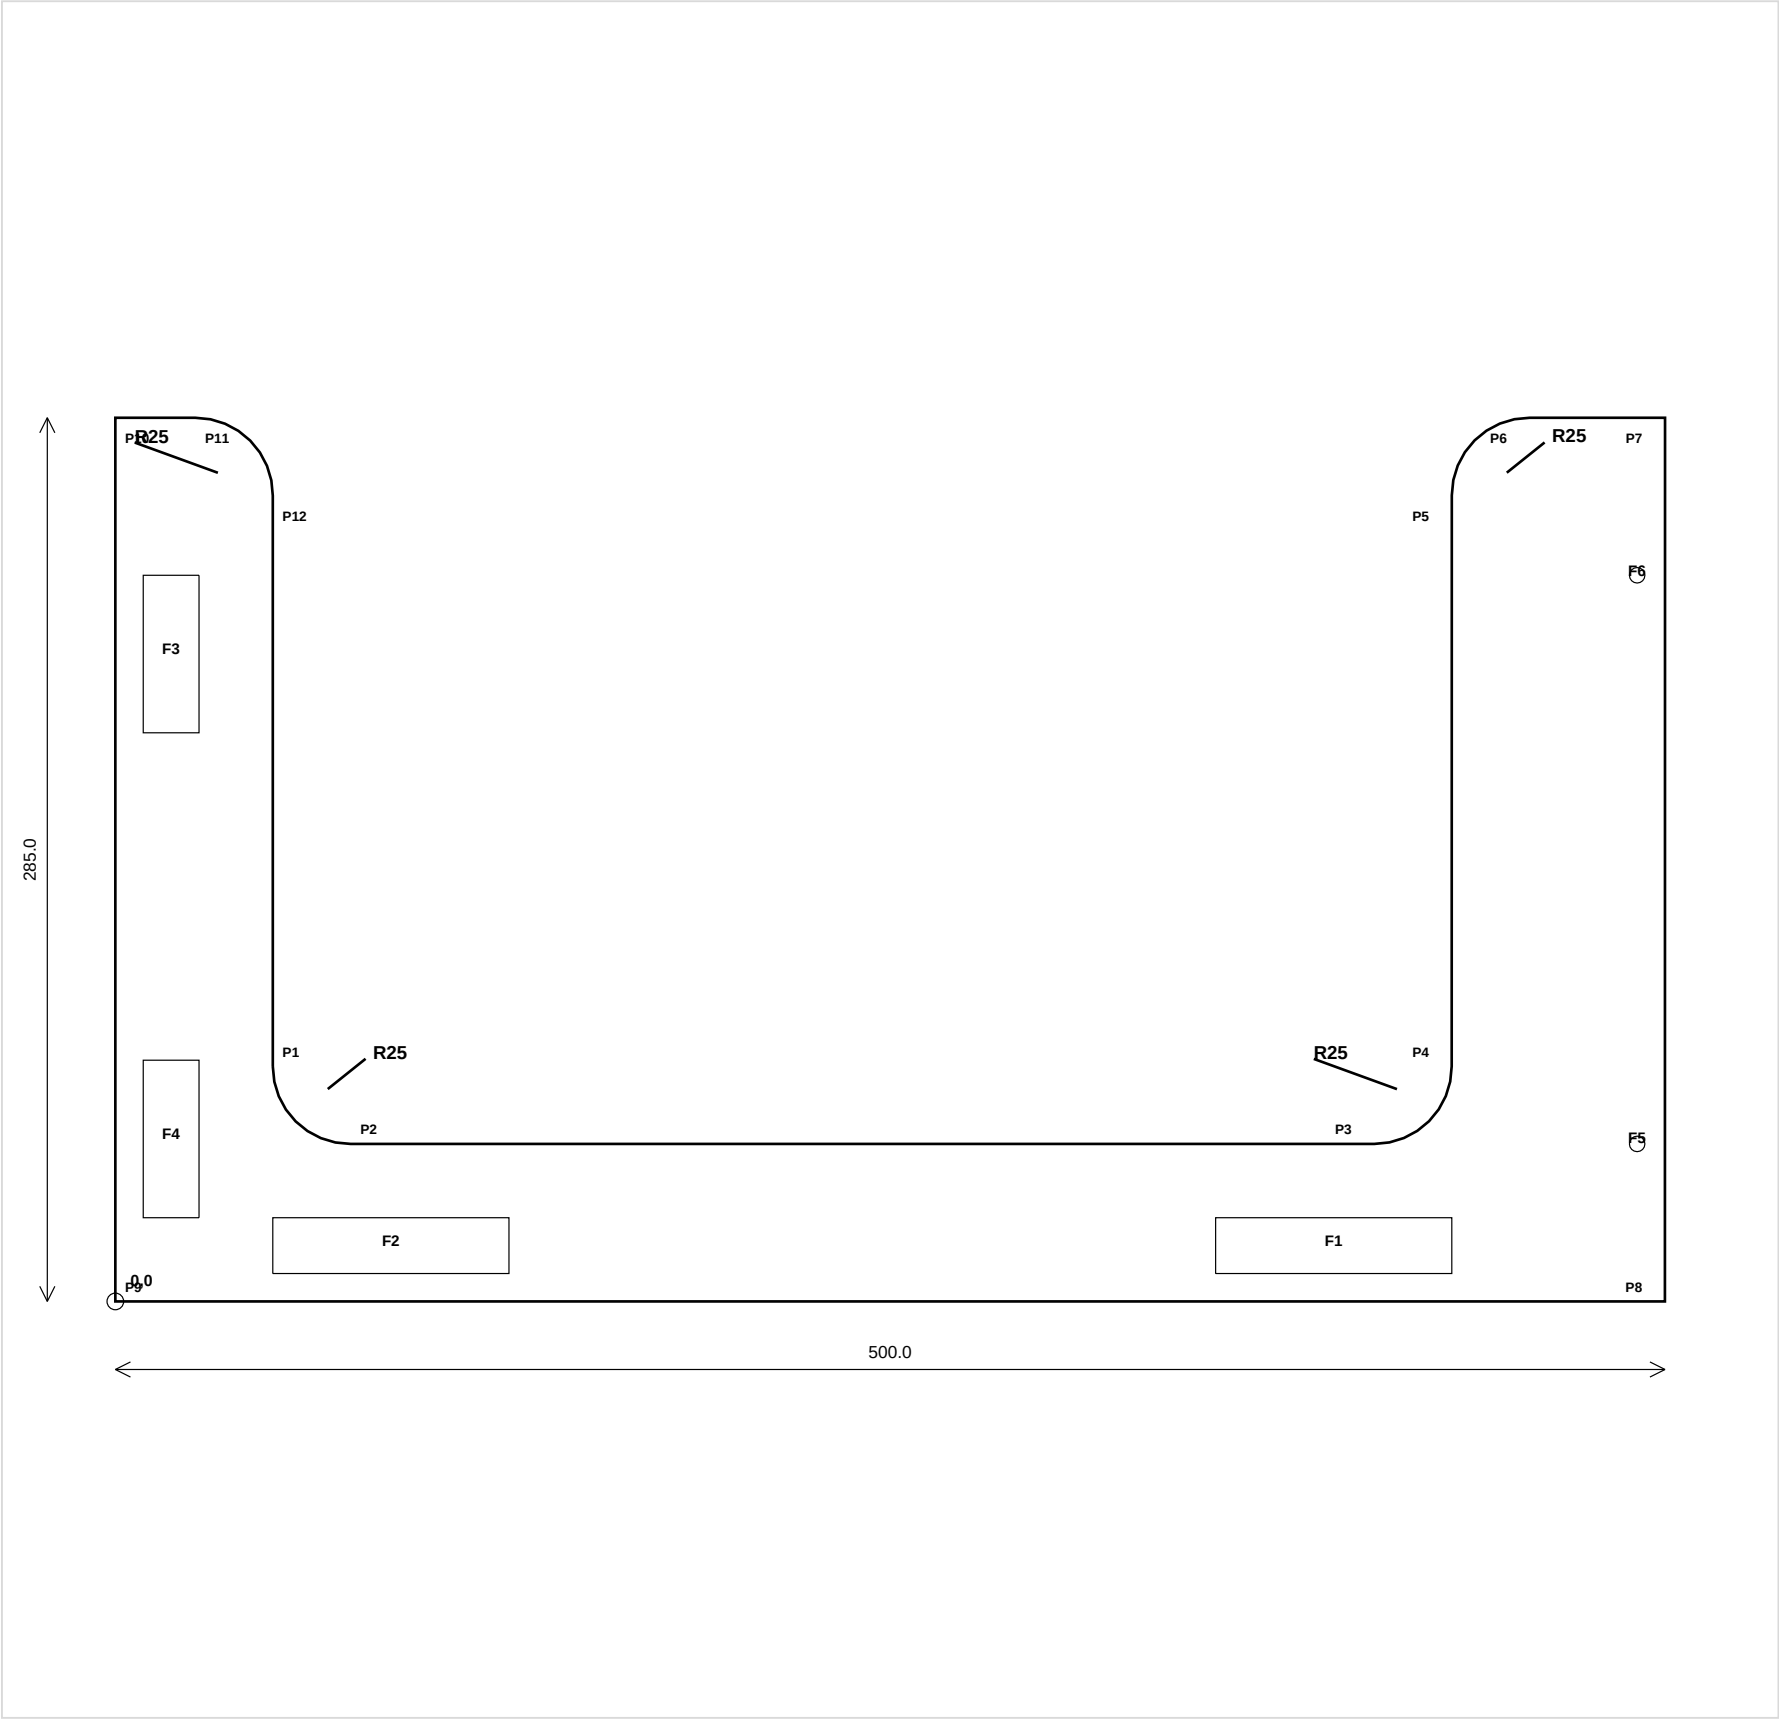

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	rectangular cut-out 76.2 x 18.0	X 393.1 Y 18.0
F2	rectangular cut-out 76.2 x 18.0	X 88.9 Y 18.0
F3	rectangular cut-out 18.0 x 50.8	X 18.0 Y 208.8
F4	rectangular cut-out 18.0 x 50.8	X 18.0 Y 52.4
F5	Dia 5 x 11 deep	X 491.0 Y 51.0
F6	Dia 5 x 11 deep	X 491.0 Y 234.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X50.8 Y75.8	ARC R25 CCW
P2	X75.9 Y50.8	LINE
P3	X406.2 Y50.8	ARC R25 CCW
P4	X431.2 Y75.8	LINE
P5	X431.2 Y260.0	ARC R25 CW
P6	X456.3 Y285.0	LINE
P7	X500.0 Y285.0	LINE
P8	X500.0 Y0.0	LINE
P9	X0.0 Y0.0	LINE
P10	X0.0 Y285.0	LINE
P11	X25.8 Y285.0	ARC R25 CW
P12	X50.8 Y259.9	LINE

S3-G - Part detail

Overall 1220.1 x 561.0 mm | 18 mm plywood | datum lower-left = X0 Y0

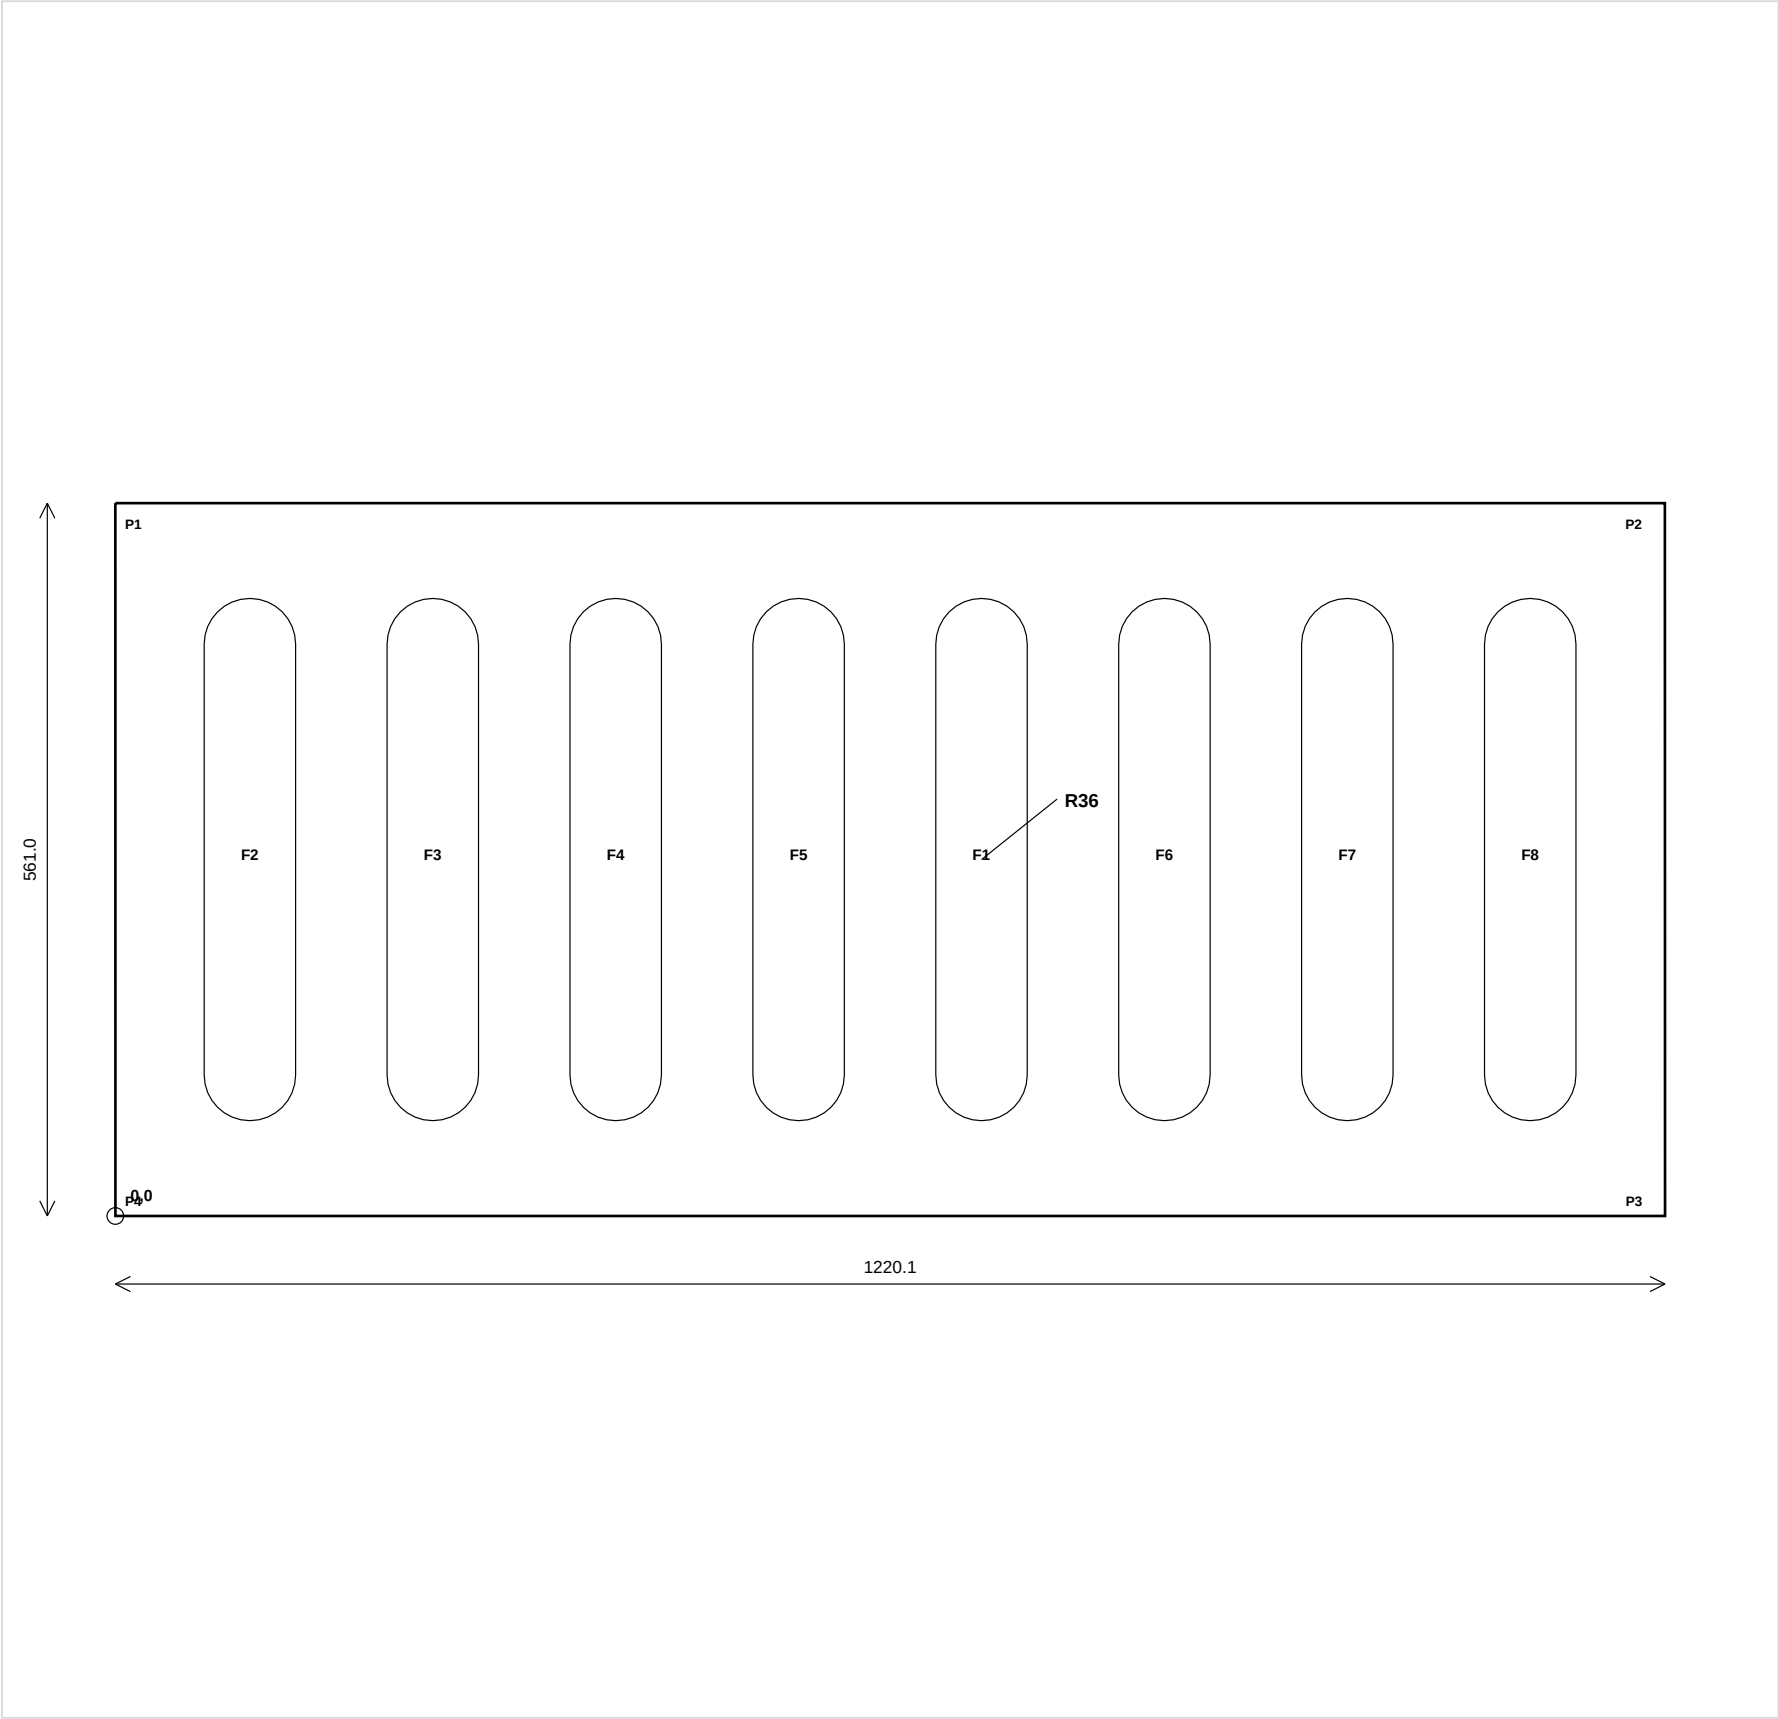

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	slot 72.0 x 411.0, R36	X 681.9 Y 280.5
F2	slot 72.0 x 411.0, R36	X 105.9 Y 280.5
F3	slot 72.0 x 411.0, R36	X 249.9 Y 280.5
F4	slot 72.0 x 411.0, R36	X 393.9 Y 280.5
F5	slot 72.0 x 411.0, R36	X 537.9 Y 280.5
F6	slot 72.0 x 411.0, R36	X 825.9 Y 280.5
F7	slot 72.0 x 411.0, R36	X 969.9 Y 280.5
F8	slot 72.0 x 411.0, R36	X 1113.9 Y 280.5


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X0.0 Y561.0	LINE
P2	X1219.9 Y561.0	LINE
P3	X1220.1 Y0.0	LINE
P4	X0.1 Y0.0	LINE

S3-H - Part detail

Overall 1220.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

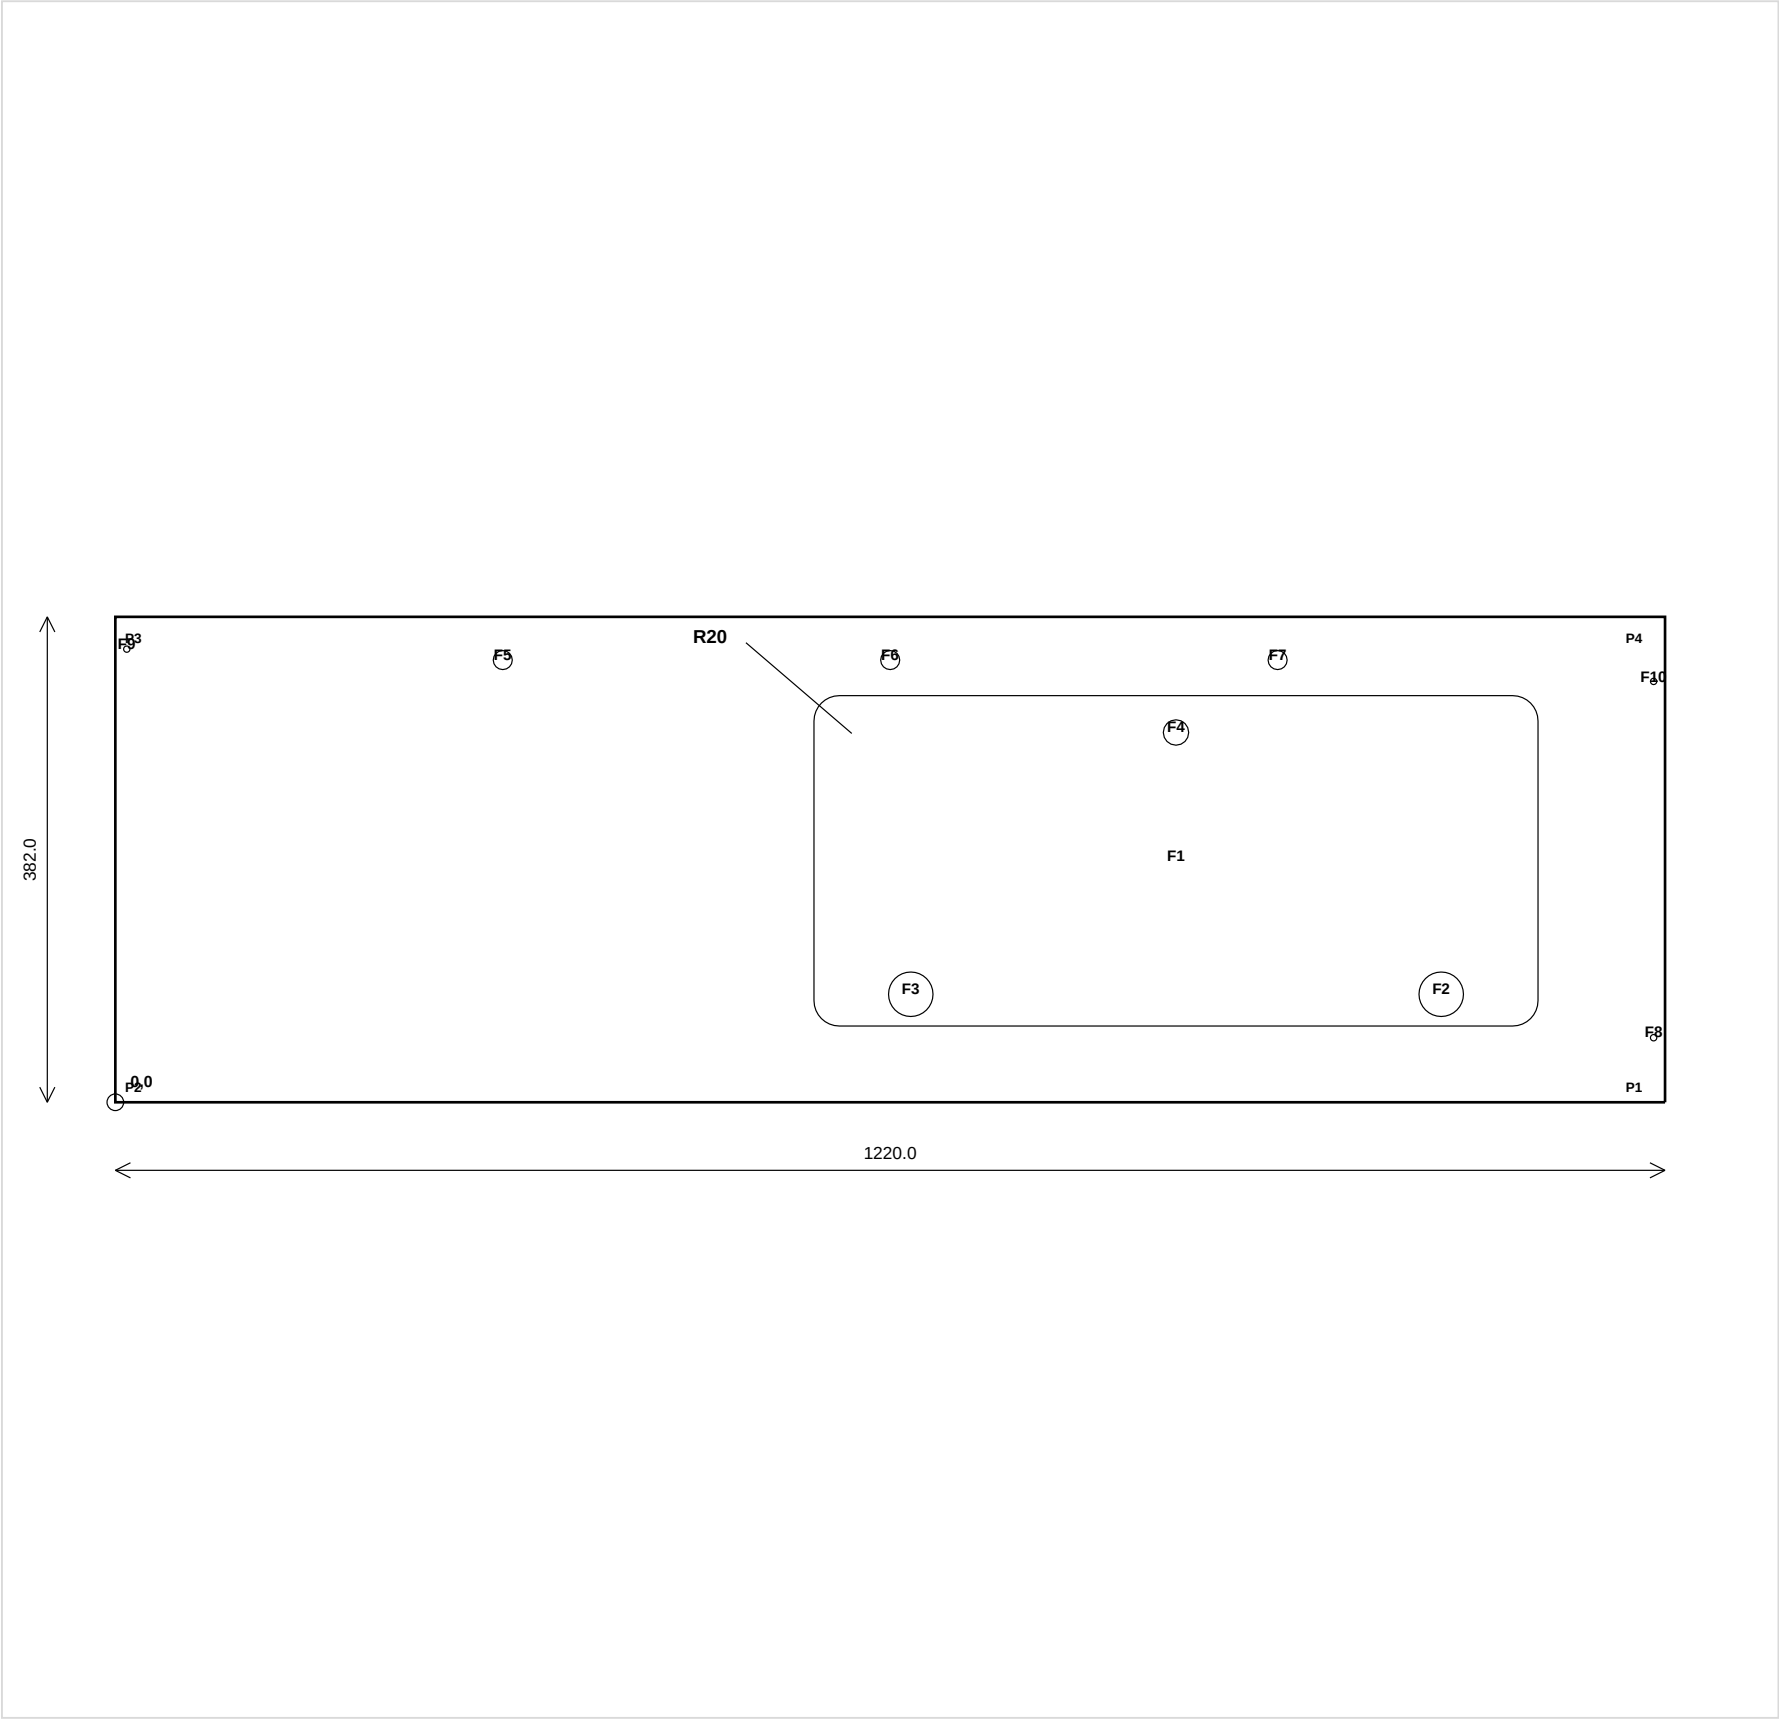

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 570.0 x 260.0, R20	X 835.0 Y 190.0
F2	Dia 35 x 13 deep	X 1043.8 Y 85.0
F3	Dia 35 x 13 deep	X 626.2 Y 85.0
F4	Dia 20 THROUGH	X 835.0 Y 291.0
F5	Dia 15 x 14 deep	X 305.0 Y 348.0
F6	Dia 15 x 14 deep	X 610.0 Y 348.0
F7	Dia 15 x 14 deep	X 915.0 Y 348.0
F8	Dia 5 x 11 deep	X 1211.0 Y 51.0
F9	Dia 5 x 11 deep	X 9.0 Y 356.6
F10	Dia 5 x 11 deep	X 1211.0 Y 331.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X1220.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y382.0	LINE
P4	X1220.0 Y382.0	LINE

S4-A - Part detail

Overall 462.5 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X462.5 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y382.0	LINE
P4	X462.5 Y382.0	LINE

S4-B - Part detail

Overall 463.0 x 382.0 mm | 18 mm plywood | datum lower-left = X0 Y0

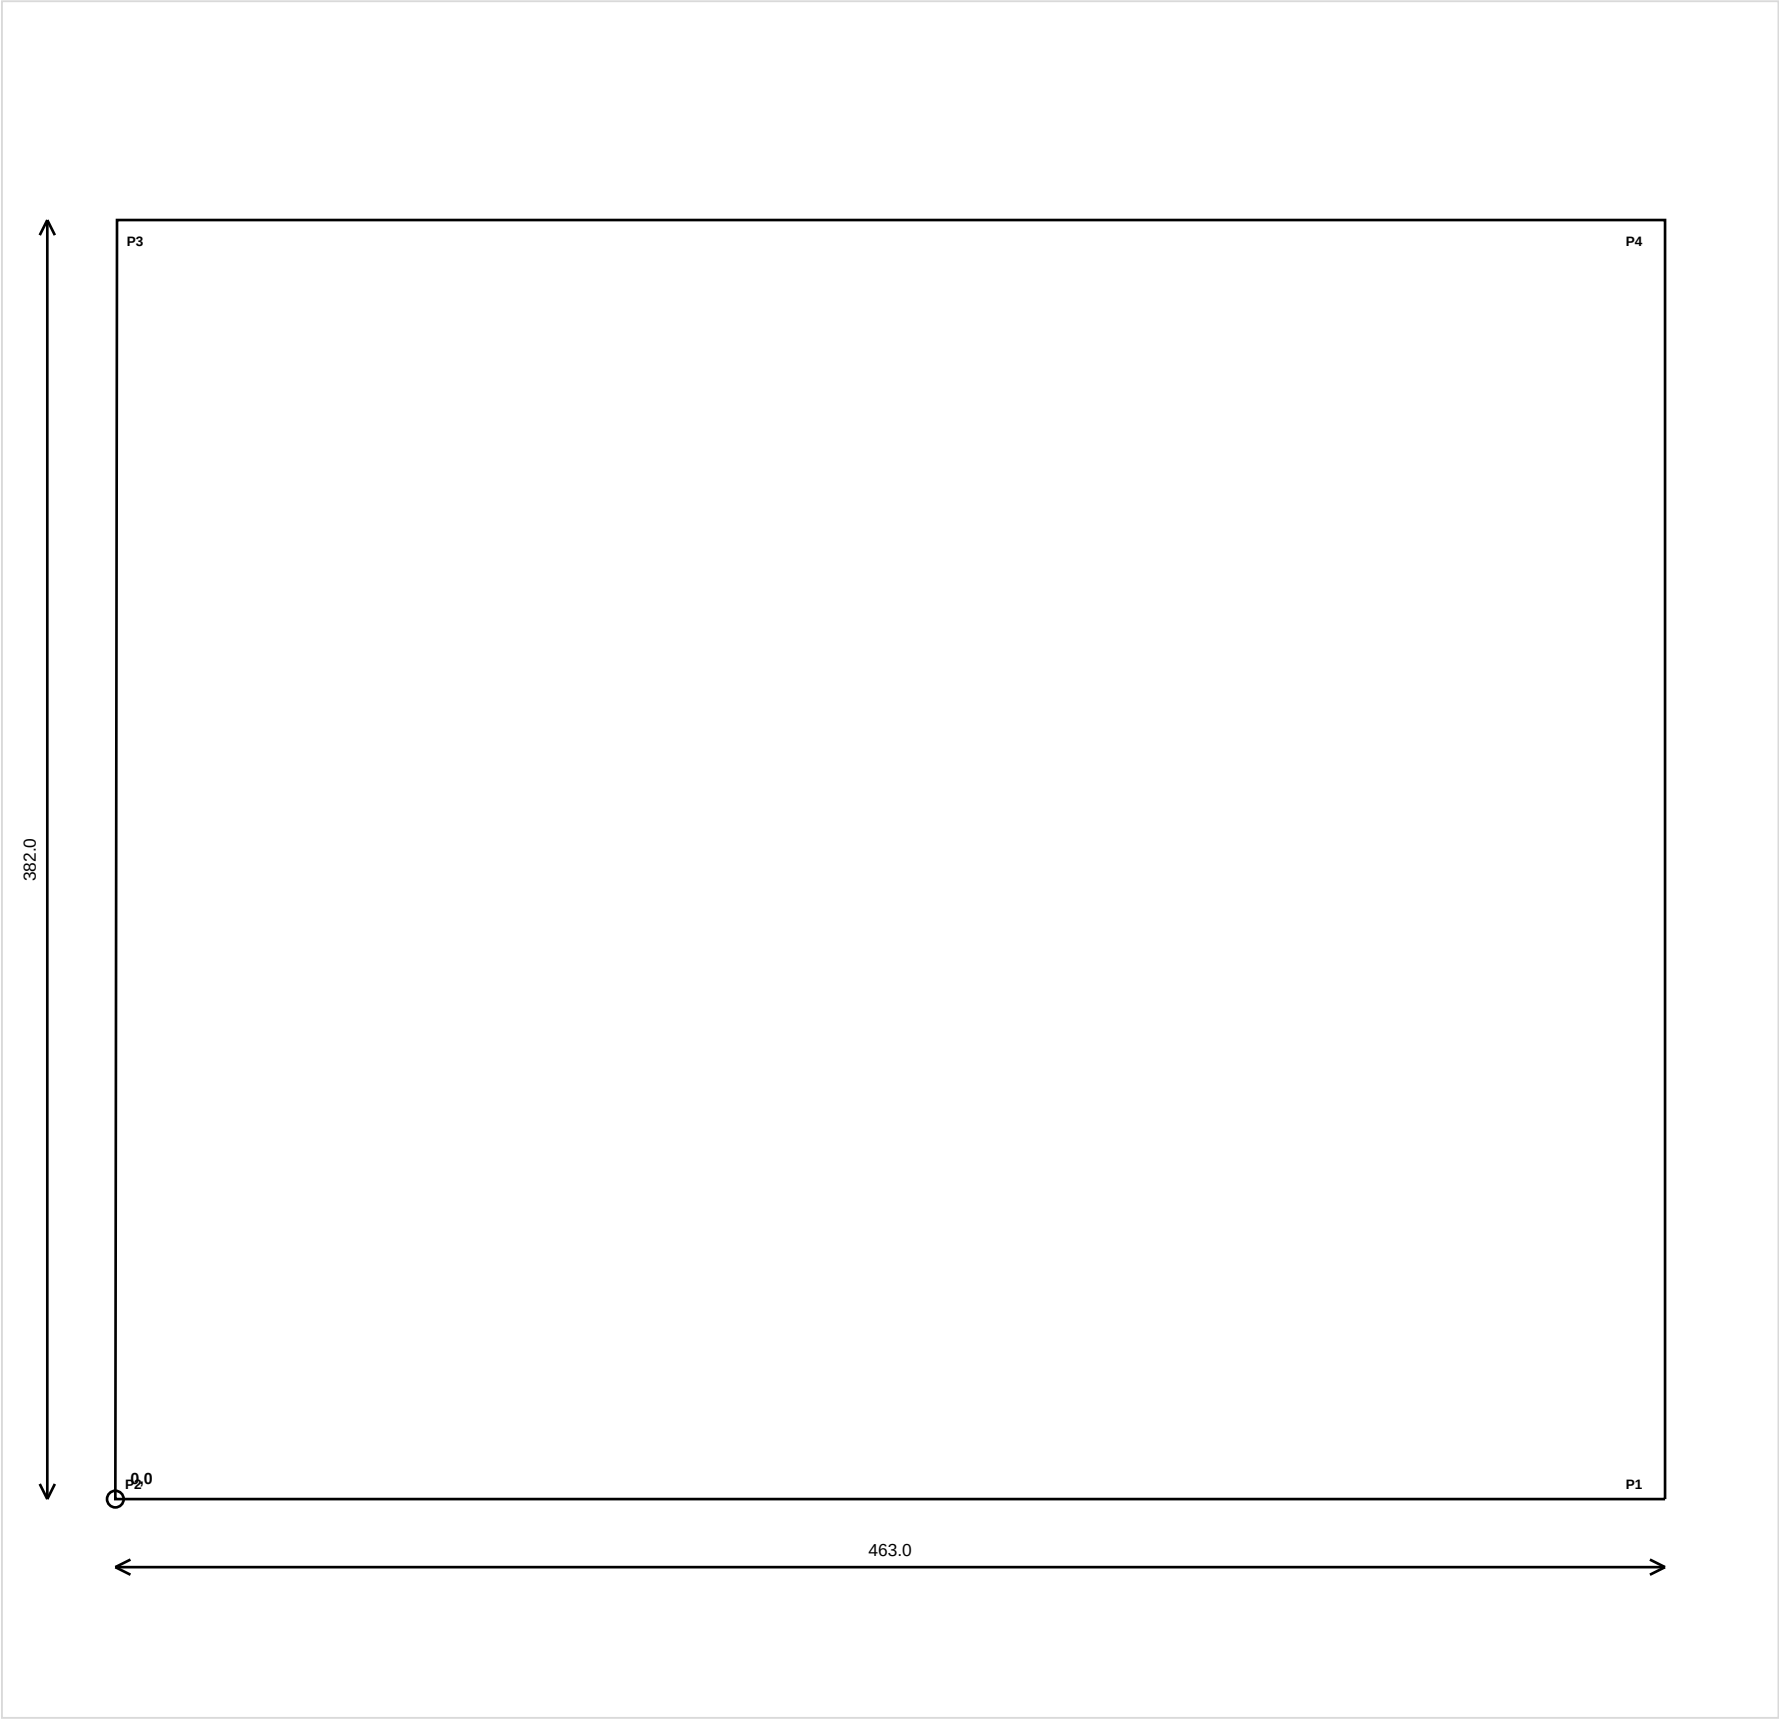

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X463.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.5 Y382.0	LINE
P4	X463.0 Y382.0	LINE

S4-C - Part detail

Overall 382.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

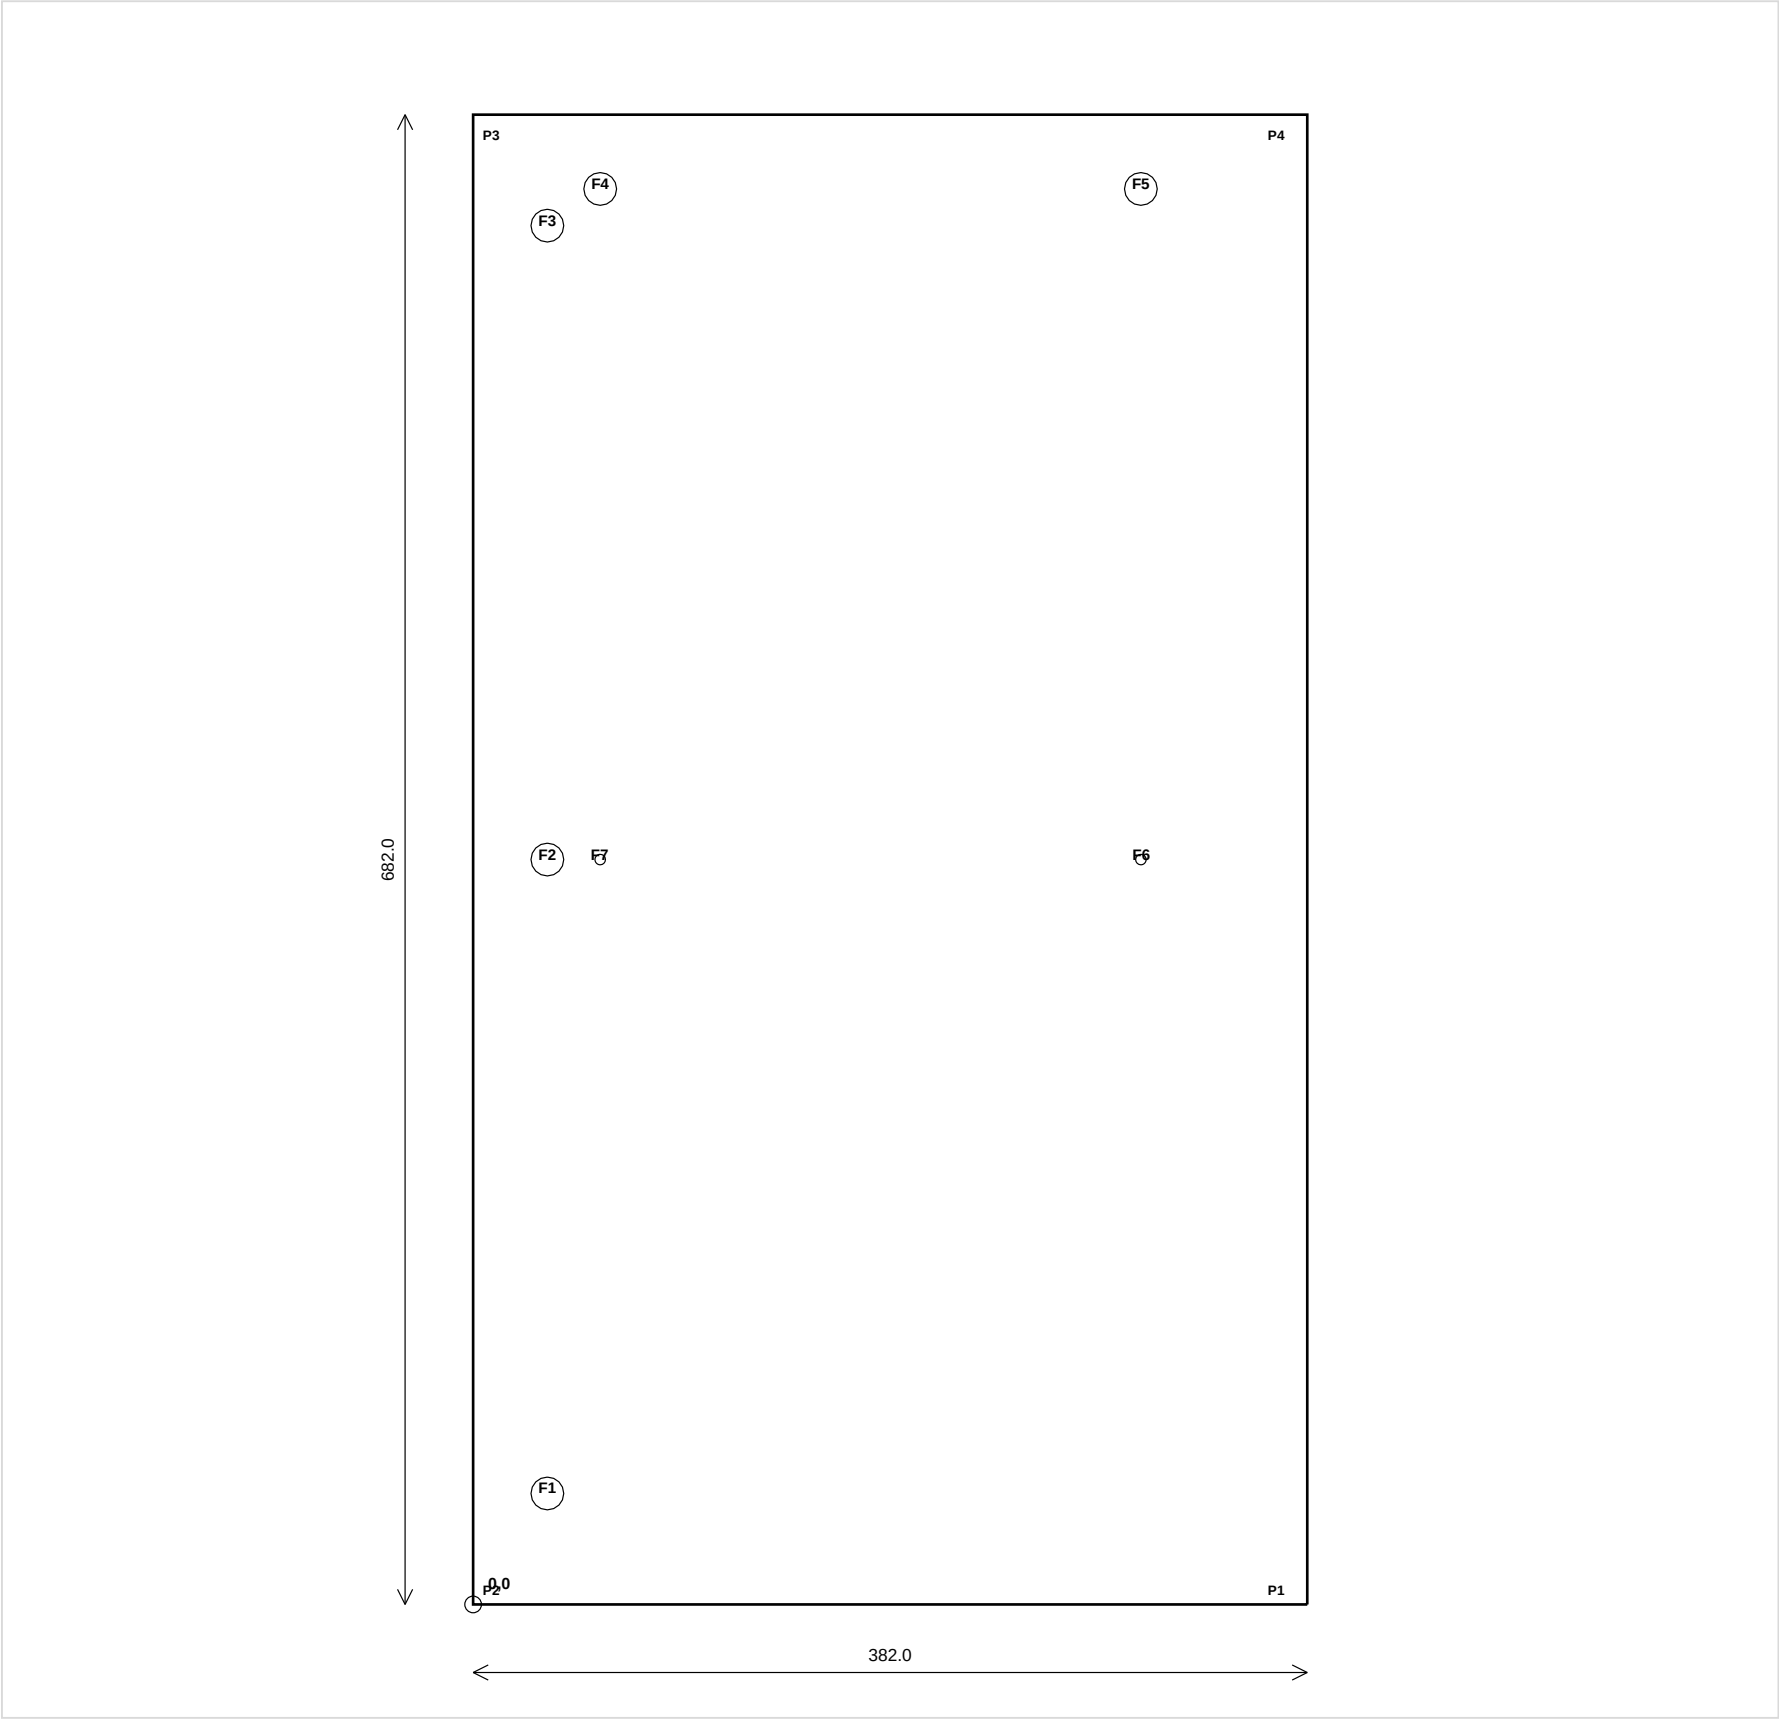

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 50.8
F2	Dia 15 x 14 deep	X 34.0 Y 341.0
F3	Dia 15 x 14 deep	X 34.0 Y 631.2
F4	Dia 15 x 14 deep	X 58.2 Y 648.0
F5	Dia 15 x 14 deep	X 305.8 Y 648.0
F6	Dia 5 x 11 deep	X 306.0 Y 341.0
F7	Dia 5 x 11 deep	X 58.0 Y 341.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y682.0	LINE
P4	X382.0 Y682.0	LINE

S4-D - Part detail

Overall 382.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

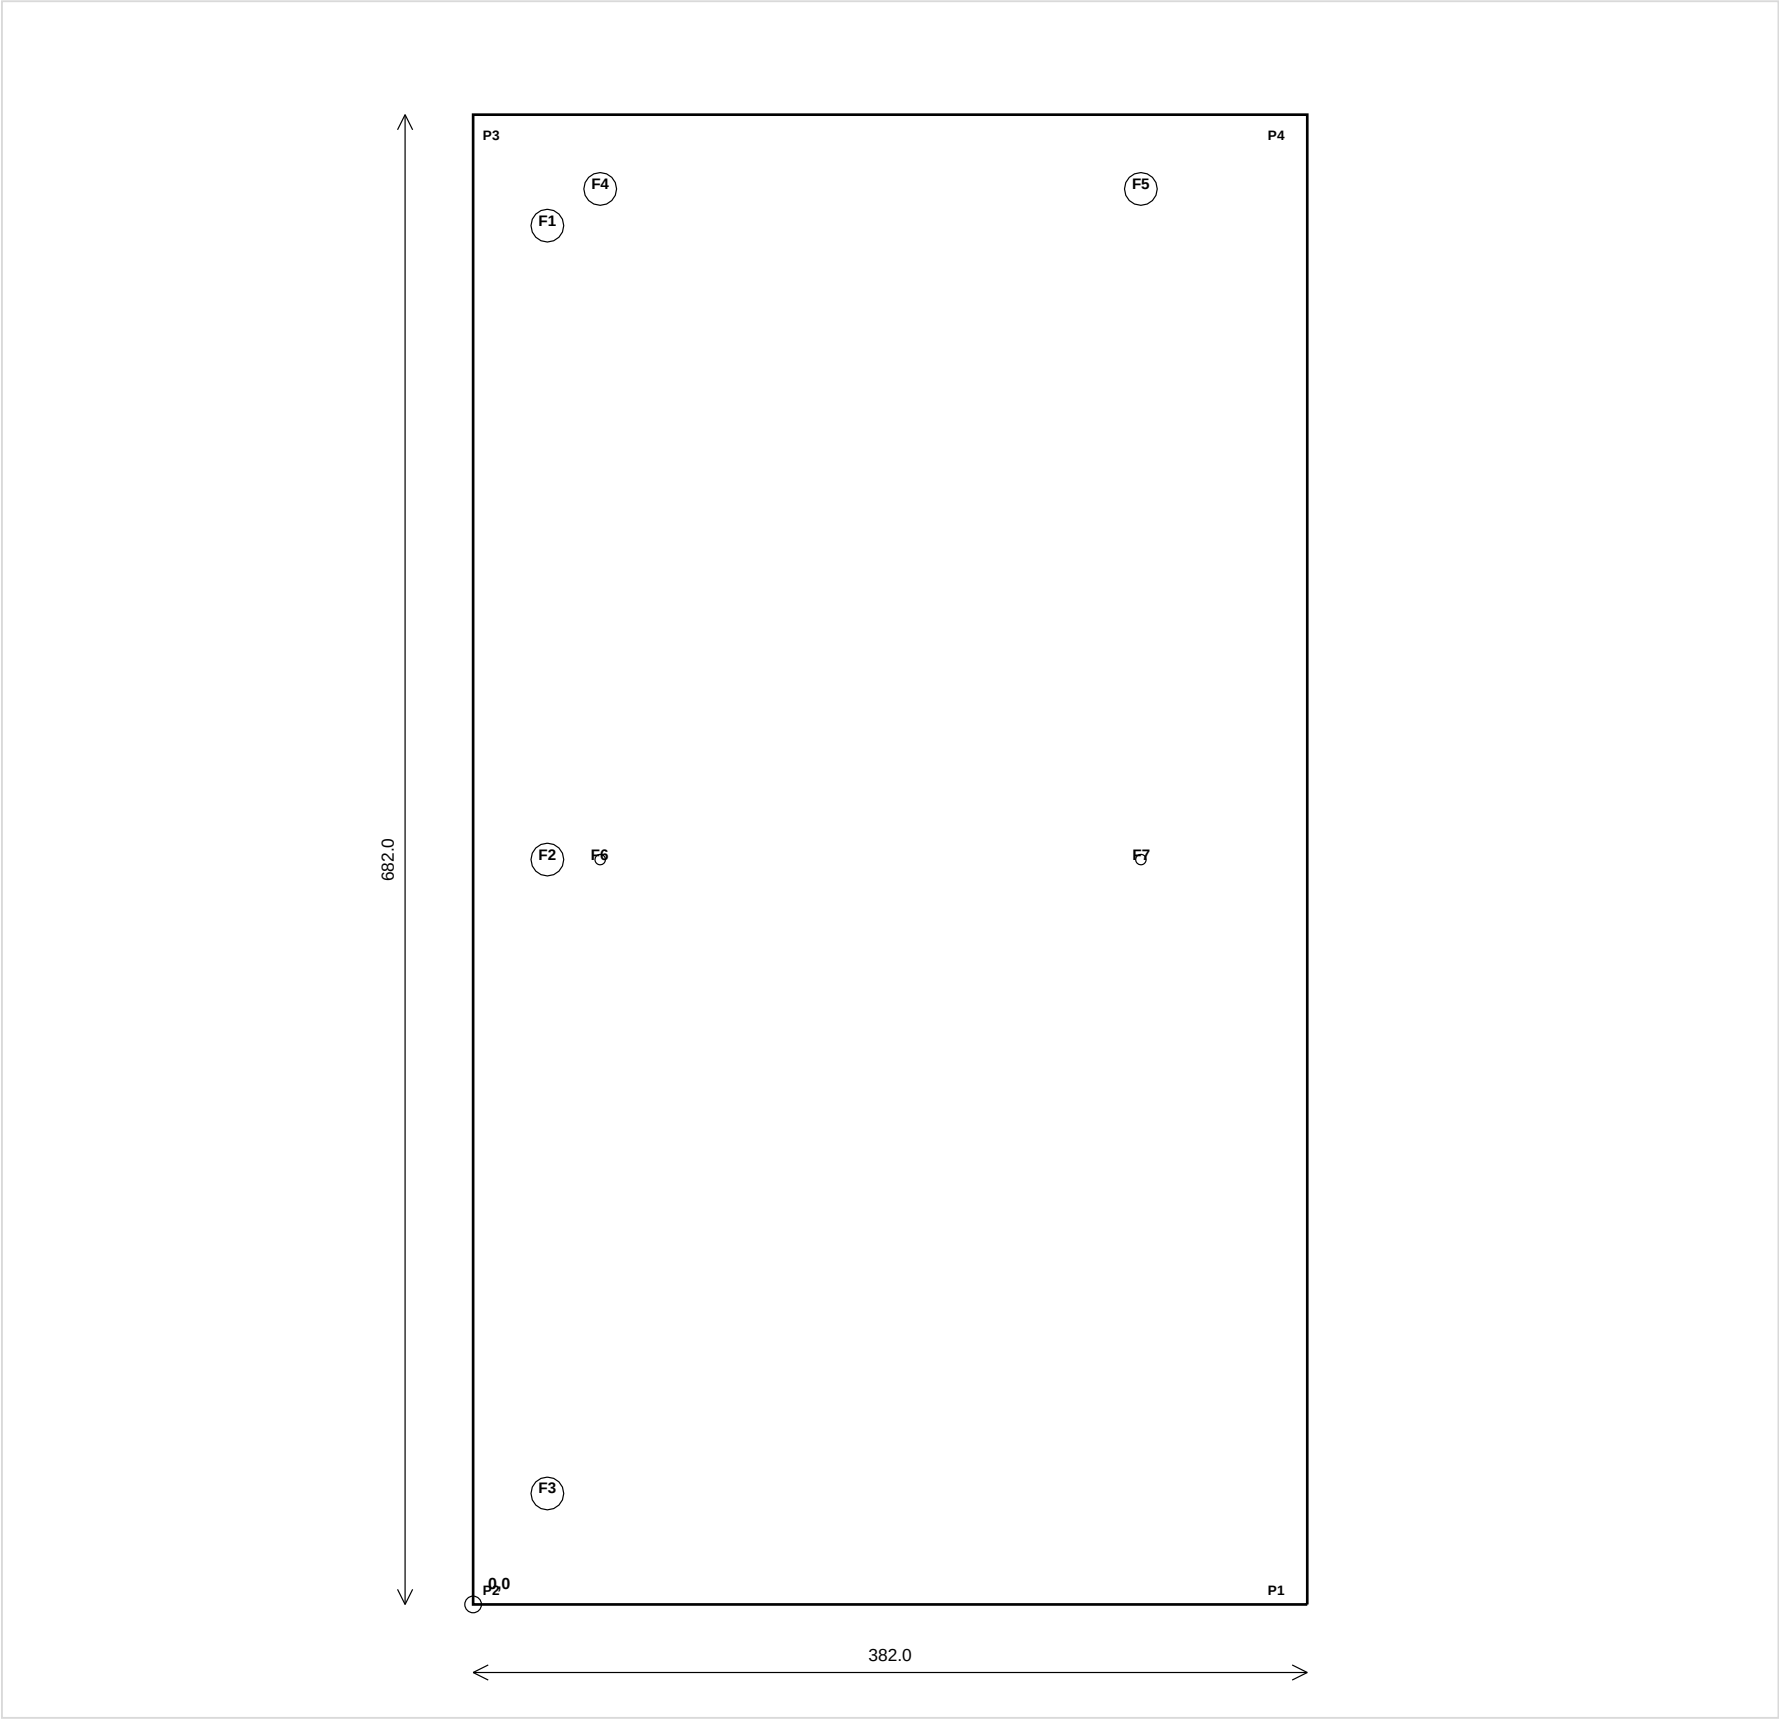

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 34.0 Y 631.2
F2	Dia 15 x 14 deep	X 34.0 Y 341.0
F3	Dia 15 x 14 deep	X 34.0 Y 50.8
F4	Dia 15 x 14 deep	X 58.2 Y 648.0
F5	Dia 15 x 14 deep	X 305.8 Y 648.0
F6	Dia 5 x 11 deep	X 58.0 Y 341.0
F7	Dia 5 x 11 deep	X 306.0 Y 341.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X382.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y682.0	LINE
P4	X382.0 Y682.0	LINE

S4-E - Part detail

Overall 382.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

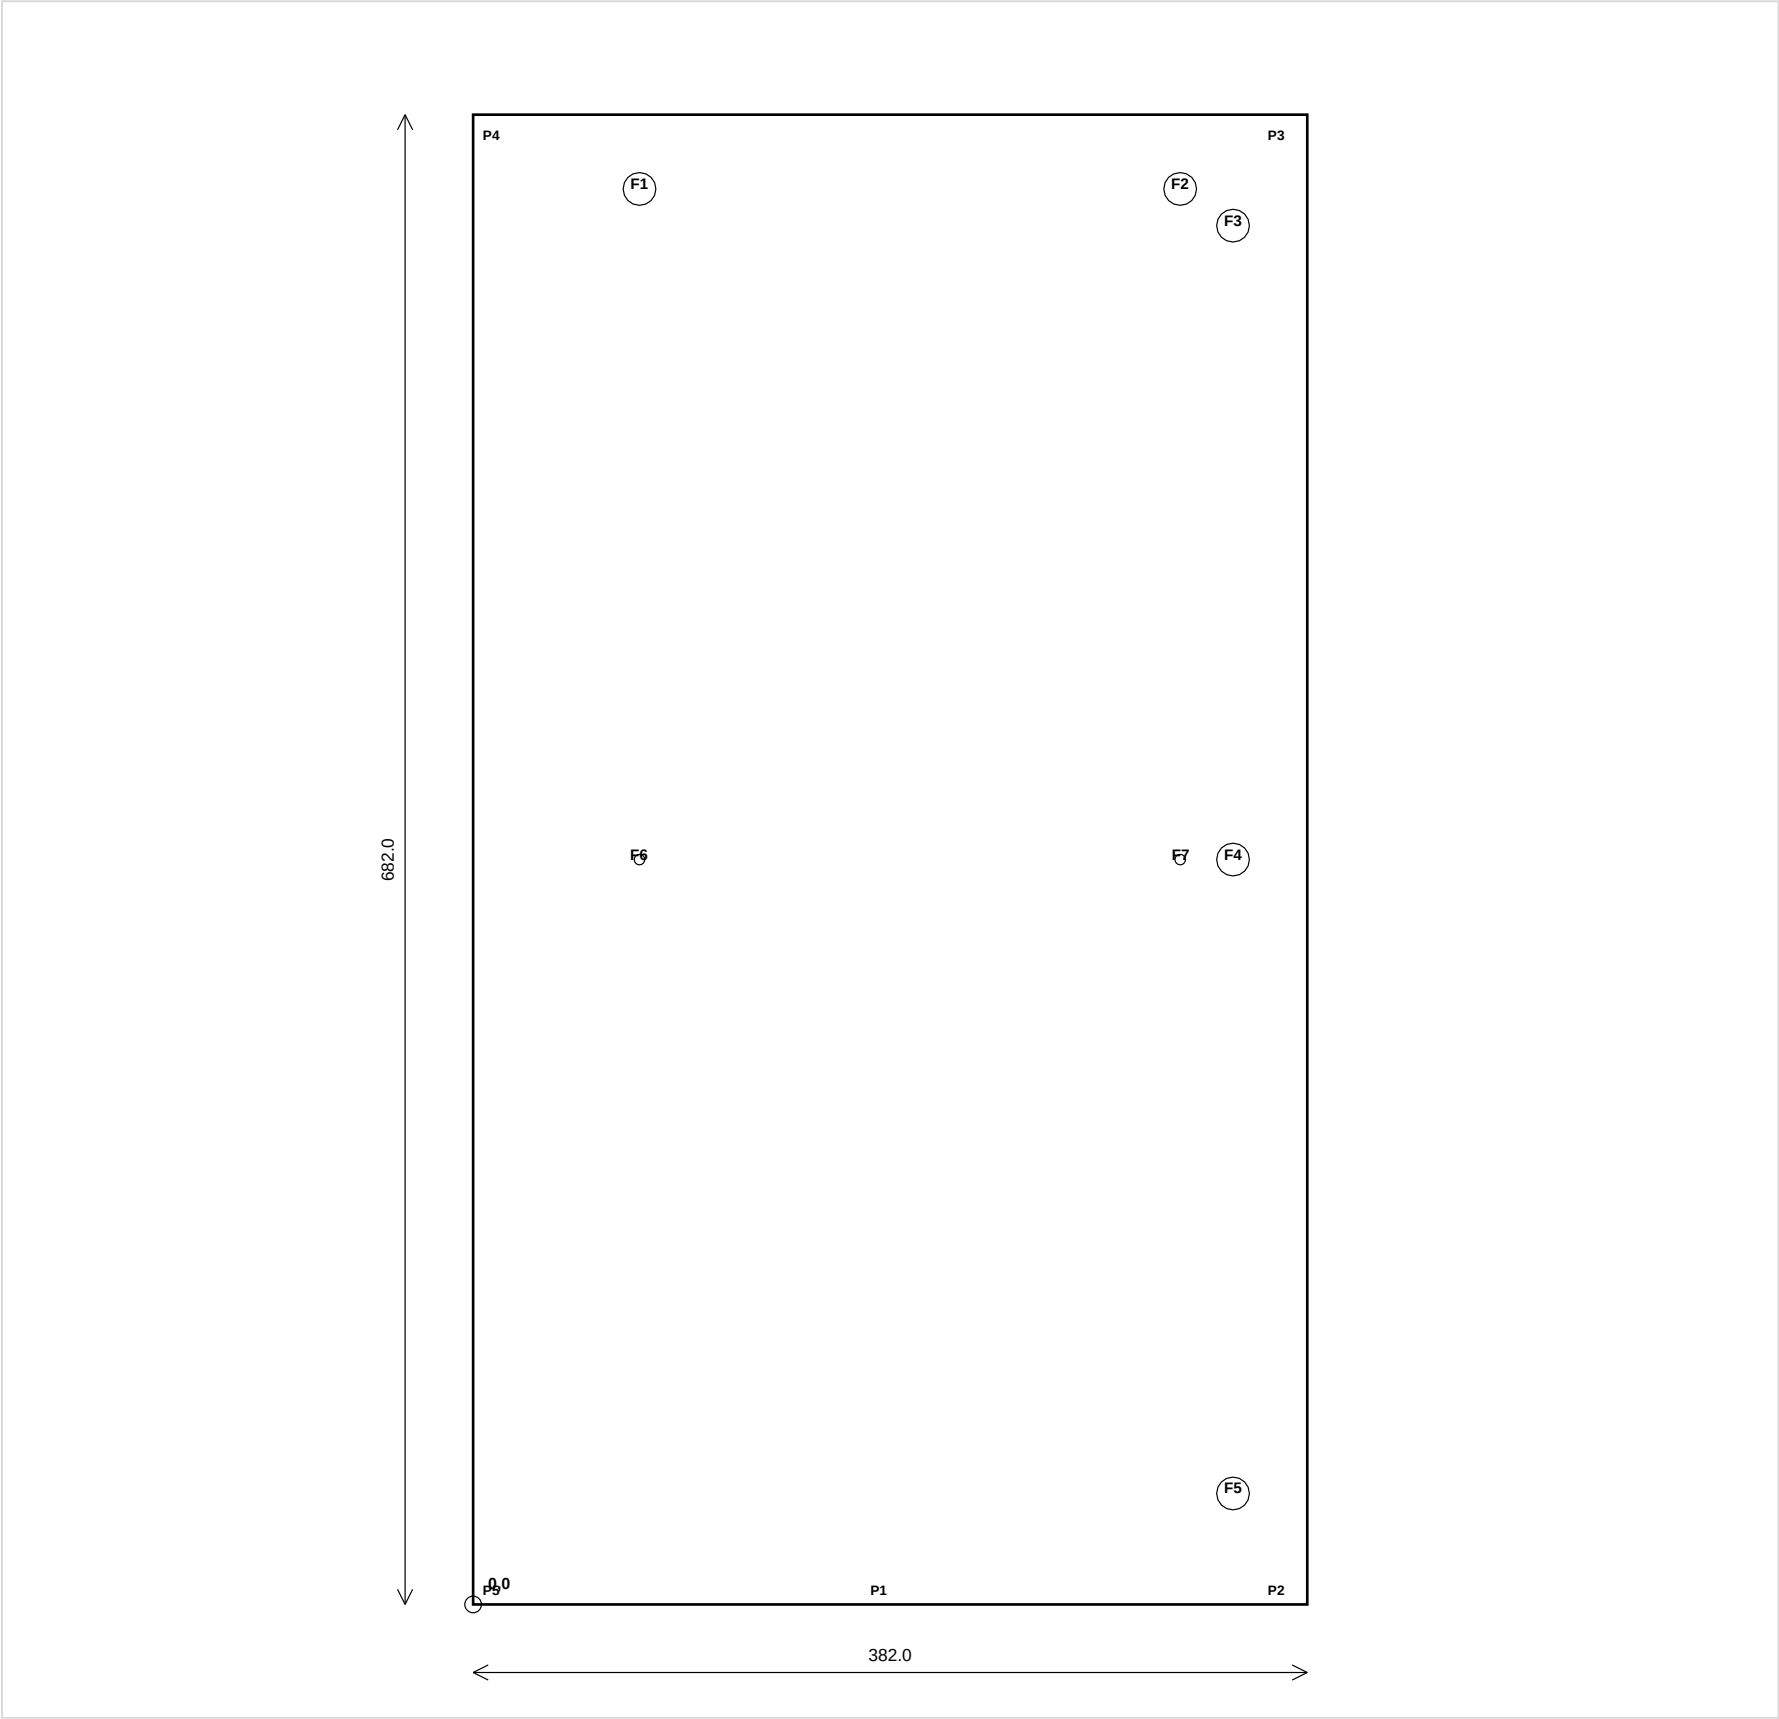

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 15 x 14 deep	X 76.2 Y 648.0
F2	Dia 15 x 14 deep	X 323.8 Y 648.0
F3	Dia 15 x 14 deep	X 348.0 Y 631.2
F4	Dia 15 x 14 deep	X 348.0 Y 341.0
F5	Dia 15 x 14 deep	X 348.0 Y 50.8
F6	Dia 5 x 11 deep	X 76.0 Y 341.0
F7	Dia 5 x 11 deep	X 324.0 Y 341.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X200.0 Y0.0	LINE
P2	X382.0 Y0.0	LINE
P3	X382.0 Y682.0	LINE
P4	X0.0 Y682.0	LINE
P5	X0.0 Y0.0	LINE

S4-F - Part detail

Overall 980.0 x 400.0 mm | 18 mm plywood | datum lower-left = X0 Y0

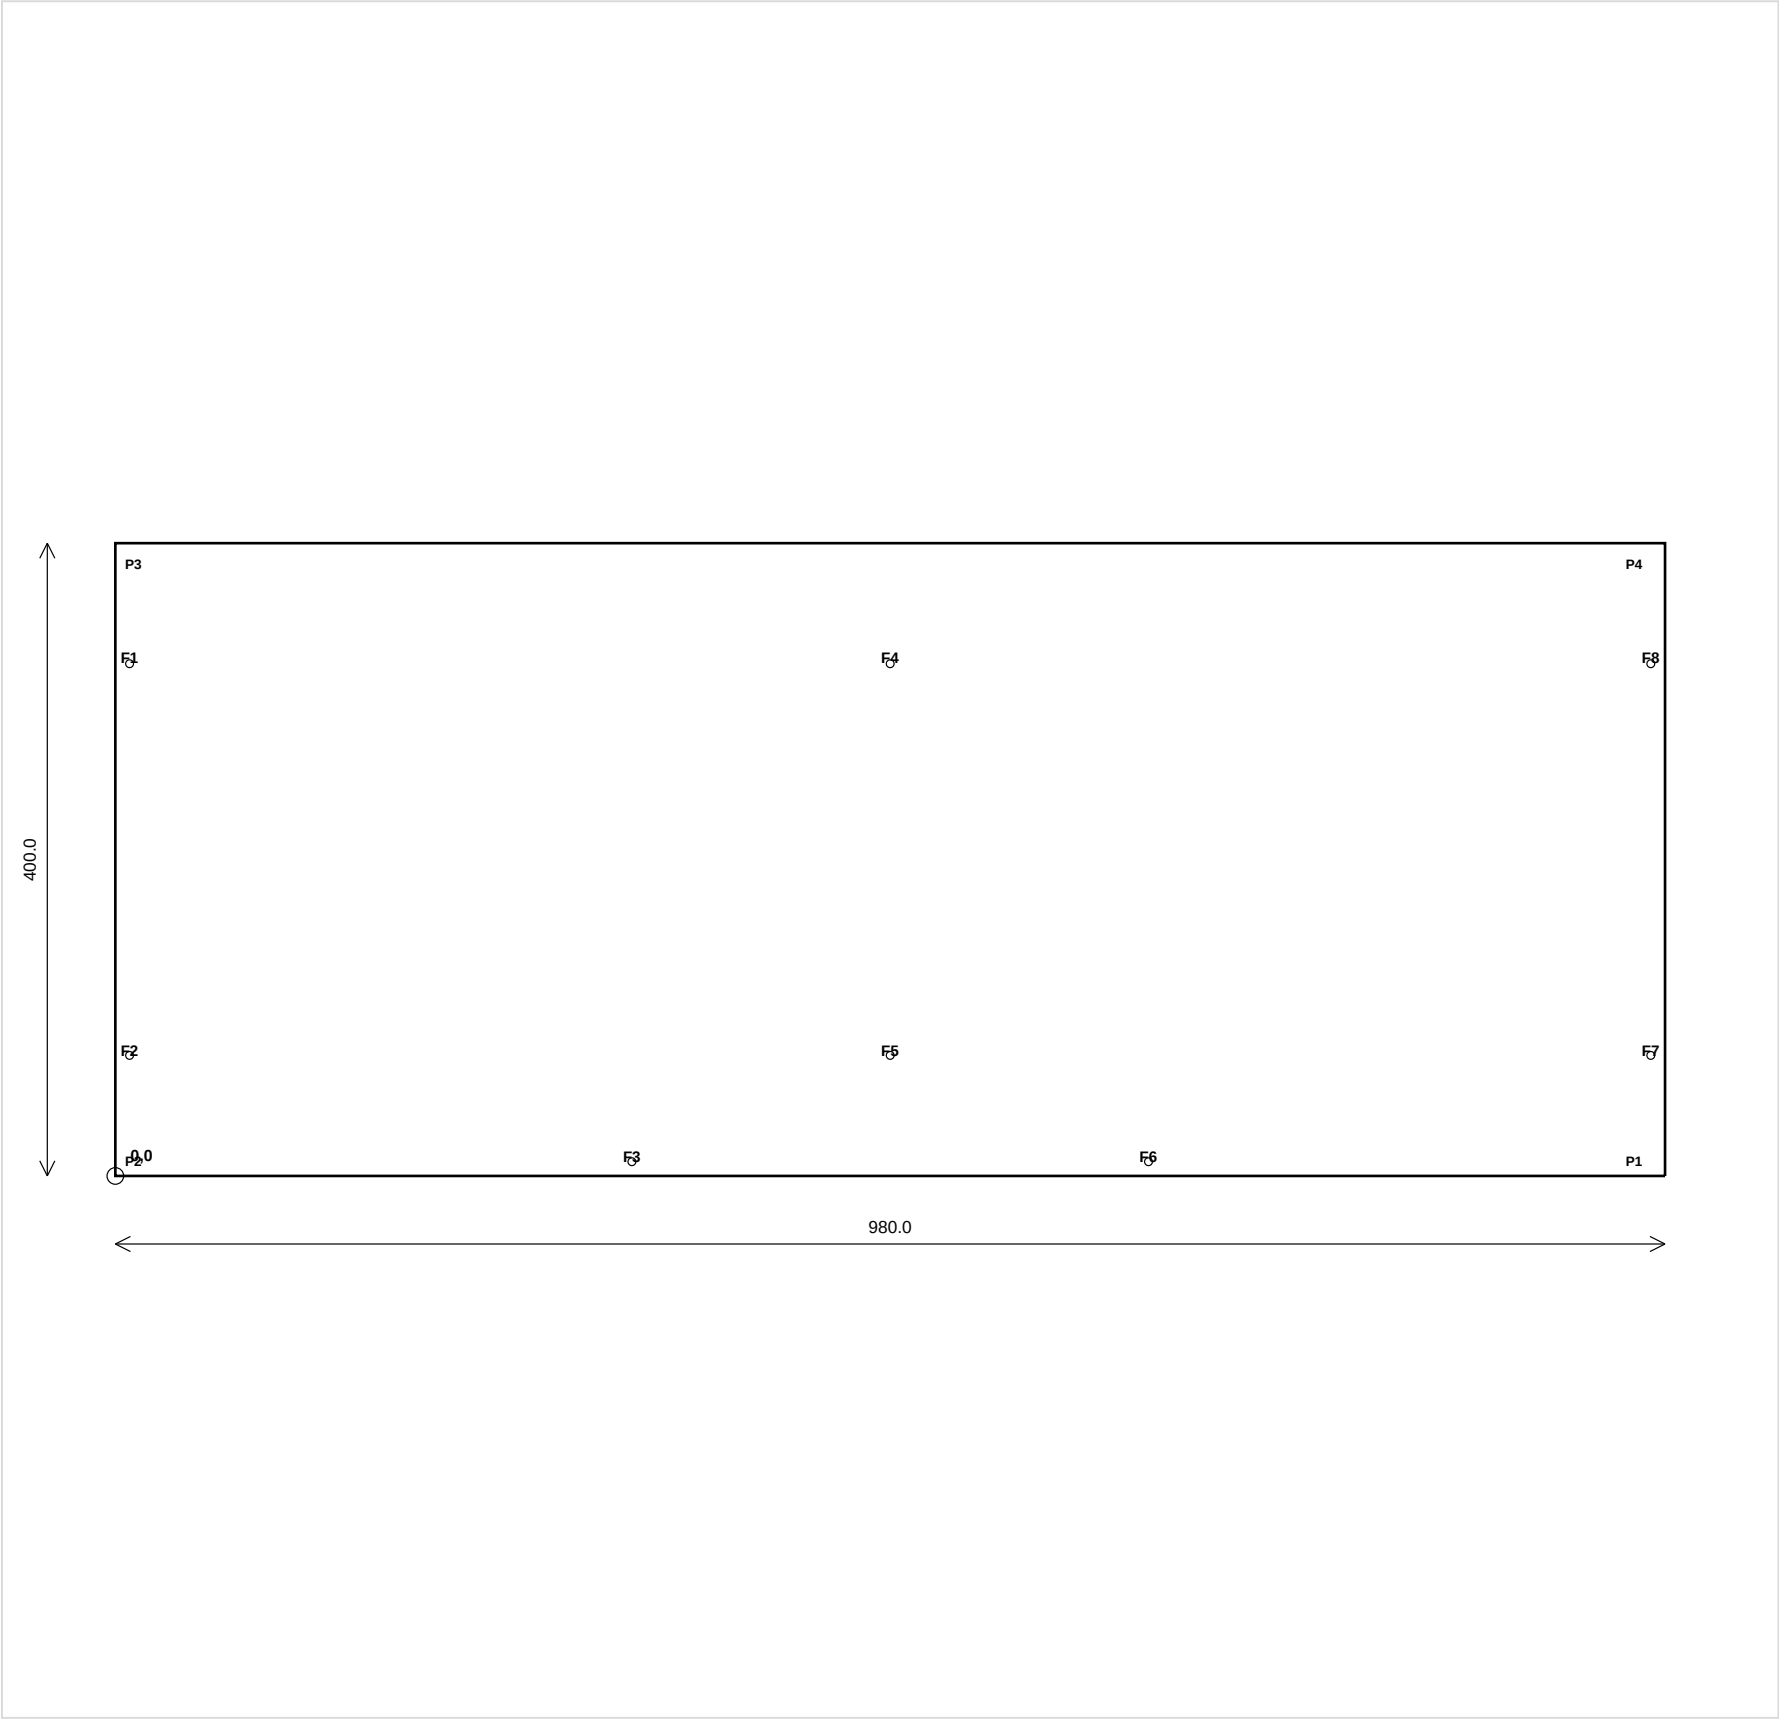

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	Dia 5 x 11 deep	X 9.0 Y 324.0
F2	Dia 5 x 11 deep	X 9.0 Y 76.0
F3	Dia 5 x 11 deep	X 326.7 Y 9.0
F4	Dia 5 x 11 deep	X 490.0 Y 324.0
F5	Dia 5 x 11 deep	X 490.0 Y 76.0
F6	Dia 5 x 11 deep	X 653.3 Y 9.0
F7	Dia 5 x 11 deep	X 971.0 Y 76.0
F8	Dia 5 x 11 deep	X 971.0 Y 324.0


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X980.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y400.0	LINE
P4	X980.0 Y400.0	LINE

S4-G - Part detail

Overall 980.0 x 682.0 mm | 18 mm plywood | datum lower-left = X0 Y0

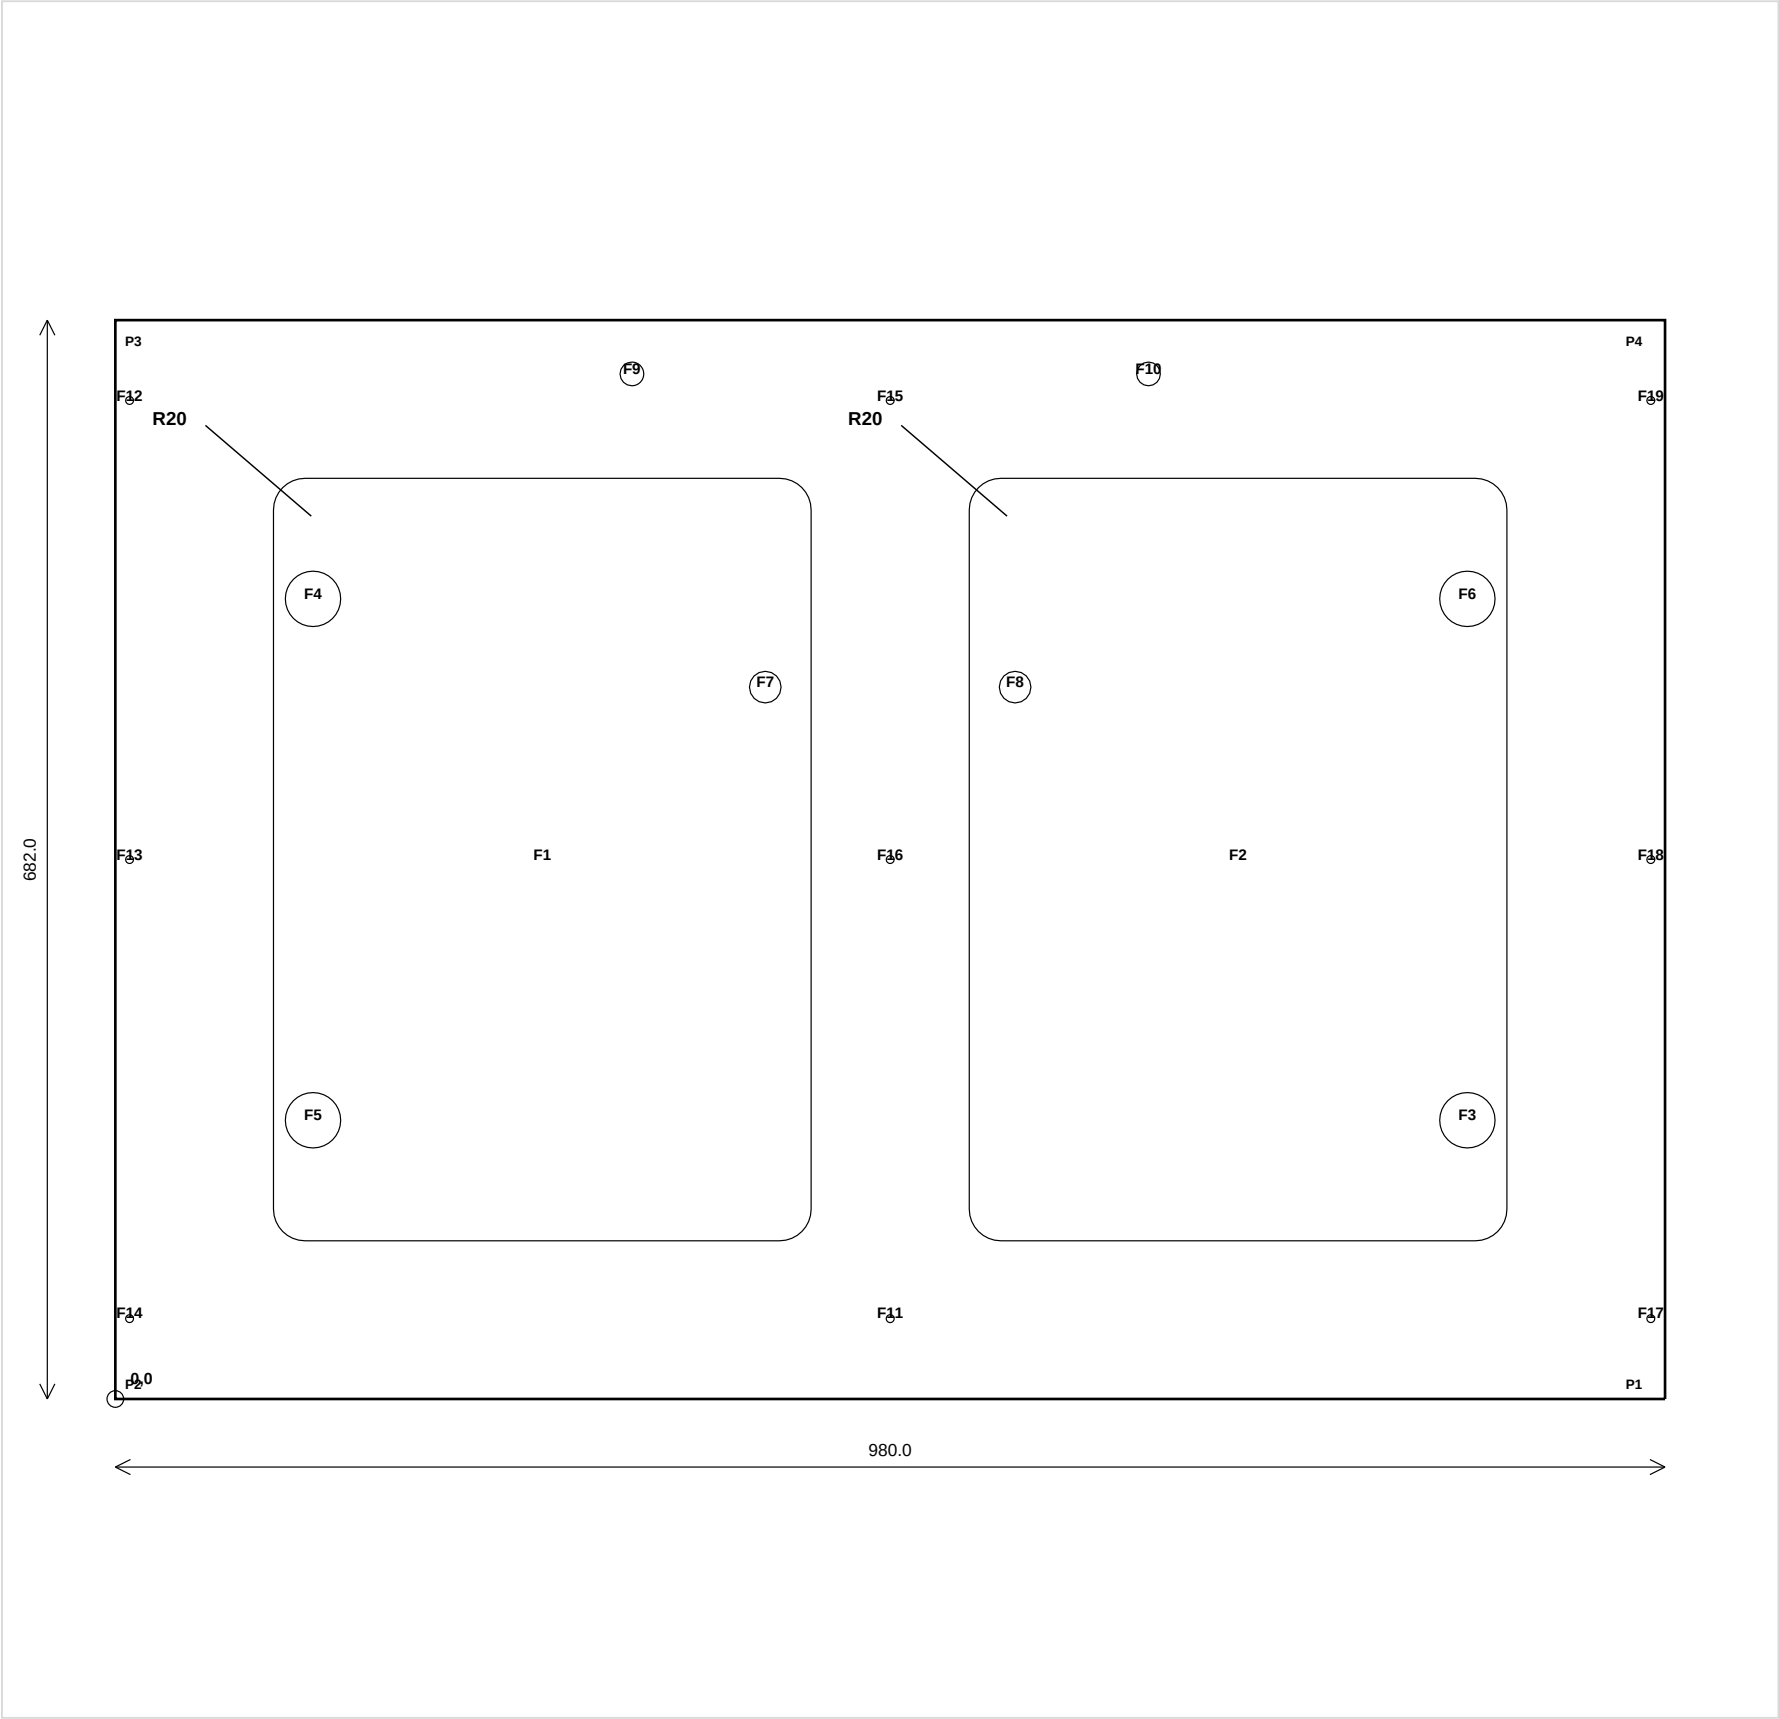

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1	door cut-out 340.0 x 482.0, R20	X 270.0 Y 341.0
F2	door cut-out 340.0 x 482.0, R20	X 710.0 Y 341.0
F3	Dia 35 x 13 deep	X 855.0 Y 176.2
F4	Dia 35 x 13 deep	X 125.0 Y 505.8
F5	Dia 35 x 13 deep	X 125.0 Y 176.2
F6	Dia 35 x 13 deep	X 855.0 Y 505.8
F7	Dia 20 THROUGH	X 411.0 Y 450.0
F8	Dia 20 THROUGH	X 569.0 Y 450.0
F9	Dia 15 x 14 deep	X 326.7 Y 648.0
F10	Dia 15 x 14 deep	X 653.3 Y 648.0
F11	Dia 5 x 11 deep	X 490.0 Y 51.0
F12	Dia 5 x 11 deep	X 9.0 Y 631.0
F13	Dia 5 x 11 deep	X 9.0 Y 341.0
F14	Dia 5 x 11 deep	X 9.0 Y 51.0
F15	Dia 5 x 11 deep	X 490.0 Y 631.0
F16	Dia 5 x 11 deep	X 490.0 Y 341.0
F17	Dia 5 x 11 deep	X 971.0 Y 51.0
F18	Dia 5 x 11 deep	X 971.0 Y 341.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1	X980.0 Y0.0	LINE
P2	X0.0 Y0.0	LINE
P3	X0.0 Y682.0	LINE
P4	X980.0 Y682.0	LINE

Machining features - continued

F19	Dia 5 x 11 deep	X 971.0 Y 631.0
-----	-----------------	-----------------