

VW-CADDY-MAXI-USHAPE

Coordinate system

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Example: X100 / Y50 = 100 mm right from the left edge, then 50 mm up from the bottom.

Rules

- 18 mm plywood
- Dia 5 = 11 mm deep; nominal 8.8/8.9 edge positions shown as 9 mm
- Dia 15 = 14 mm deep
- Dia 20 = THROUGH
- Dia 35 = 13 mm deep
- Radius of a rounded slot/cut-out = half its narrow width
- Door cut-outs use R20
- 5 mm / 15 mm fixing holes may be omitted when using L-brackets or timber blocks.

8 mm cam-fitting edge holes

Where a 15 mm cam-lock hole is shown, drill an 8 mm hole centrally through the edge of the mating side panel using a self-centring jig with an 8 mm guide.

Align the 8 mm hole with the centre of the 15 mm cam-lock bore.


Sheet structure

Sheet 1: 9 panels

Sheet 2: 13 panels


Sheet 3: 13 panels

Total: 35 panels

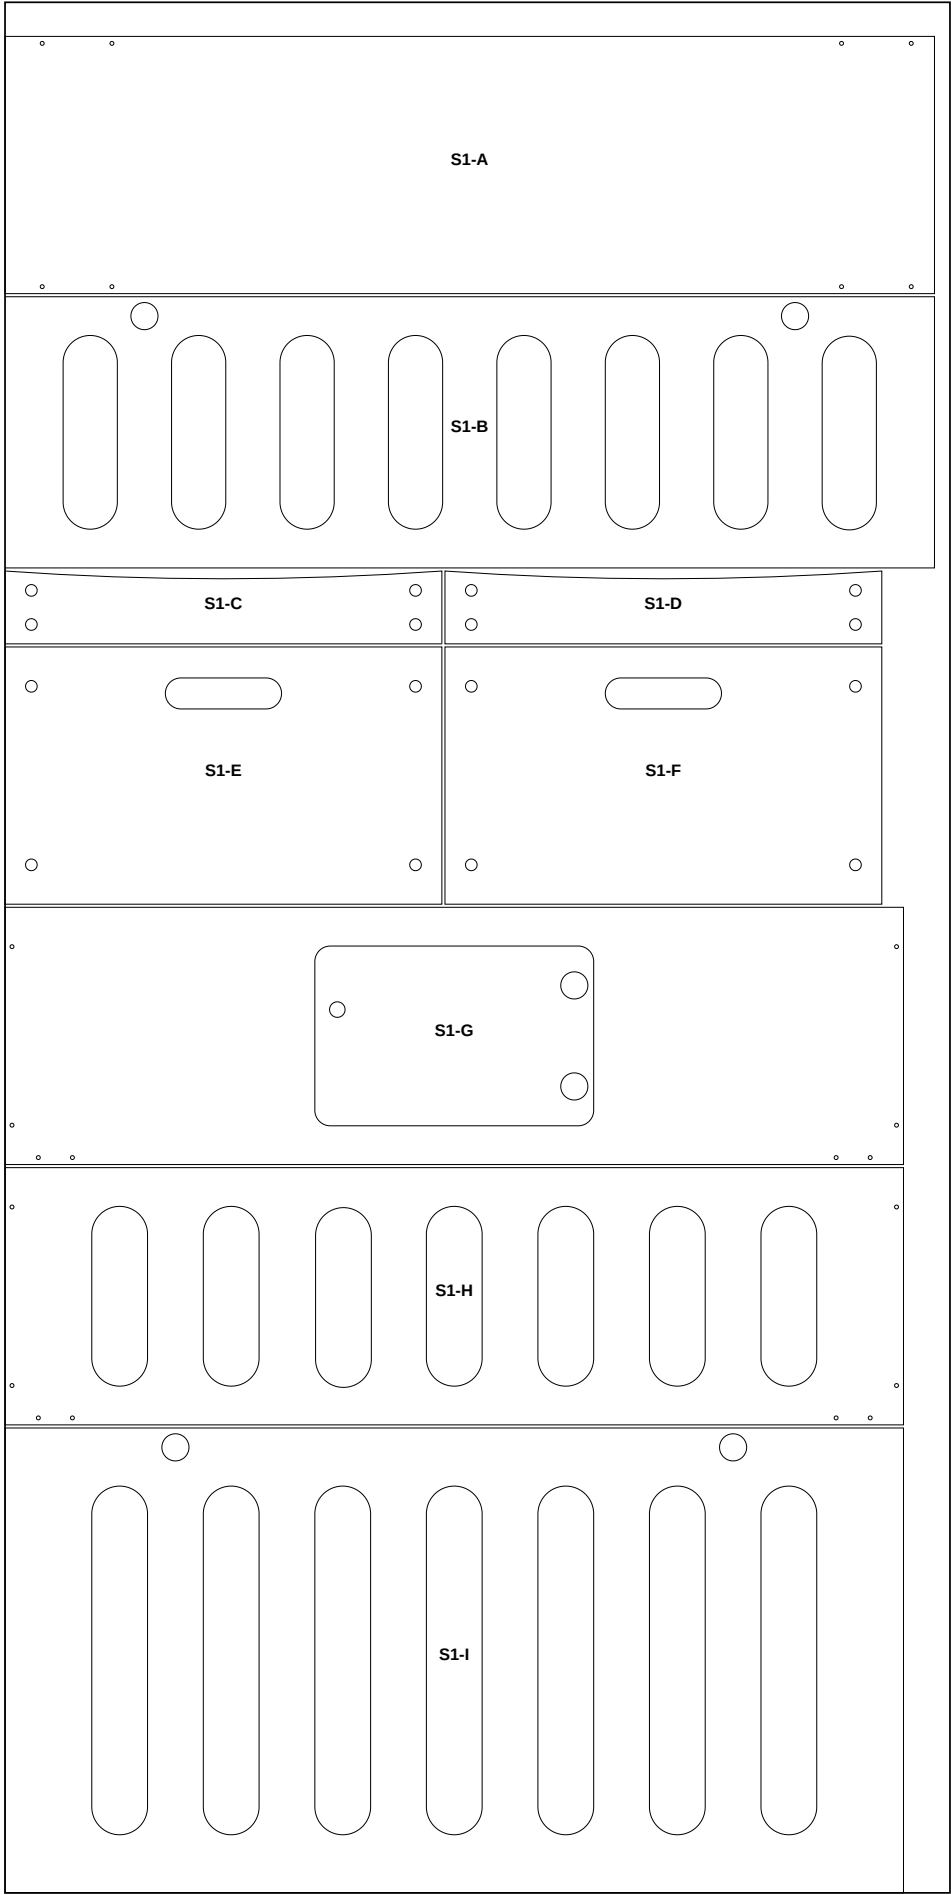


Sheet 2 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

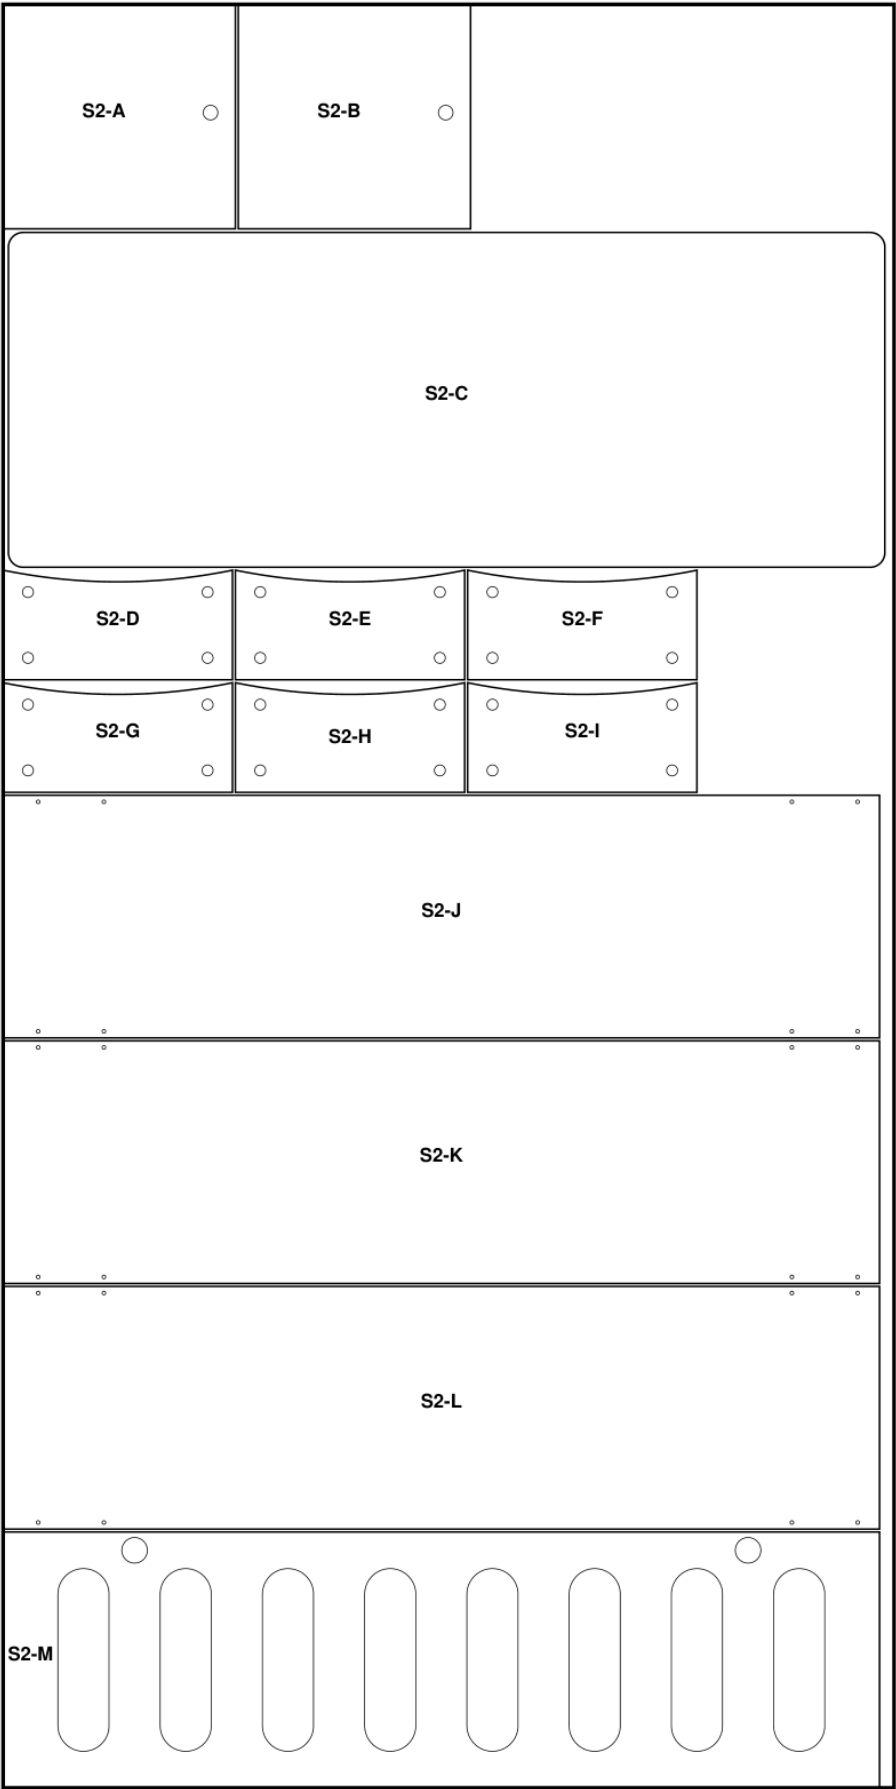


Sheet 3 - 1220 x 2440 x 18 mm layout

Part labels correspond to the detailed pages.

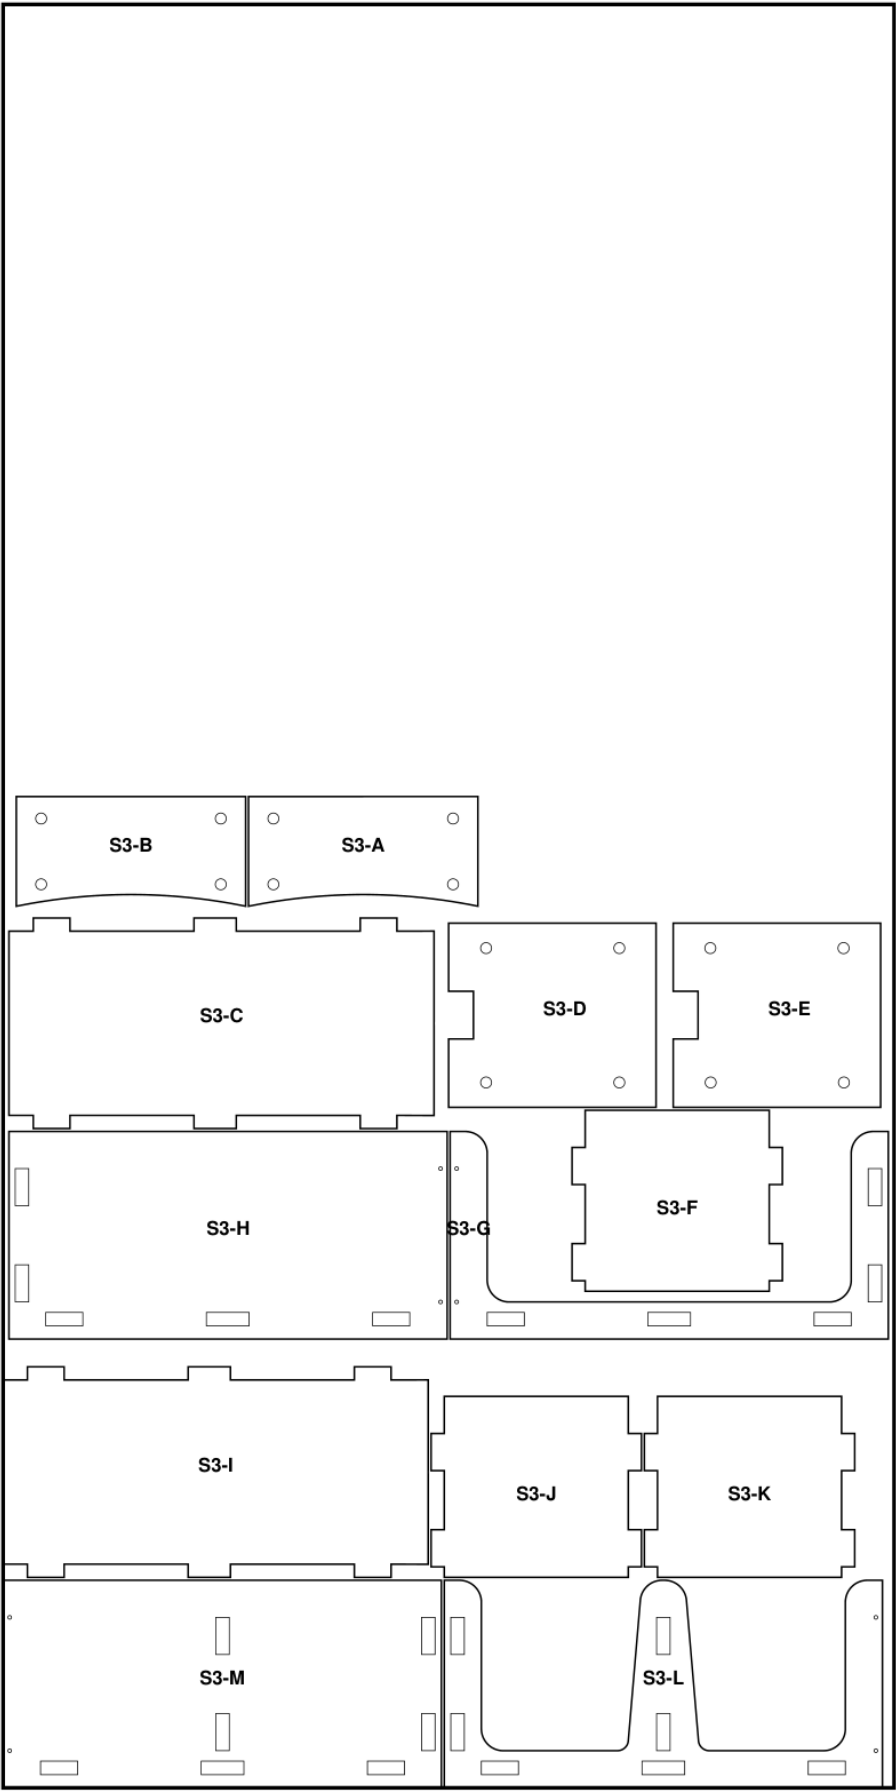

S1-A - Part detail

Overall 1200.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

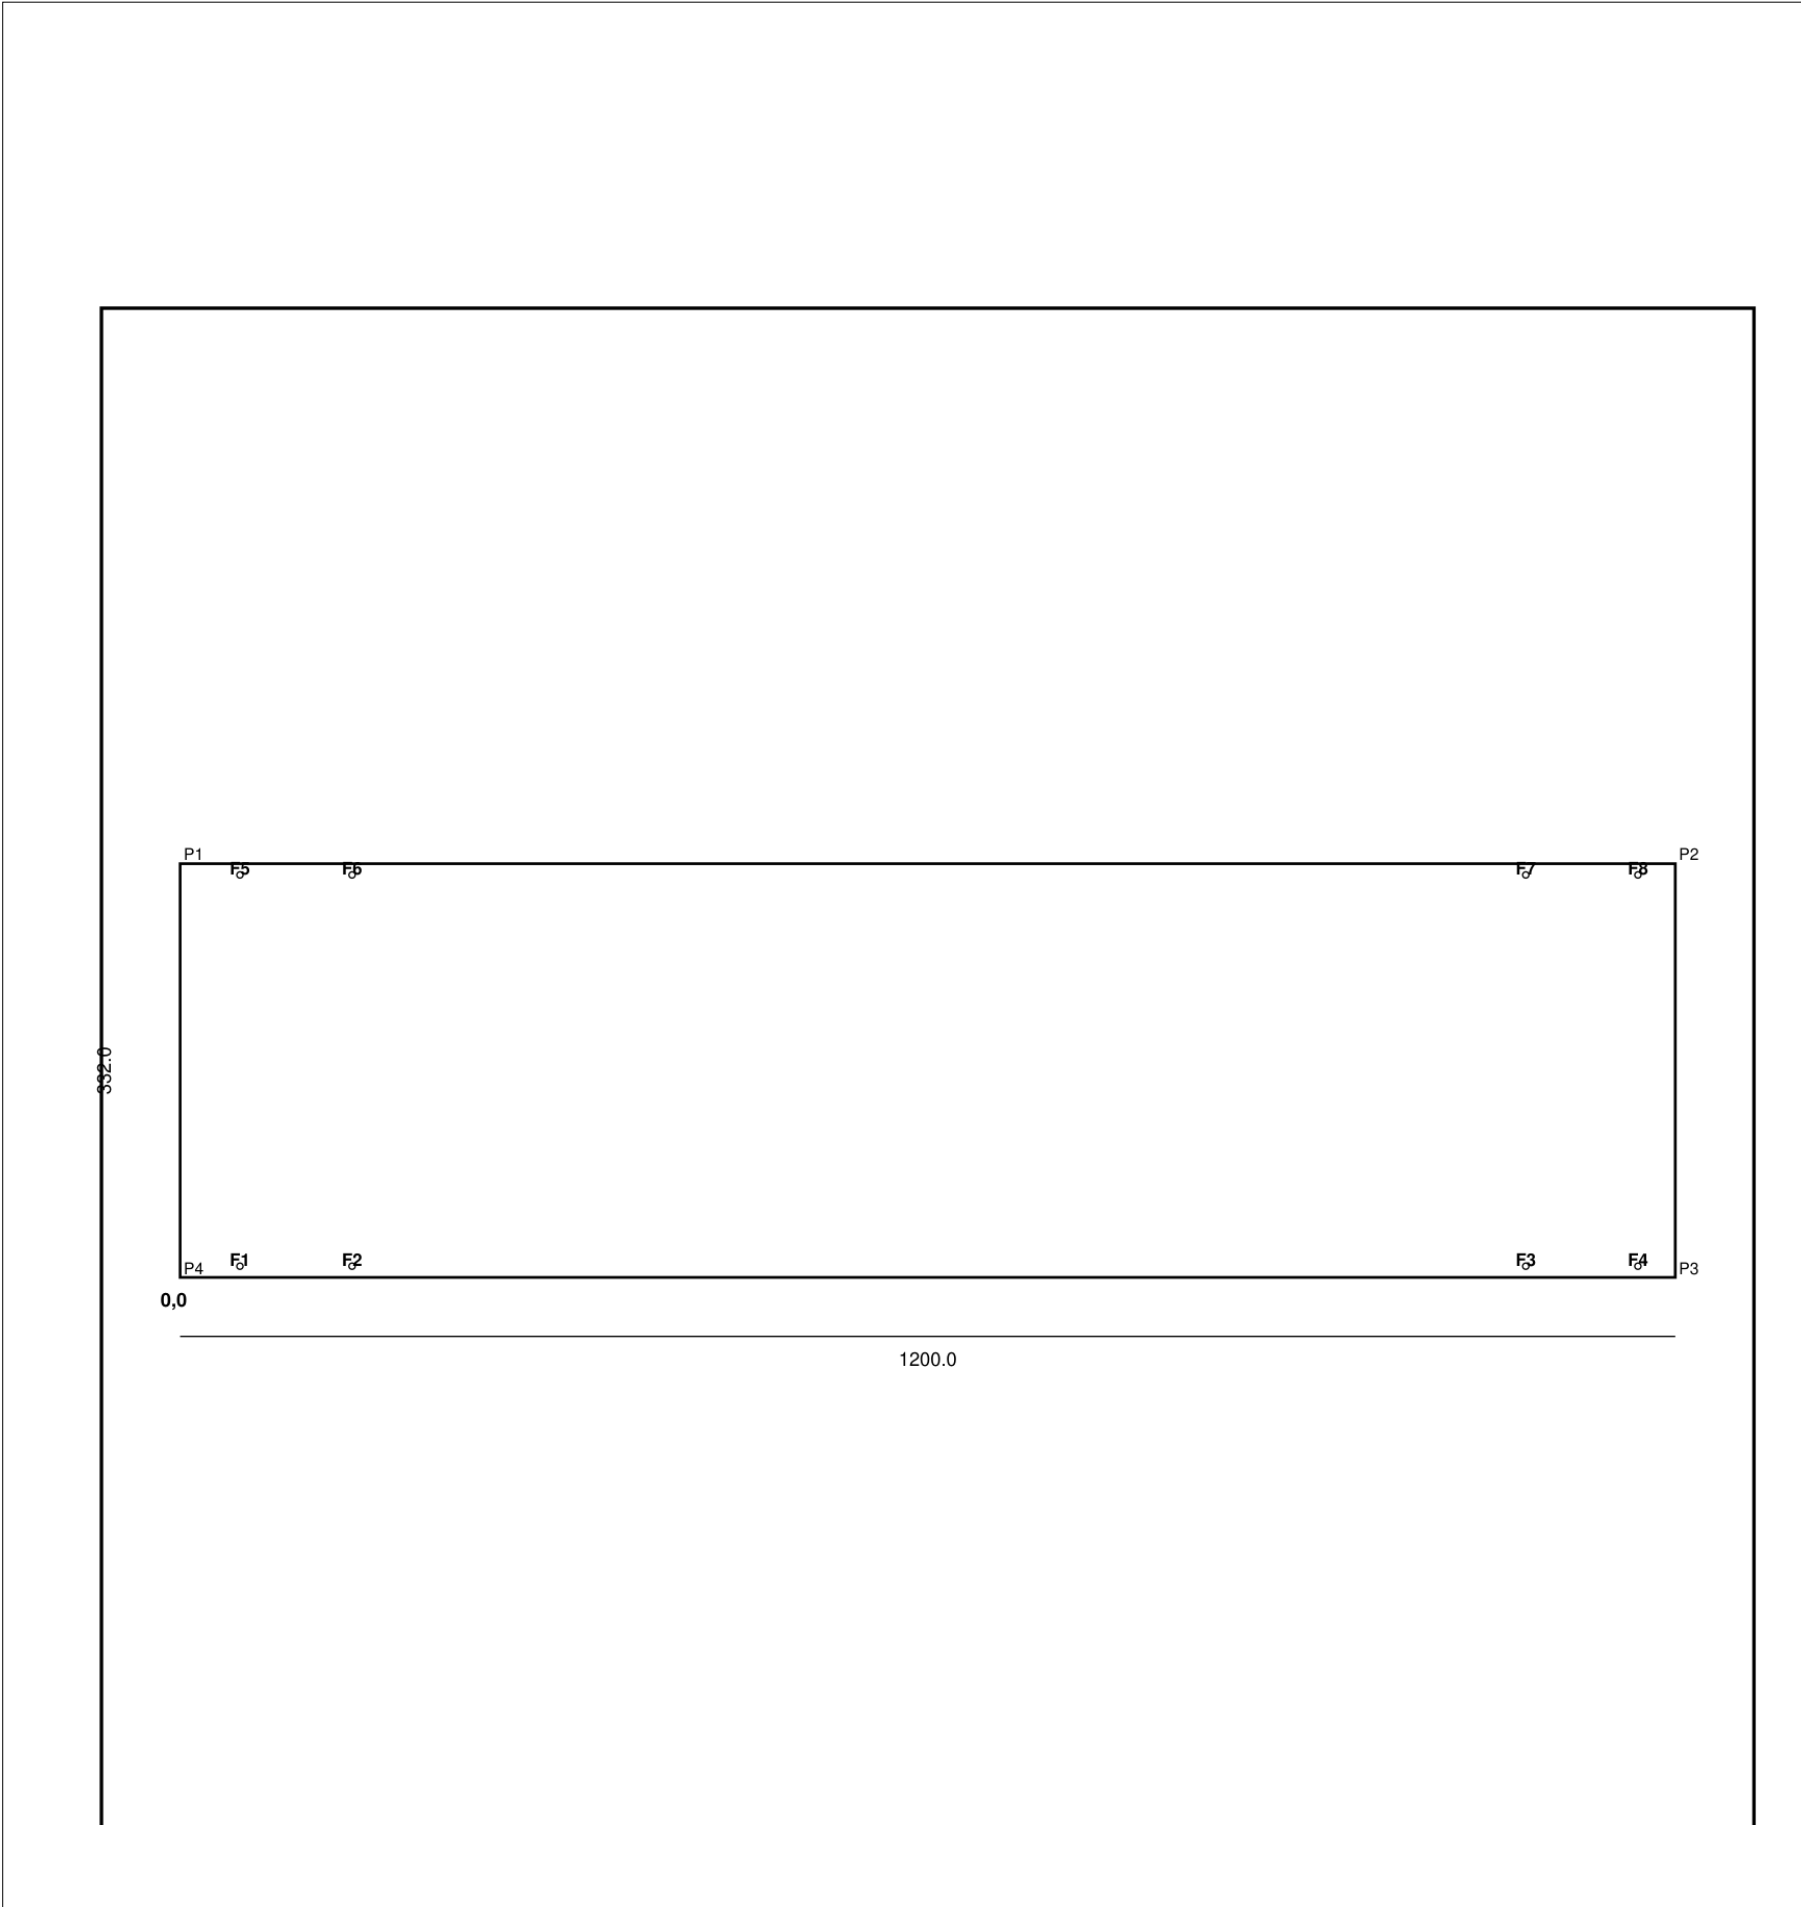

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 1080.0 Y 9.0
- F4 Dia 5 x 11 deep X 1170.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 1080.0 Y 323.0
- F8 Dia 5 x 11 deep X 1170.0 Y 323.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
- P2 X1200.0 Y332.0 LINE
- P3 X1200.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE
- Page 5

S1-B - Part detail

Overall 1200.0 x 350.0 mm | 18 mm plywood | datum lower-left = X0 Y0

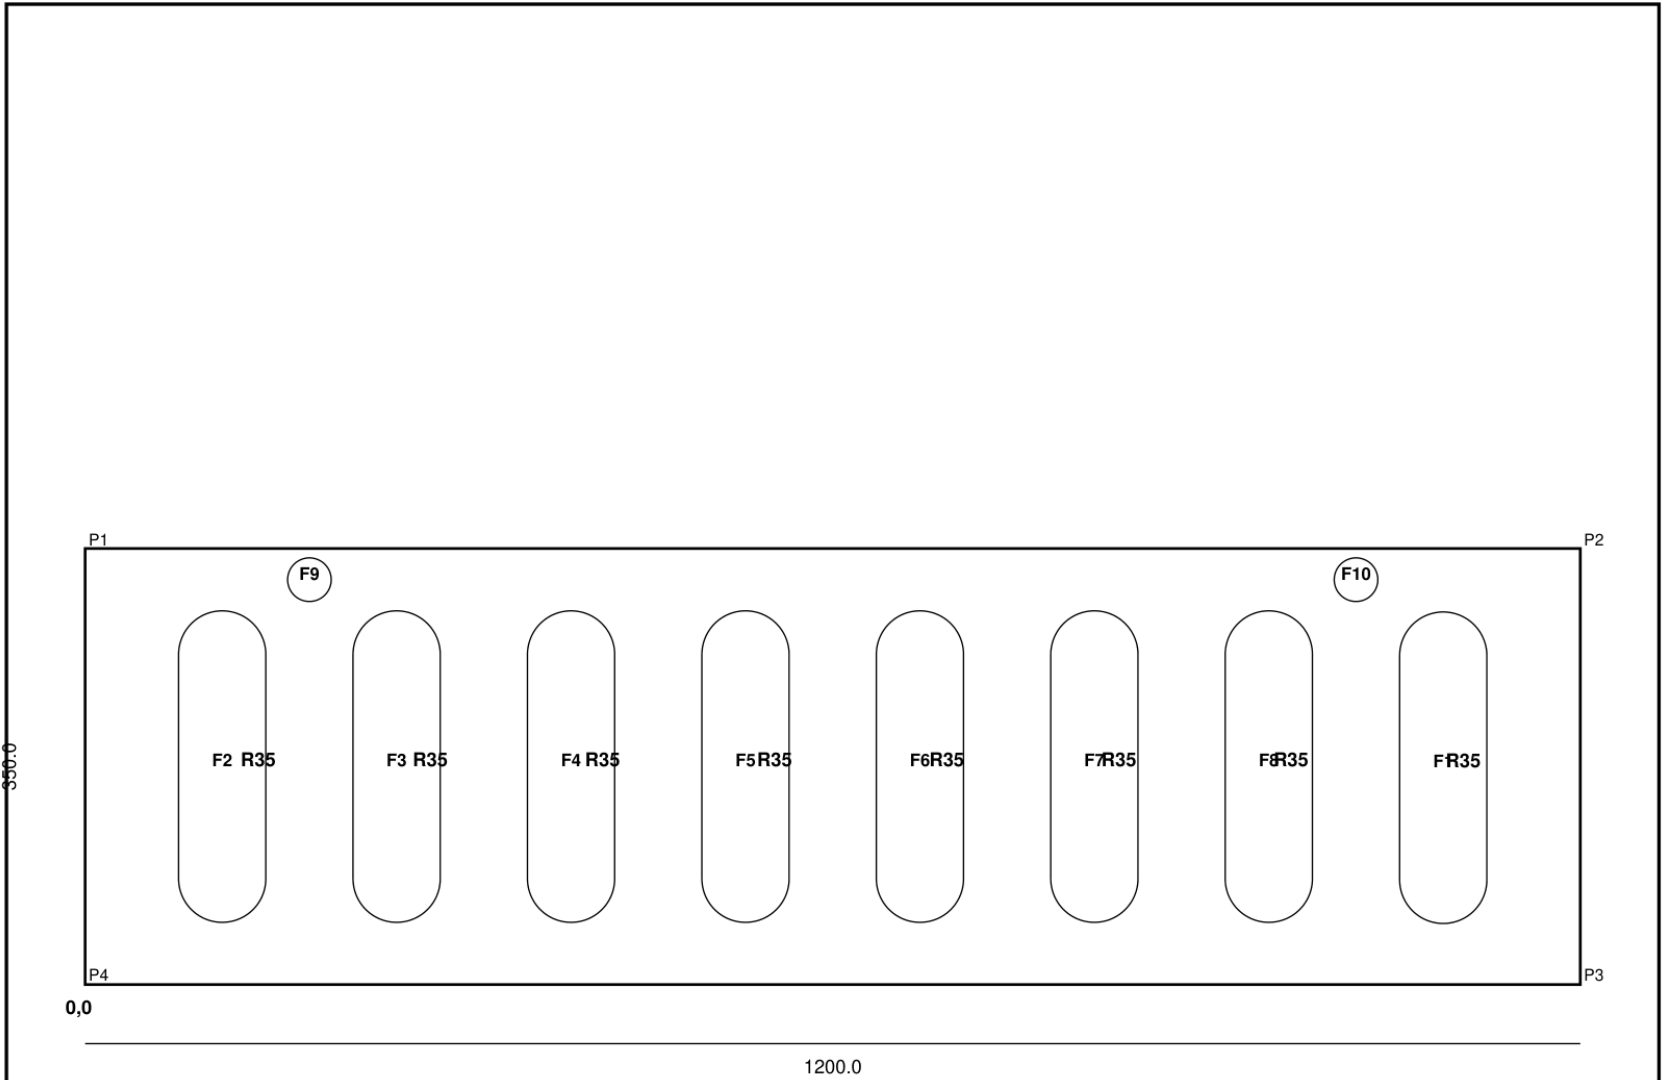

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 70.0 x 250.0, R35 X 1090.0 Y 174.1
- F2 slot/cut-out 70.0 x 250.0, R35 X 110.0 Y 175.0
- F3 slot/cut-out 70.0 x 250.0, R35 X 250.0 Y 175.0
- F4 slot/cut-out 70.0 x 250.0, R35 X 390.0 Y 175.0
- F5 slot/cut-out 70.0 x 250.0, R35 X 530.0 Y 175.0
- F6 slot/cut-out 70.0 x 250.0, R35 X 670.0 Y 175.0
- F7 slot/cut-out 70.0 x 250.0, R35 X 810.0 Y 175.0
- F8 slot/cut-out 70.0 x 250.0, R35 X 950.0 Y 175.0
- F9 Dia 35 x 13 deep X 180.0 Y 325.0
- F10 Dia 35 x 13 deep X 1020.0 Y 325.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y350.0 LINE
 - P2 X1200.0 Y350.0 LINE
 - P3 X1200.0 Y0.0 LINE
 - P4 X0.0 Y0.0 LINE
- Page 6

S1-C - Part detail

Overall 564.0 x 94.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 25.0

F2 Dia 15 x 14 deep X 530.0 Y 25.0

F3 Dia 15 x 14 deep X 34.0 Y 69.0

F4 Dia 15 x 14 deep X 530.0 Y 69.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.


P1 X0.0 Y0.0 LINE

P2 X564.0 Y0.0 LINE

P3 X564.0 Y94.0 ARC R3981.2 to P4

P4 X0.0 Y94.0 LINE to P1

Centre of curved edge = 84.0 mm high (10 mm sag)

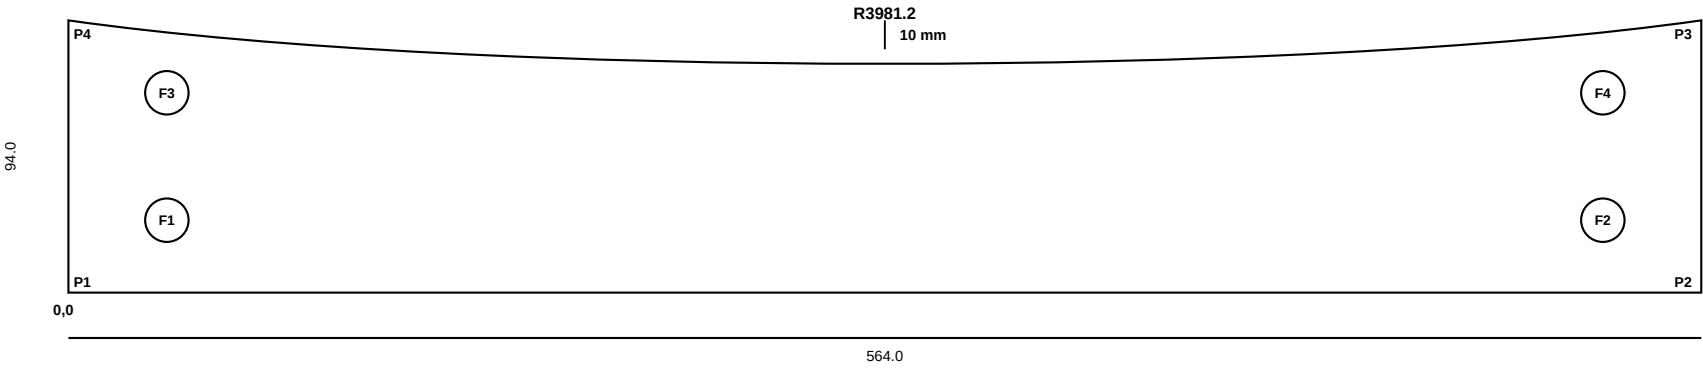

S1-D - Part detail

Overall 564.0 x 94.0 mm | 18 mm plywood | datum lower-left = X0 Y0

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 15 x 14 deep X 34.0 Y 25.0

F2 Dia 15 x 14 deep X 530.0 Y 25.0

F3 Dia 15 x 14 deep X 34.0 Y 69.0

F4 Dia 15 x 14 deep X 530.0 Y 69.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.


P1 X0.0 Y0.0 LINE


P2 X564.0 Y0.0 LINE

P3 X564.0 Y94.0 ARC R3981.2 to P4

P4 X0.0 Y94.0 LINE to P1

Centre of curved edge = 84.0 mm high (10 mm sag)

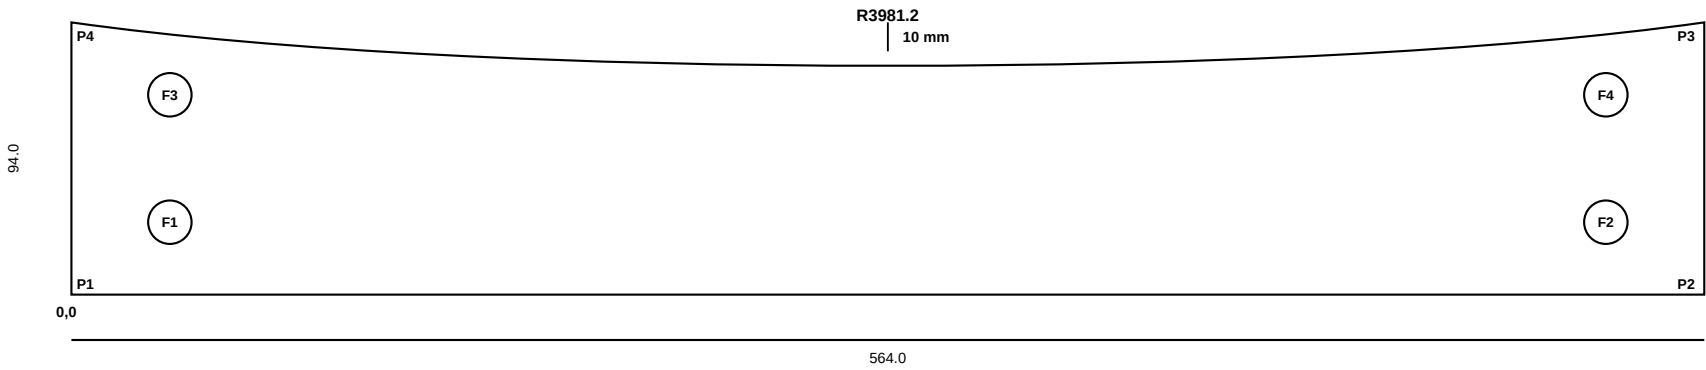

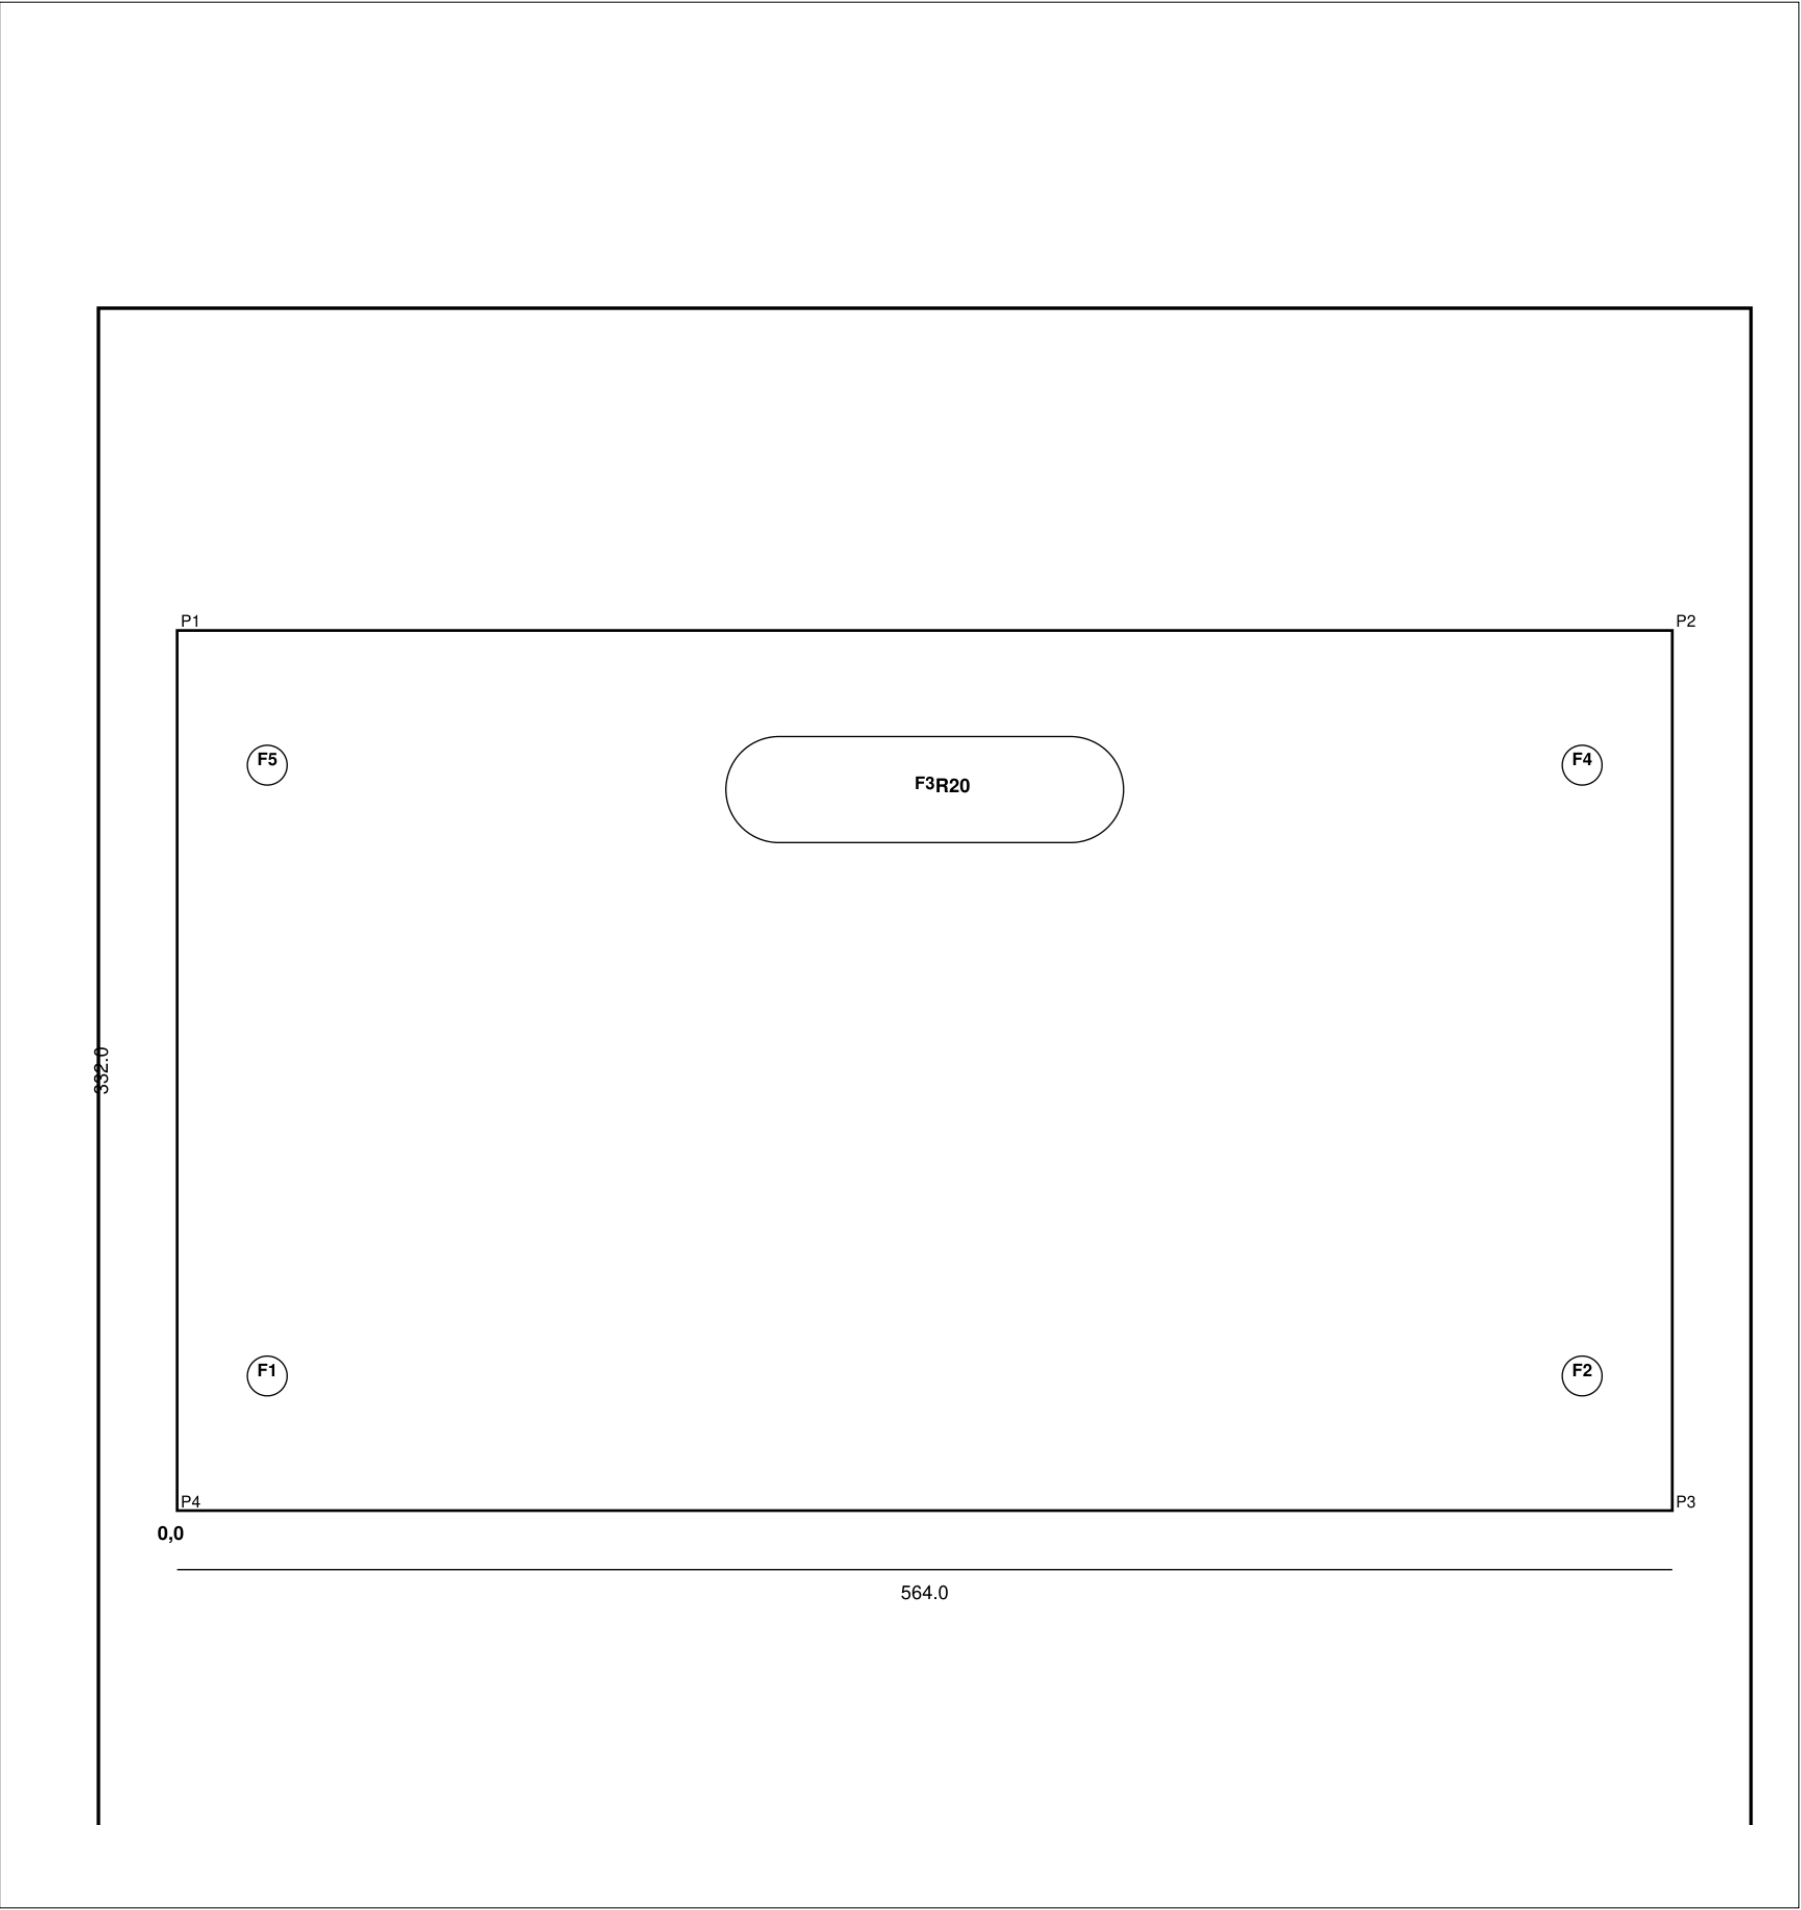


X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 50.8
- F2 Dia 15 x 14 deep X 530.0 Y 50.8
- F3 slot/cut-out 150.0 x 40.0, R20 X 282.0 Y 272.0
- F4 Dia 15 x 14 deep X 530.0 Y 281.2
- F5 Dia 15 x 14 deep X 34.0 Y 281.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
- P2 X564.0 Y332.0 LINE
- P3 X564.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE
- Page 7

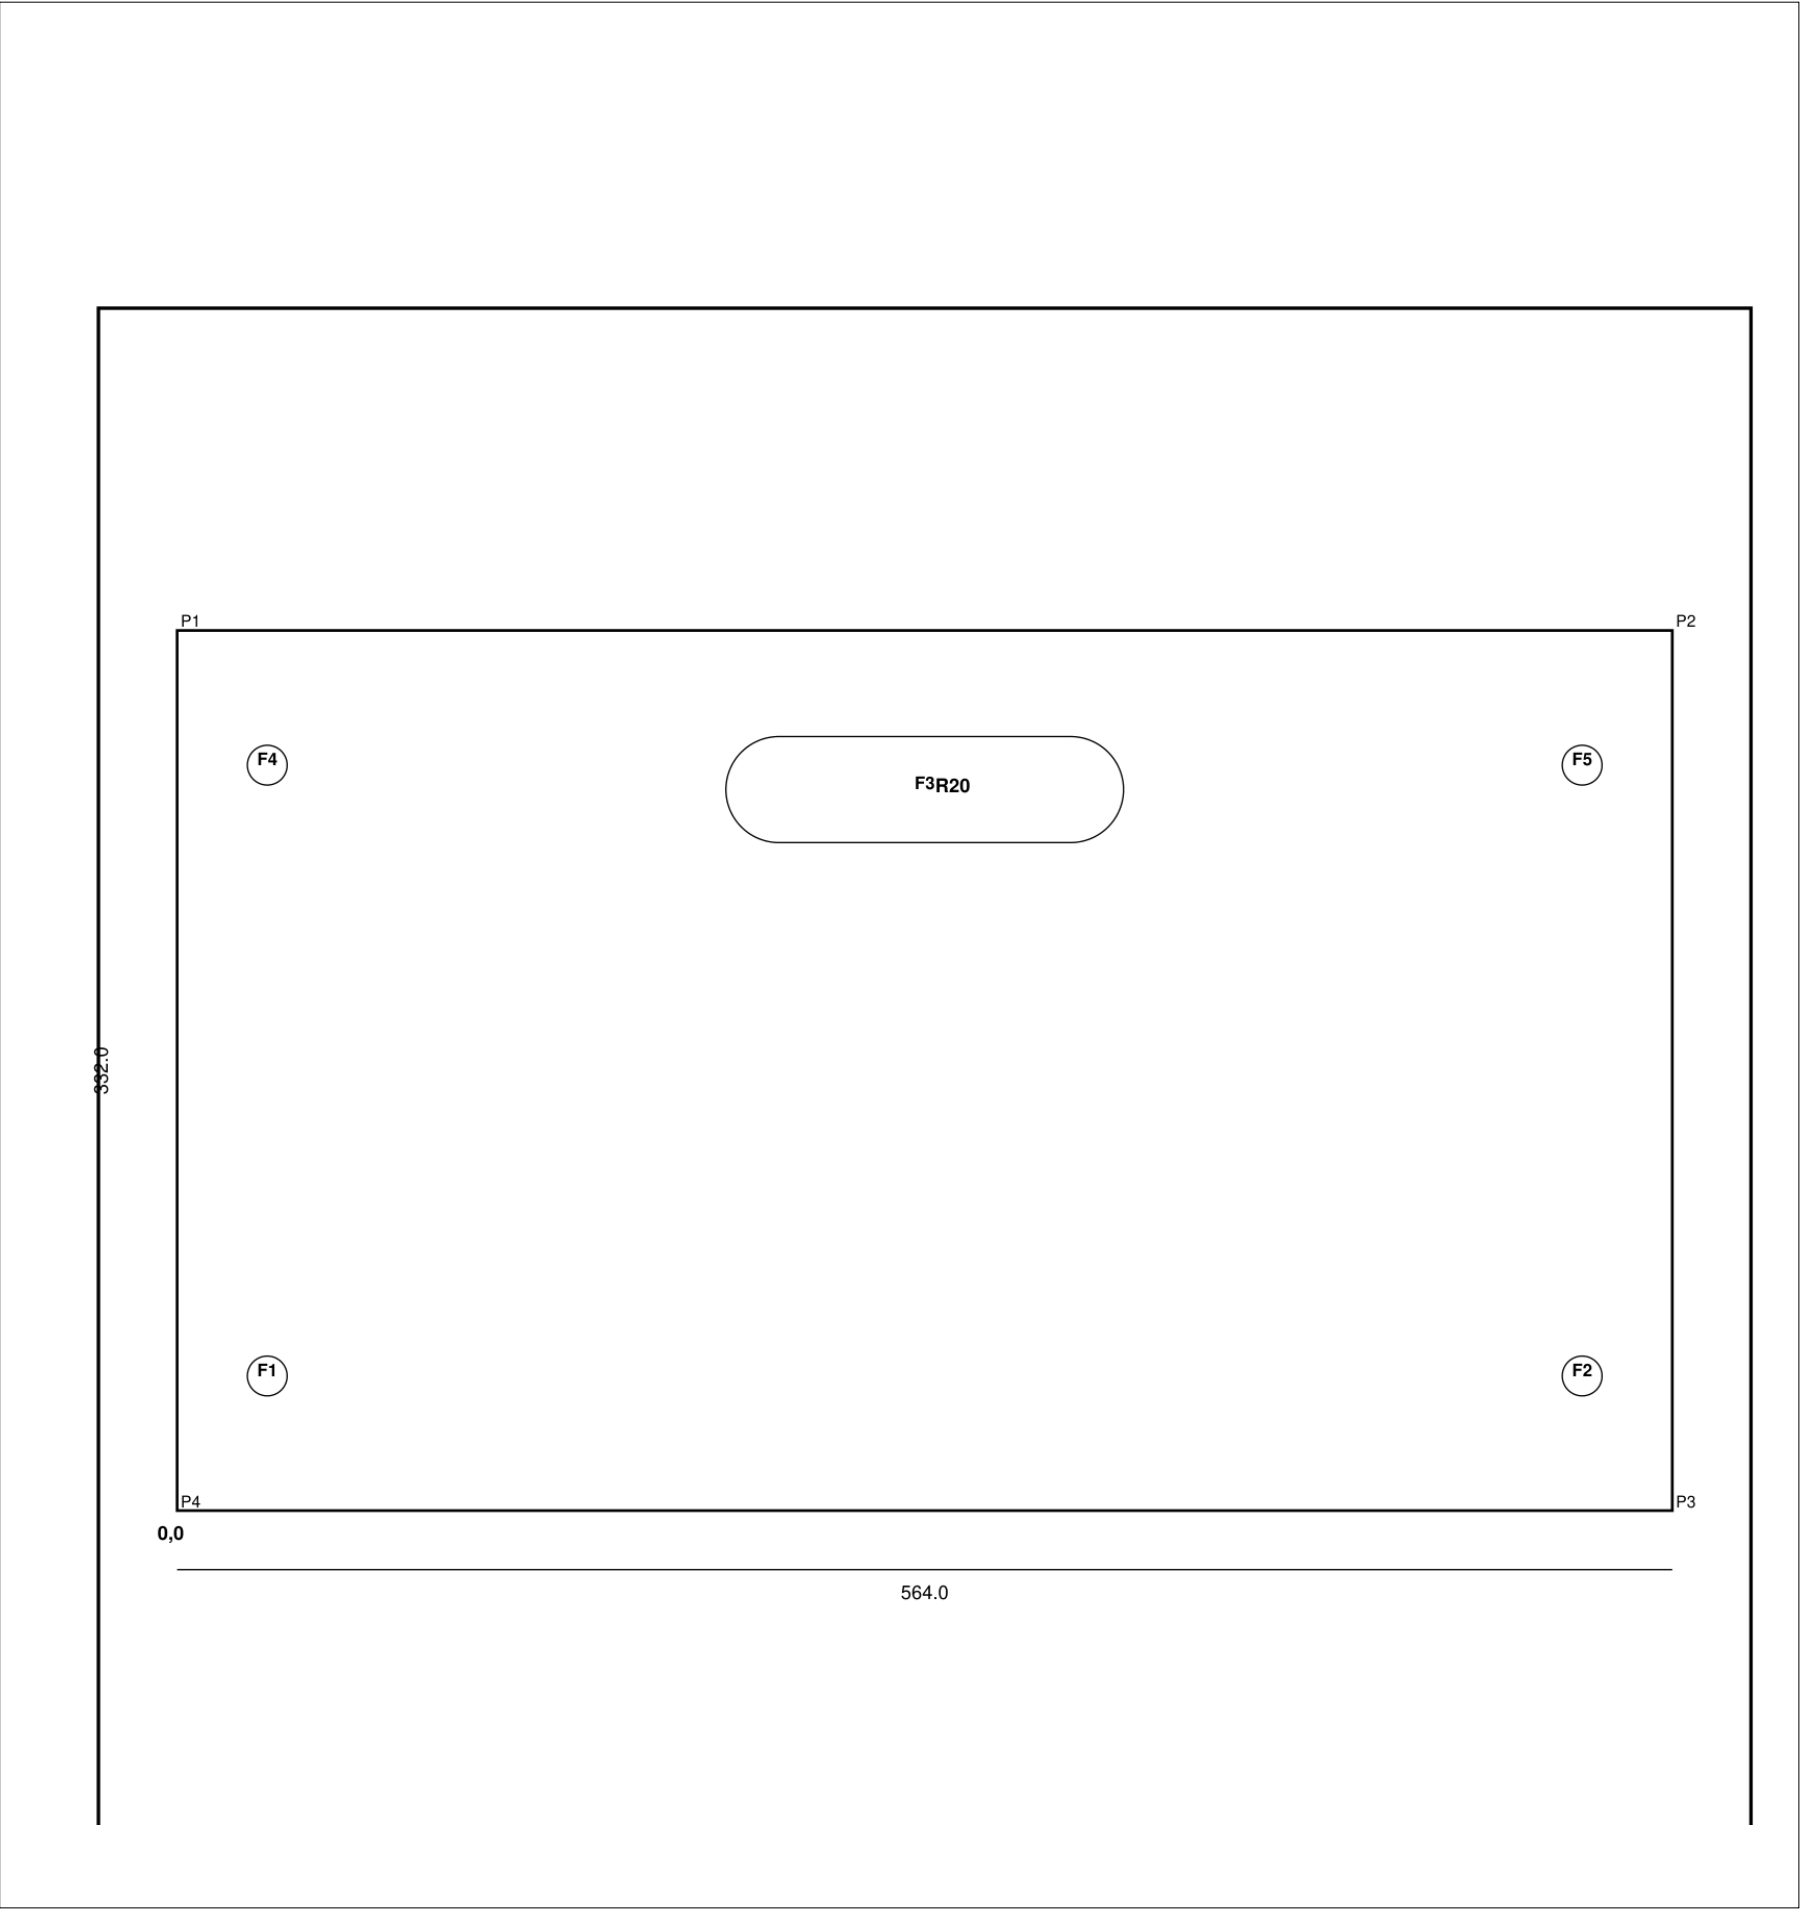


X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 34.0 Y 50.8
- F2 Dia 15 x 14 deep X 530.0 Y 50.8
- F3 slot/cut-out 150.0 x 40.0, R20 X 282.0 Y 272.0
- F4 Dia 15 x 14 deep X 34.0 Y 281.2
- F5 Dia 15 x 14 deep X 530.0 Y 281.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
- P2 X564.0 Y332.0 LINE
- P3 X564.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE
- Page 8

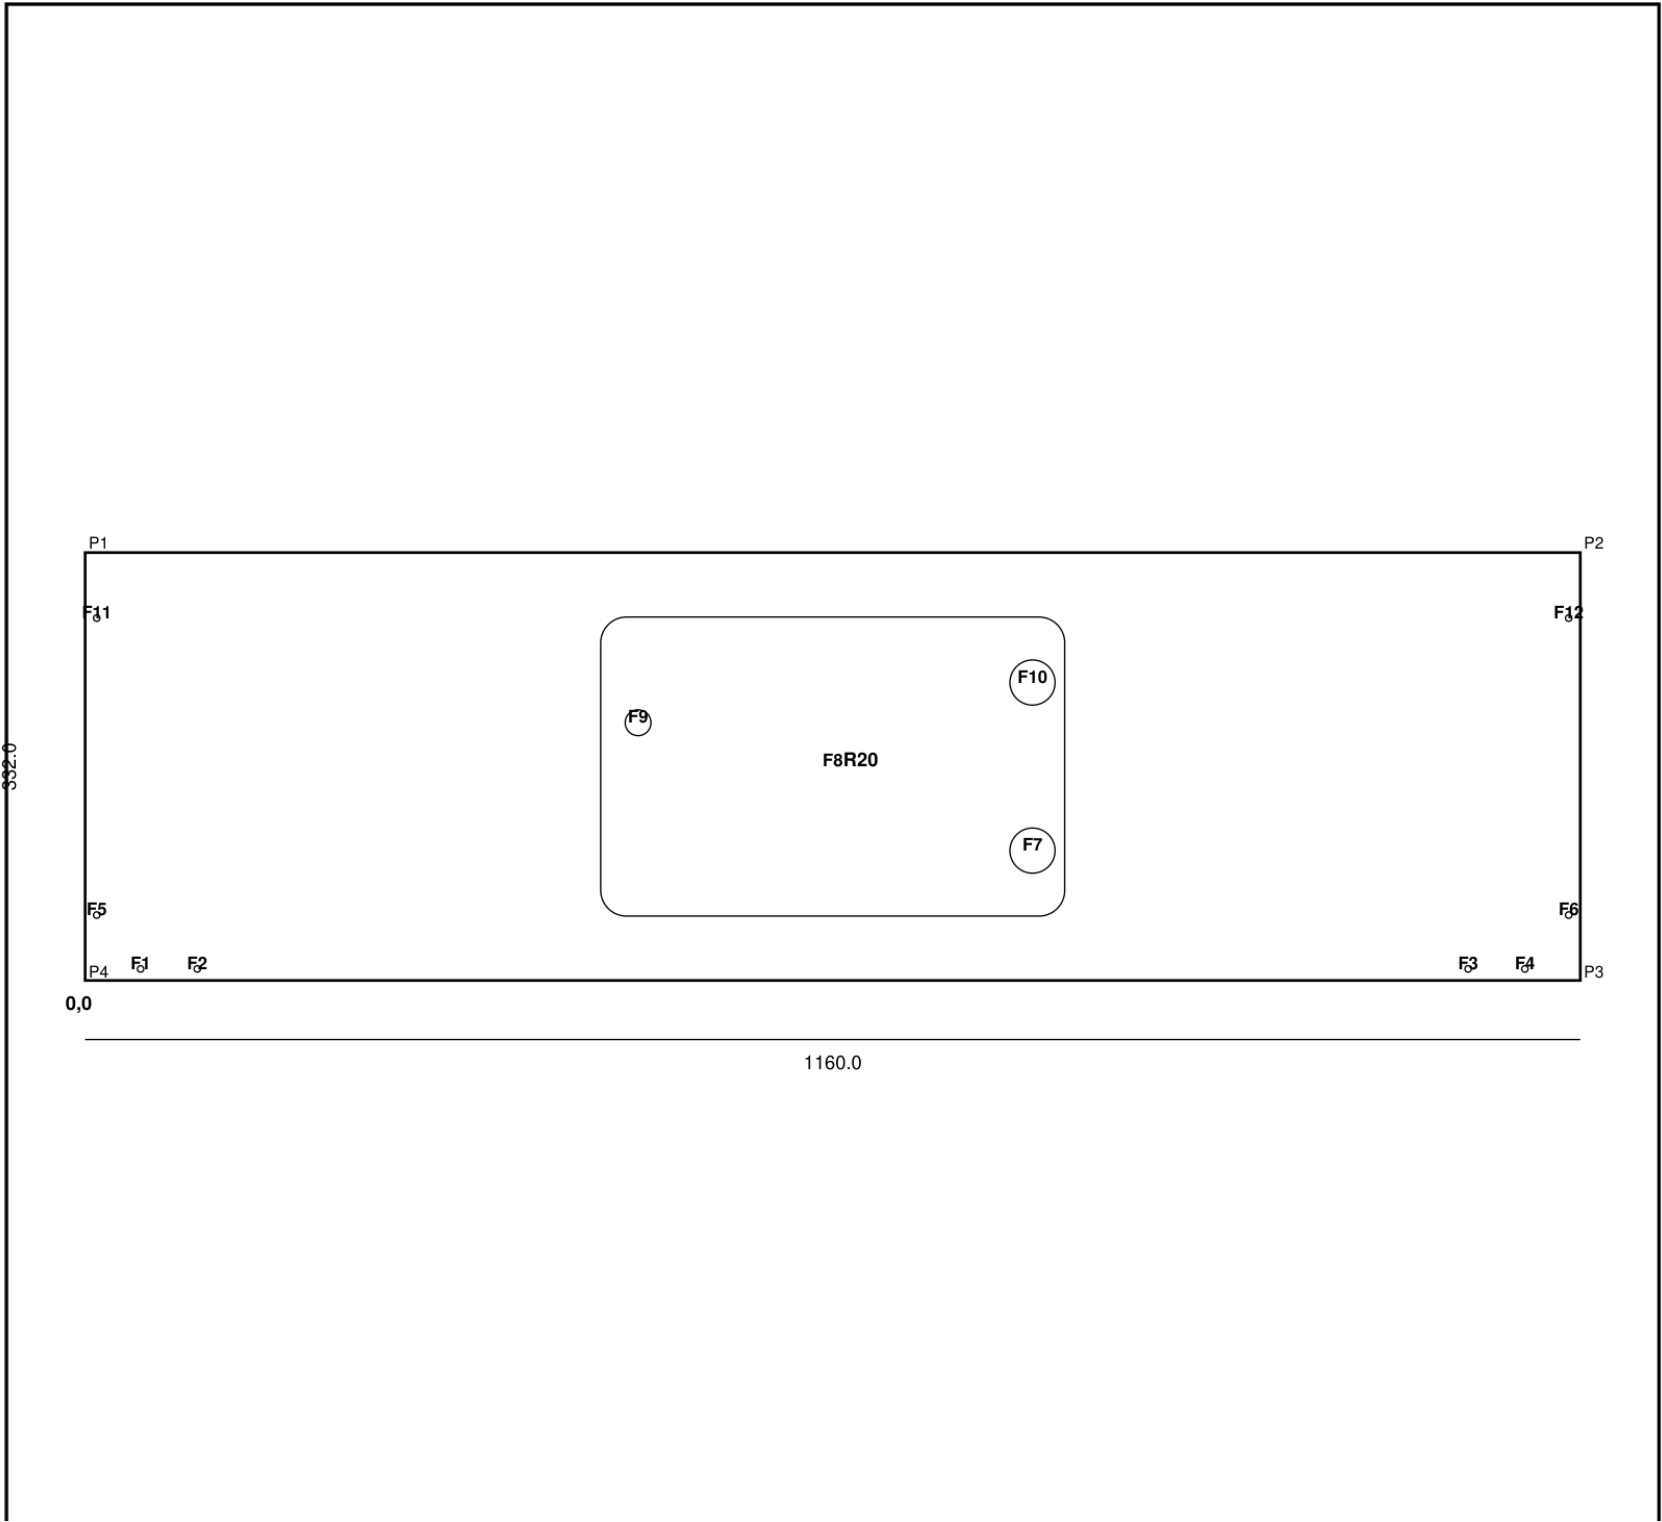


X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 43.0 Y 9.0
- F2 Dia 5 x 11 deep X 87.0 Y 9.0
- F3 Dia 5 x 11 deep X 1073.0 Y 9.0
- F4 Dia 5 x 11 deep X 1117.0 Y 9.0
- F5 Dia 5 x 11 deep X 9.0 Y 50.8
- F6 Dia 5 x 11 deep X 1151.0 Y 50.8
- F7 Dia 35 x 13 deep X 735.0 Y 100.8
- F8 cut-out 360.0 x 232.0, R20 X 580.0 Y 166.0
- F9 Dia 20 THROUGH X 429.0 Y 200.0
- F10 Dia 35 x 13 deep X 735.0 Y 231.2
- F11 Dia 5 x 11 deep X 9.0 Y 281.2
- F12 Dia 5 x 11 deep X 1151.0 Y 281.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
 - P2 X1160.0 Y332.0 LINE
 - P3 X1160.0 Y0.0 LINE
 - P4 X0.0 Y0.0 LINE
- Page 9

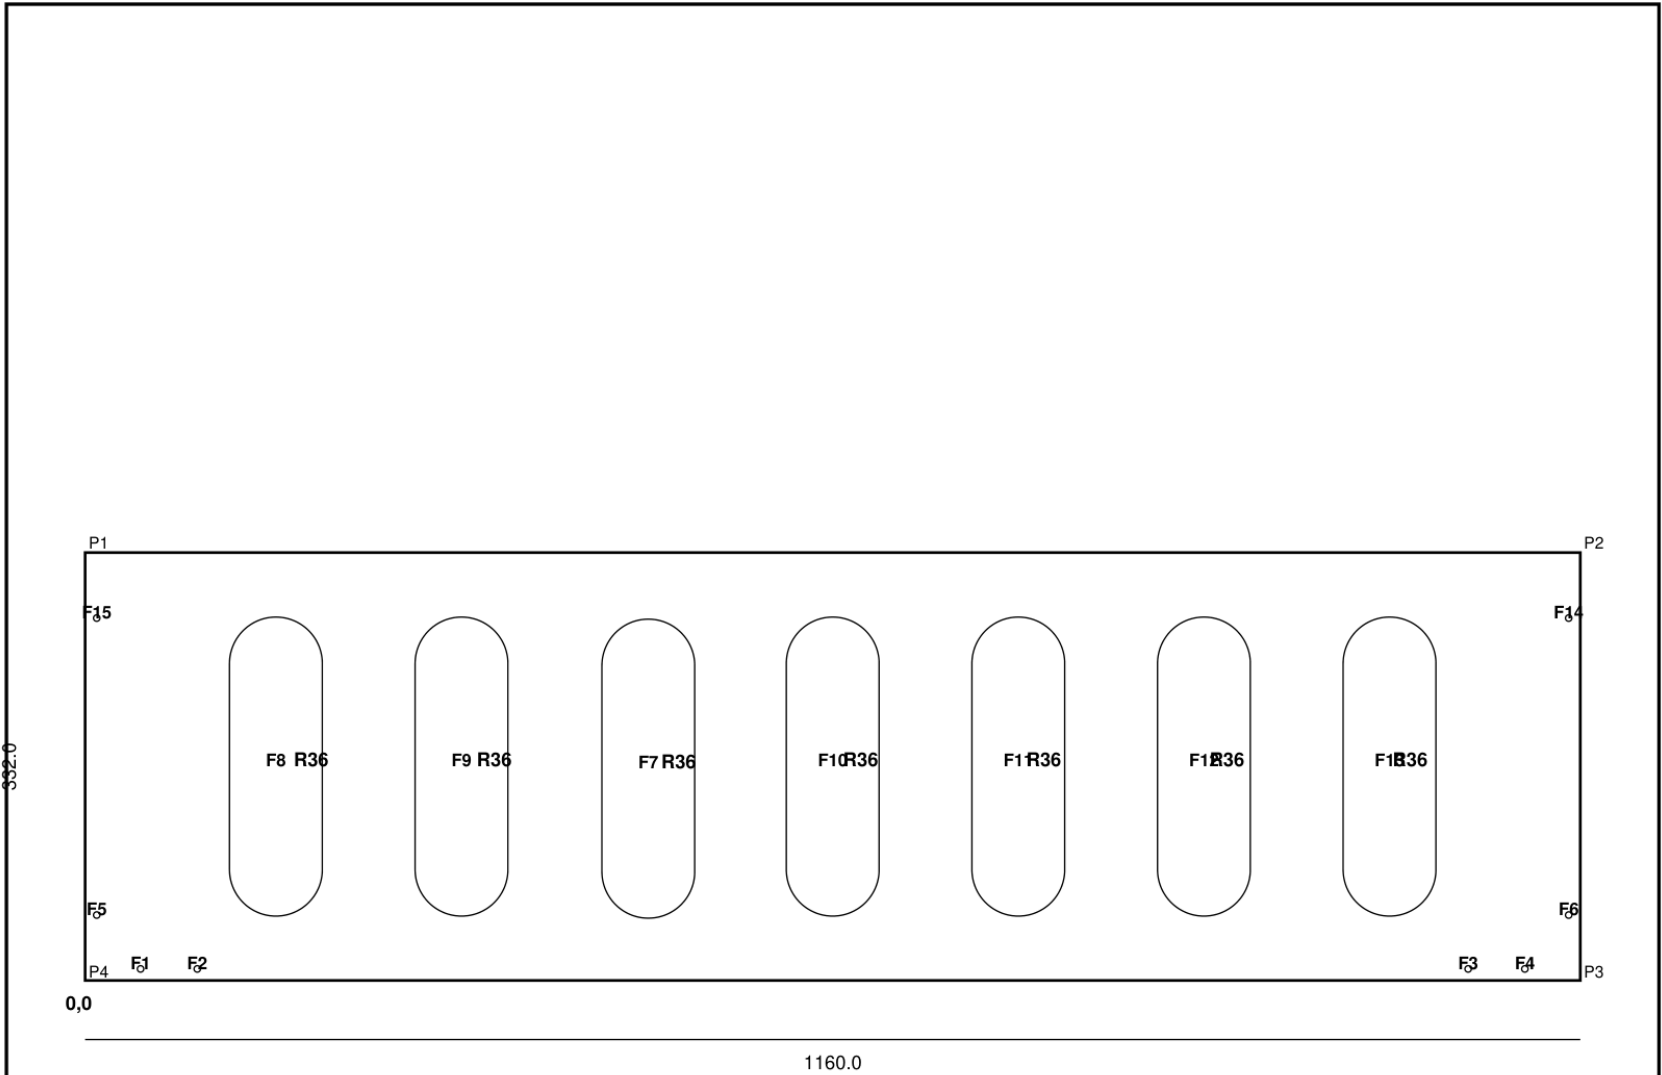


X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 5 x 11 deep X 43.0 Y 9.0
- F2 Dia 5 x 11 deep X 87.0 Y 9.0
- F3 Dia 5 x 11 deep X 1073.0 Y 9.0
- F4 Dia 5 x 11 deep X 1117.0 Y 9.0
- F5 Dia 5 x 11 deep X 9.0 Y 50.8
- F6 Dia 5 x 11 deep X 1151.0 Y 50.8
- F7 slot/cut-out 72.0 x 232.0, R36 X 436.9 Y 164.4
- F8 slot/cut-out 72.0 x 232.0, R36 X 148.0 Y 166.0
- F9 slot/cut-out 72.0 x 232.0, R36 X 292.0 Y 166.0
- F10 slot/cut-out 72.0 x 232.0, R36 X 580.0 Y 166.0
- F11 slot/cut-out 72.0 x 232.0, R36 X 724.0 Y 166.0
- F12 slot/cut-out 72.0 x 232.0, R36 X 868.0 Y 166.0
- F13 slot/cut-out 72.0 x 232.0, R36 X 1012.0 Y 166.0
- F14 Dia 5 x 11 deep X 1151.0 Y 281.2
- F15 Dia 5 x 11 deep X 9.0 Y 281.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
 - P points are labelled on the drawing. Join each point to the next as shown.
 - P1 X0.0 Y332.0 LINE
 - P2 X1160.0 Y332.0 LINE
 - P3 X1160.0 Y0.0 LINE
 - P4 X0.0 Y0.0 LINE
- Page 10

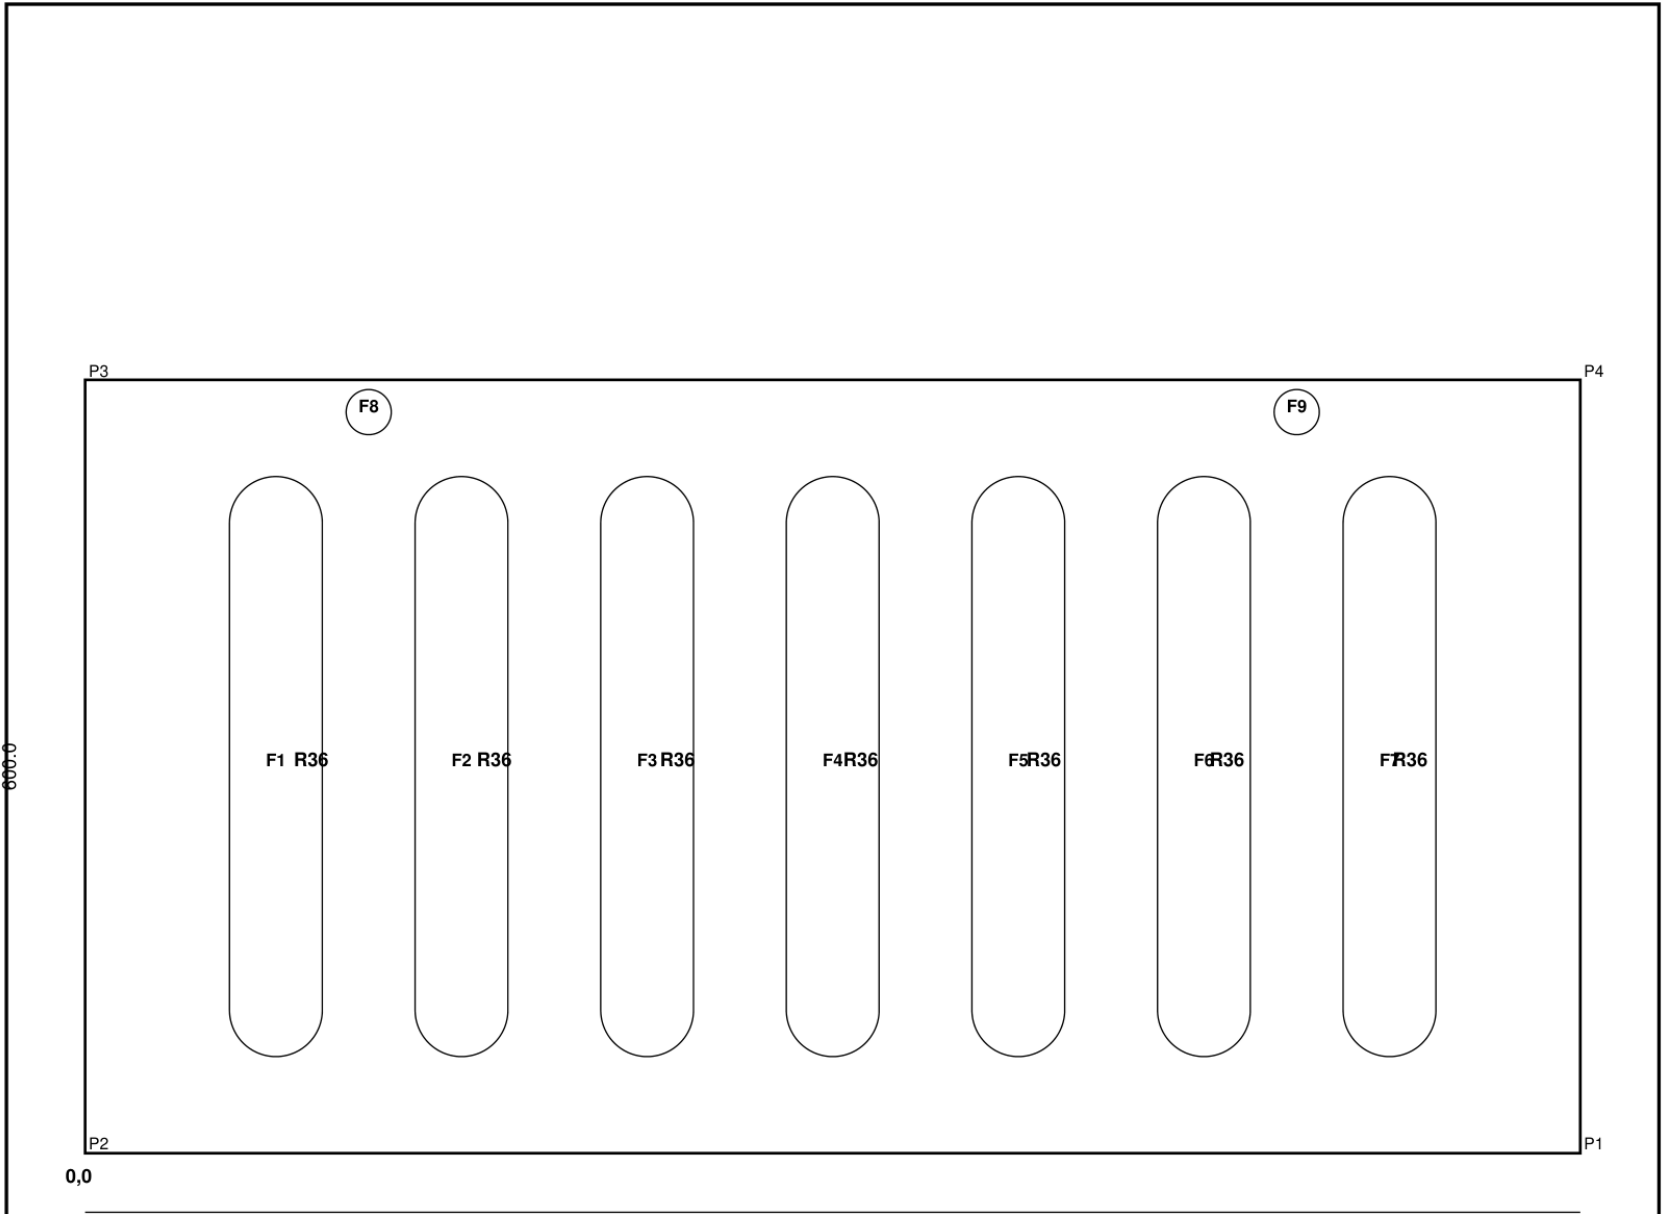

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 slot/cut-out 72.0 x 450.0, R36 X 148.0 Y 300.0
- F2 slot/cut-out 72.0 x 450.0, R36 X 292.0 Y 300.0
- F3 slot/cut-out 72.0 x 450.0, R36 X 436.0 Y 300.0
- F4 slot/cut-out 72.0 x 450.0, R36 X 580.0 Y 300.0
- F5 slot/cut-out 72.0 x 450.0, R36 X 724.0 Y 300.0
- F6 slot/cut-out 72.0 x 450.0, R36 X 868.0 Y 300.0
- F7 slot/cut-out 72.0 x 450.0, R36 X 1012.0 Y 300.0
- F8 Dia 35 x 13 deep X 220.0 Y 575.0
- F9 Dia 35 x 13 deep X 940.0 Y 575.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X1160.0 Y0.0 LINE
- P2 X0.0 Y0.0 LINE
- P3 X0.0 Y600.0 LINE
- P4 X1160.0 Y600.0 LINE
- Page 11

S2-A - Part detail

Overall 318.0 x 306.0 mm | 18 mm plywood | datum lower-left = X0 Y0

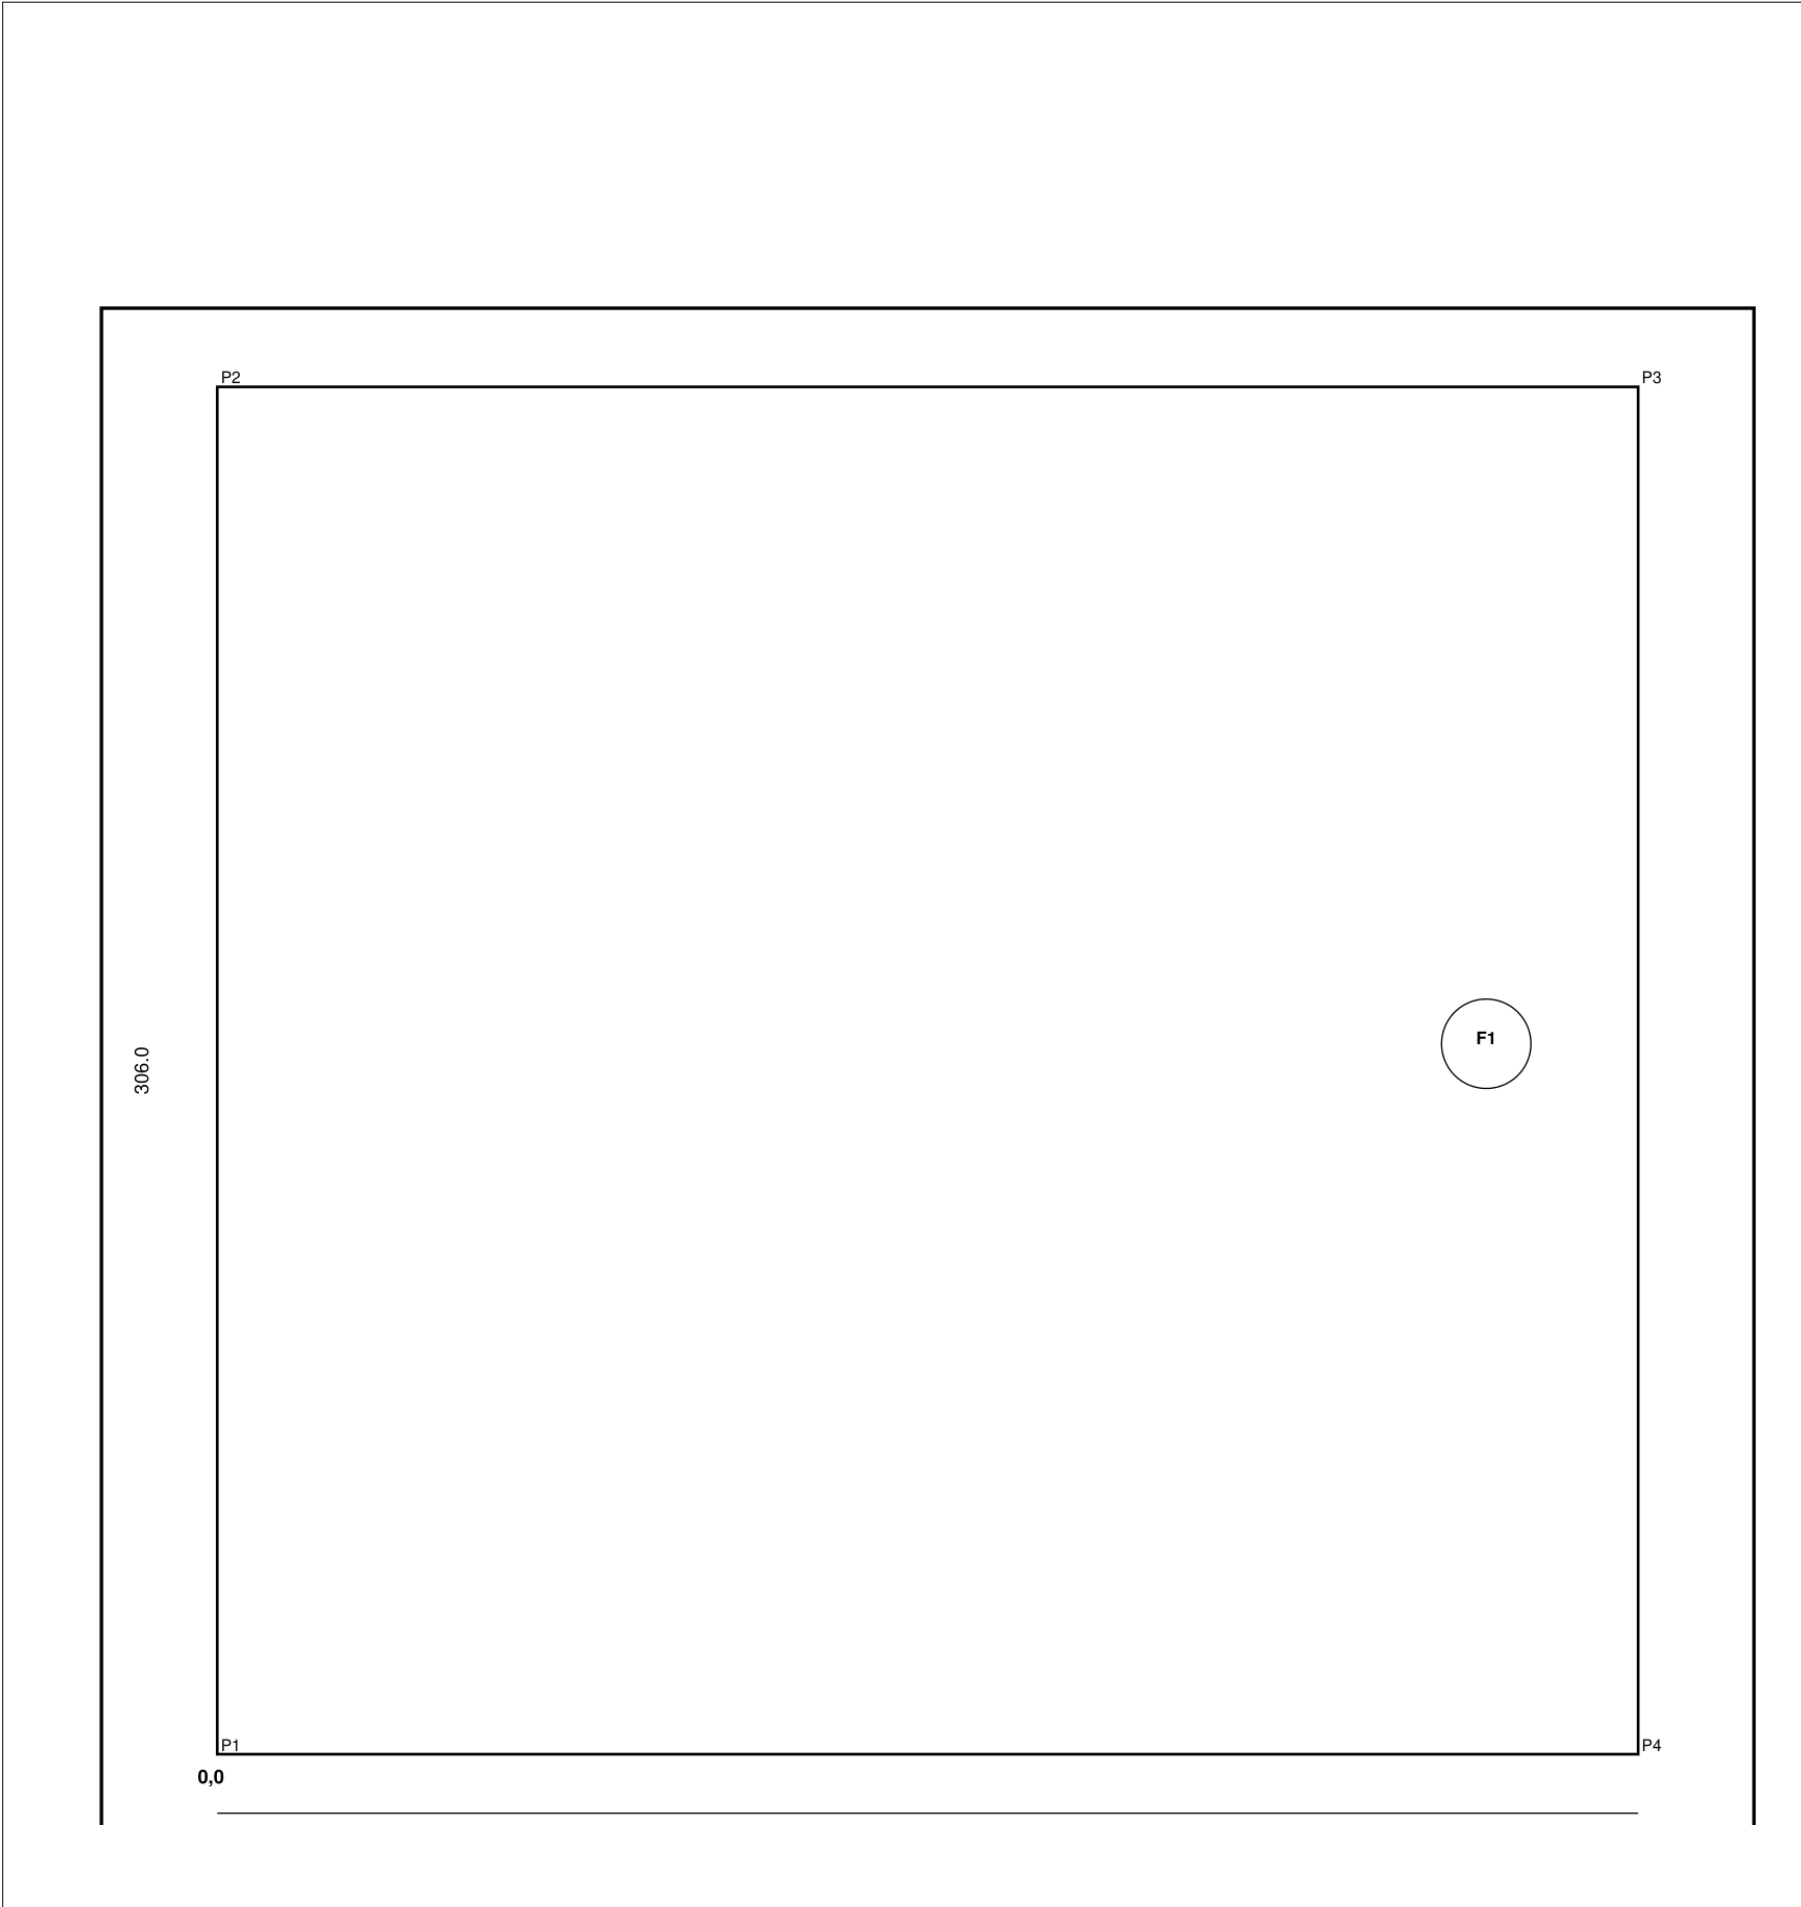

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 20 THROUGH X 284.0 Y 159.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y0.0 LINE

P2 X0.0 Y306.0 LINE


P3 X318.0 Y306.0 LINE

P4 X318.0 Y0.0 LINE

Page 12

S2-B - Part detail

Overall 318.0 x 306.0 mm | 18 mm plywood | datum lower-left = X0 Y0

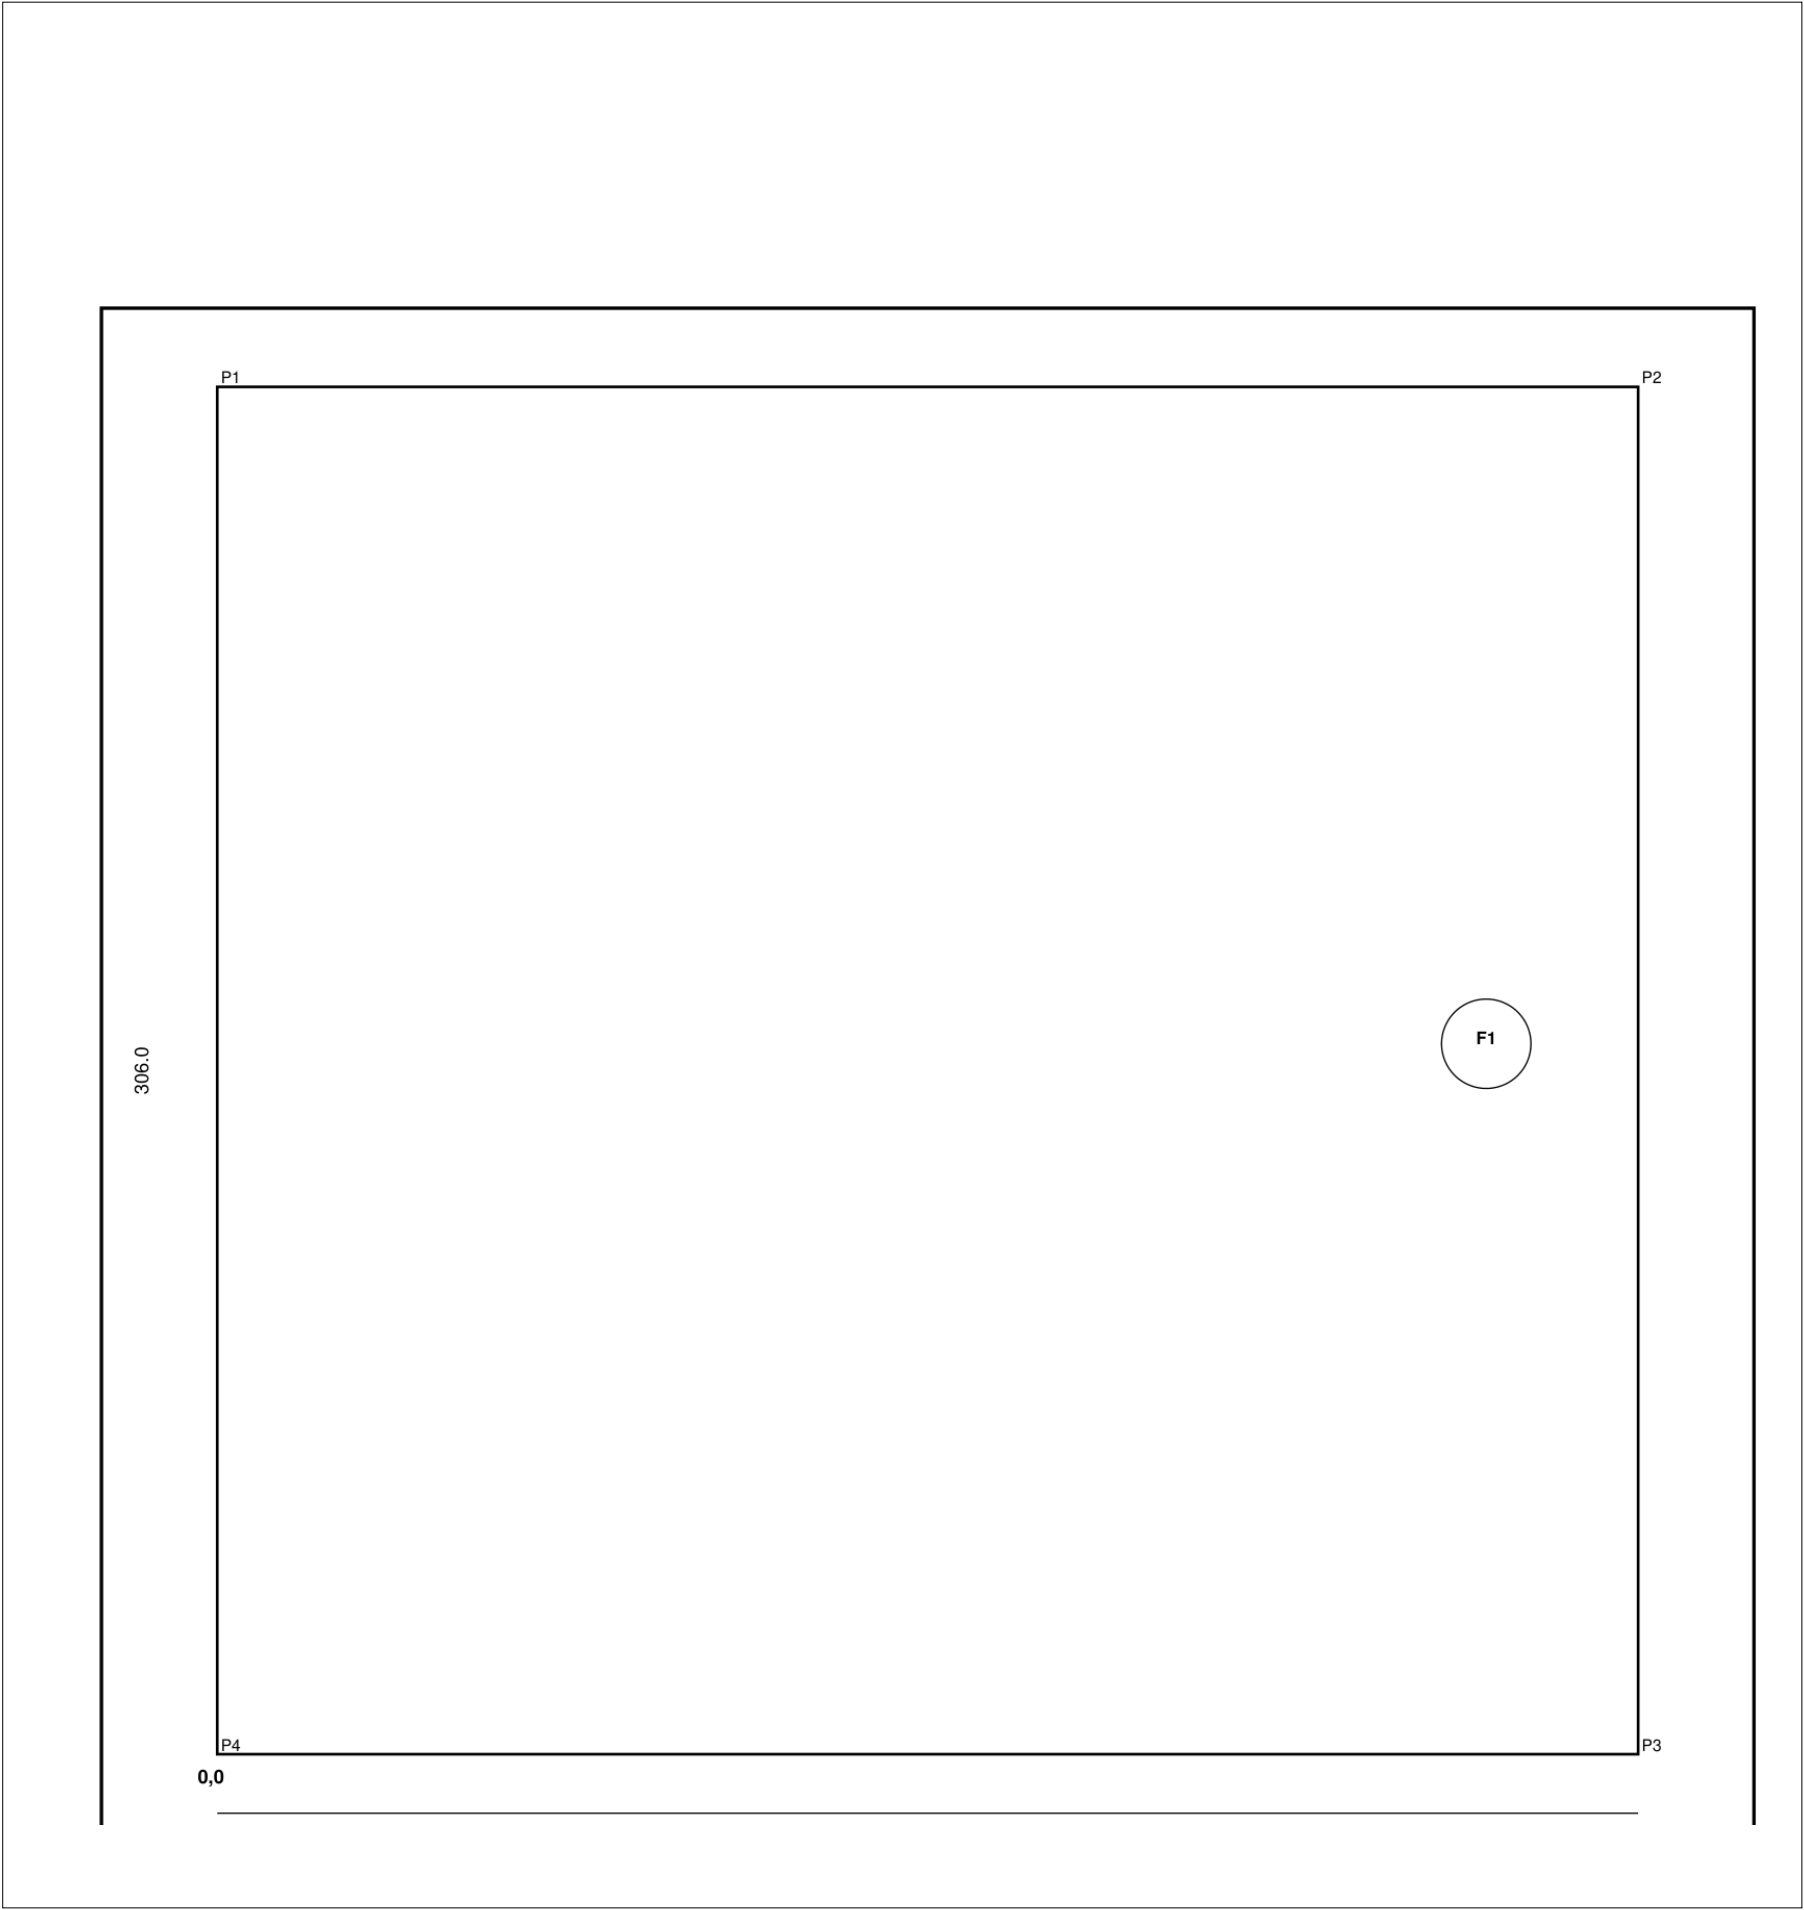

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

F1 Dia 20 THROUGH X 284.0 Y 159.0

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y306.0 LINE

P2 X318.0 Y306.0 LINE


P3 X318.0 Y0.0 LINE

P4 X0.0 Y0.0 LINE

Page 13

S2-C - Part detail

Overall 1200.0 x 458.0 mm | 18 mm plywood | datum lower-left = X0 Y0



X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X0.0 Y20.0 ARC R20 CCW

P2 X20.0 Y0.0 LINE

P3 X1180.0 Y0.0 LINE

P4 X1200.0 Y20.0 ARC R20 CCW

P5 X1200.0 Y438.0 ARC R20 CCW


P6 X1180.0 Y458.0 LINE

P7 X20.0 Y458.0 LINE

P8 X0.0 Y438.0 ARC R20 CCW

S2-D - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

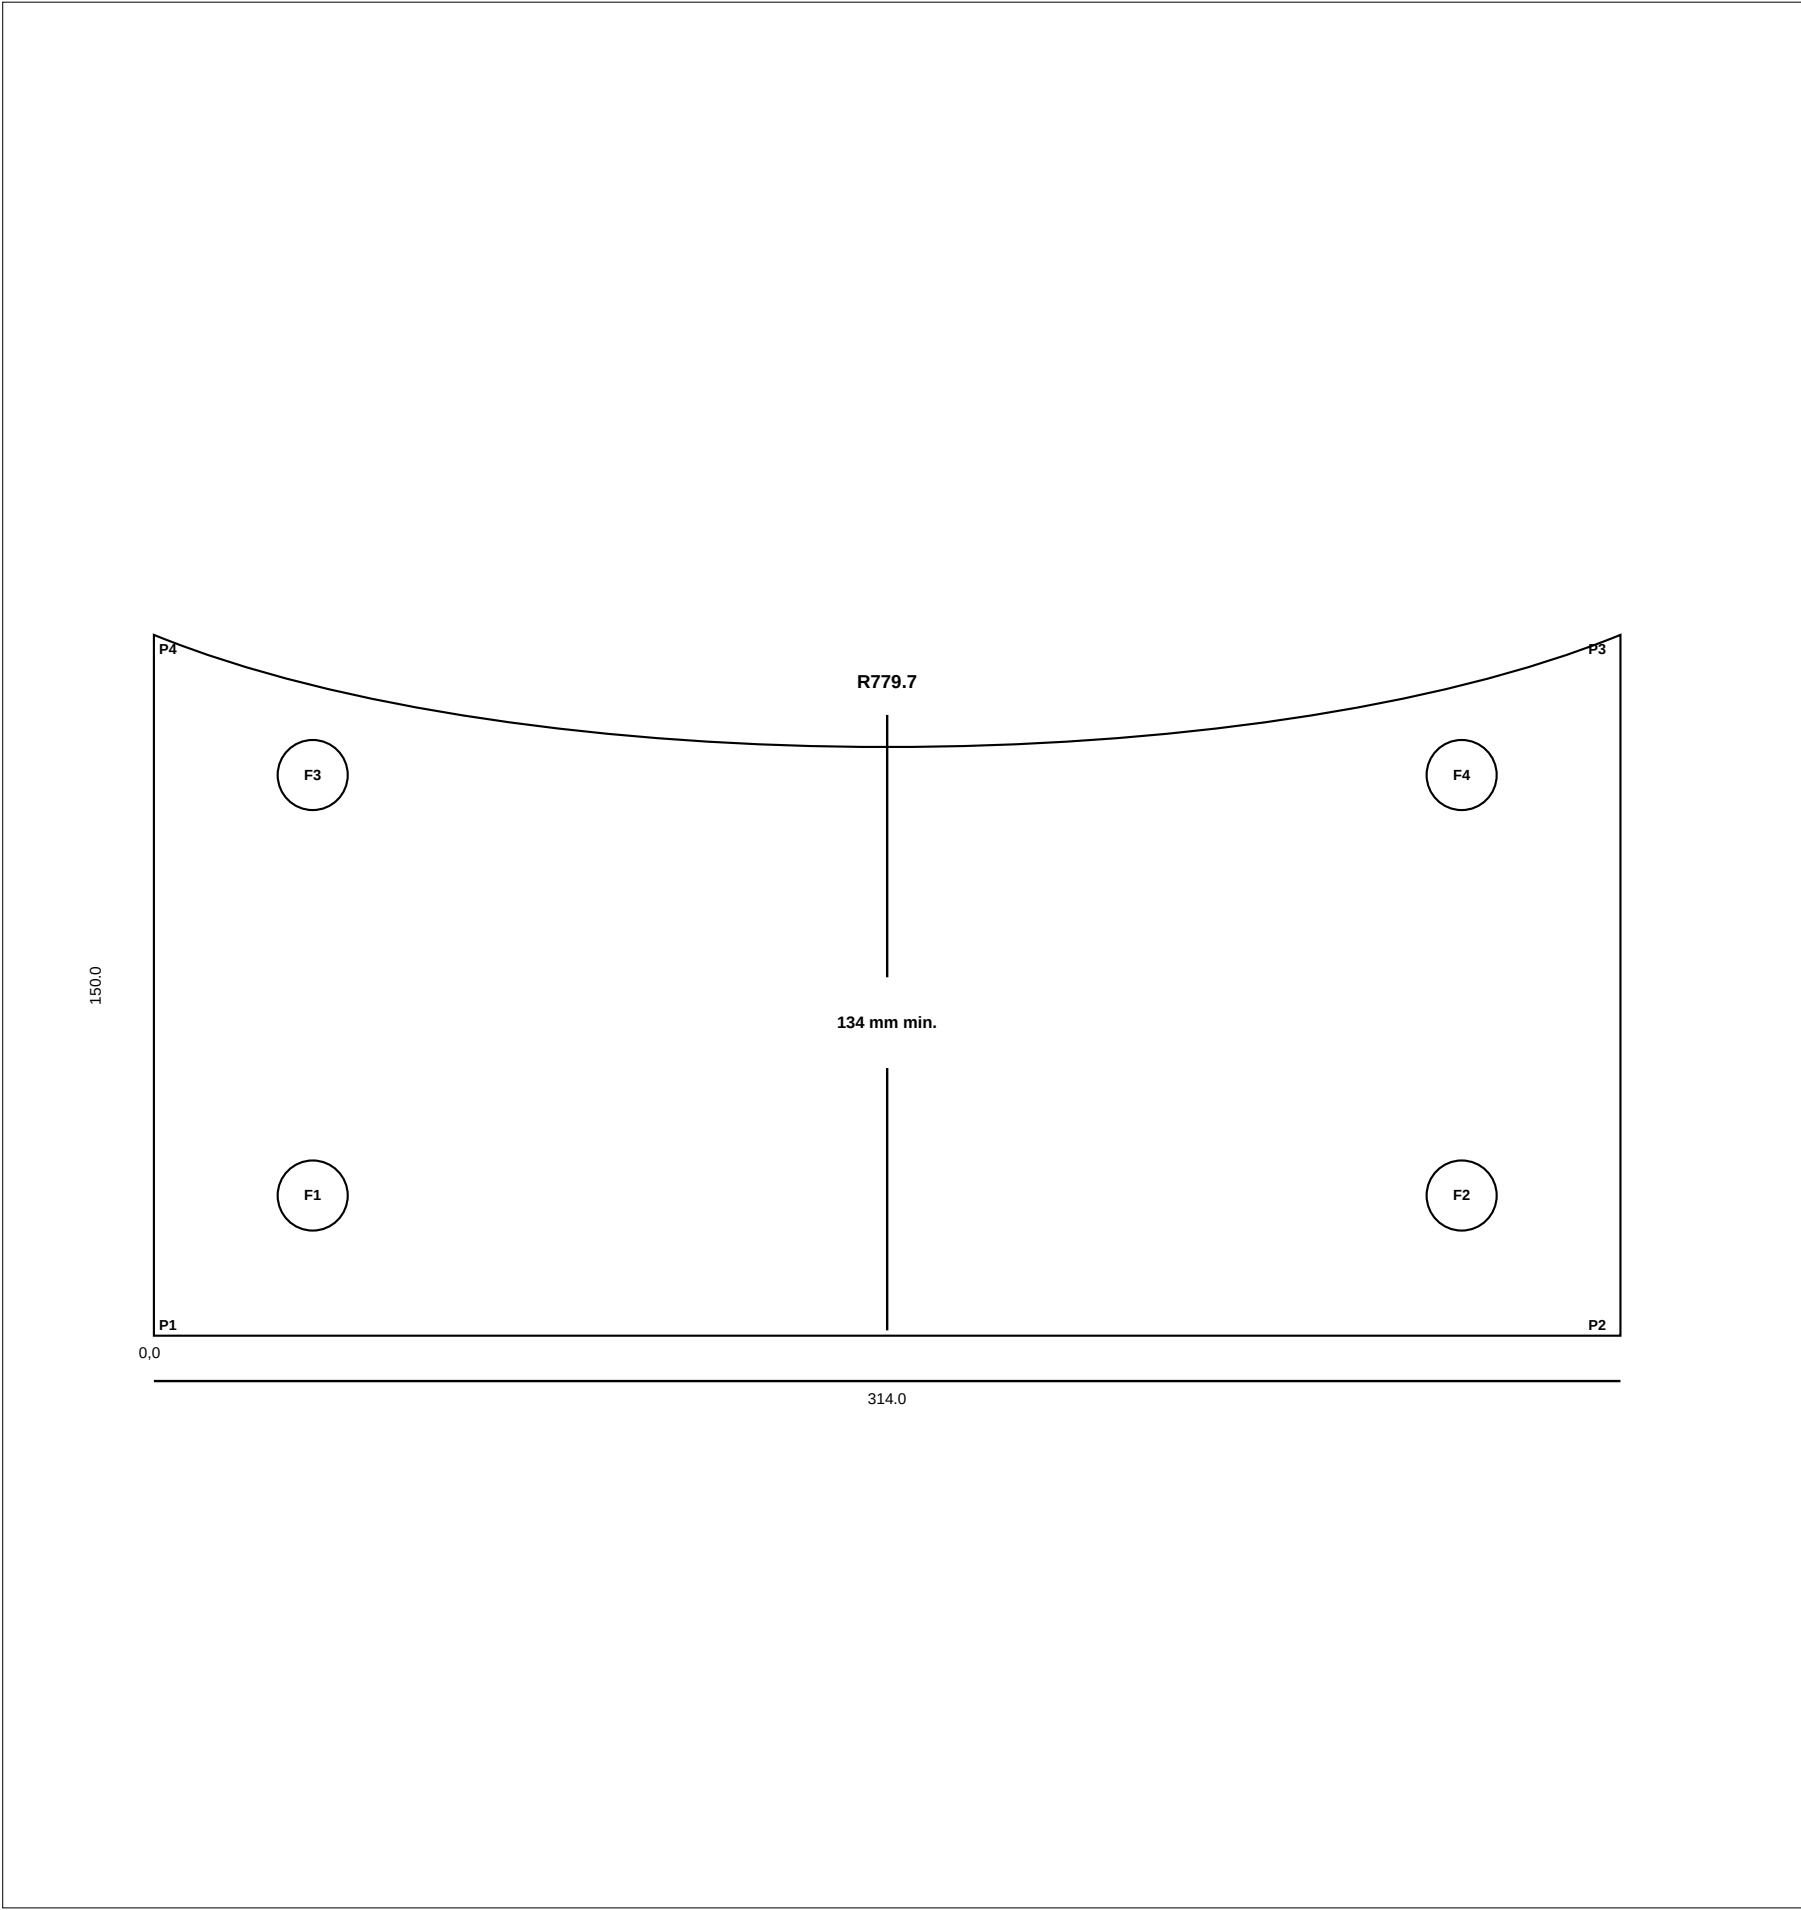

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S2-E - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

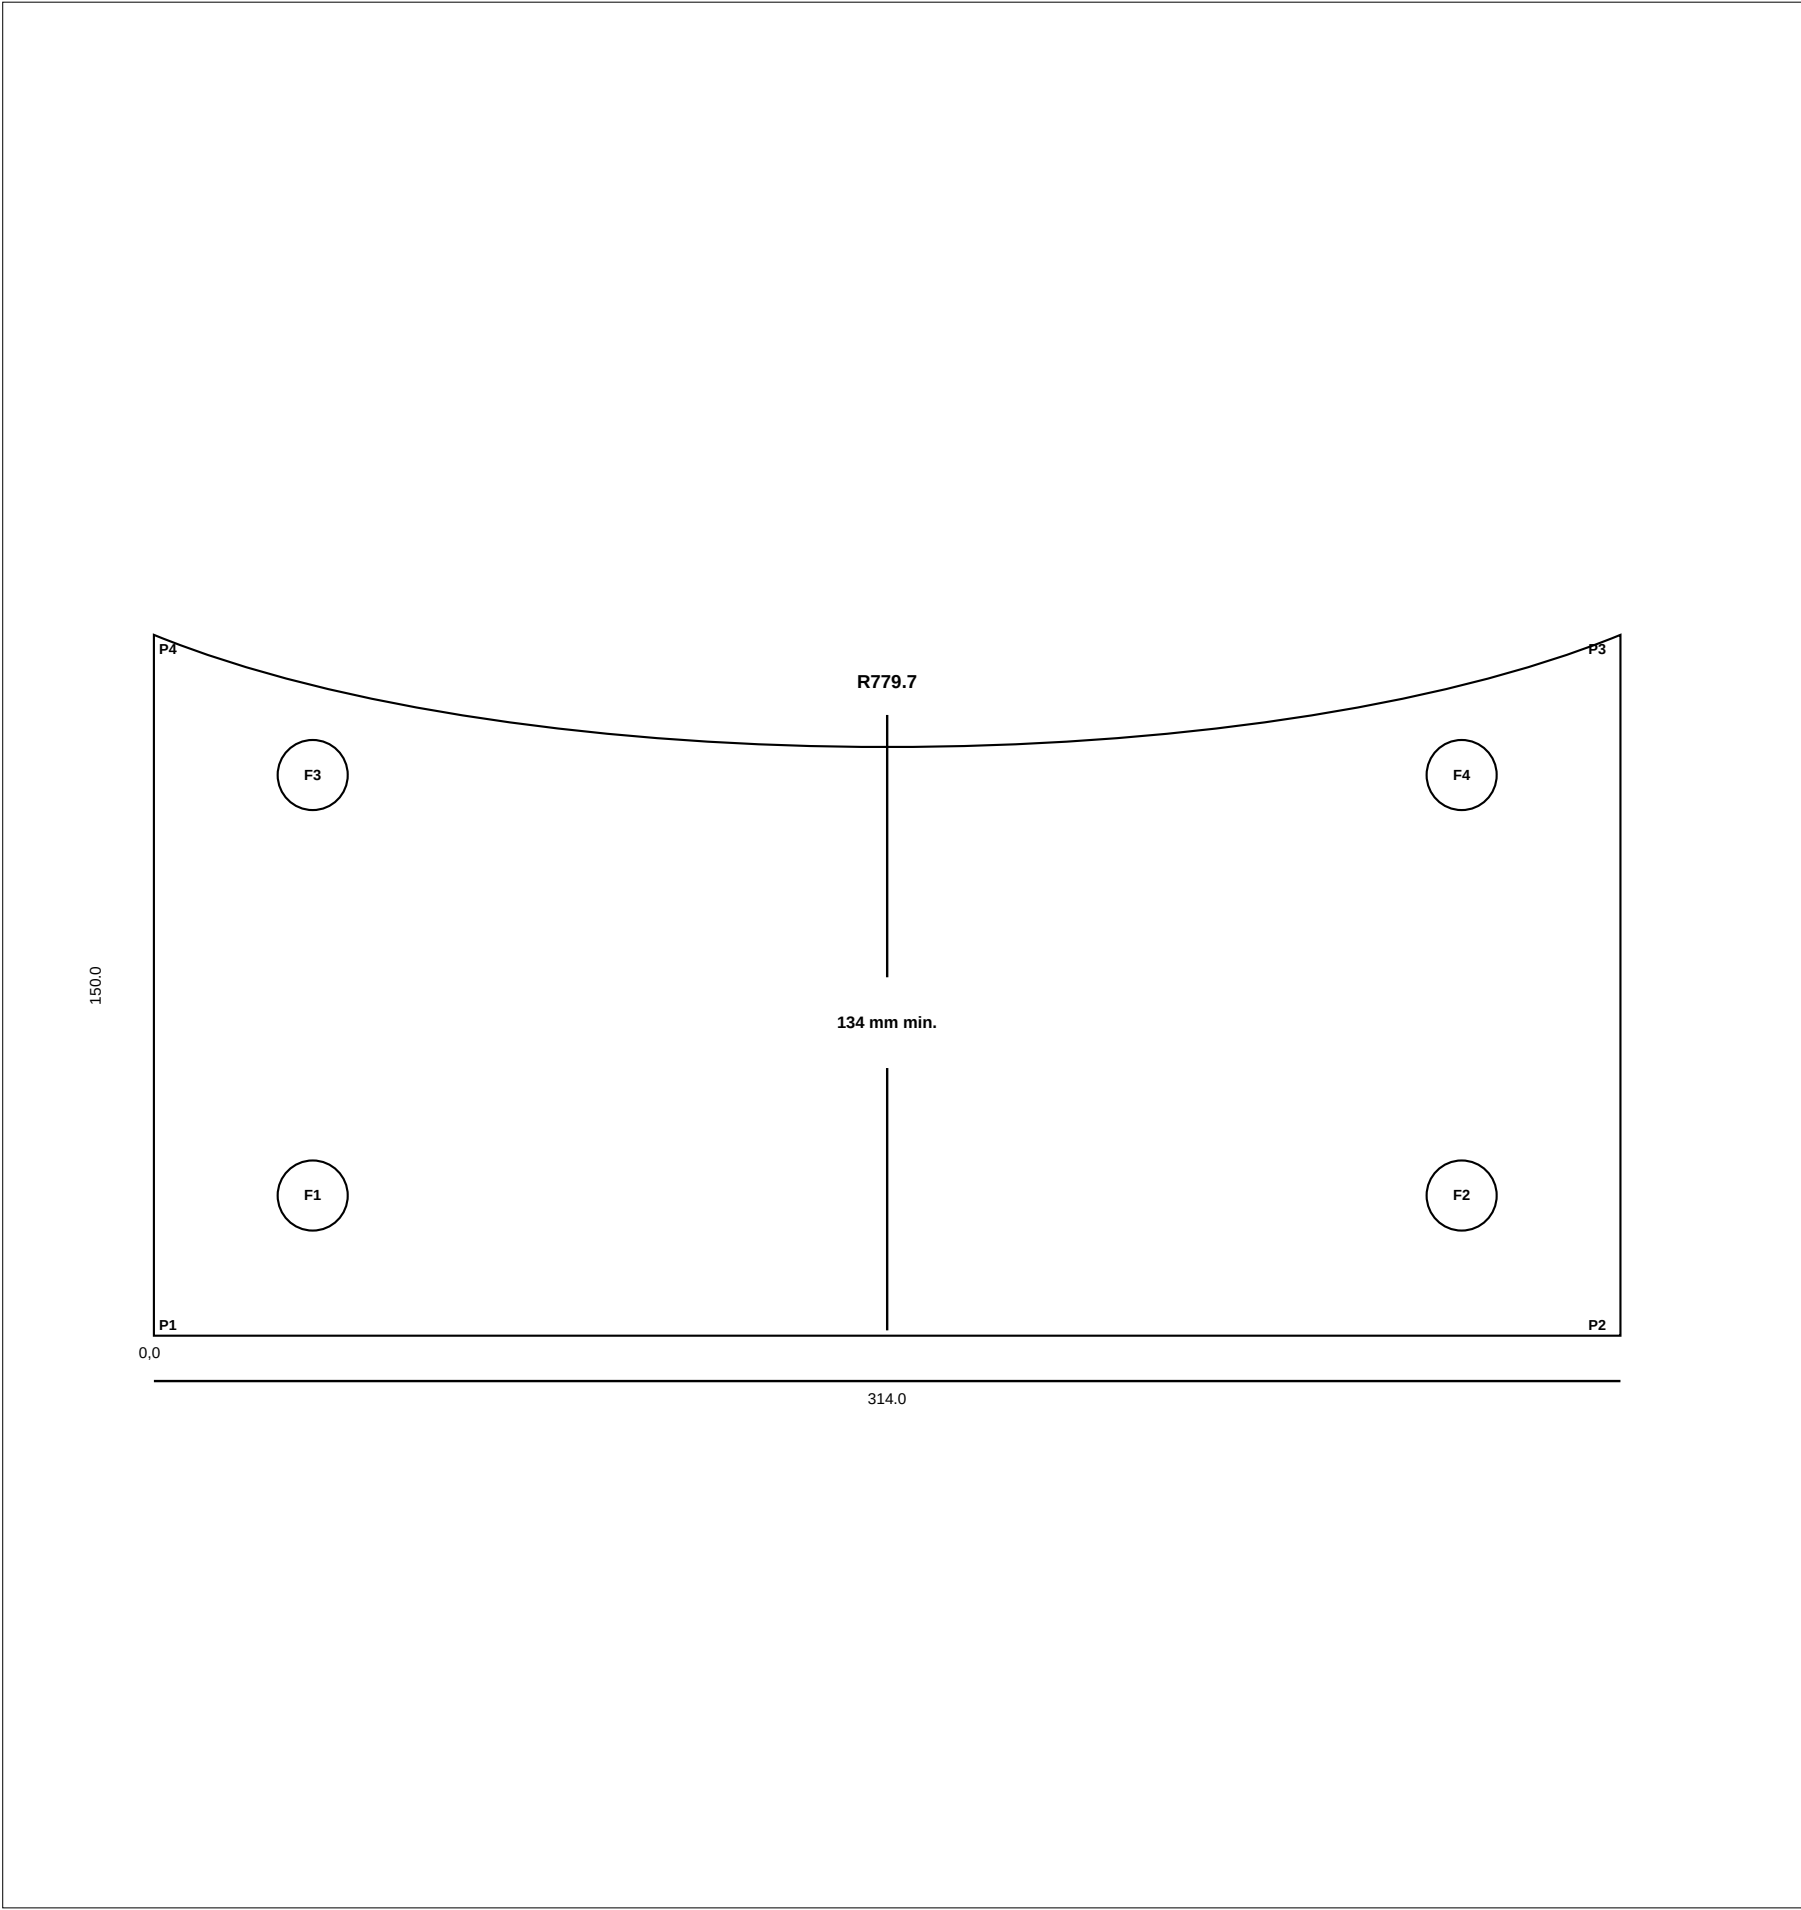

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S2-F - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

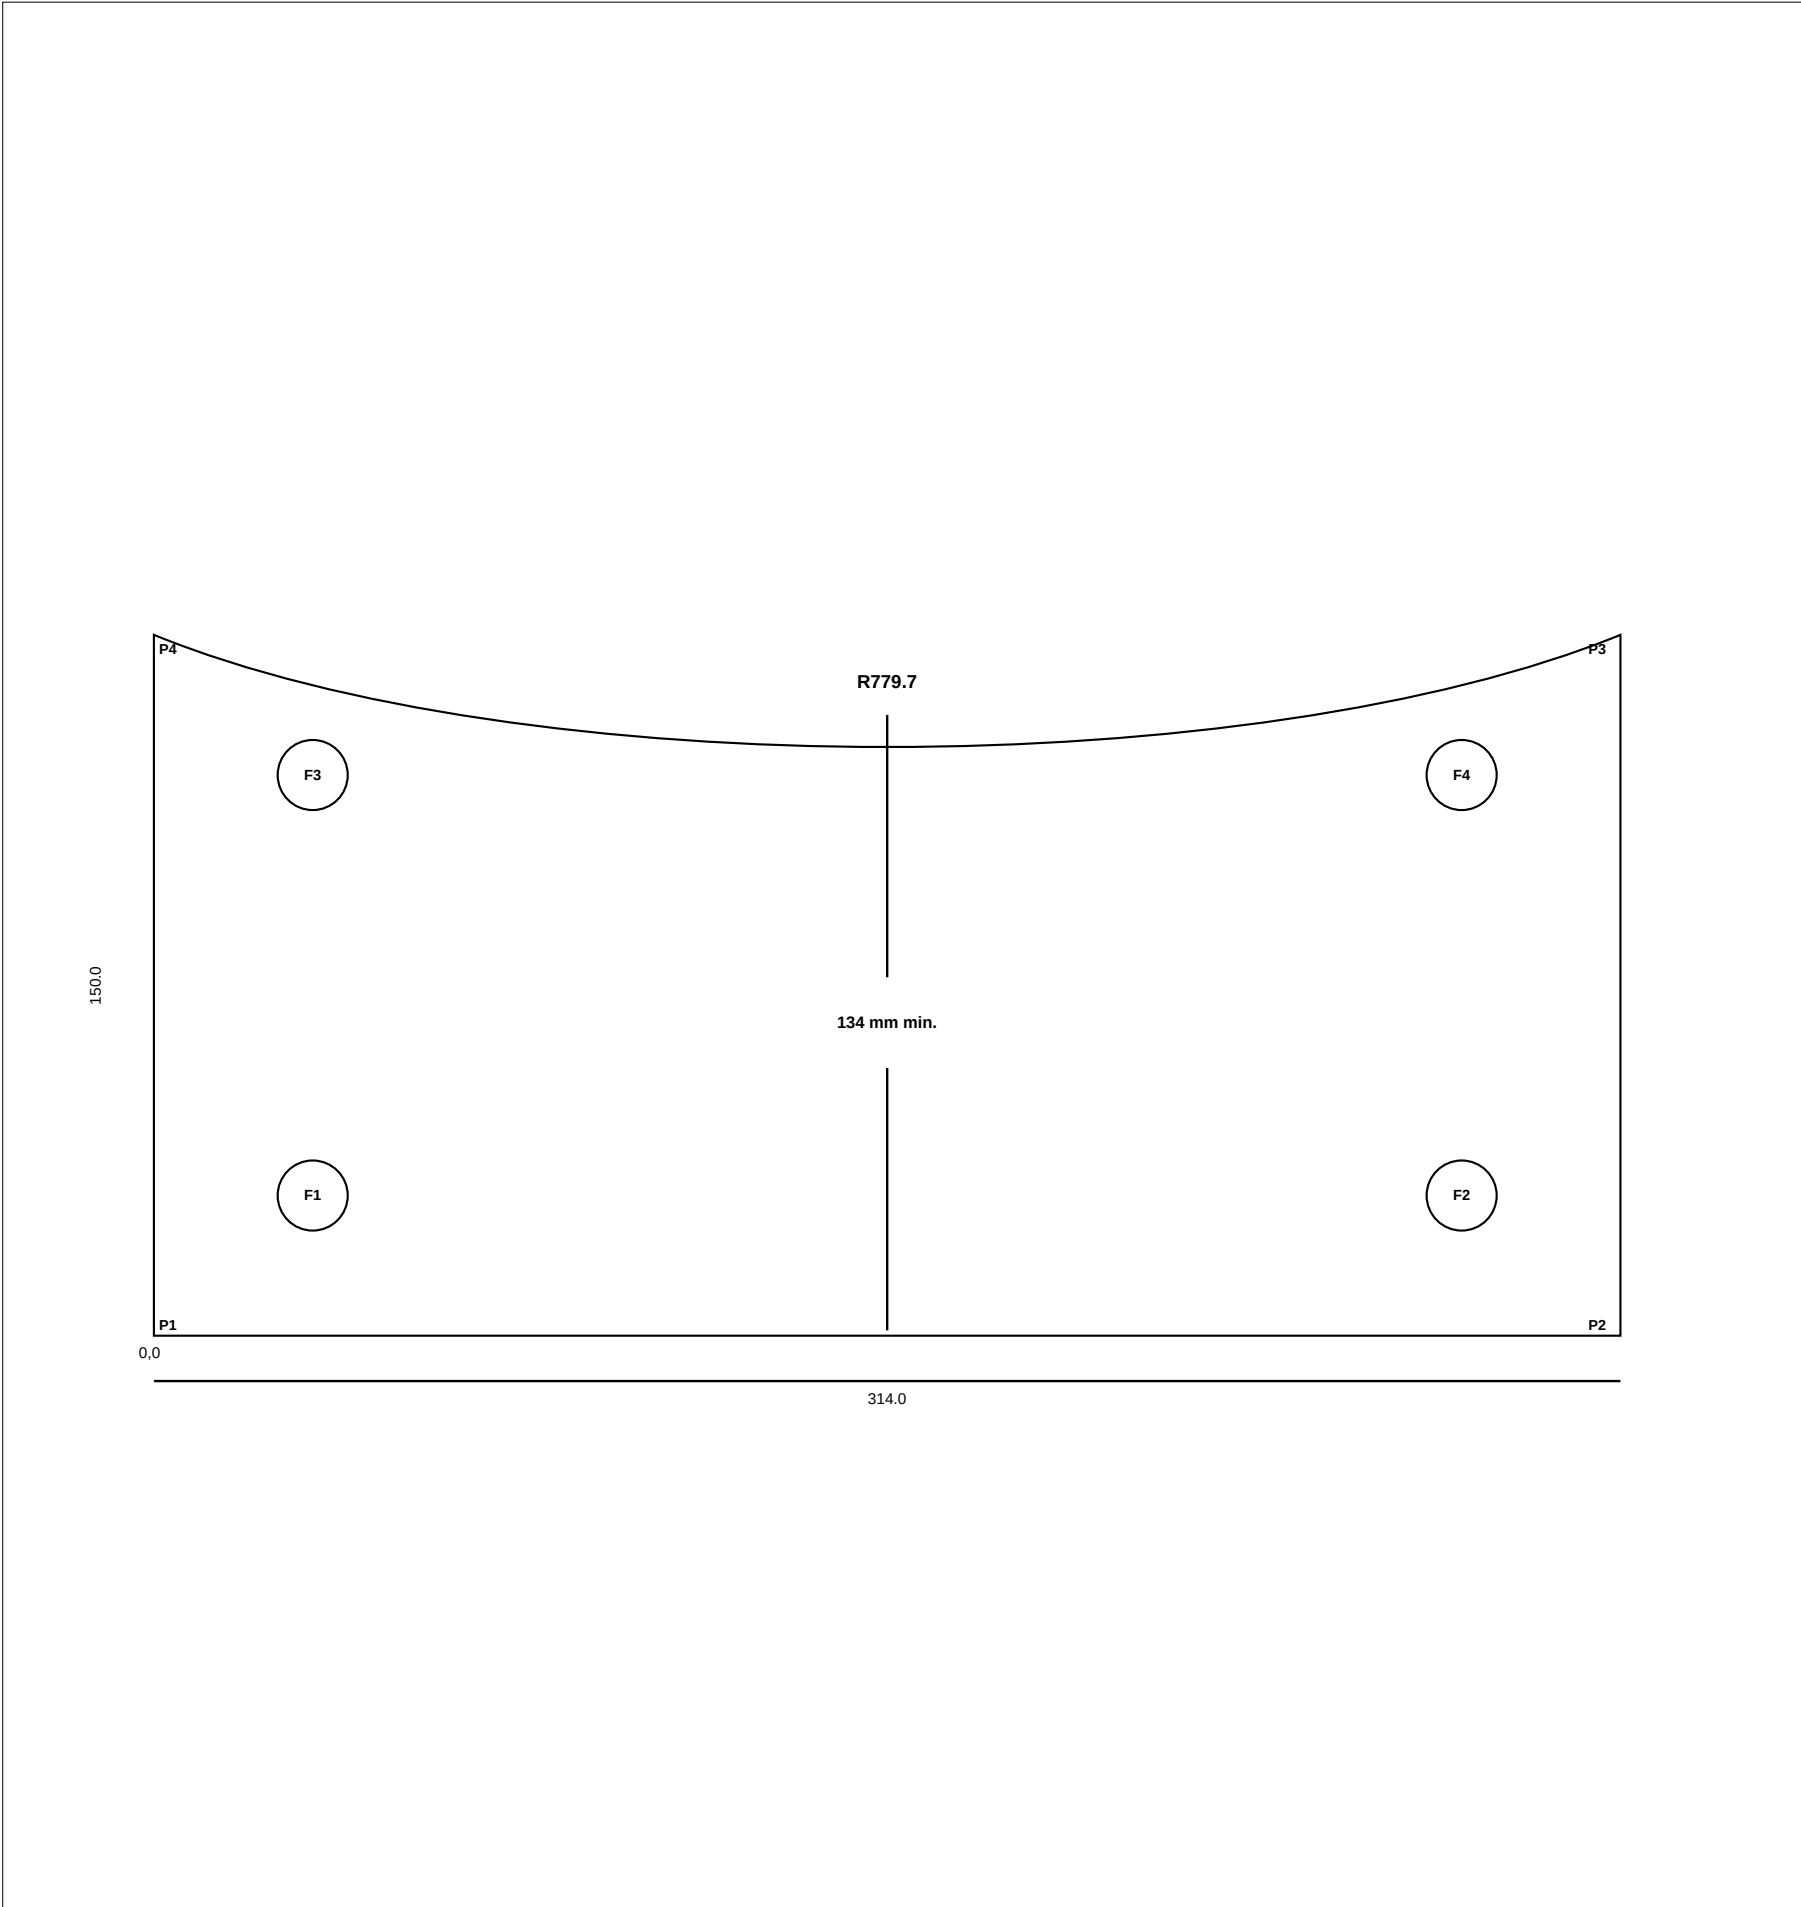

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S2-G - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

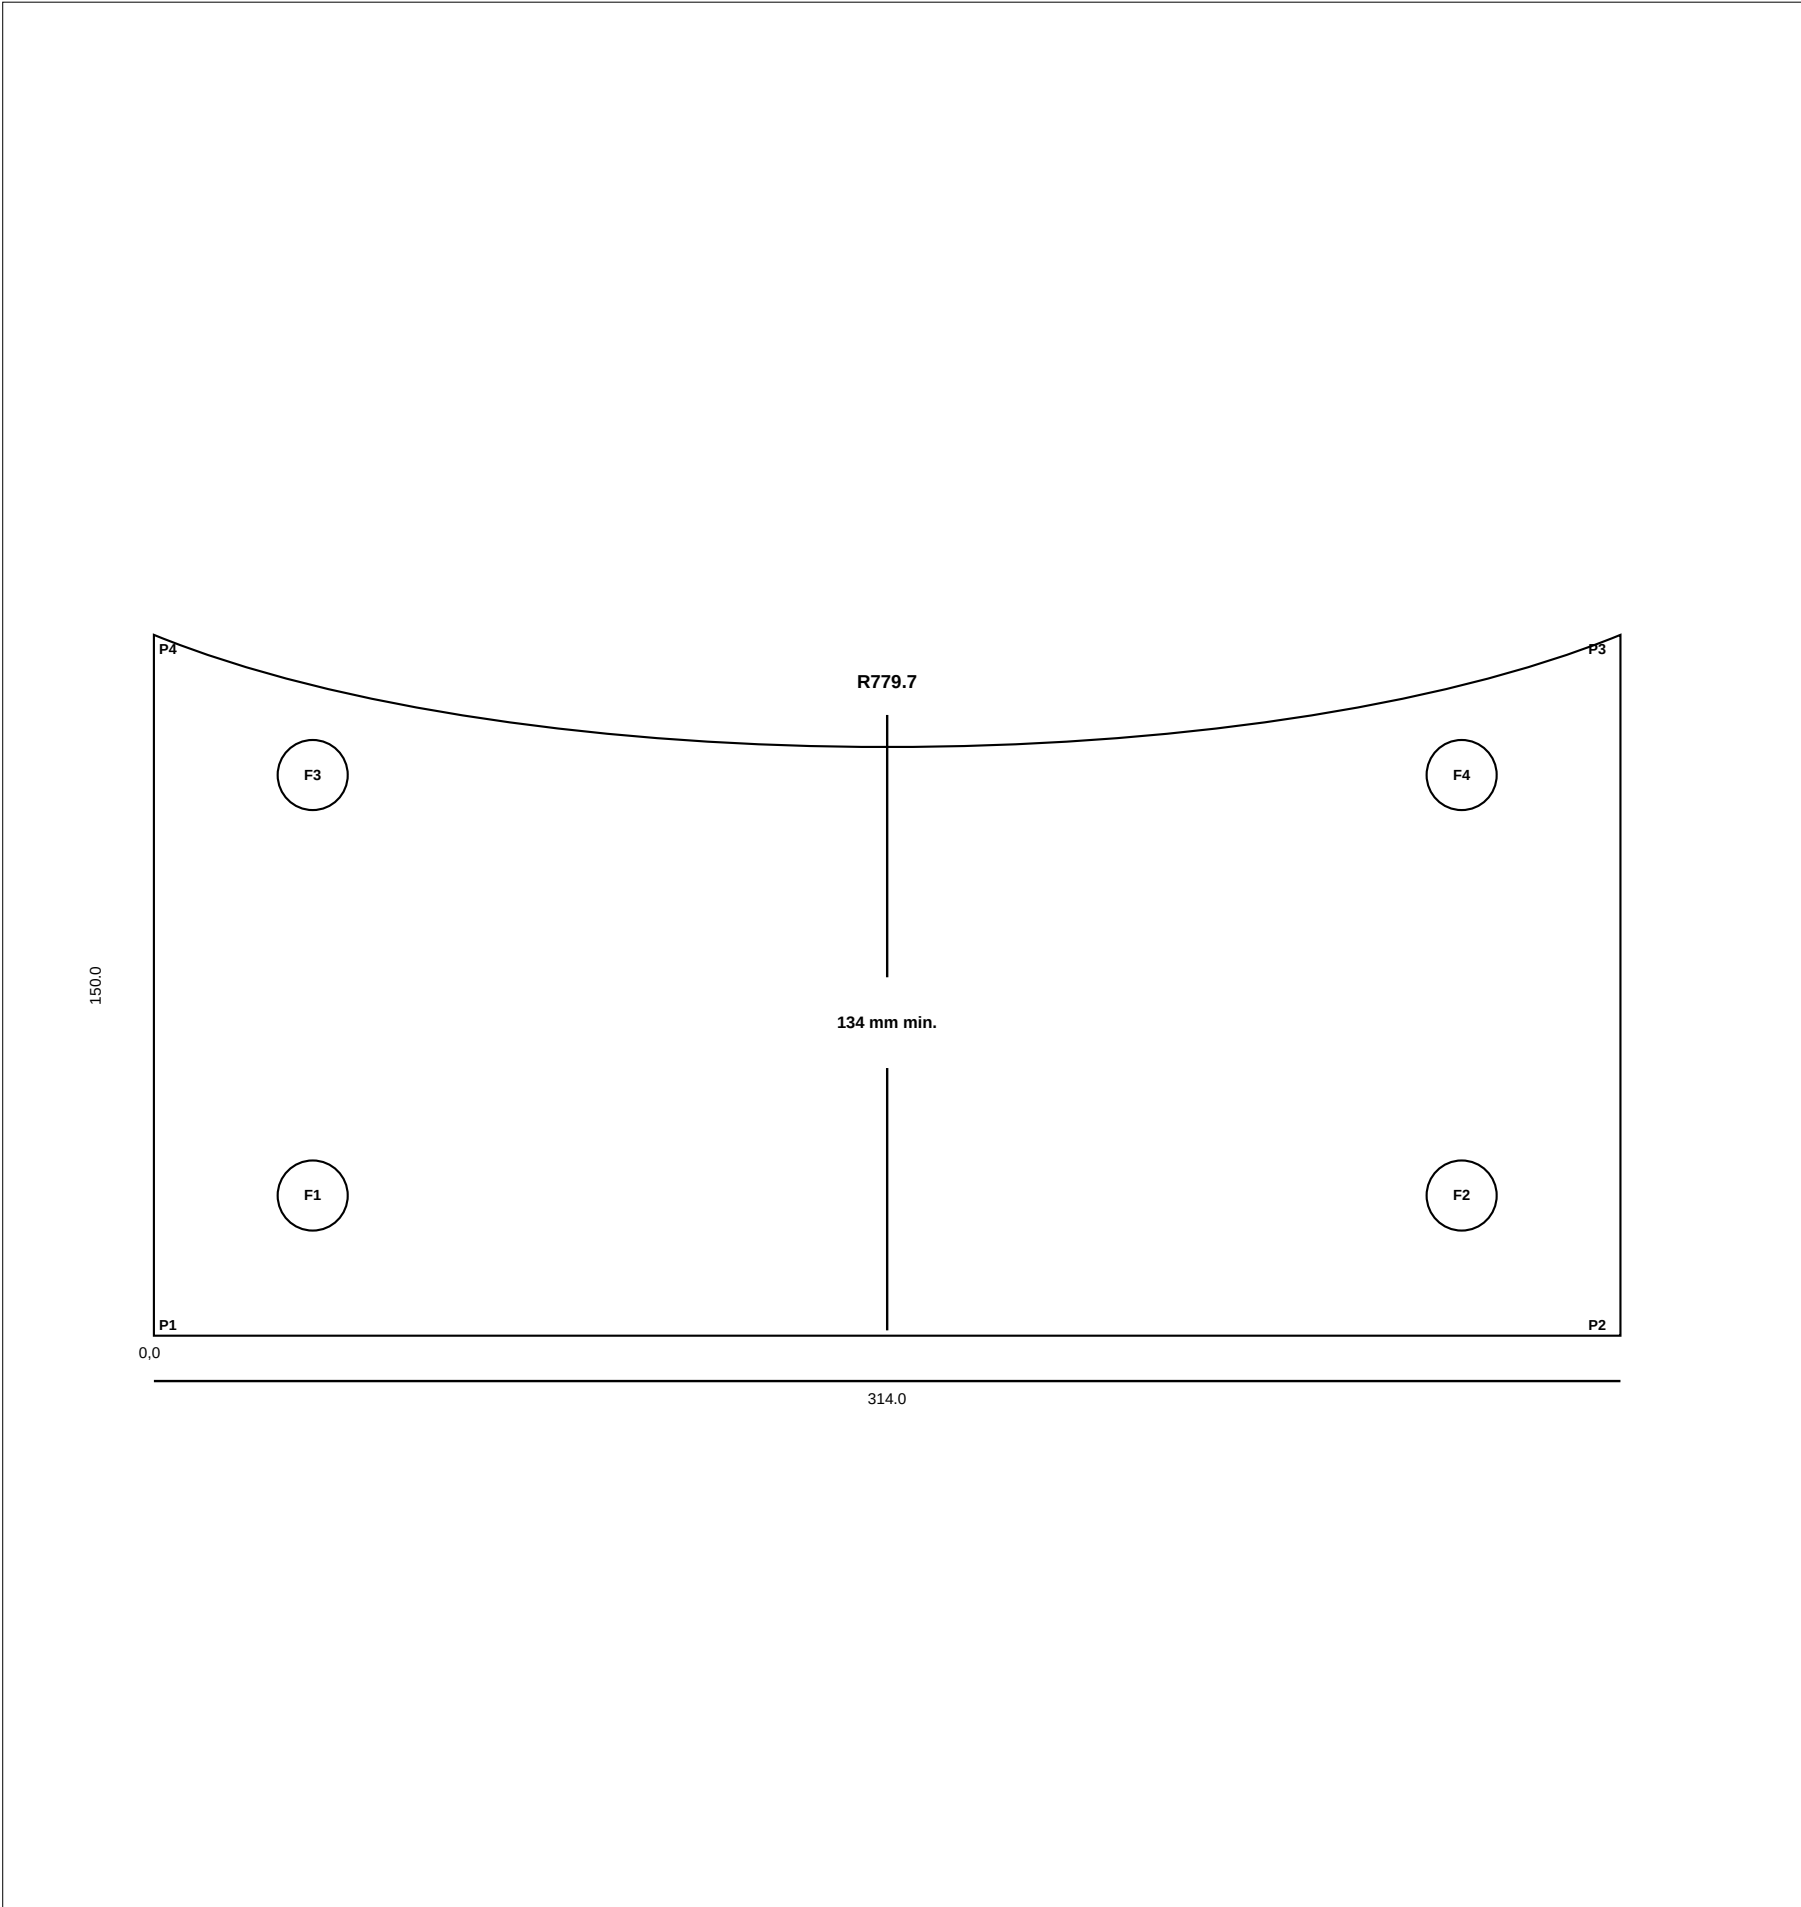

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S2-H - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

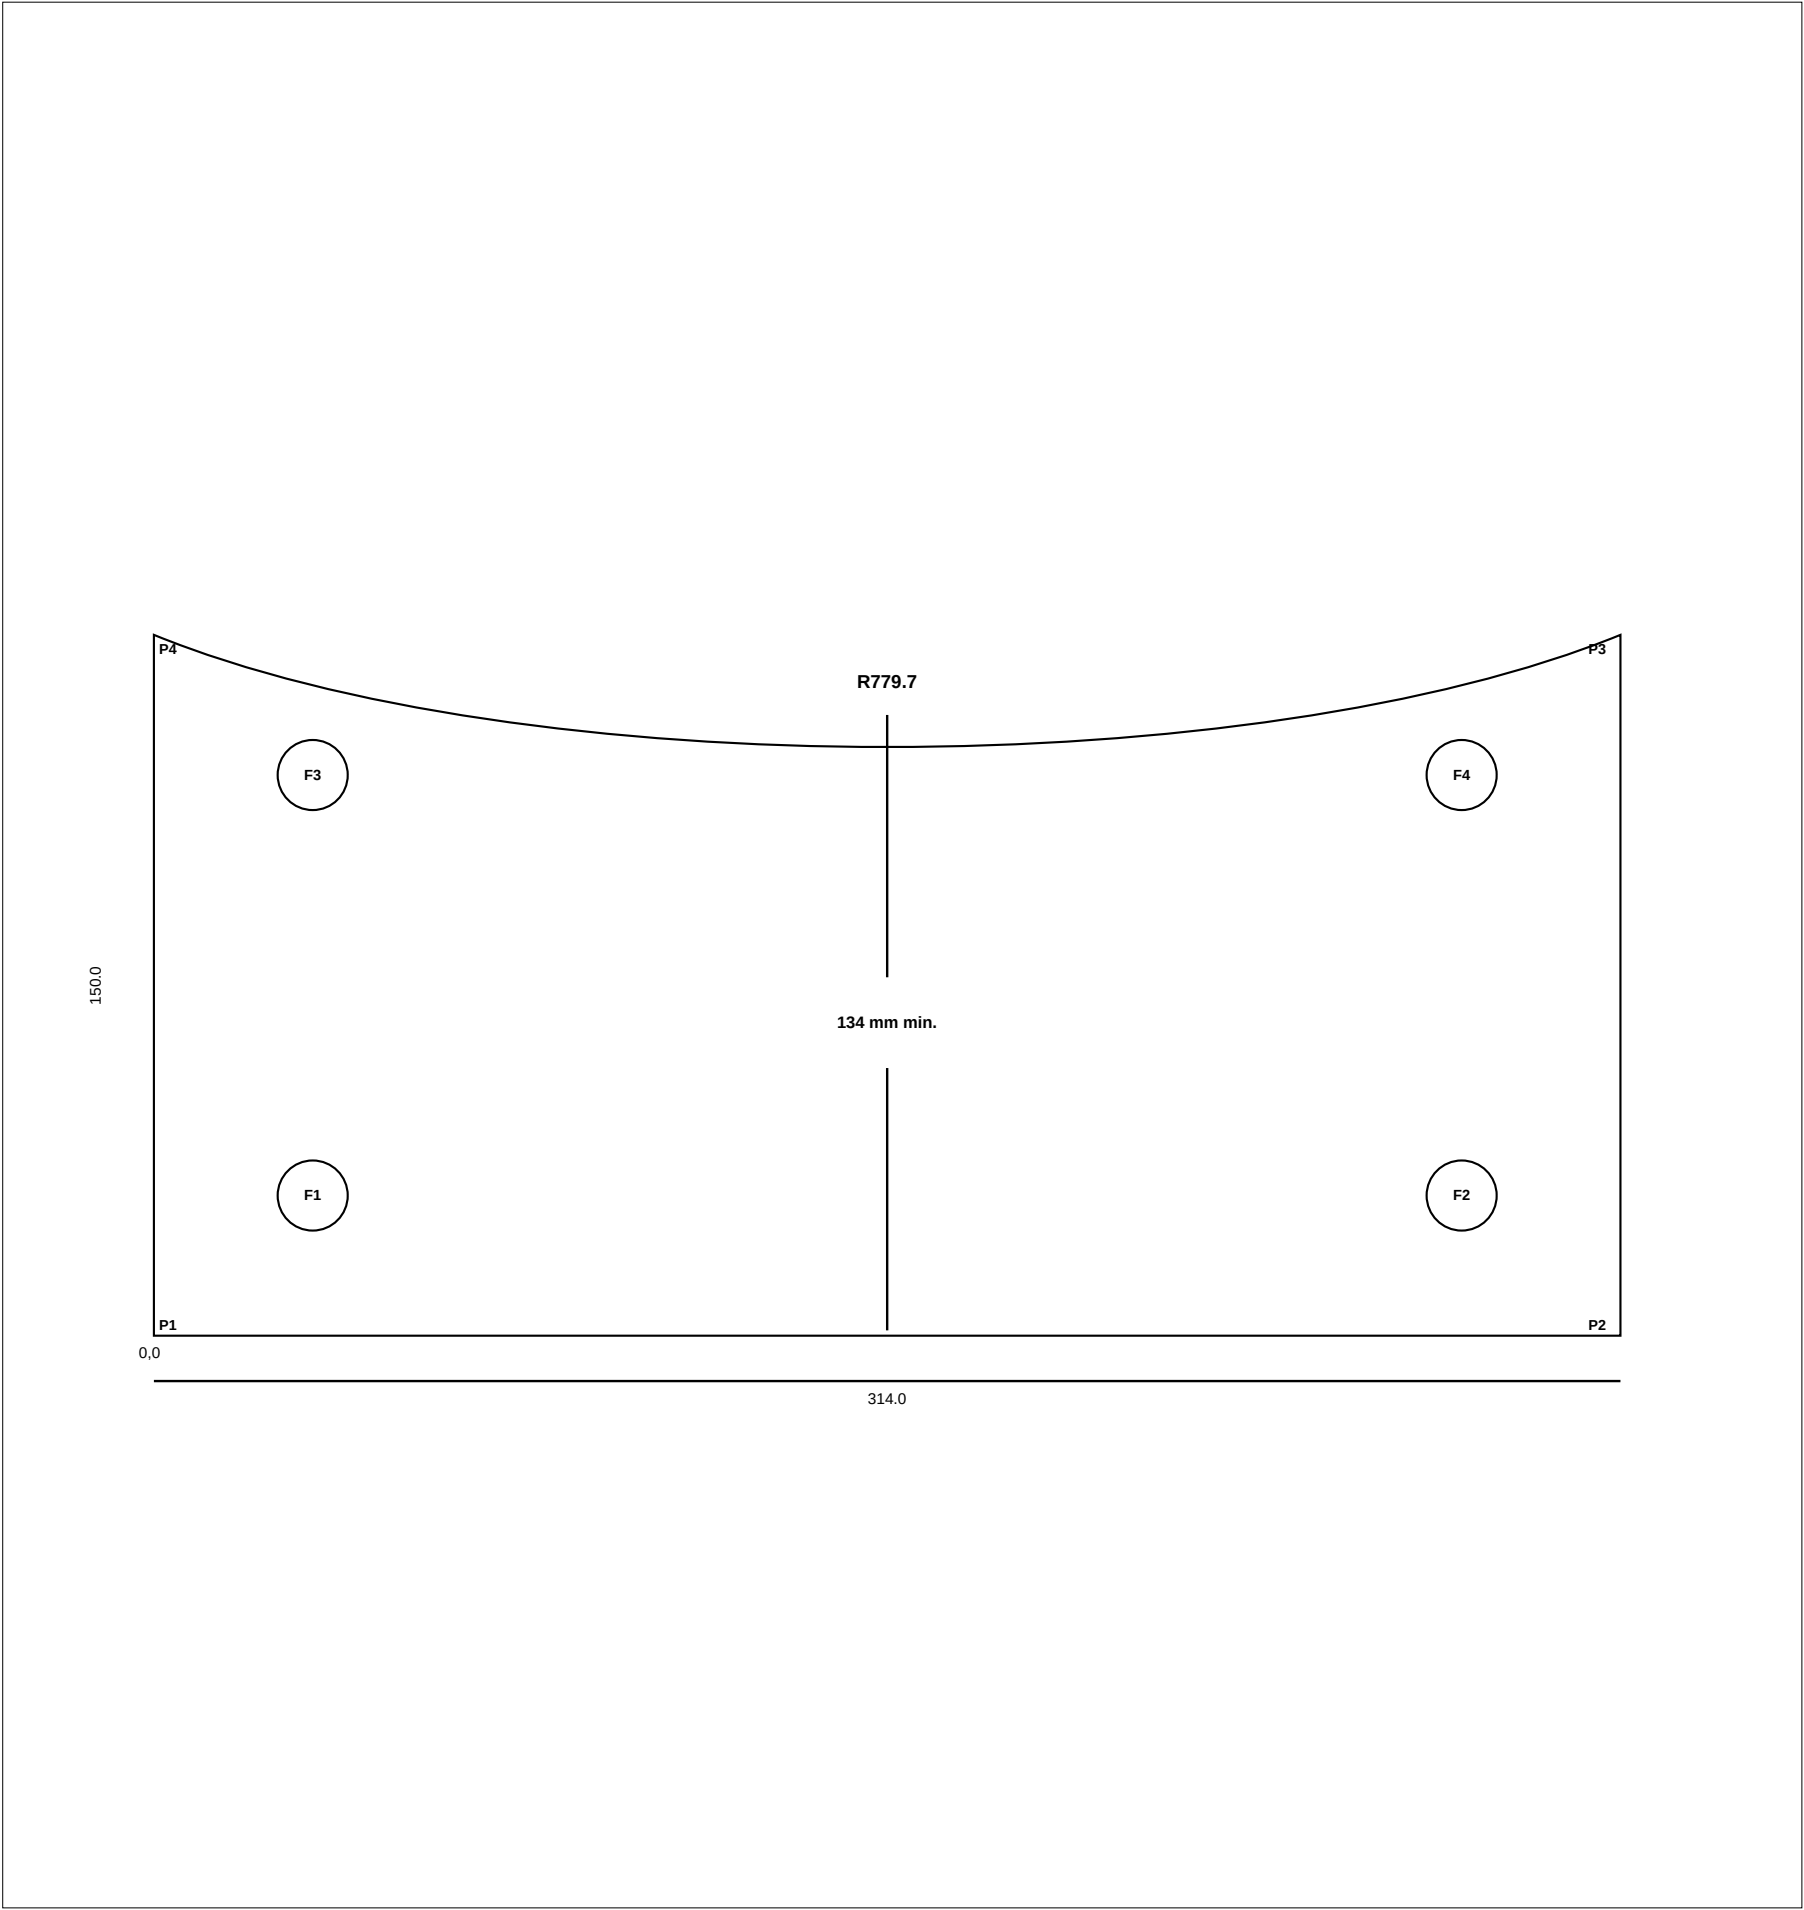

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S2-I - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

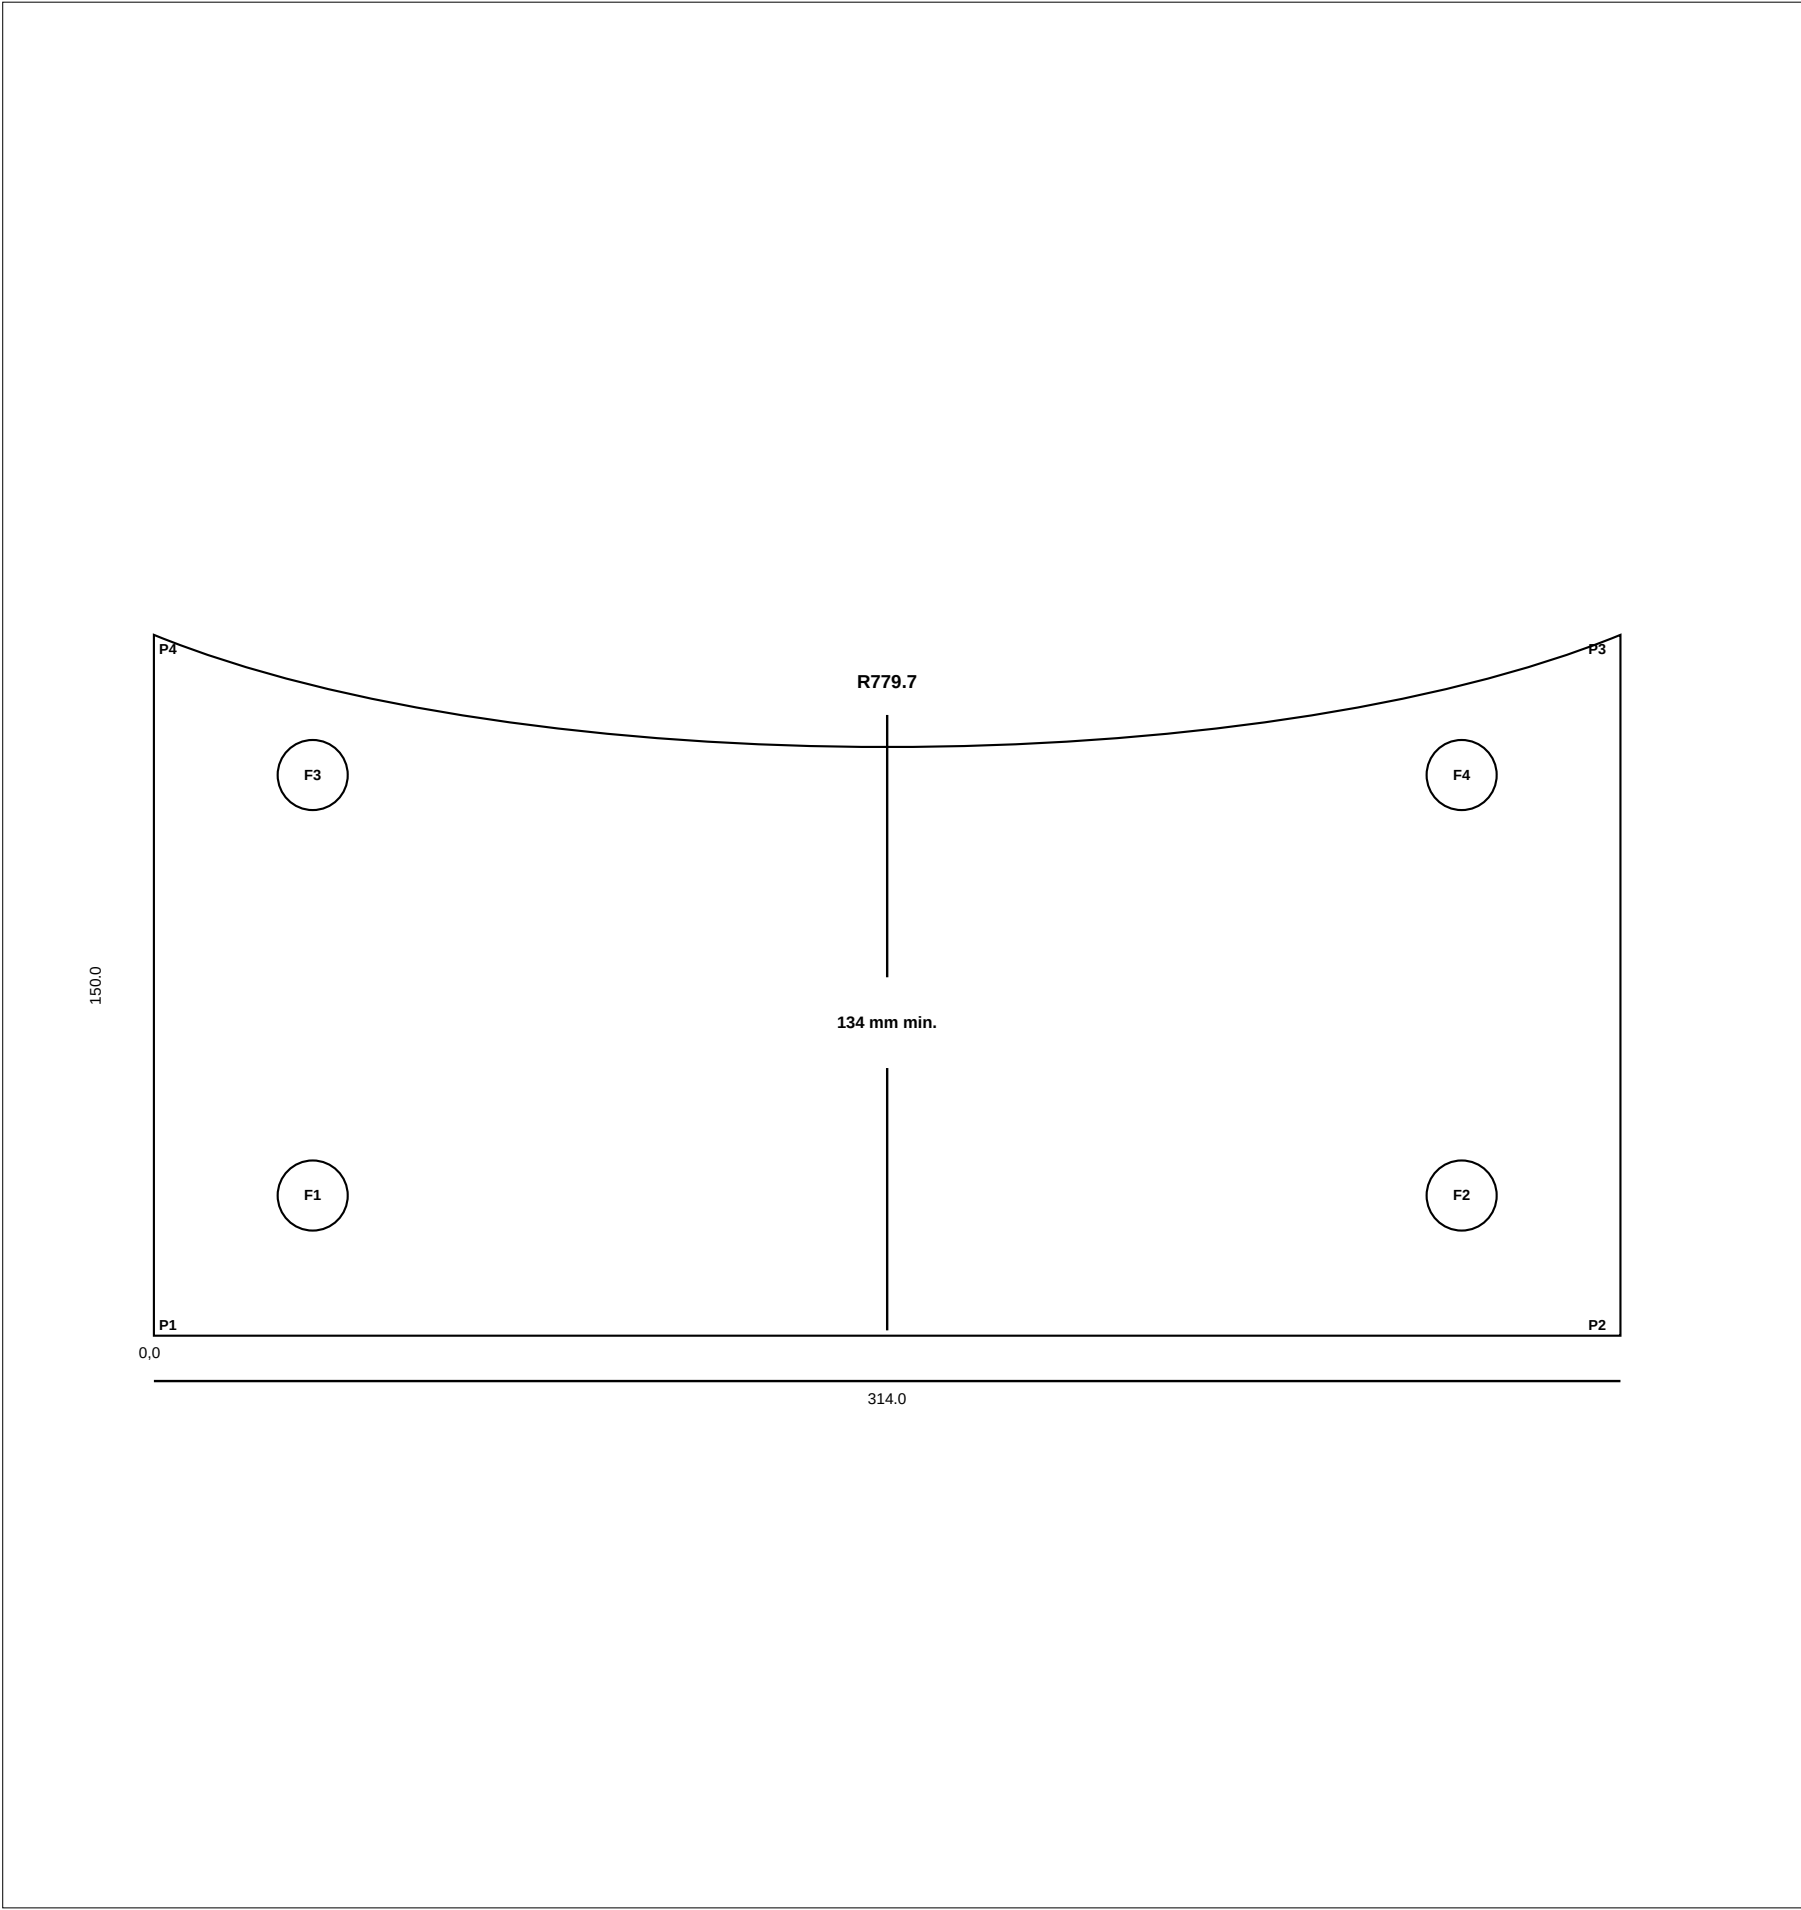

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S2-J - Part detail

Overall 1200.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

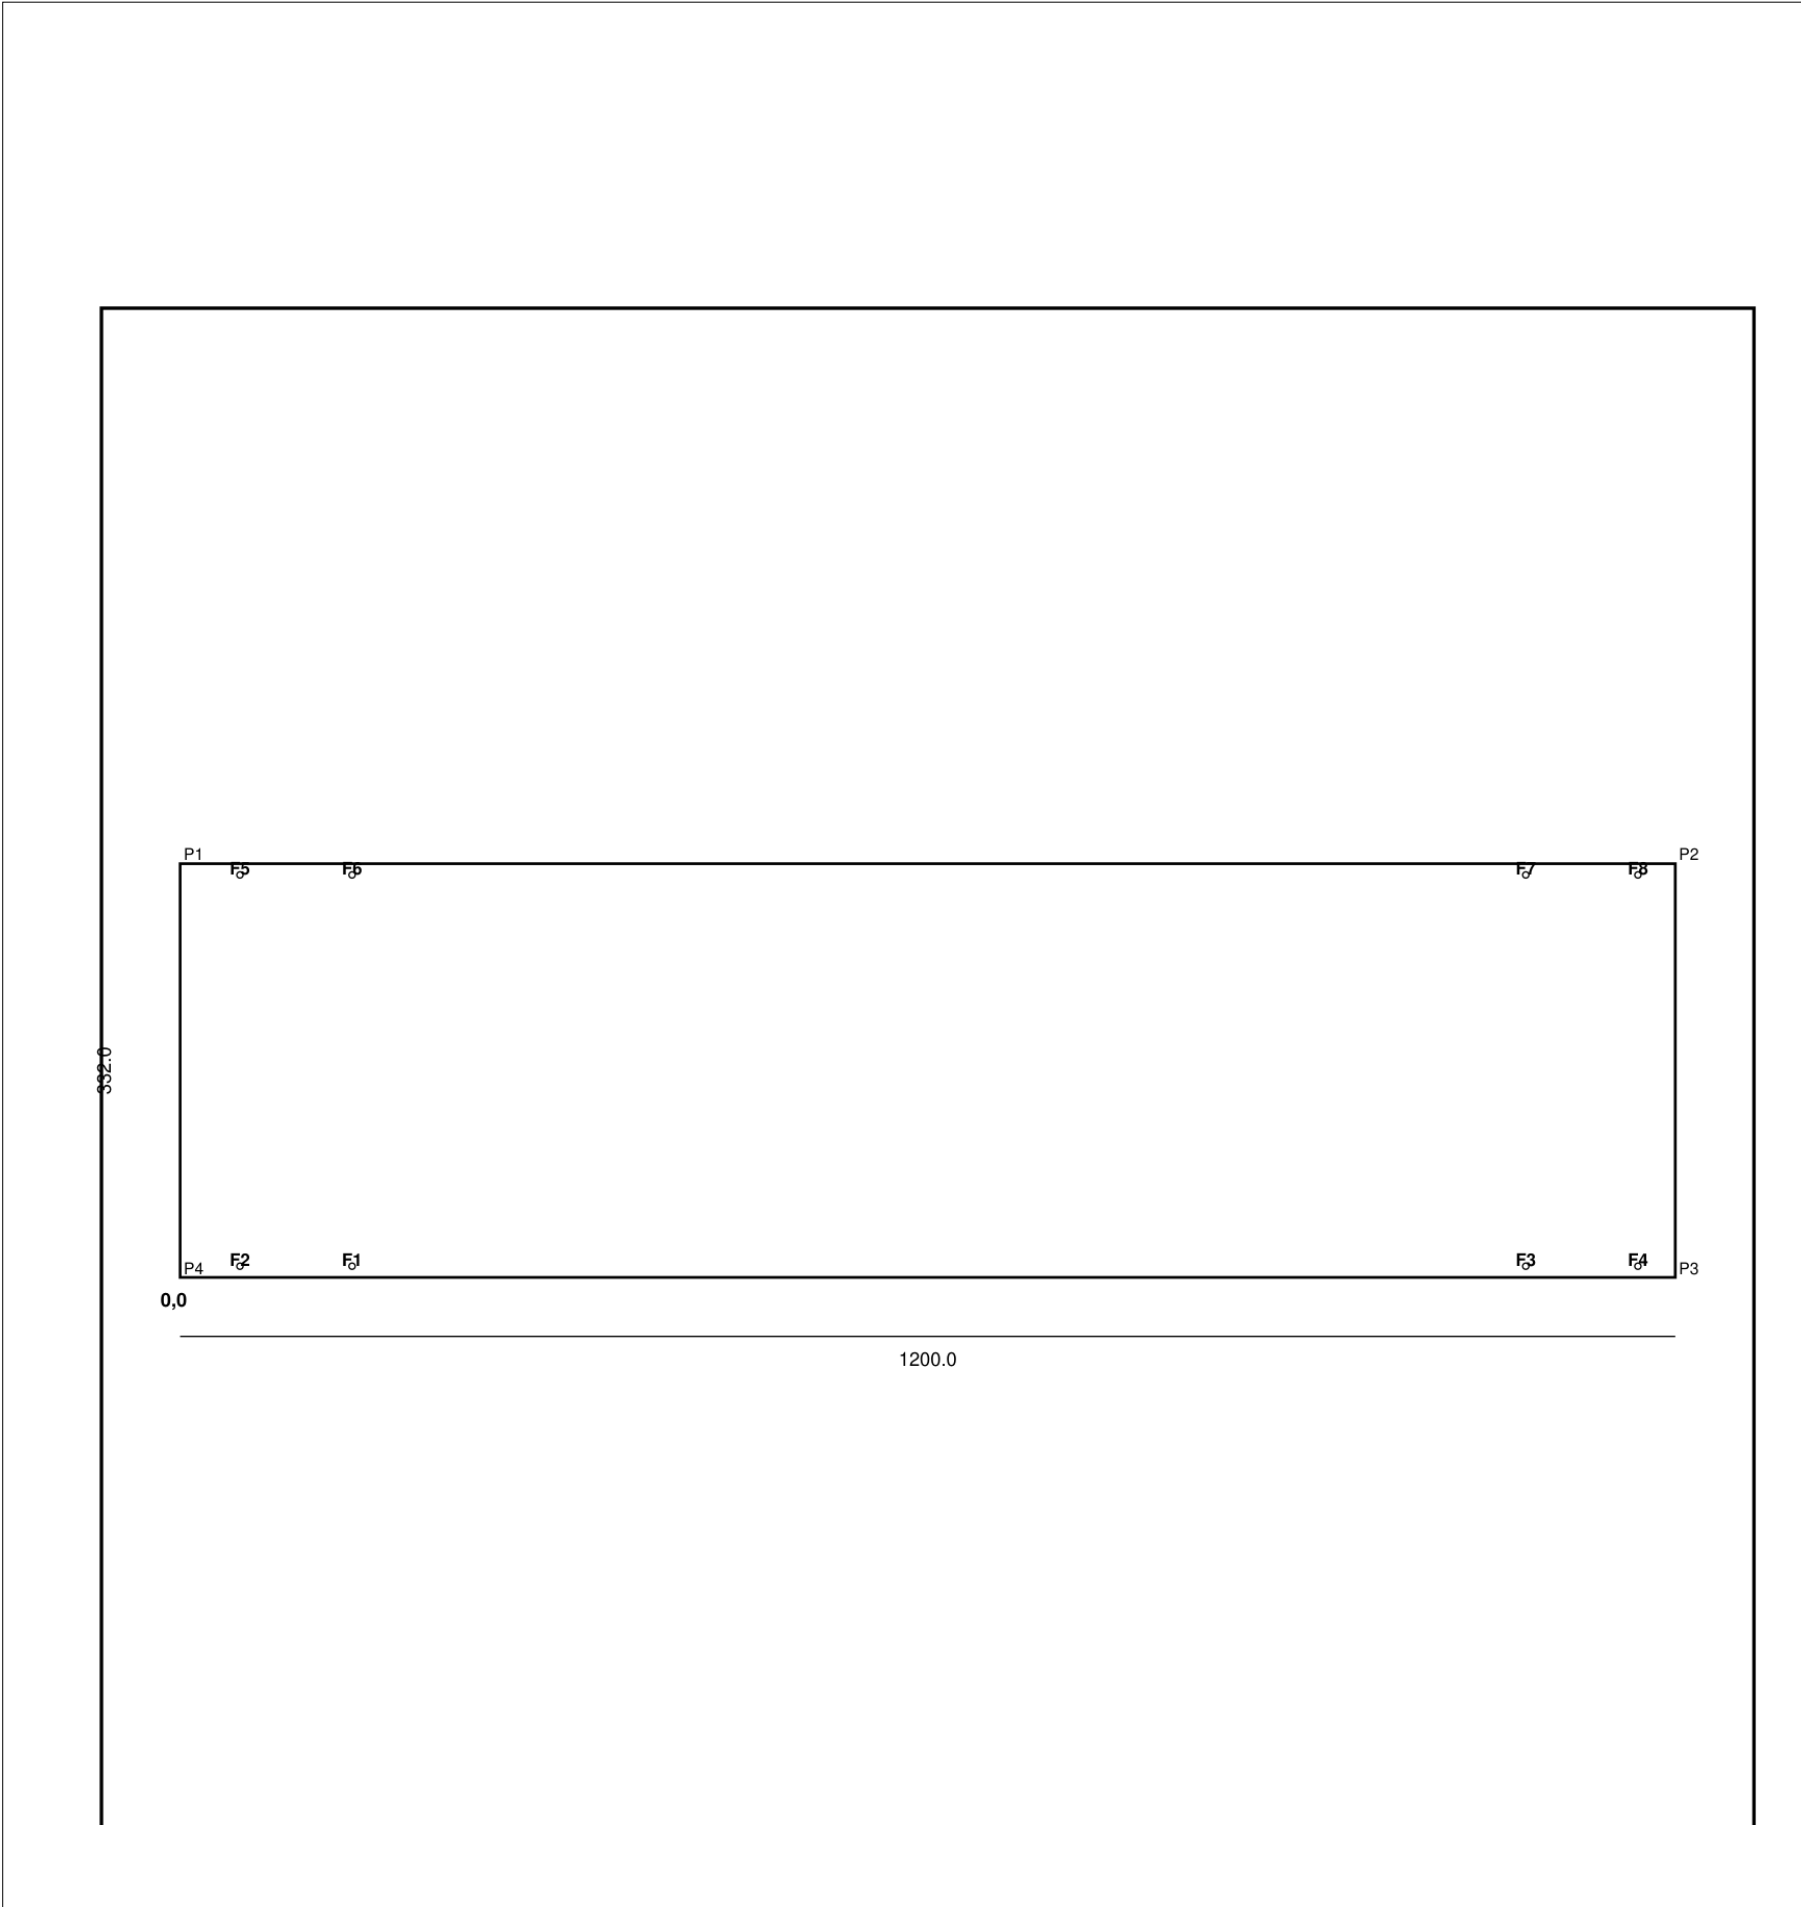

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 5 x 11 deep X 138.0 Y 9.0
- F2 Dia 5 x 11 deep X 48.0 Y 9.0
- F3 Dia 5 x 11 deep X 1080.0 Y 9.0
- F4 Dia 5 x 11 deep X 1170.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 1080.0 Y 323.0
- F8 Dia 5 x 11 deep X 1170.0 Y 323.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
- P2 X1200.0 Y332.0 LINE
- P3 X1200.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE
- Page 21

S2-K - Part detail

Overall 1200.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

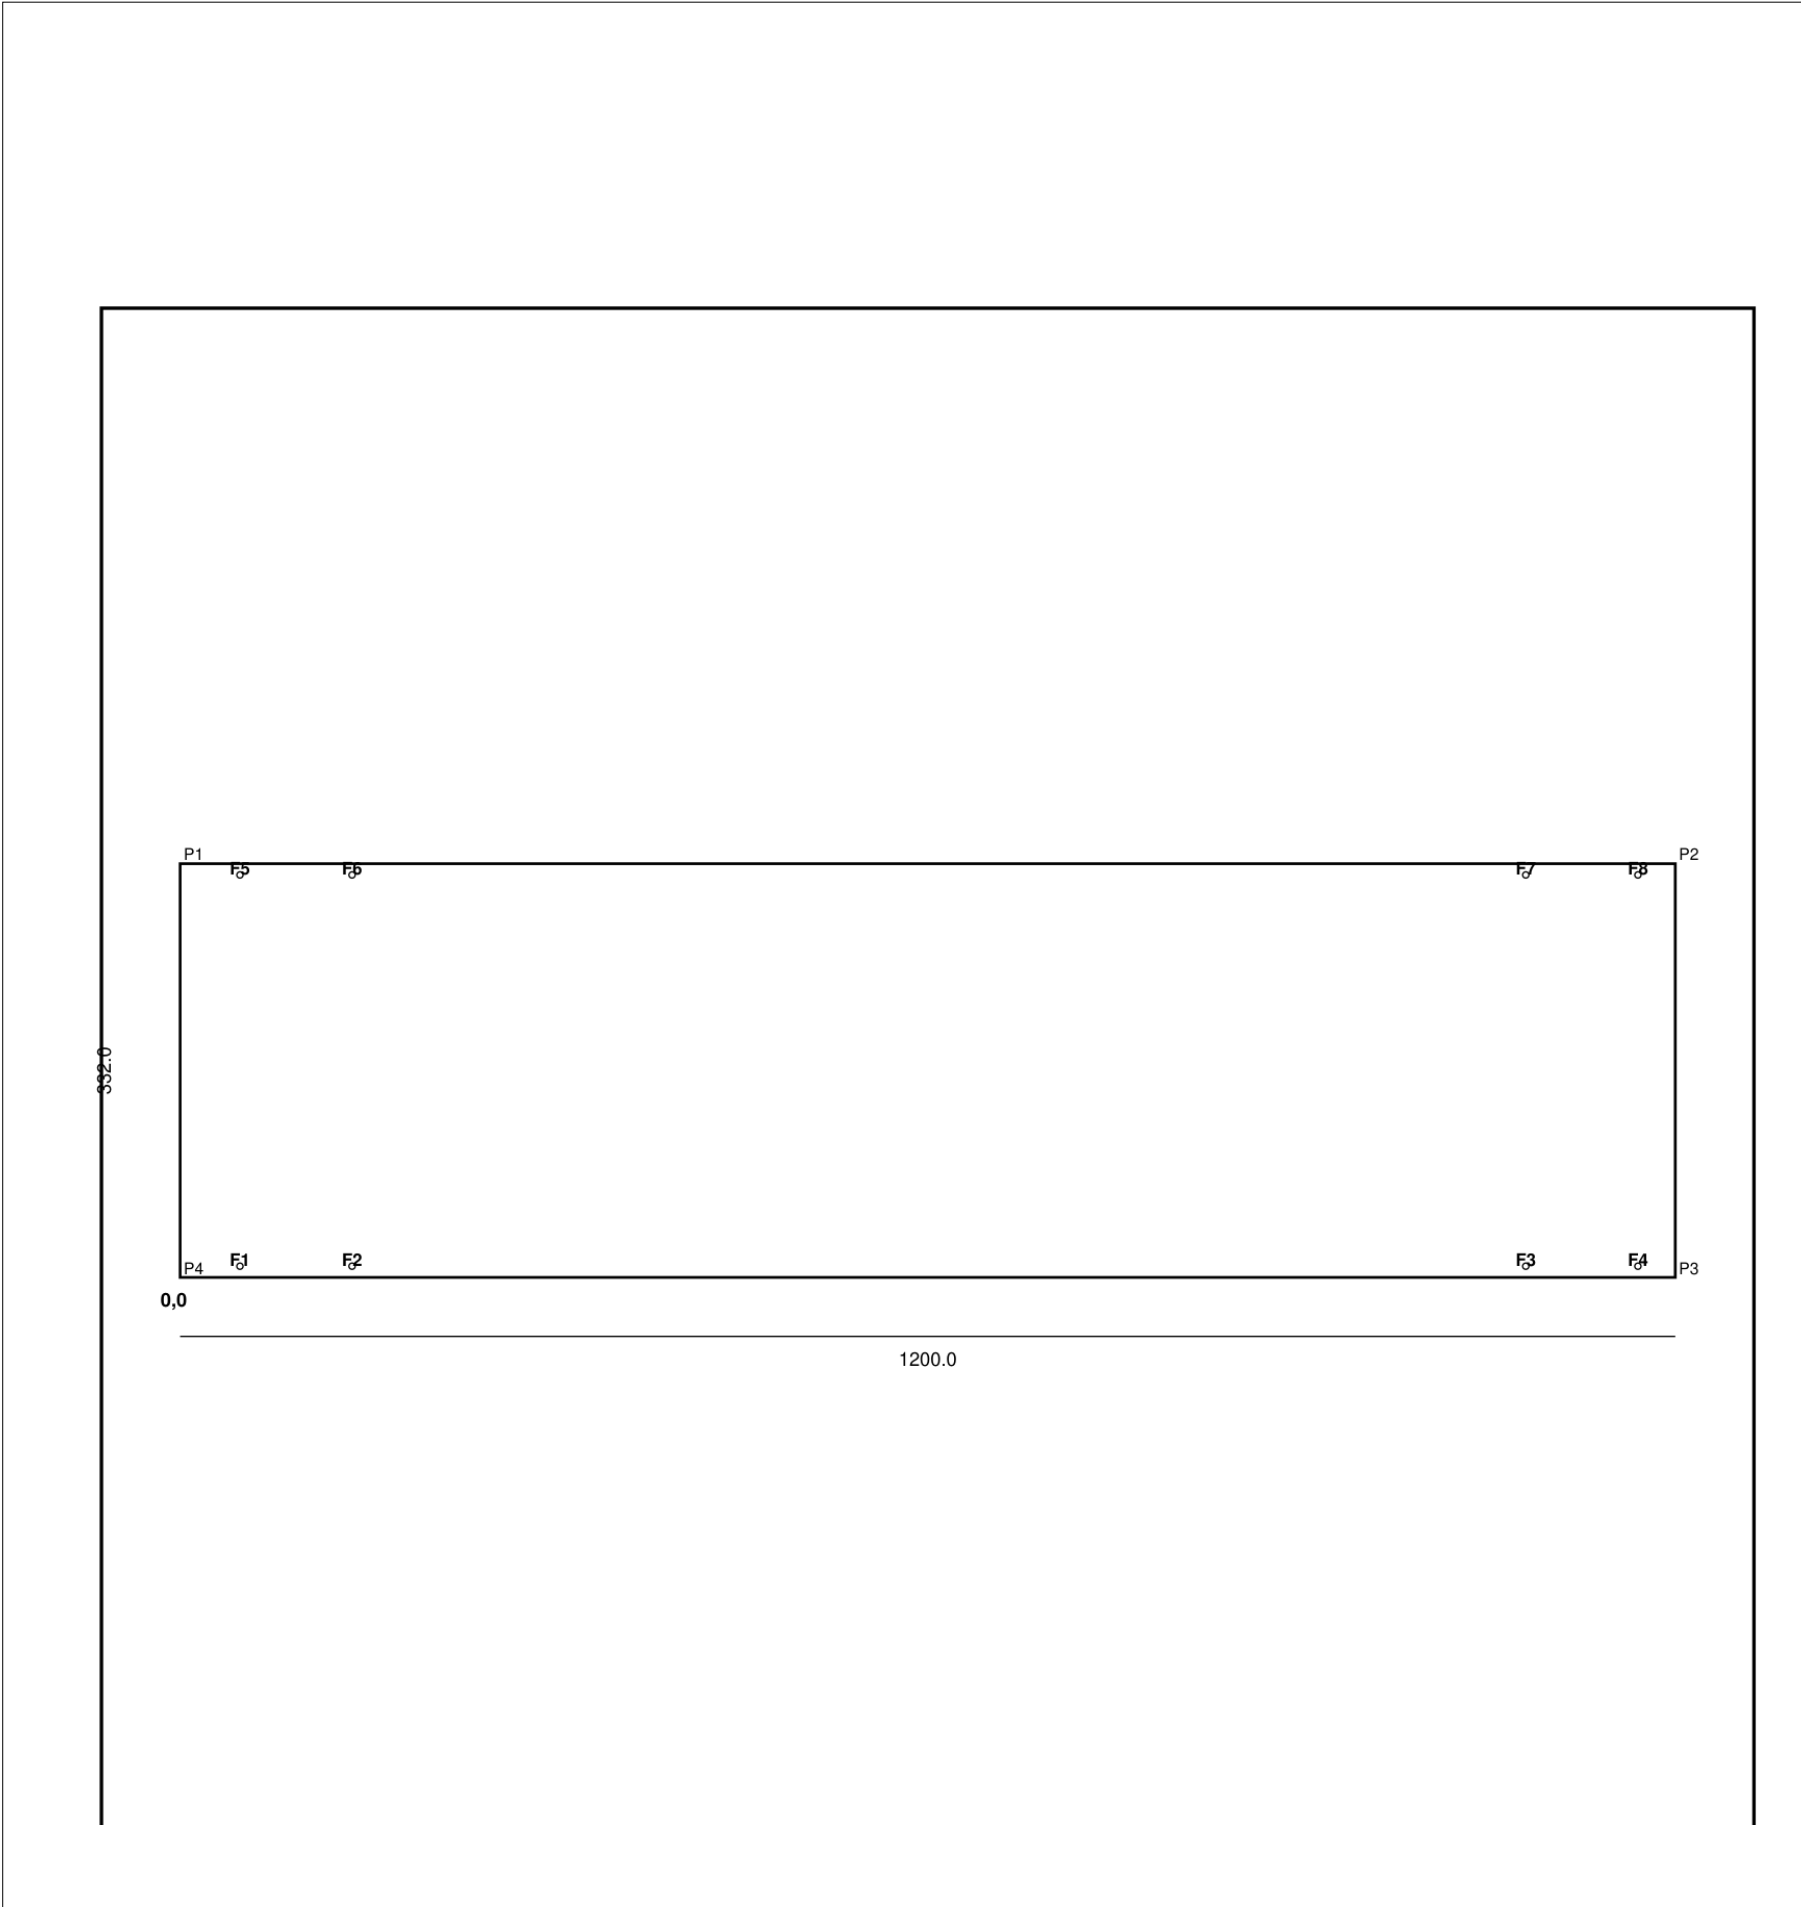

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 1080.0 Y 9.0
- F4 Dia 5 x 11 deep X 1170.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 1080.0 Y 323.0
- F8 Dia 5 x 11 deep X 1170.0 Y 323.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
- P2 X1200.0 Y332.0 LINE
- P3 X1200.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE
- Page 22

S2-L - Part detail

Overall 1200.0 x 332.0 mm | 18 mm plywood | datum lower-left = X0 Y0

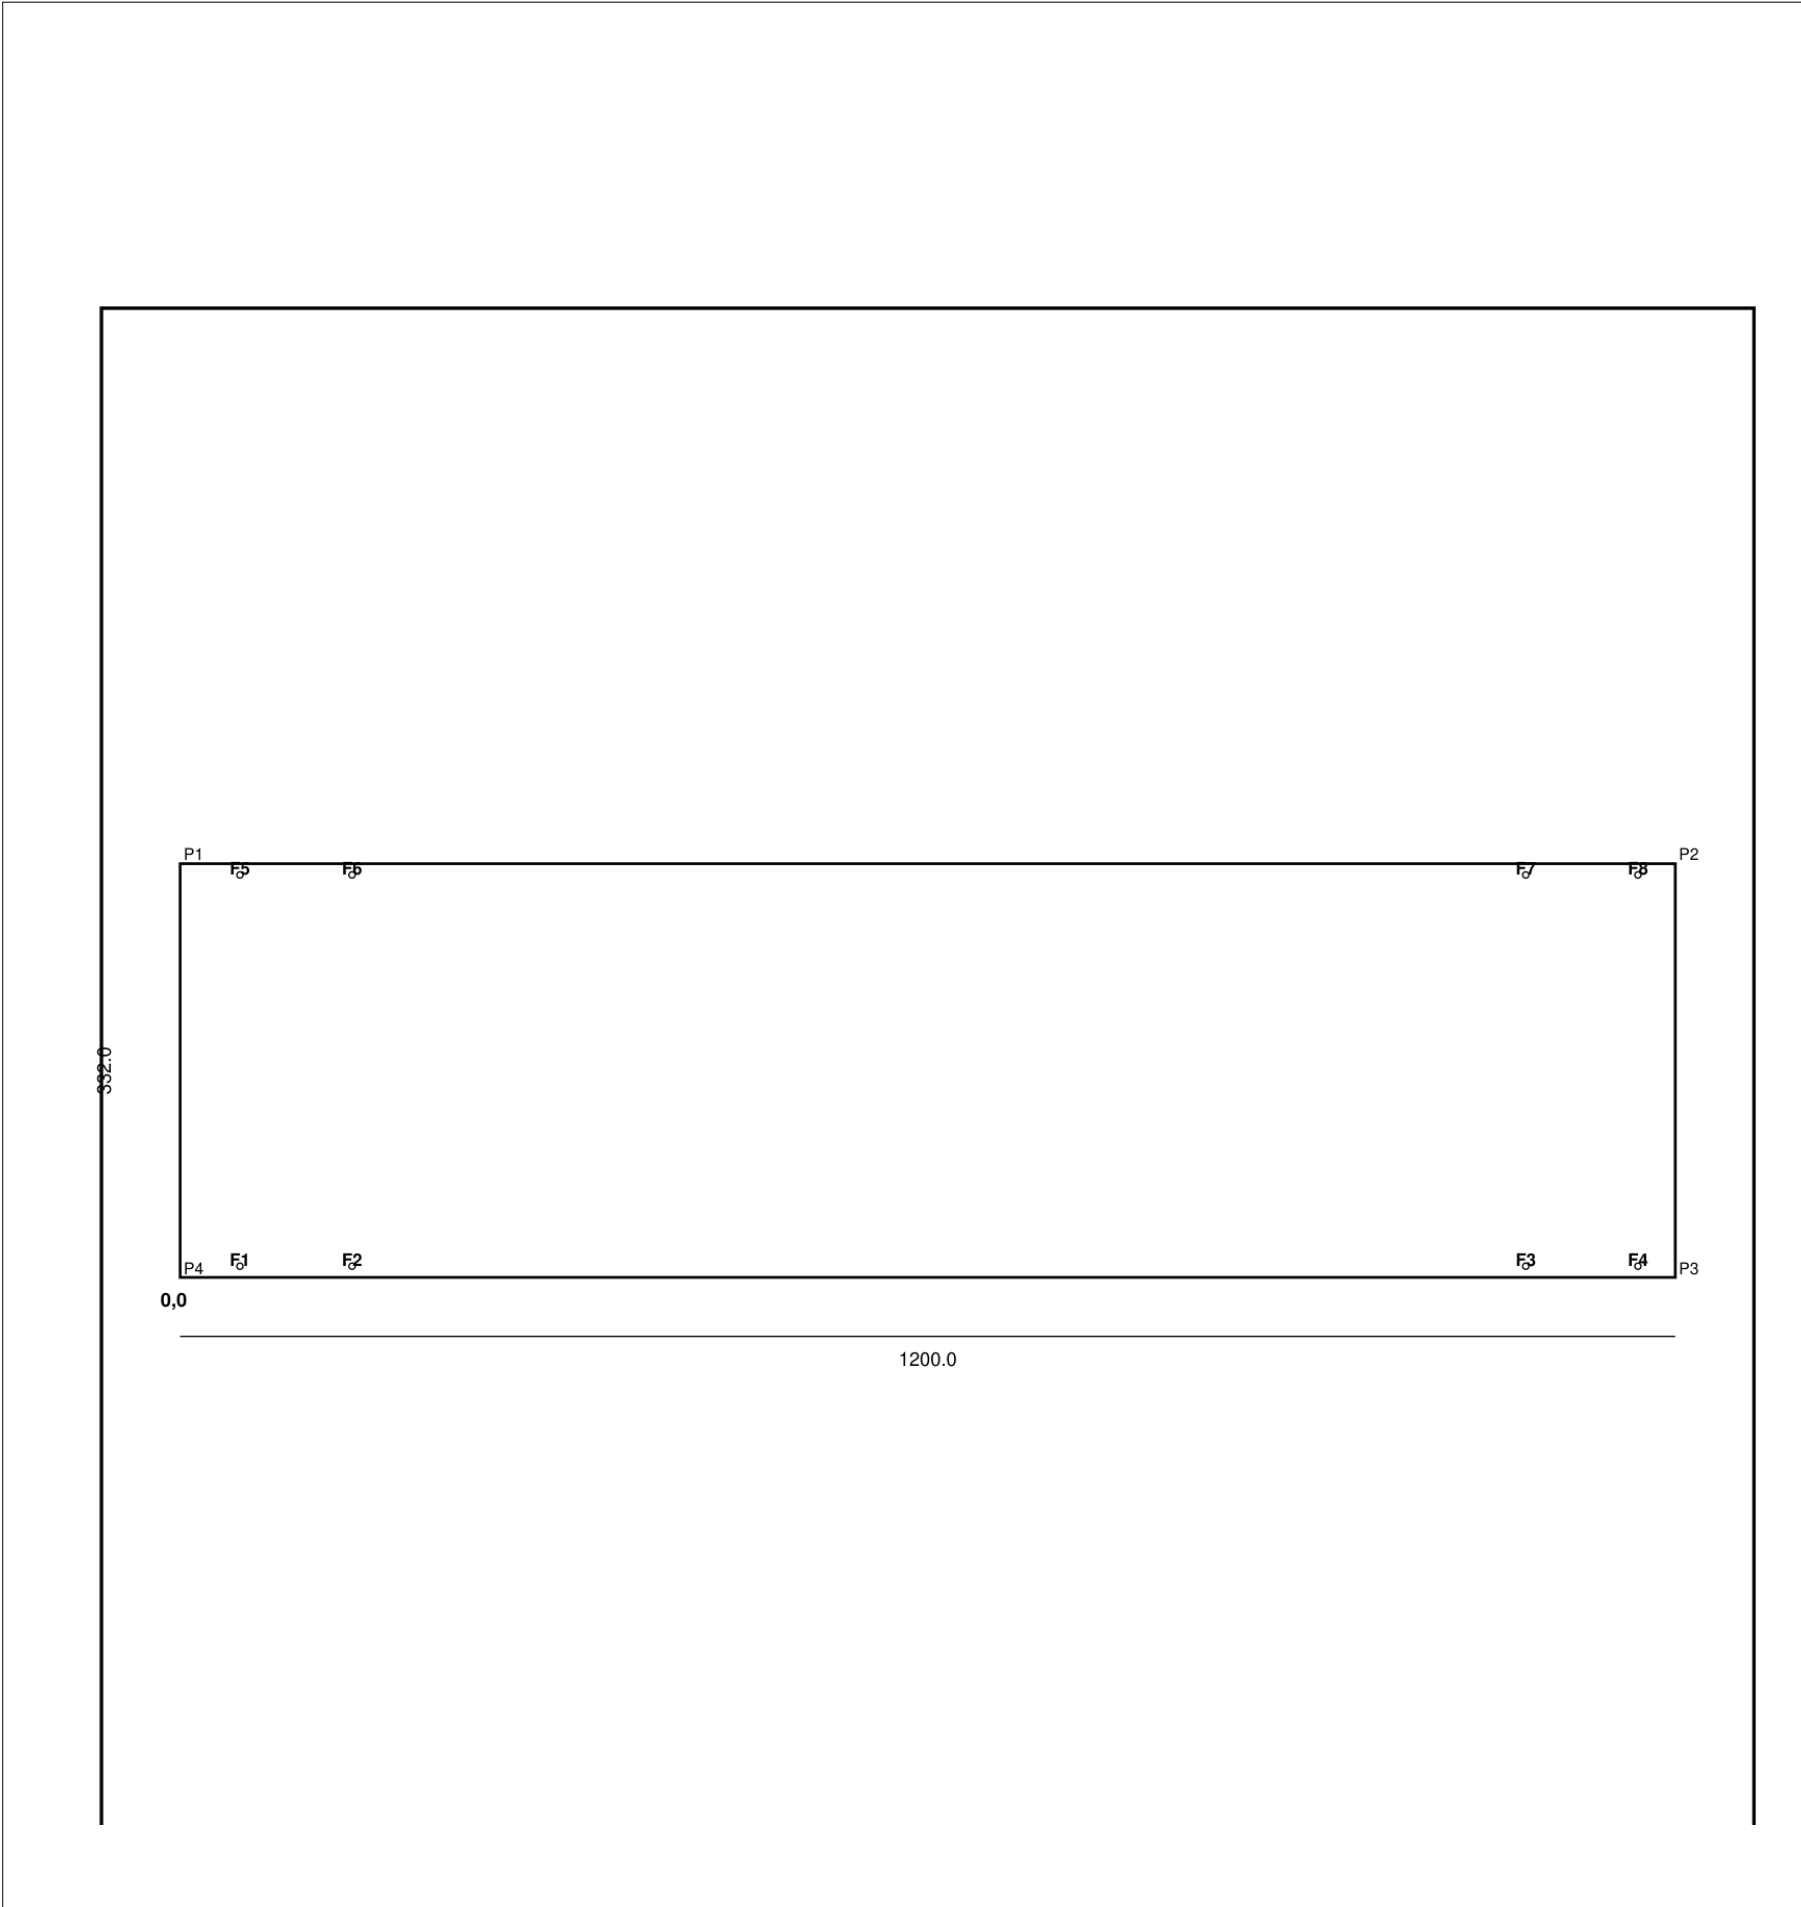

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 5 x 11 deep X 48.0 Y 9.0
- F2 Dia 5 x 11 deep X 138.0 Y 9.0
- F3 Dia 5 x 11 deep X 1080.0 Y 9.0
- F4 Dia 5 x 11 deep X 1170.0 Y 9.0
- F5 Dia 5 x 11 deep X 48.0 Y 323.0
- F6 Dia 5 x 11 deep X 138.0 Y 323.0
- F7 Dia 5 x 11 deep X 1080.0 Y 323.0
- F8 Dia 5 x 11 deep X 1170.0 Y 323.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y332.0 LINE
- P2 X1200.0 Y332.0 LINE
- P3 X1200.0 Y0.0 LINE
- P4 X0.0 Y0.0 LINE
- Page 23

S2-M - Part detail

Overall 1200.0 x 350.0 mm | 18 mm plywood | datum lower-left = X0 Y0

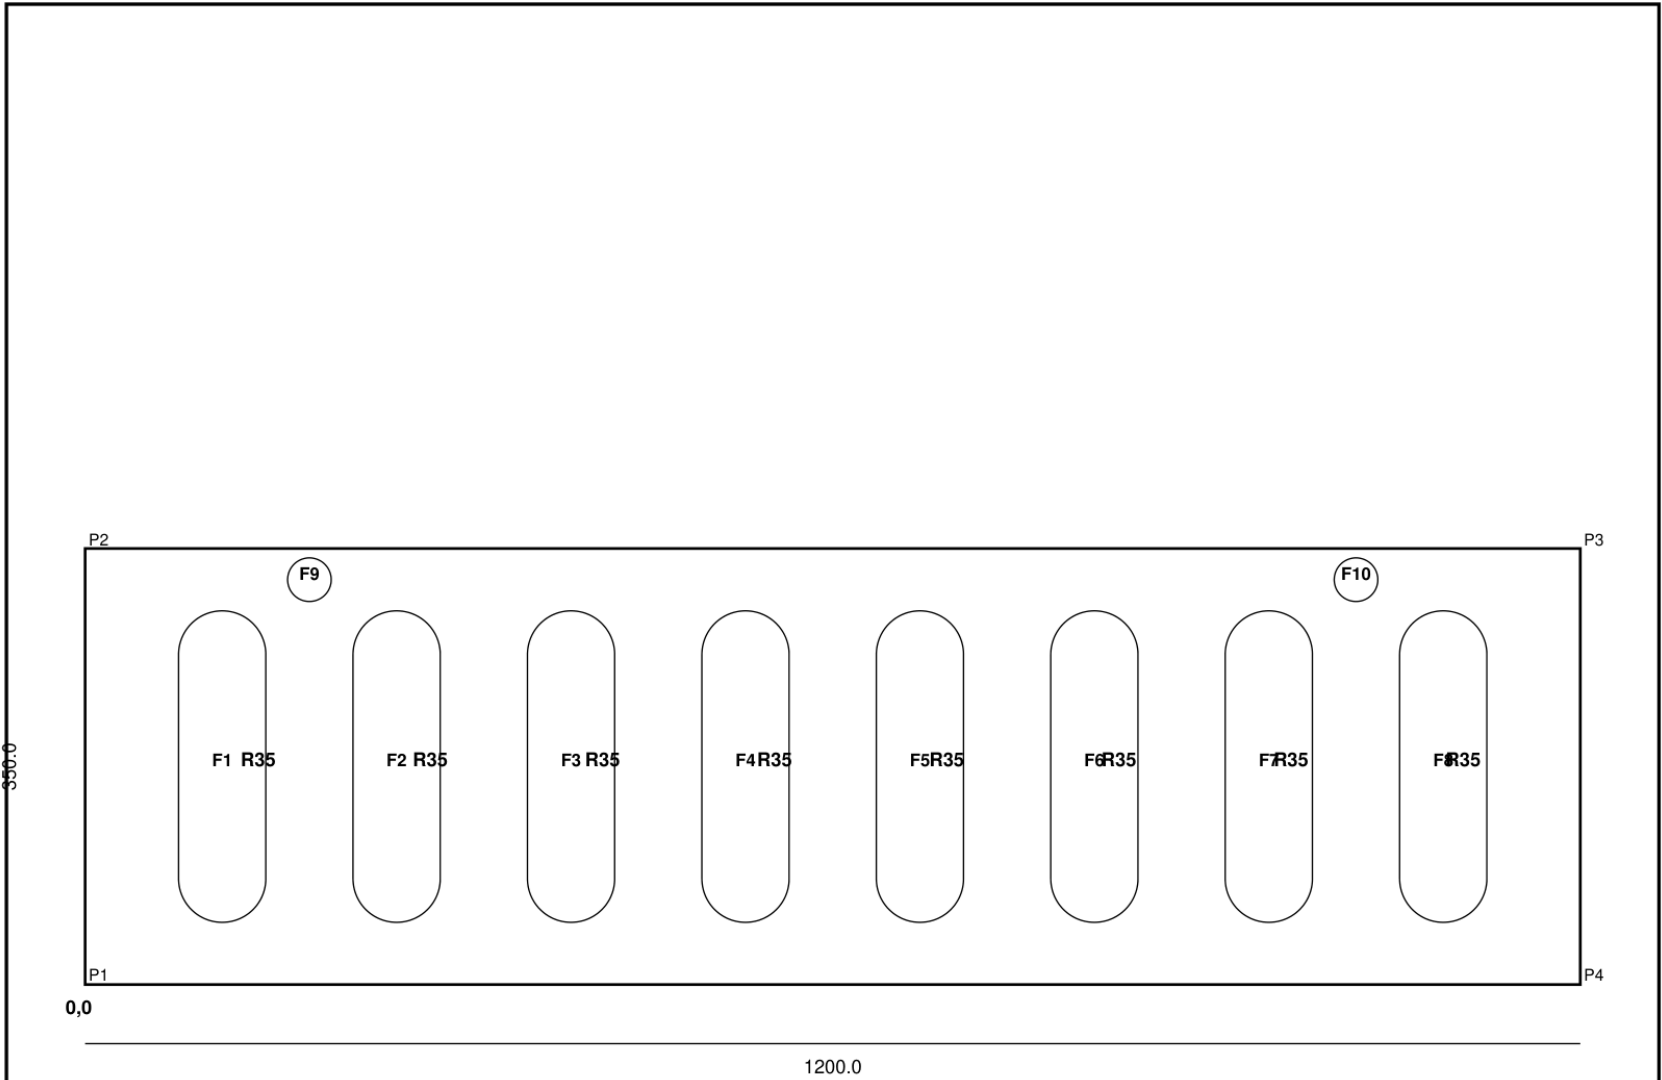

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 slot/cut-out 70.0 x 250.0, R35 X 110.0 Y 175.0
- F2 slot/cut-out 70.0 x 250.0, R35 X 250.0 Y 175.0
- F3 slot/cut-out 70.0 x 250.0, R35 X 390.0 Y 175.0
- F4 slot/cut-out 70.0 x 250.0, R35 X 530.0 Y 175.0
- F5 slot/cut-out 70.0 x 250.0, R35 X 670.0 Y 175.0
- F6 slot/cut-out 70.0 x 250.0, R35 X 810.0 Y 175.0
- F7 slot/cut-out 70.0 x 250.0, R35 X 950.0 Y 175.0
- F8 slot/cut-out 70.0 x 250.0, R35 X 1090.0 Y 175.0
- F9 Dia 35 x 13 deep X 180.0 Y 325.0
- F10 Dia 35 x 13 deep X 1020.0 Y 325.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X0.0 Y350.0 LINE
 - P3 X1200.0 Y350.0 LINE
 - P4 X1200.0 Y0.0 LINE
- Page 24

S3-A - Part detail

Overall 314.0 x 150.1 mm | 18 mm plywood | datum lower-left = X0 Y0

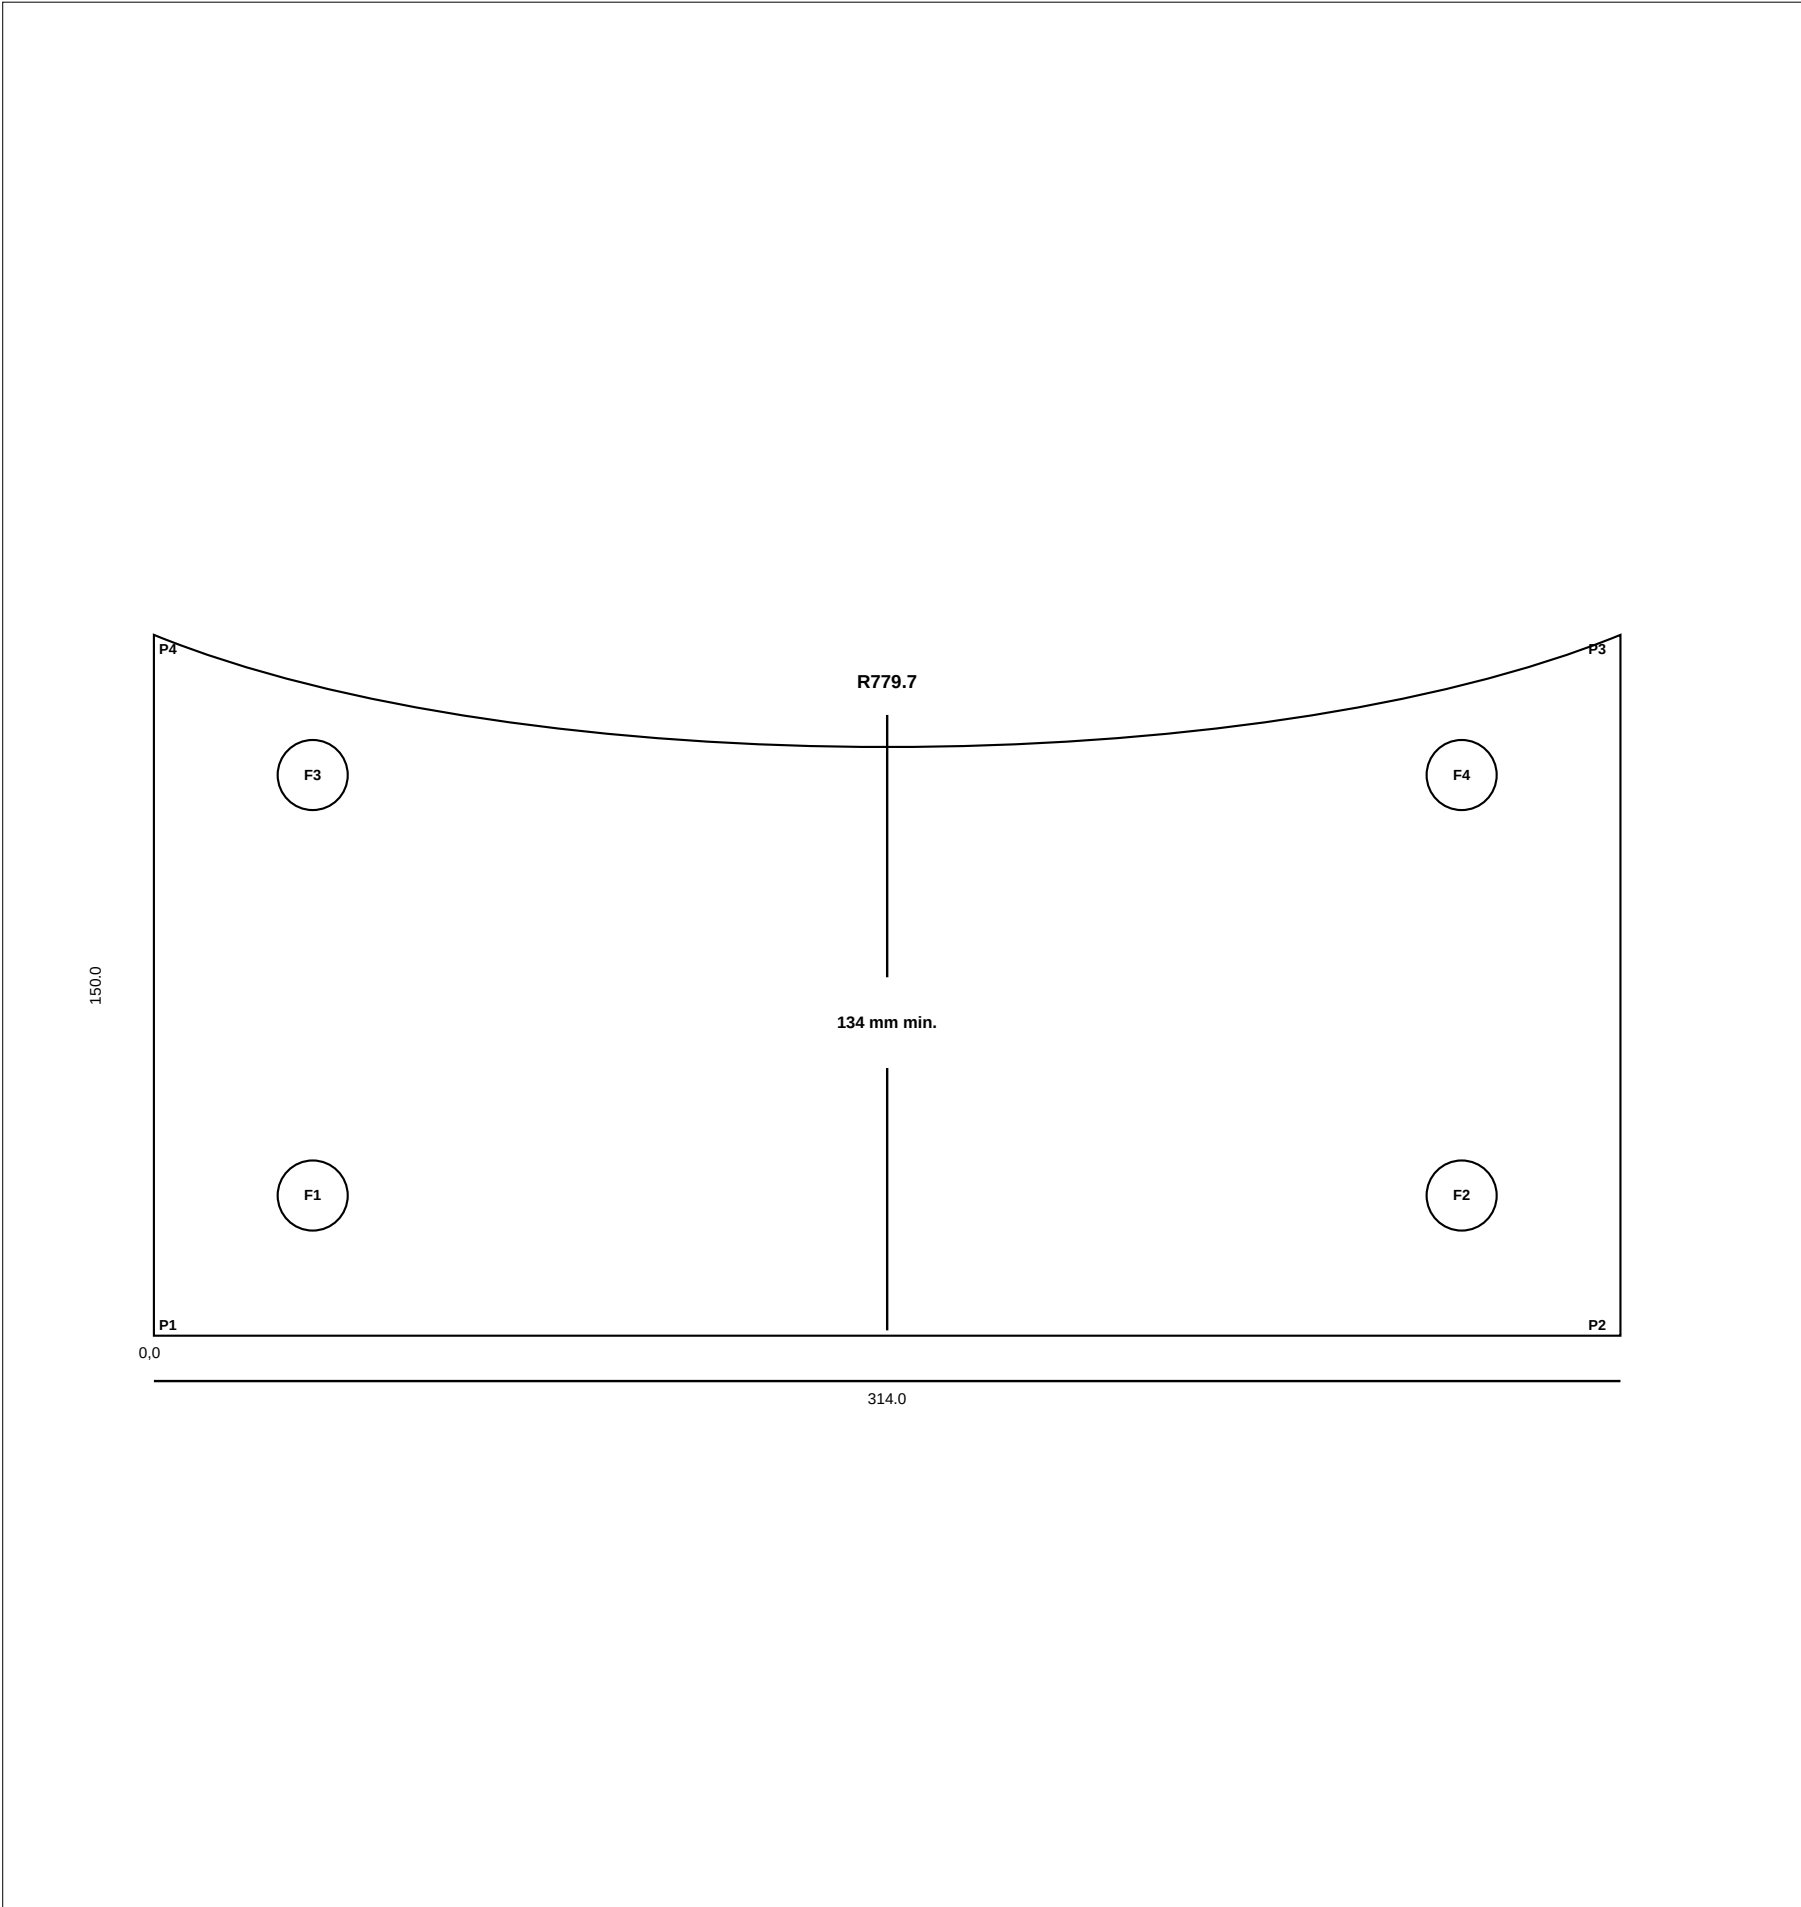

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S3-B - Part detail

Overall 314.0 x 150.0 mm | 18 mm plywood | datum lower-left = X0 Y0

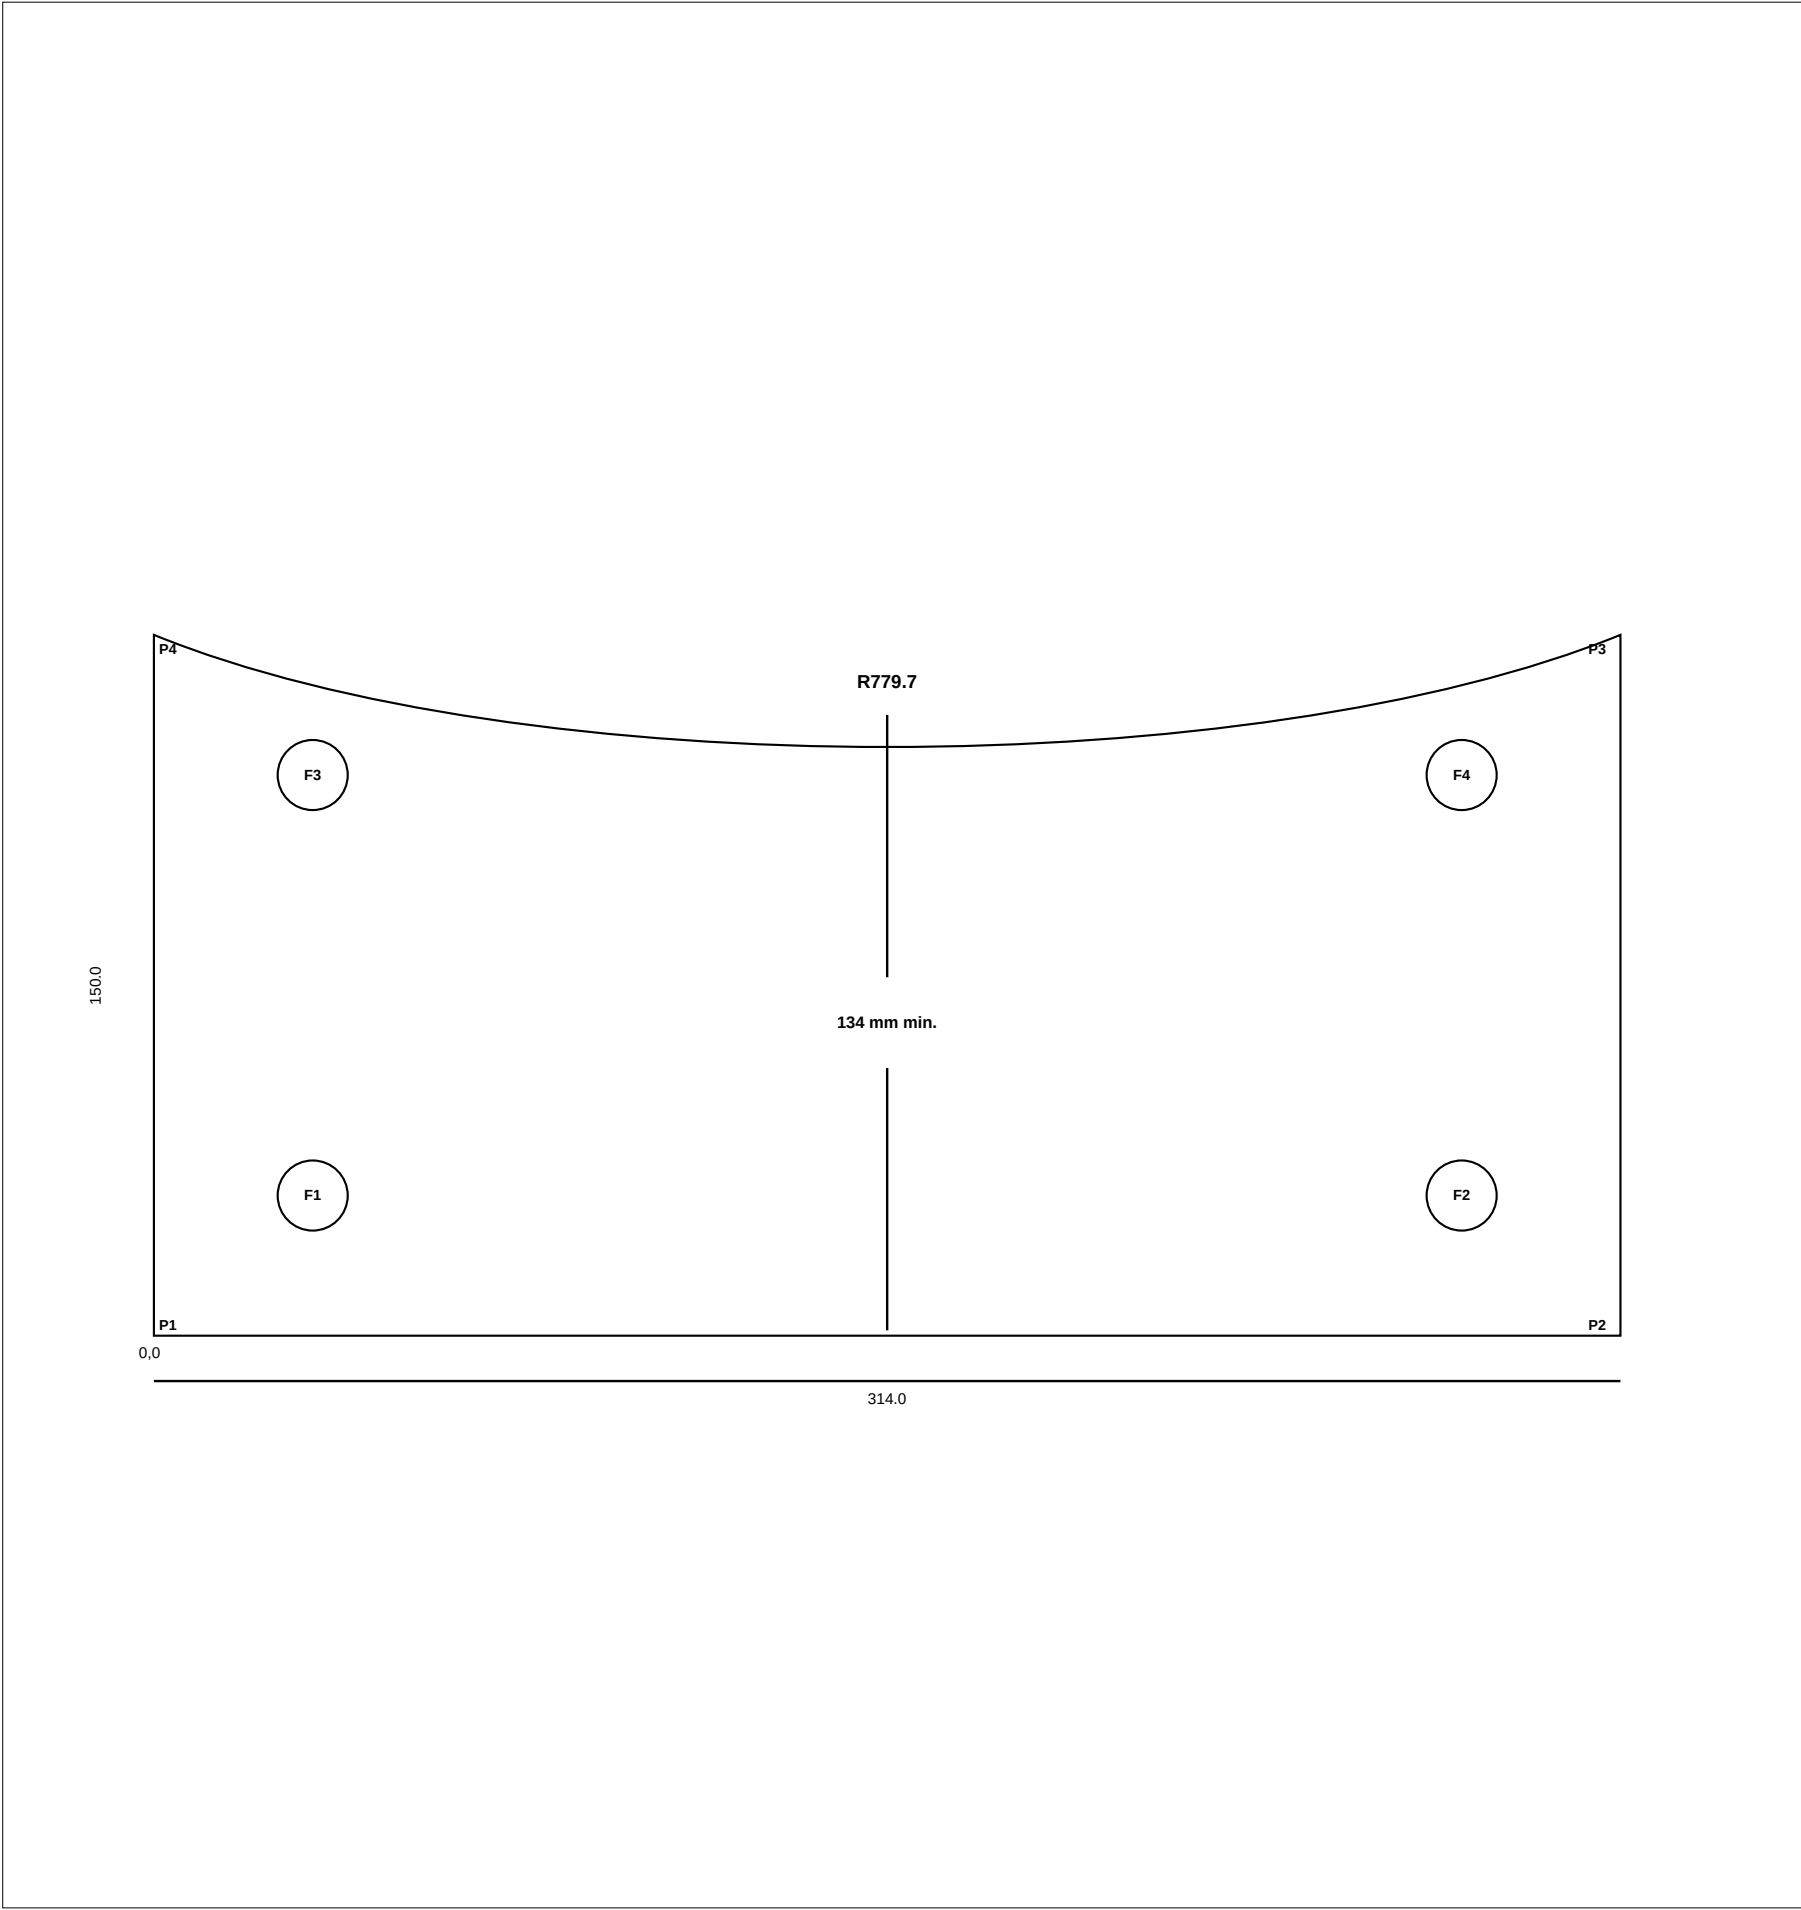

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 34.0 Y 30.0
- F2 Dia 15 x 14 deep X 280.0 Y 30.0
- F3 Dia 15 x 14 deep X 34.0 Y 120.0
- F4 Dia 15 x 14 deep X 280.0 Y 120.0

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
 - P2 X314.0 Y0.0 LINE
 - P3 X314.0 Y150.0 ARC R779.7 CW
 - P4 X0.0 Y150.0 LINE
- Minimum height at centre = 134 mm

S3-C - Part detail

Overall 582.0 x 288.1 mm | 18 mm plywood | datum lower-left = X0 Y0

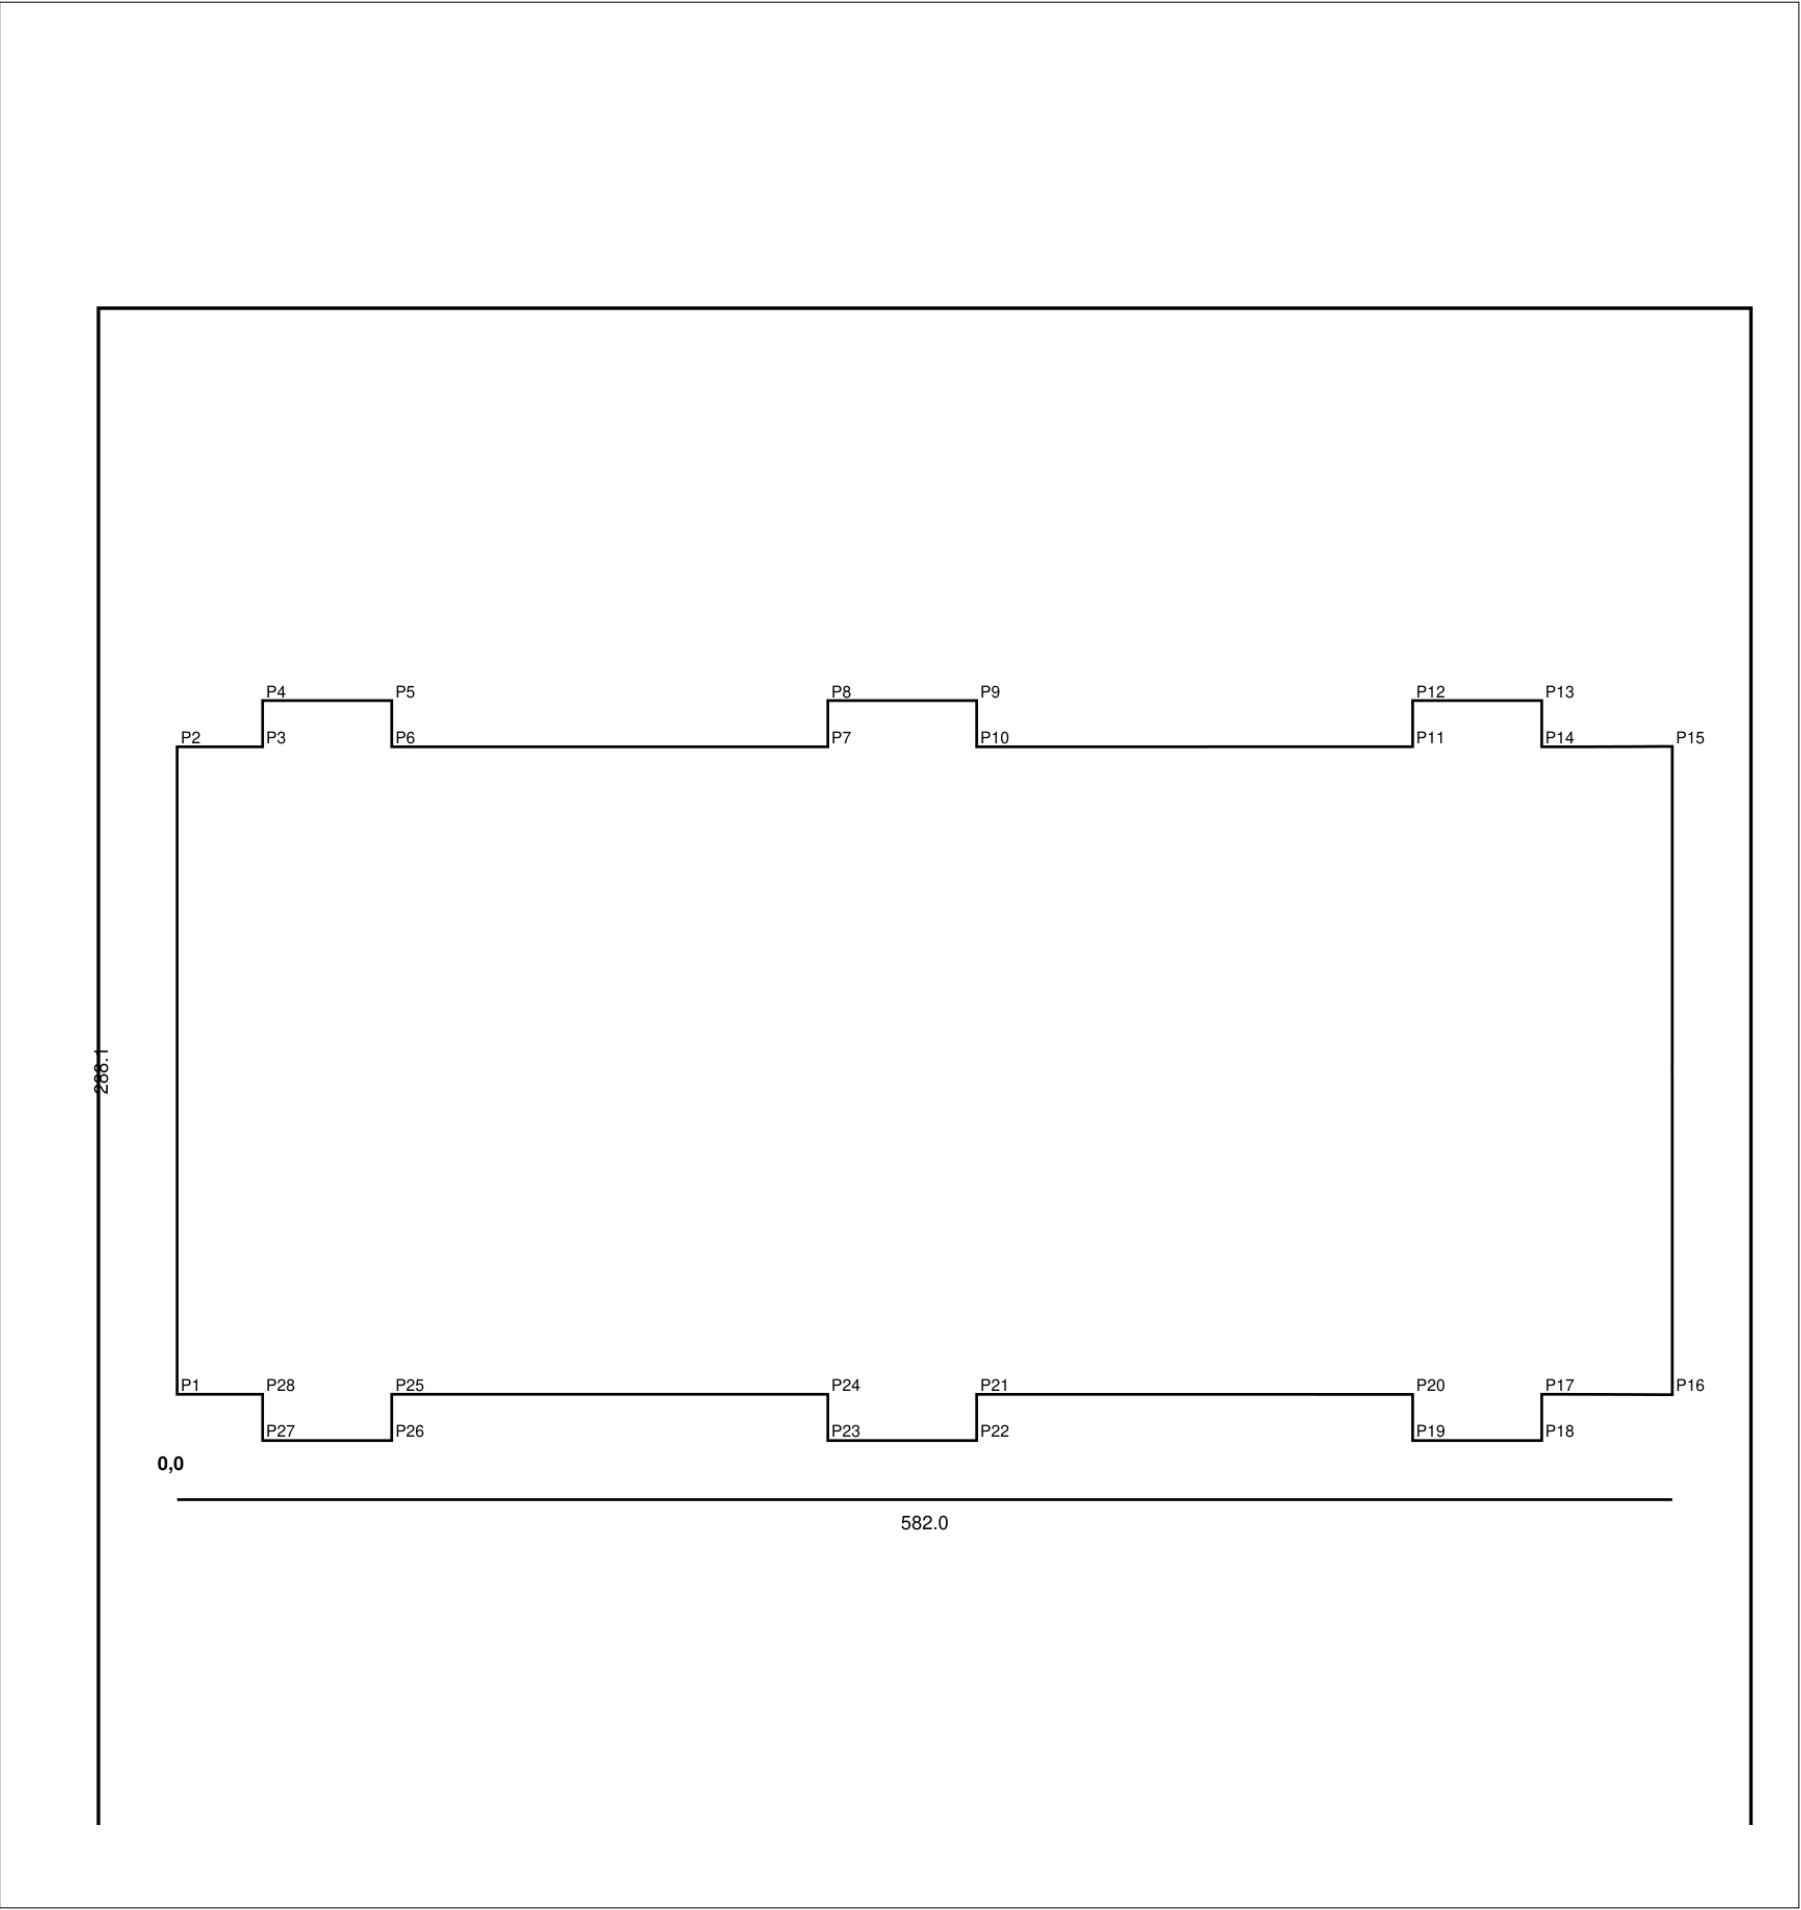

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y270.1 LINE
- P2 X33.3 Y270.0 LINE
- P3 X33.3 Y288.1 LINE
- P4 X83.5 Y288.1 LINE
- P5 X83.5 Y270.1 LINE
- P6 X253.3 Y270.0 LINE
- P7 X253.3 Y288.1 LINE
- P8 X311.2 Y288.1 LINE
- P9 X311.2 Y270.1 LINE
- P10 X480.9 Y270.1 LINE
- P11 X480.9 Y288.1 LINE
- P12 X531.2 Y288.1 LINE
- P13 X531.2 Y270.1 LINE
- P14 X582.0 Y270.2 LINE
- P15 X582.0 Y17.9 LINE
- P16 X531.2 Y18.0 LINE
- P17 X531.2 Y0.0 LINE
- P18 X480.9 Y0.0 LINE
- P19 X480.9 Y18.0 LINE
- P20 X311.2 Y18.0 LINE
- P21 X311.2 Y0.0 LINE
- P22 X253.3 Y0.0 LINE
- P23 X253.3 Y18.0 LINE
- P24 X83.5 Y18.0 LINE
- P25 X83.5 Y0.0 LINE
- P26 X33.3 Y0.0 LINE
- P27 X33.3 Y18.0 LINE
- P28 X0.0 Y18.0 LINE

S3-D - Part detail

Overall 284.0 x 252.0 mm | 18 mm plywood | datum lower-left = X0 Y0

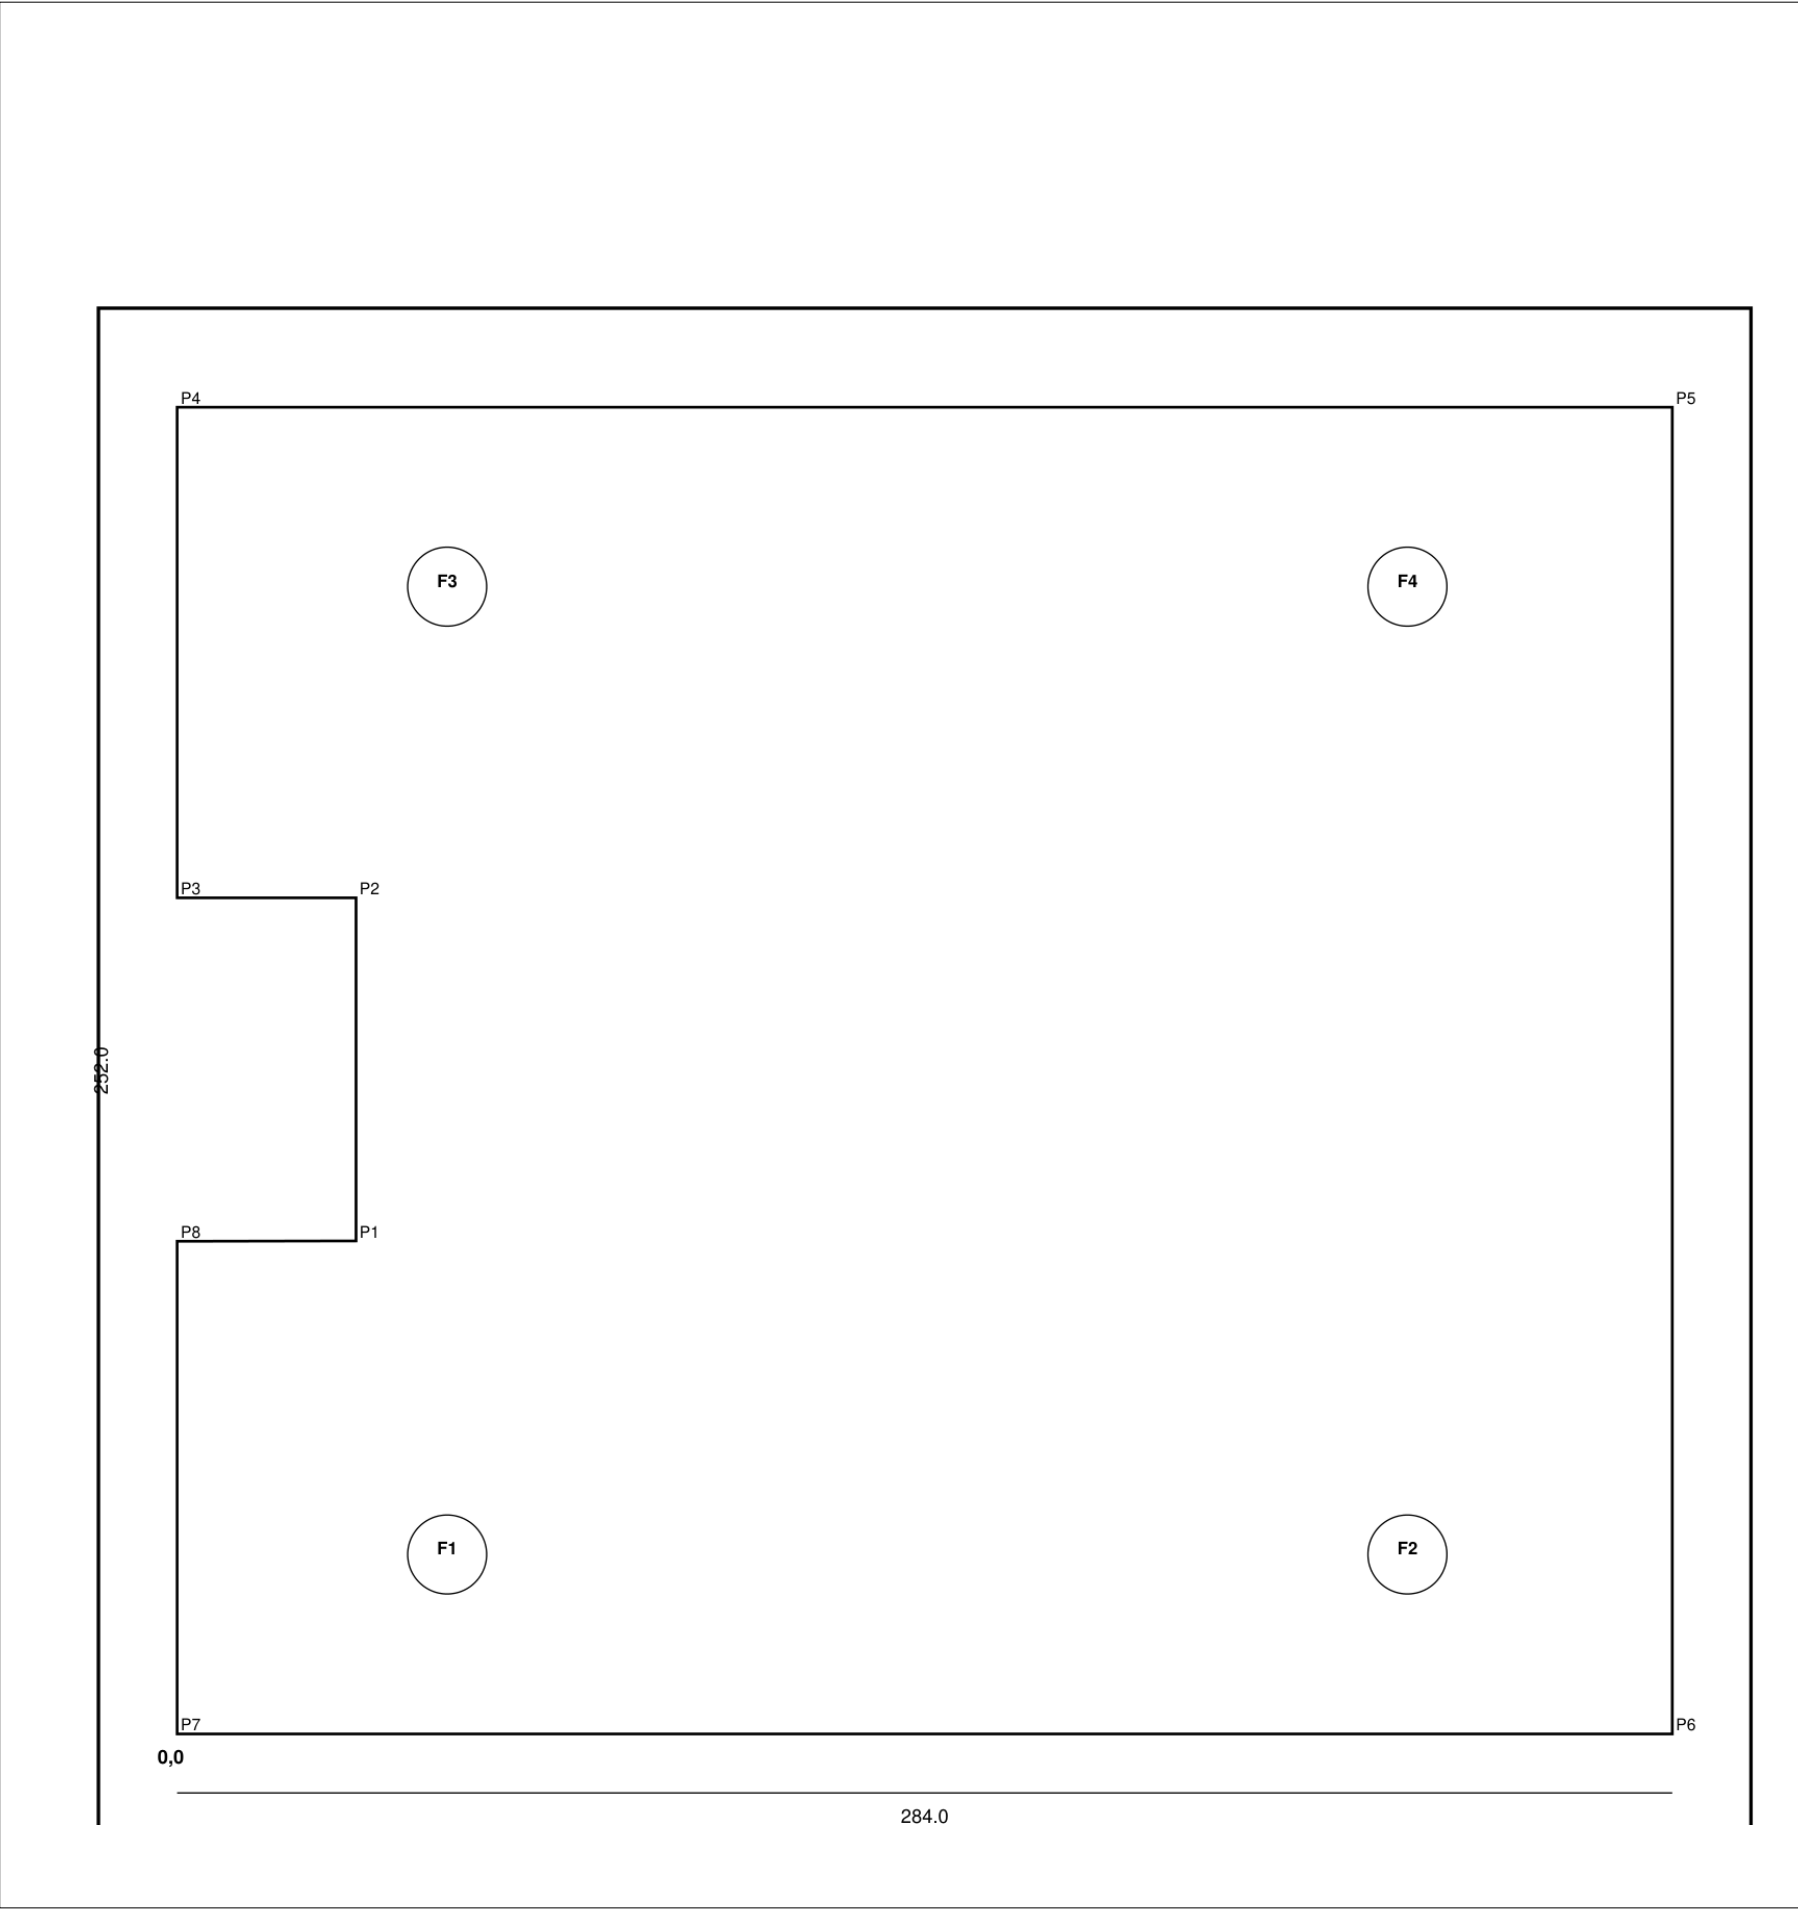

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 Dia 15 x 14 deep X 51.3 Y 34.1
- F2 Dia 15 x 14 deep X 233.7 Y 34.1
- F3 Dia 15 x 14 deep X 51.3 Y 217.9
- F4 Dia 15 x 14 deep X 233.7 Y 217.9

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X34.0 Y93.6 LINE
 - P2 X34.0 Y158.8 LINE
 - P3 X0.0 Y158.8 LINE
 - P4 X0.0 Y252.0 LINE
 - P5 X284.0 Y252.0 LINE
 - P6 X284.0 Y0.0 LINE
 - P7 X0.0 Y0.0 LINE
 - P8 X0.0 Y93.6 LINE
- Page 28

S3-E - Part detail

Overall 284.0 x 252.0 mm | 18 mm plywood | datum lower-left = X0 Y0

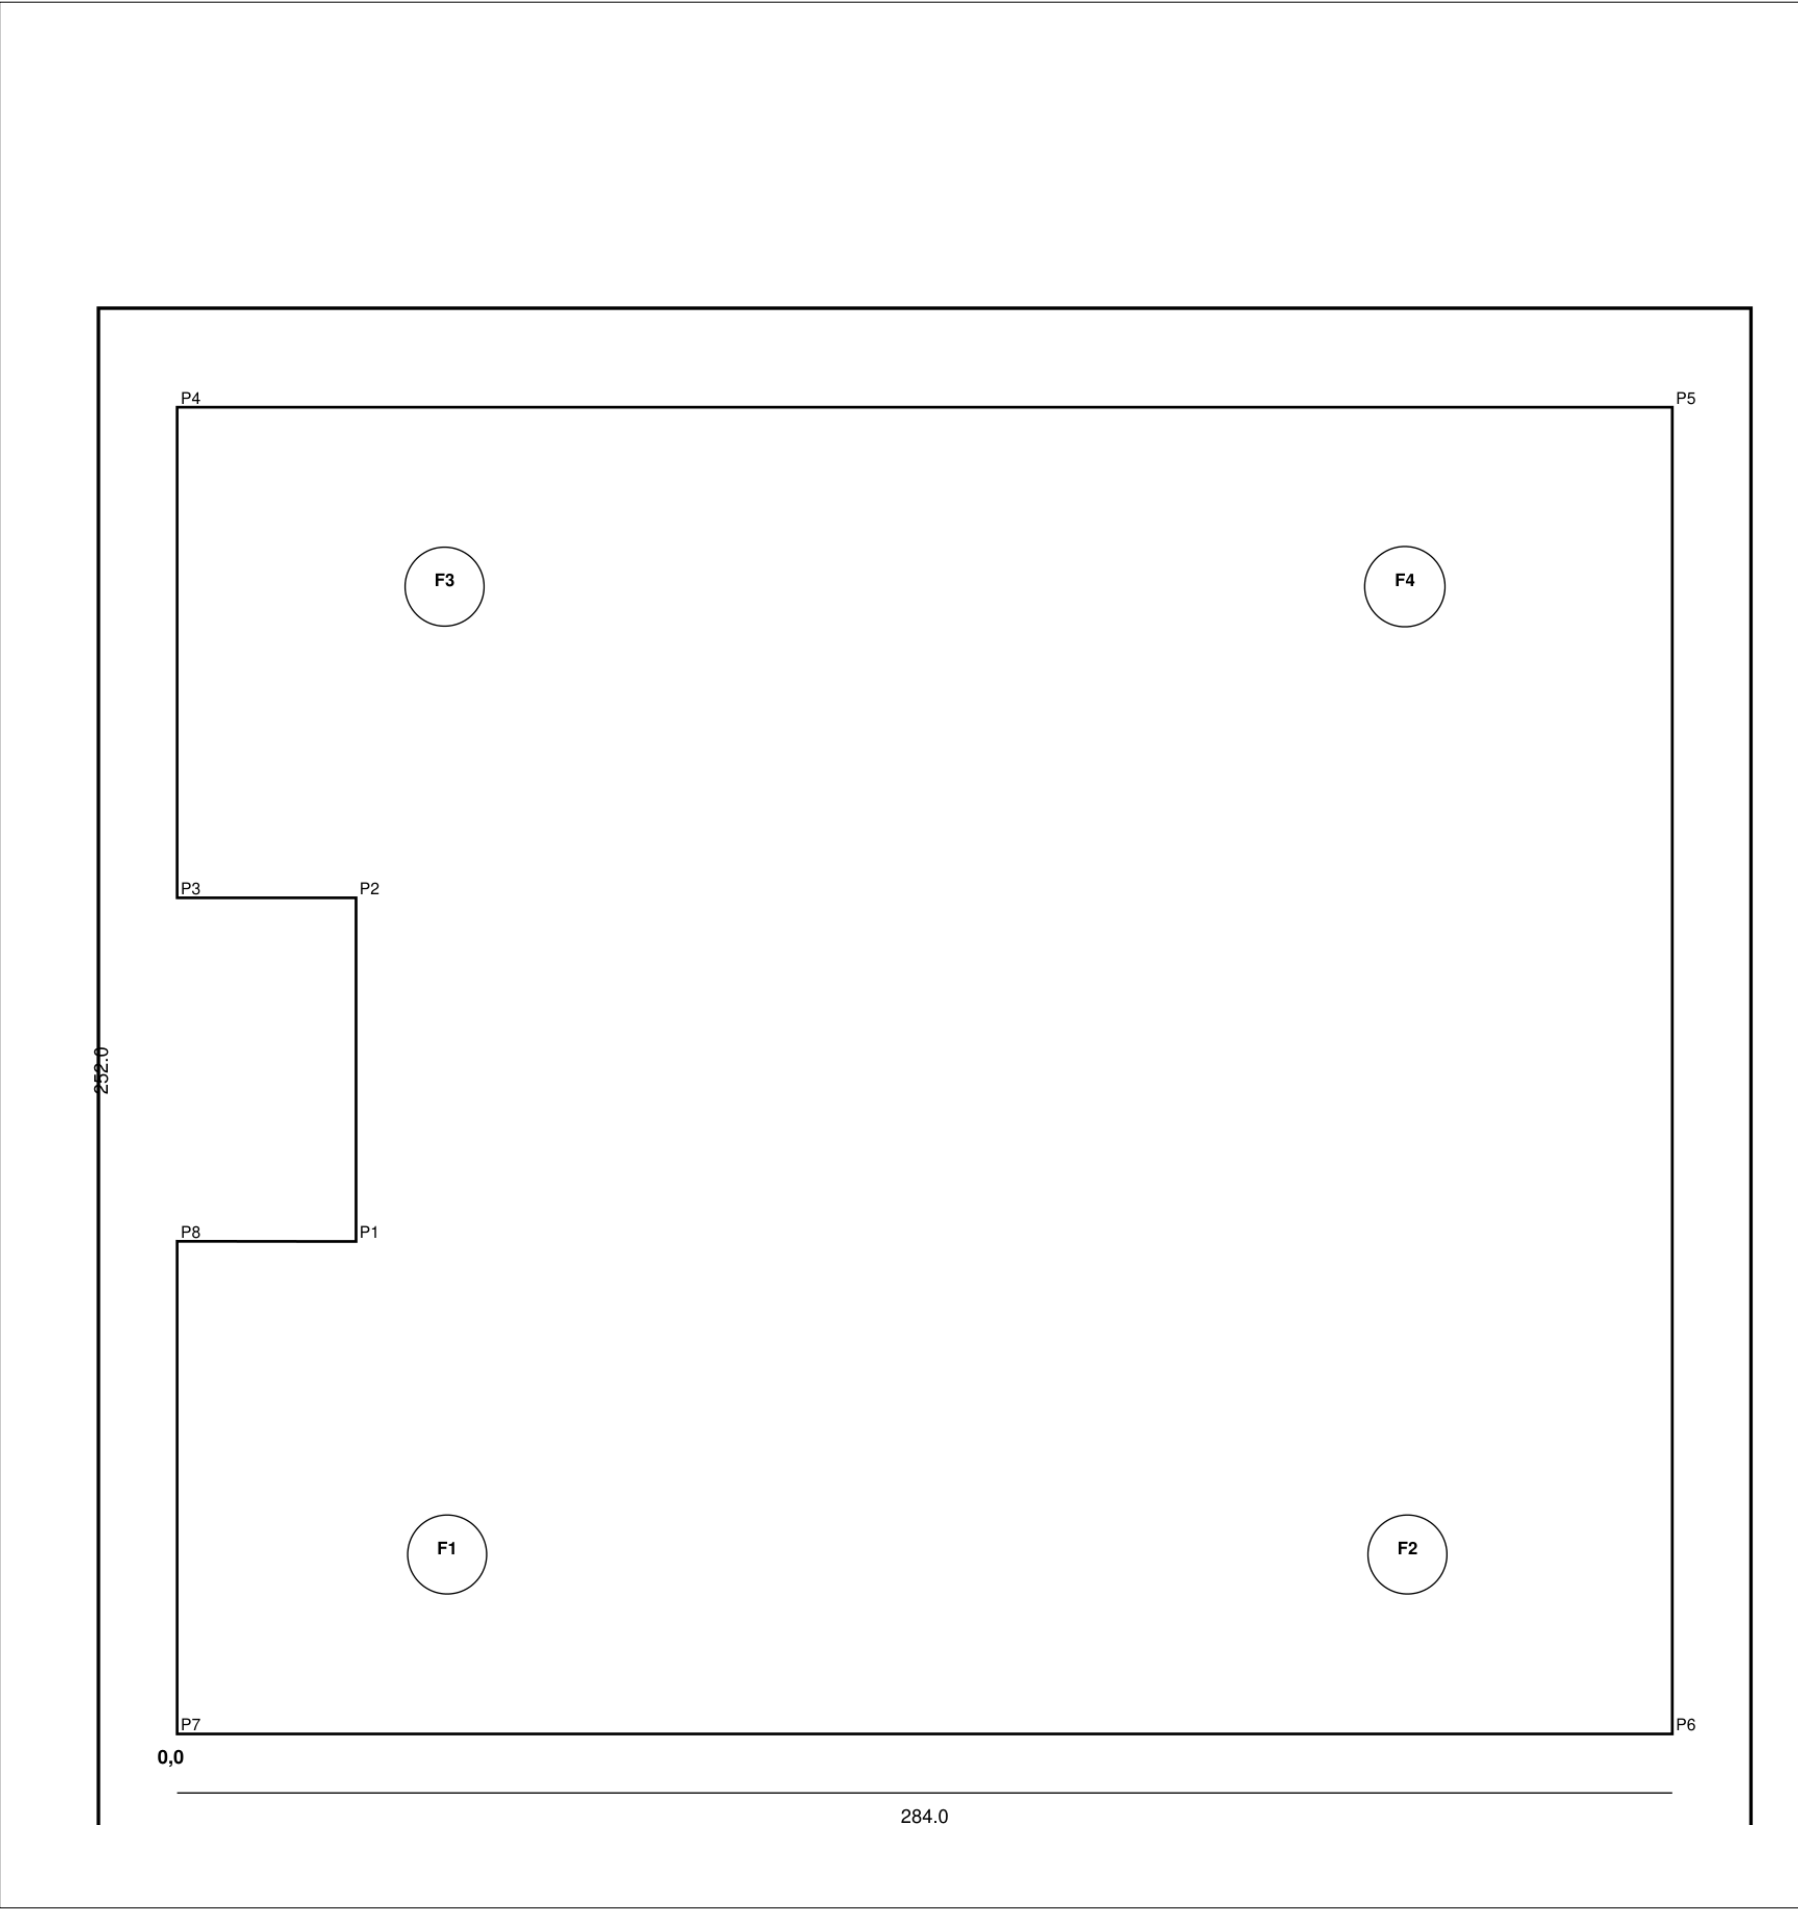

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 Dia 15 x 14 deep X 51.3 Y 34.1
- F2 Dia 15 x 14 deep X 233.7 Y 34.1
- F3 Dia 15 x 14 deep X 50.8 Y 217.9
- F4 Dia 15 x 14 deep X 233.2 Y 217.9


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.
P points are labelled on the drawing. Join each point to the next as shown.

- P1 X34.0 Y93.5 LINE
- P2 X34.0 Y158.8 LINE
- P3 X0.0 Y158.8 LINE
- P4 X0.0 Y252.0 LINE
- P5 X284.0 Y252.0 LINE
- P6 X284.0 Y0.0 LINE
- P7 X0.0 Y0.0 LINE
- P8 X0.0 Y93.6 LINE

S3-F - Part detail

Overall 288.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

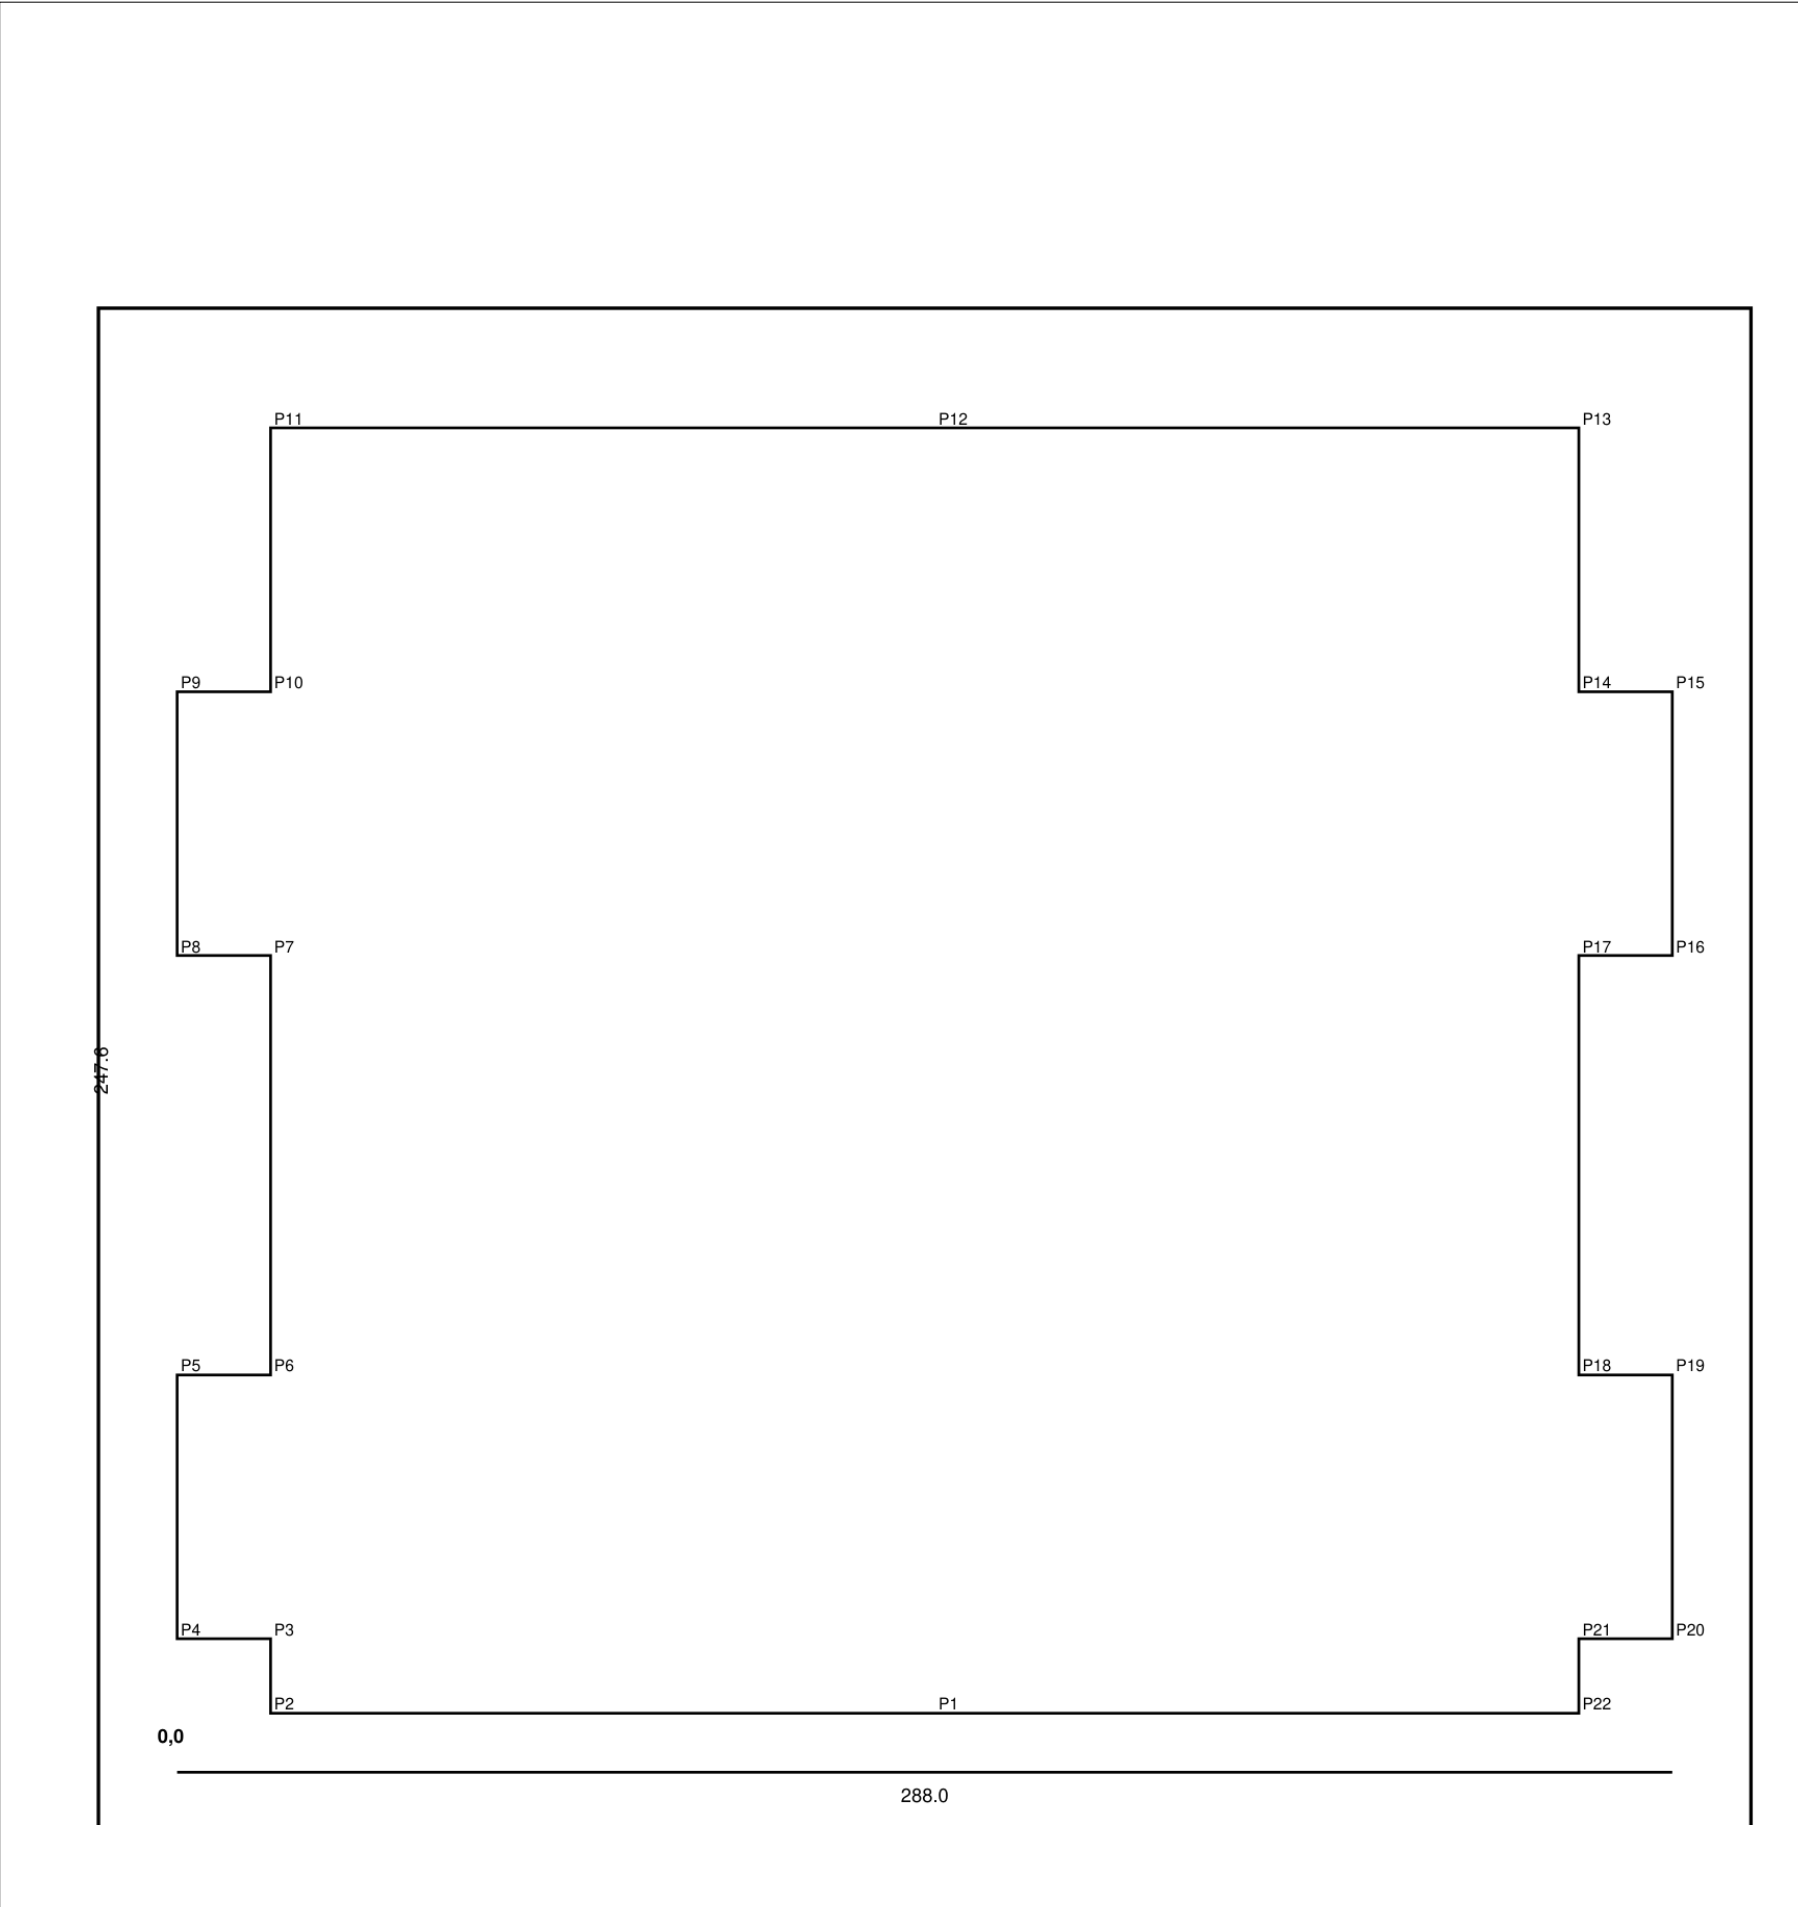

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X146.0 Y0.0 LINE

P2 X18.0 Y0.0 LINE

P3 X18.0 Y14.3 LINE

P4 X0.0 Y14.3 LINE

P5 X0.0 Y65.1 LINE

P6 X18.0 Y65.1 LINE

P7 X18.0 Y145.9 LINE

P8 X0.0 Y145.9 LINE

P9 X0.0 Y196.7 LINE

P10 X18.0 Y196.7 LINE

P11 X18.0 Y247.6 LINE

P12 X146.0 Y247.6 LINE

P13 X270.0 Y247.6 LINE

P14 X270.0 Y196.8 LINE

P15 X288.0 Y196.8 LINE

P16 X288.0 Y146.0 LINE

P17 X270.0 Y146.0 LINE

P18 X270.0 Y65.2 LINE

P19 X288.0 Y65.2 LINE


P20 X288.0 Y14.4 LINE

P21 X270.0 Y14.4 LINE

P22 X270.0 Y0.0 LINE

S3-G - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

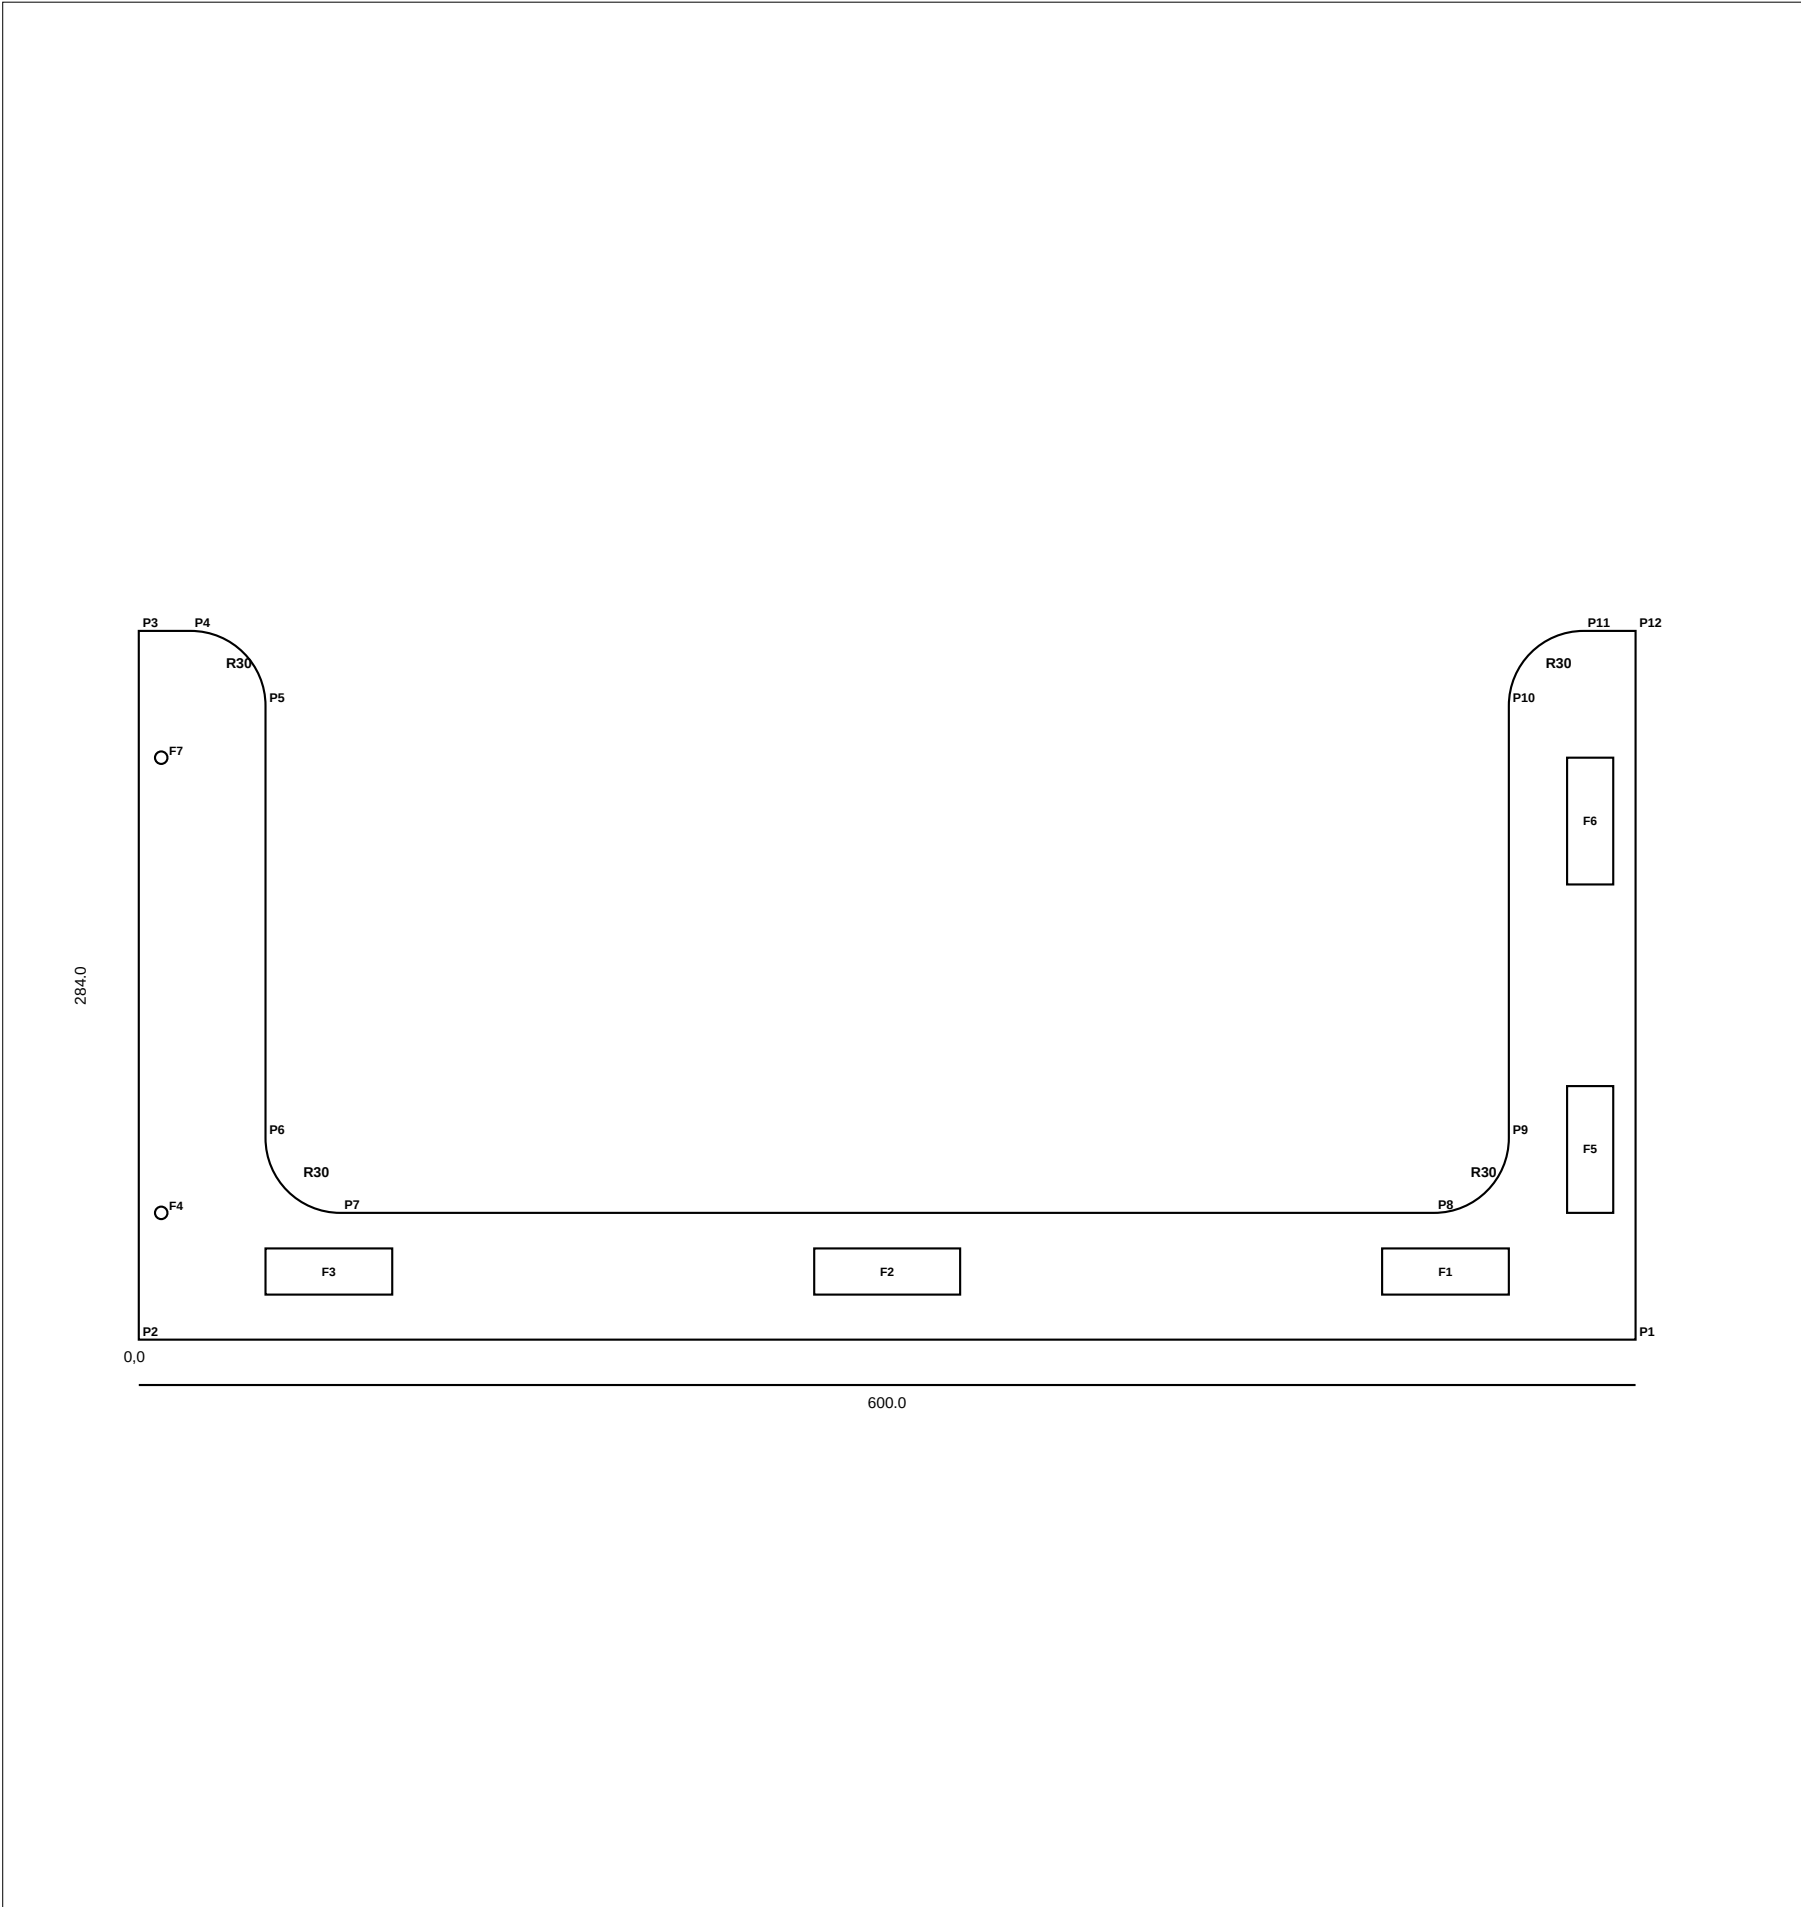

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 slot/cut-out 50.8 x 18.5 X 523.8 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 300.0 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 76.2 Y 27.3
- F4 Dia 5 x 11 deep X 9.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 581.8 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 581.8 Y 207.8
- F7 Dia 5 x 11 deep X 9.0 Y 233.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X600.0 Y0.0 LINE
 - P2 X0.0 Y0.0 LINE
 - P3 X0.0 Y284.0 LINE
 - P4 X20.8 Y284.0 ARC R30 CW
 - P5 X50.8 Y254.0 LINE
 - P6 X50.8 Y80.8 ARC R30 CW
 - P7 X80.8 Y50.8 LINE
 - P8 X519.2 Y50.8 ARC R30 CW
 - P9 X549.2 Y80.8 LINE
 - P10 X549.2 Y254.0 ARC R30 CW
 - P11 X579.2 Y284.0 LINE
 - P12 X600.0 Y284.0 LINE

S3-H - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

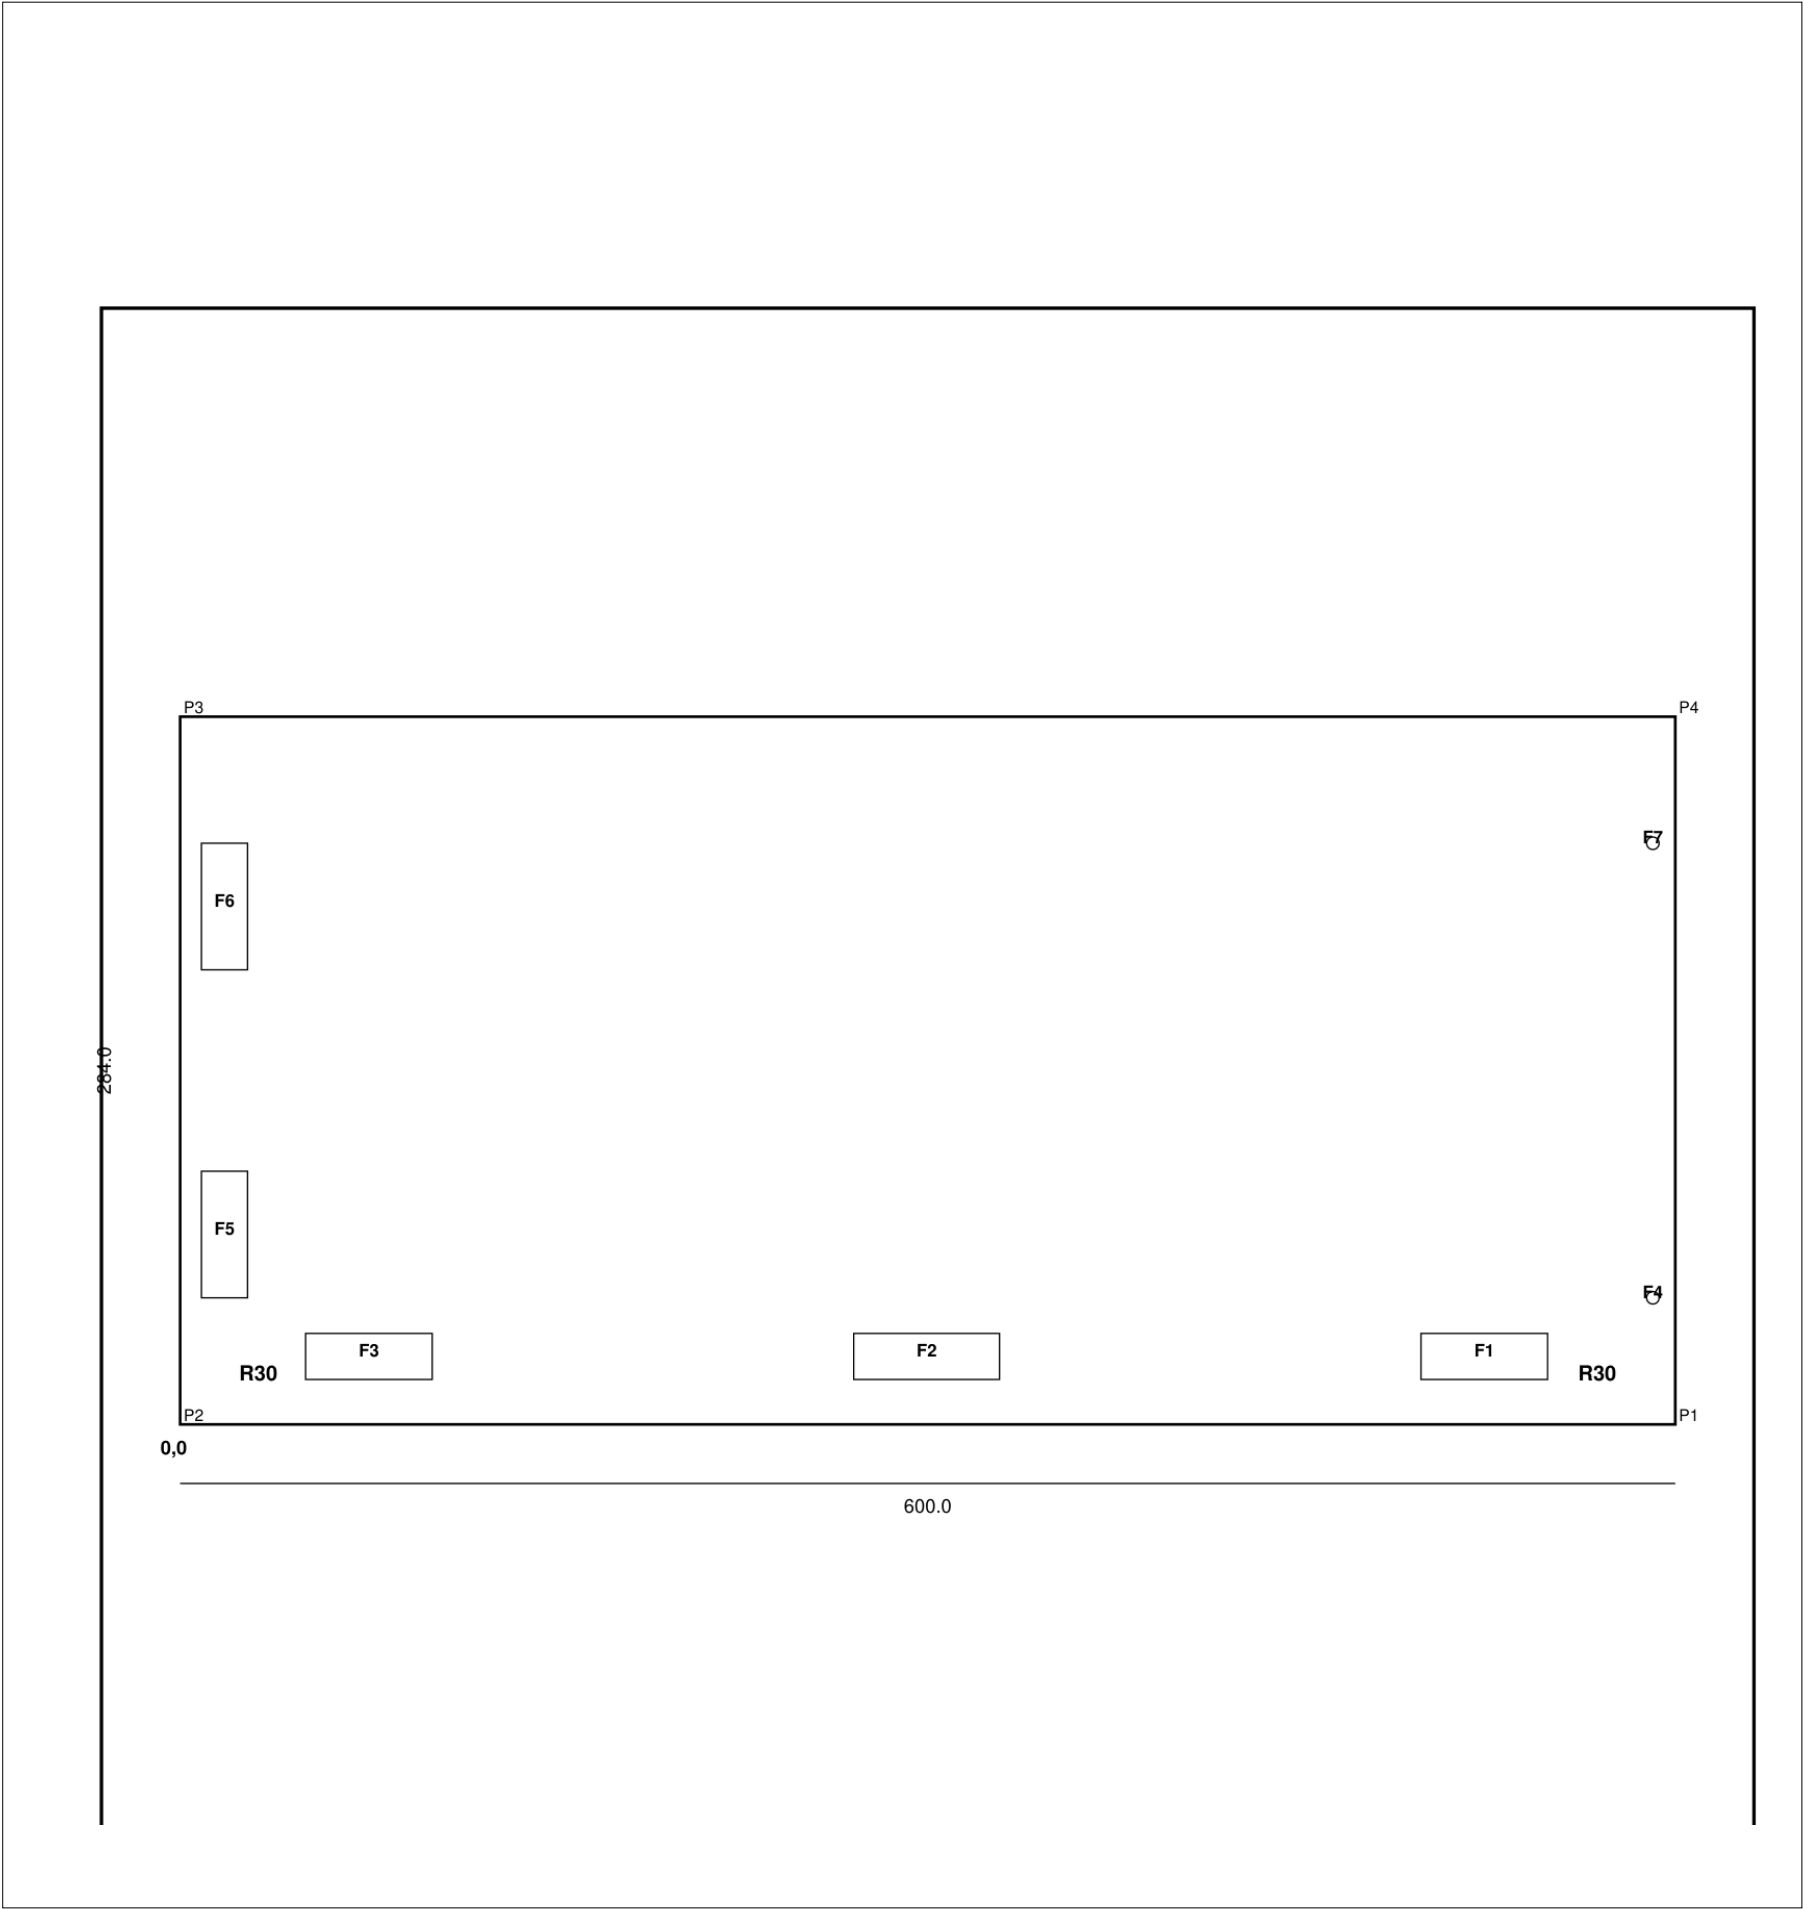

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features


- F1 slot/cut-out 50.8 x 18.5 X 523.4 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 299.6 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 75.8 Y 27.3
- F4 Dia 5 x 11 deep X 591.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 17.8 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 17.8 Y 207.8
- F7 Dia 5 x 11 deep X 591.0 Y 233.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X600.0 Y0.0 LINE
- P2 X0.0 Y0.0 LINE
- P3 X0.0 Y284.0 LINE
- P4 X600.0 Y284.0 LINE
- Page 32

S3-I - Part detail

Overall 582.0 x 288.1 mm | 18 mm plywood | datum lower-left = X0 Y0

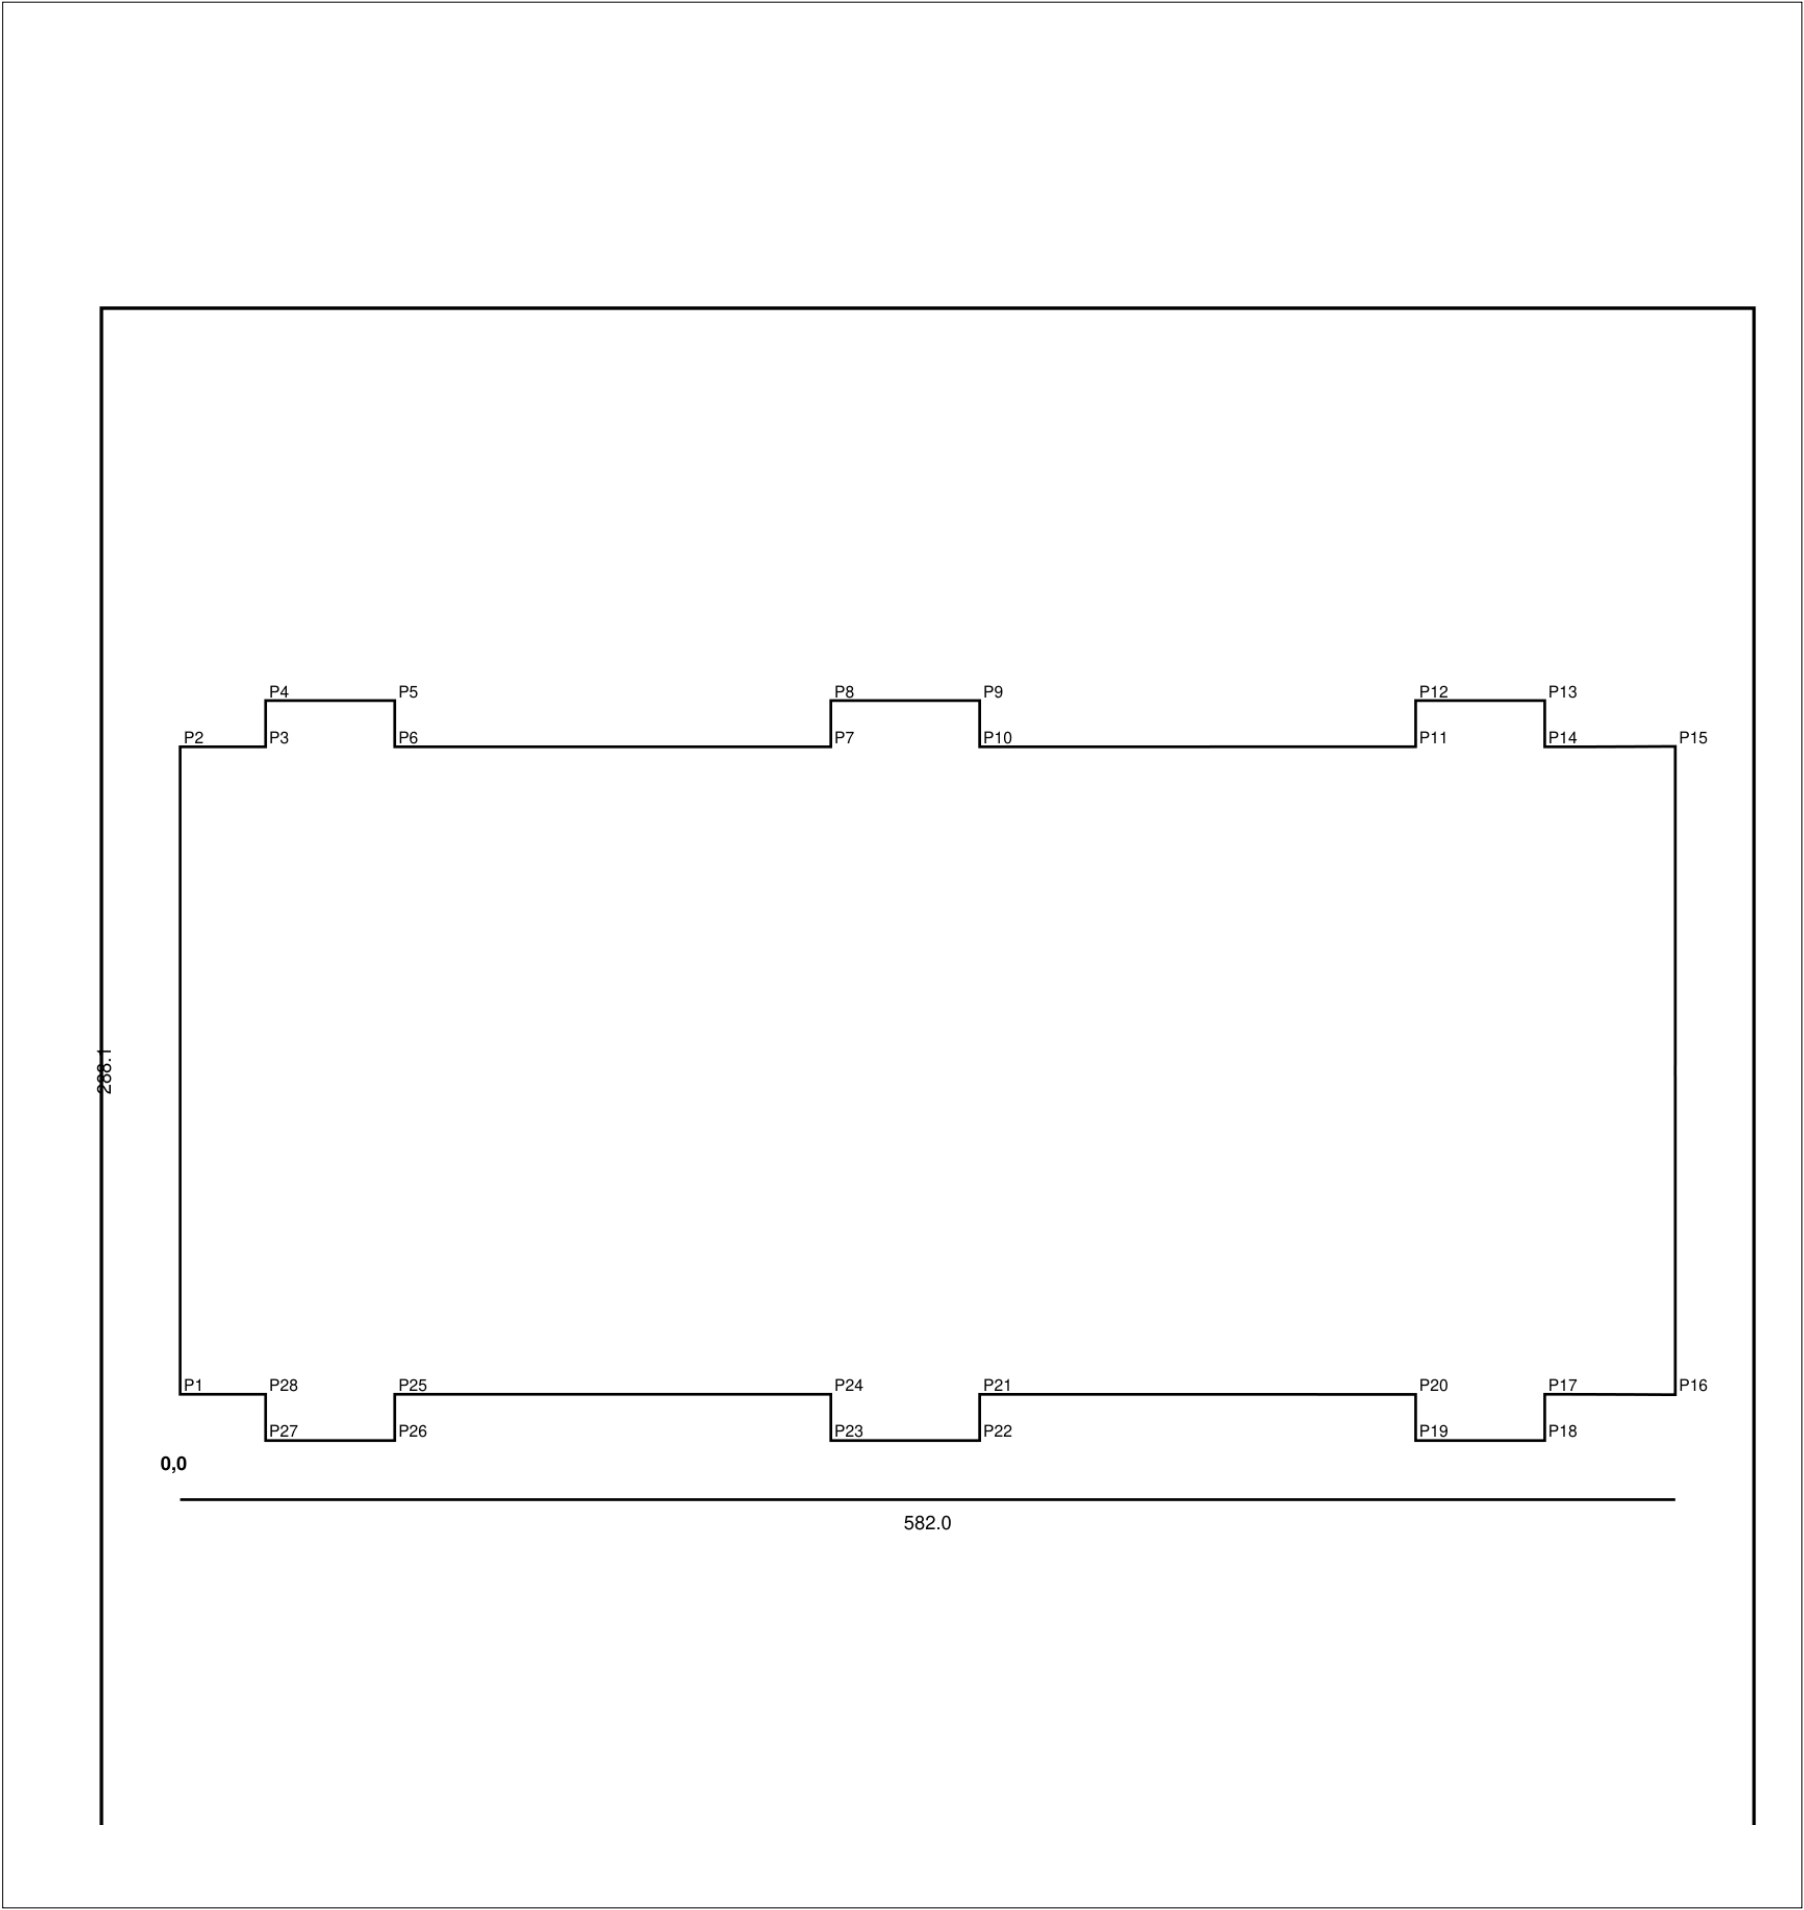

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y270.1 LINE
- P2 X33.3 Y270.0 LINE
- P3 X33.3 Y288.1 LINE
- P4 X83.5 Y288.1 LINE
- P5 X83.5 Y270.1 LINE
- P6 X253.3 Y270.0 LINE
- P7 X253.3 Y288.1 LINE
- P8 X311.2 Y288.1 LINE
- P9 X311.2 Y270.1 LINE
- P10 X480.9 Y270.1 LINE
- P11 X480.9 Y288.1 LINE
- P12 X531.2 Y288.1 LINE
- P13 X531.2 Y270.1 LINE
- P14 X582.0 Y270.2 LINE
- P15 X582.0 Y17.9 LINE
- P16 X531.2 Y18.0 LINE
- P17 X531.2 Y0.0 LINE
- P18 X480.9 Y0.0 LINE
- P19 X480.9 Y18.0 LINE
- P20 X311.2 Y18.0 LINE
- P21 X311.2 Y0.0 LINE
- P22 X253.3 Y0.0 LINE
- P23 X253.3 Y18.0 LINE
- P24 X83.5 Y18.0 LINE
- P25 X83.5 Y0.0 LINE
- P26 X33.3 Y0.0 LINE
- P27 X33.3 Y18.0 LINE
- P28 X0.0 Y18.0 LINE

S3-J - Part detail

Overall 288.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

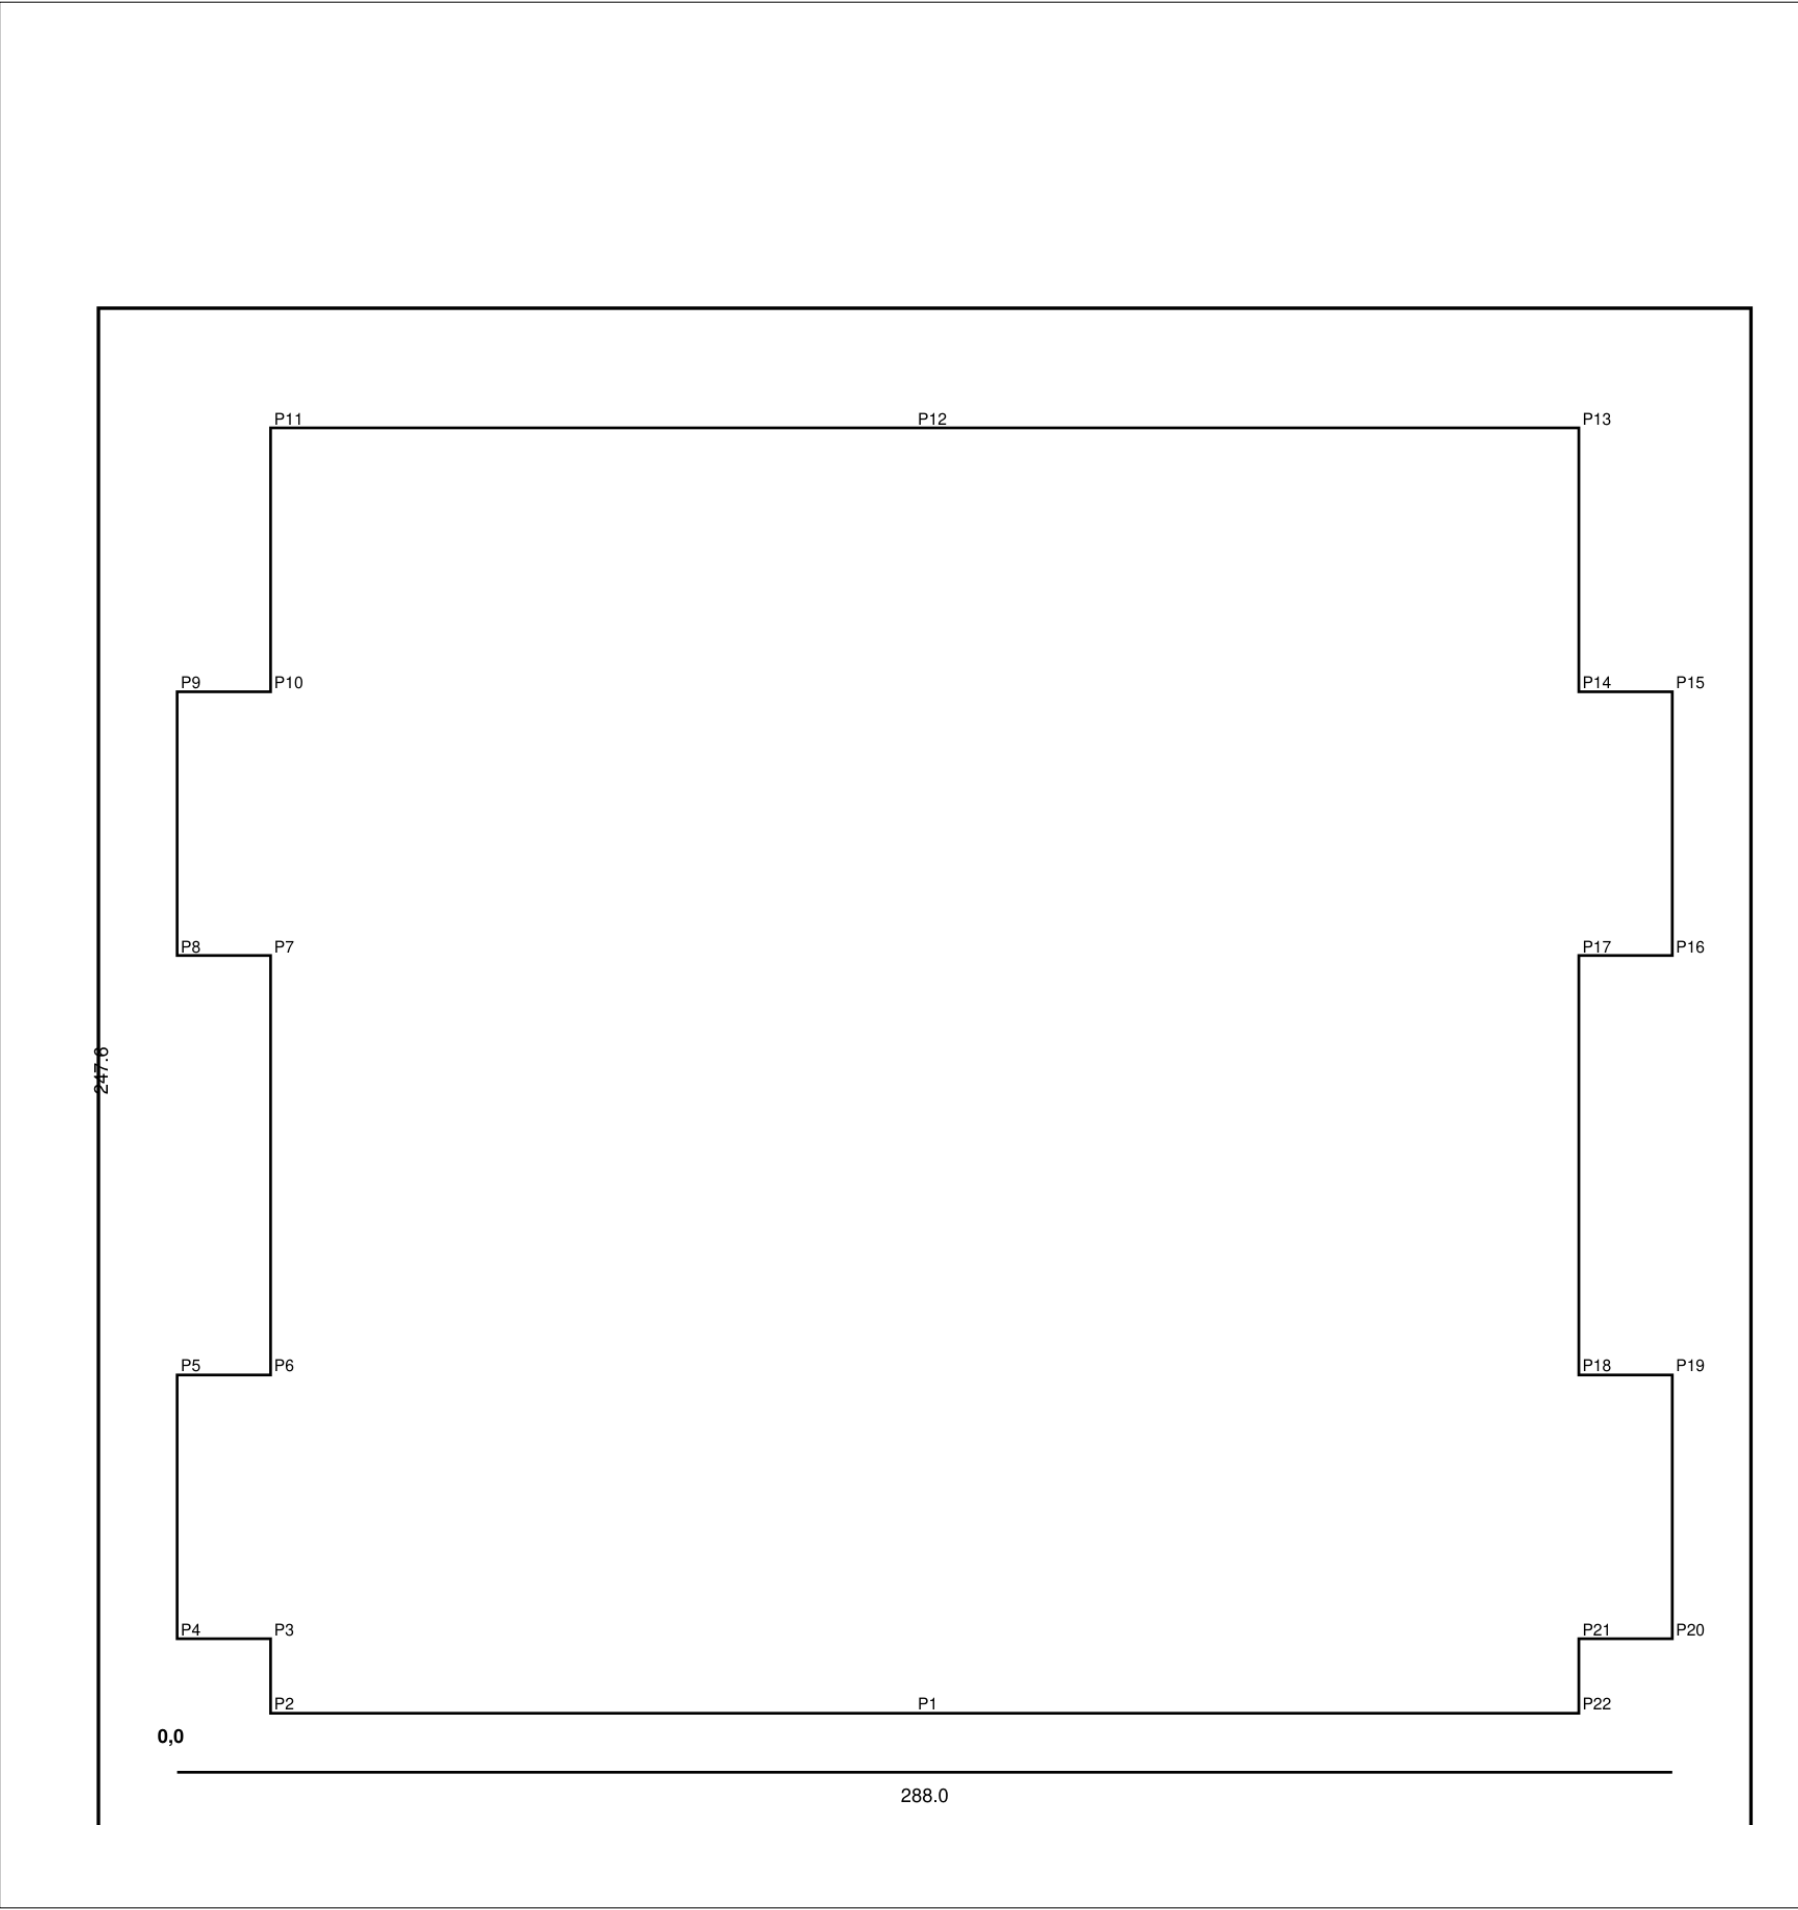

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X142.0 Y0.0 LINE

P2 X18.0 Y0.0 LINE

P3 X18.0 Y14.4 LINE

P4 X0.0 Y14.4 LINE

P5 X0.0 Y65.2 LINE

P6 X18.0 Y65.2 LINE

P7 X18.0 Y146.0 LINE

P8 X0.0 Y146.0 LINE

P9 X0.0 Y196.8 LINE

P10 X18.0 Y196.8 LINE

P11 X18.0 Y247.6 LINE

P12 X142.0 Y247.6 LINE

P13 X270.0 Y247.6 LINE

P14 X270.0 Y196.7 LINE

P15 X288.0 Y196.7 LINE

P16 X288.0 Y145.9 LINE

P17 X270.0 Y145.9 LINE

P18 X270.0 Y65.1 LINE

P19 X288.0 Y65.1 LINE


P20 X288.0 Y14.3 LINE

P21 X270.0 Y14.3 LINE

P22 X270.0 Y0.0 LINE

S3-K - Part detail

Overall 288.0 x 247.6 mm | 18 mm plywood | datum lower-left = X0 Y0

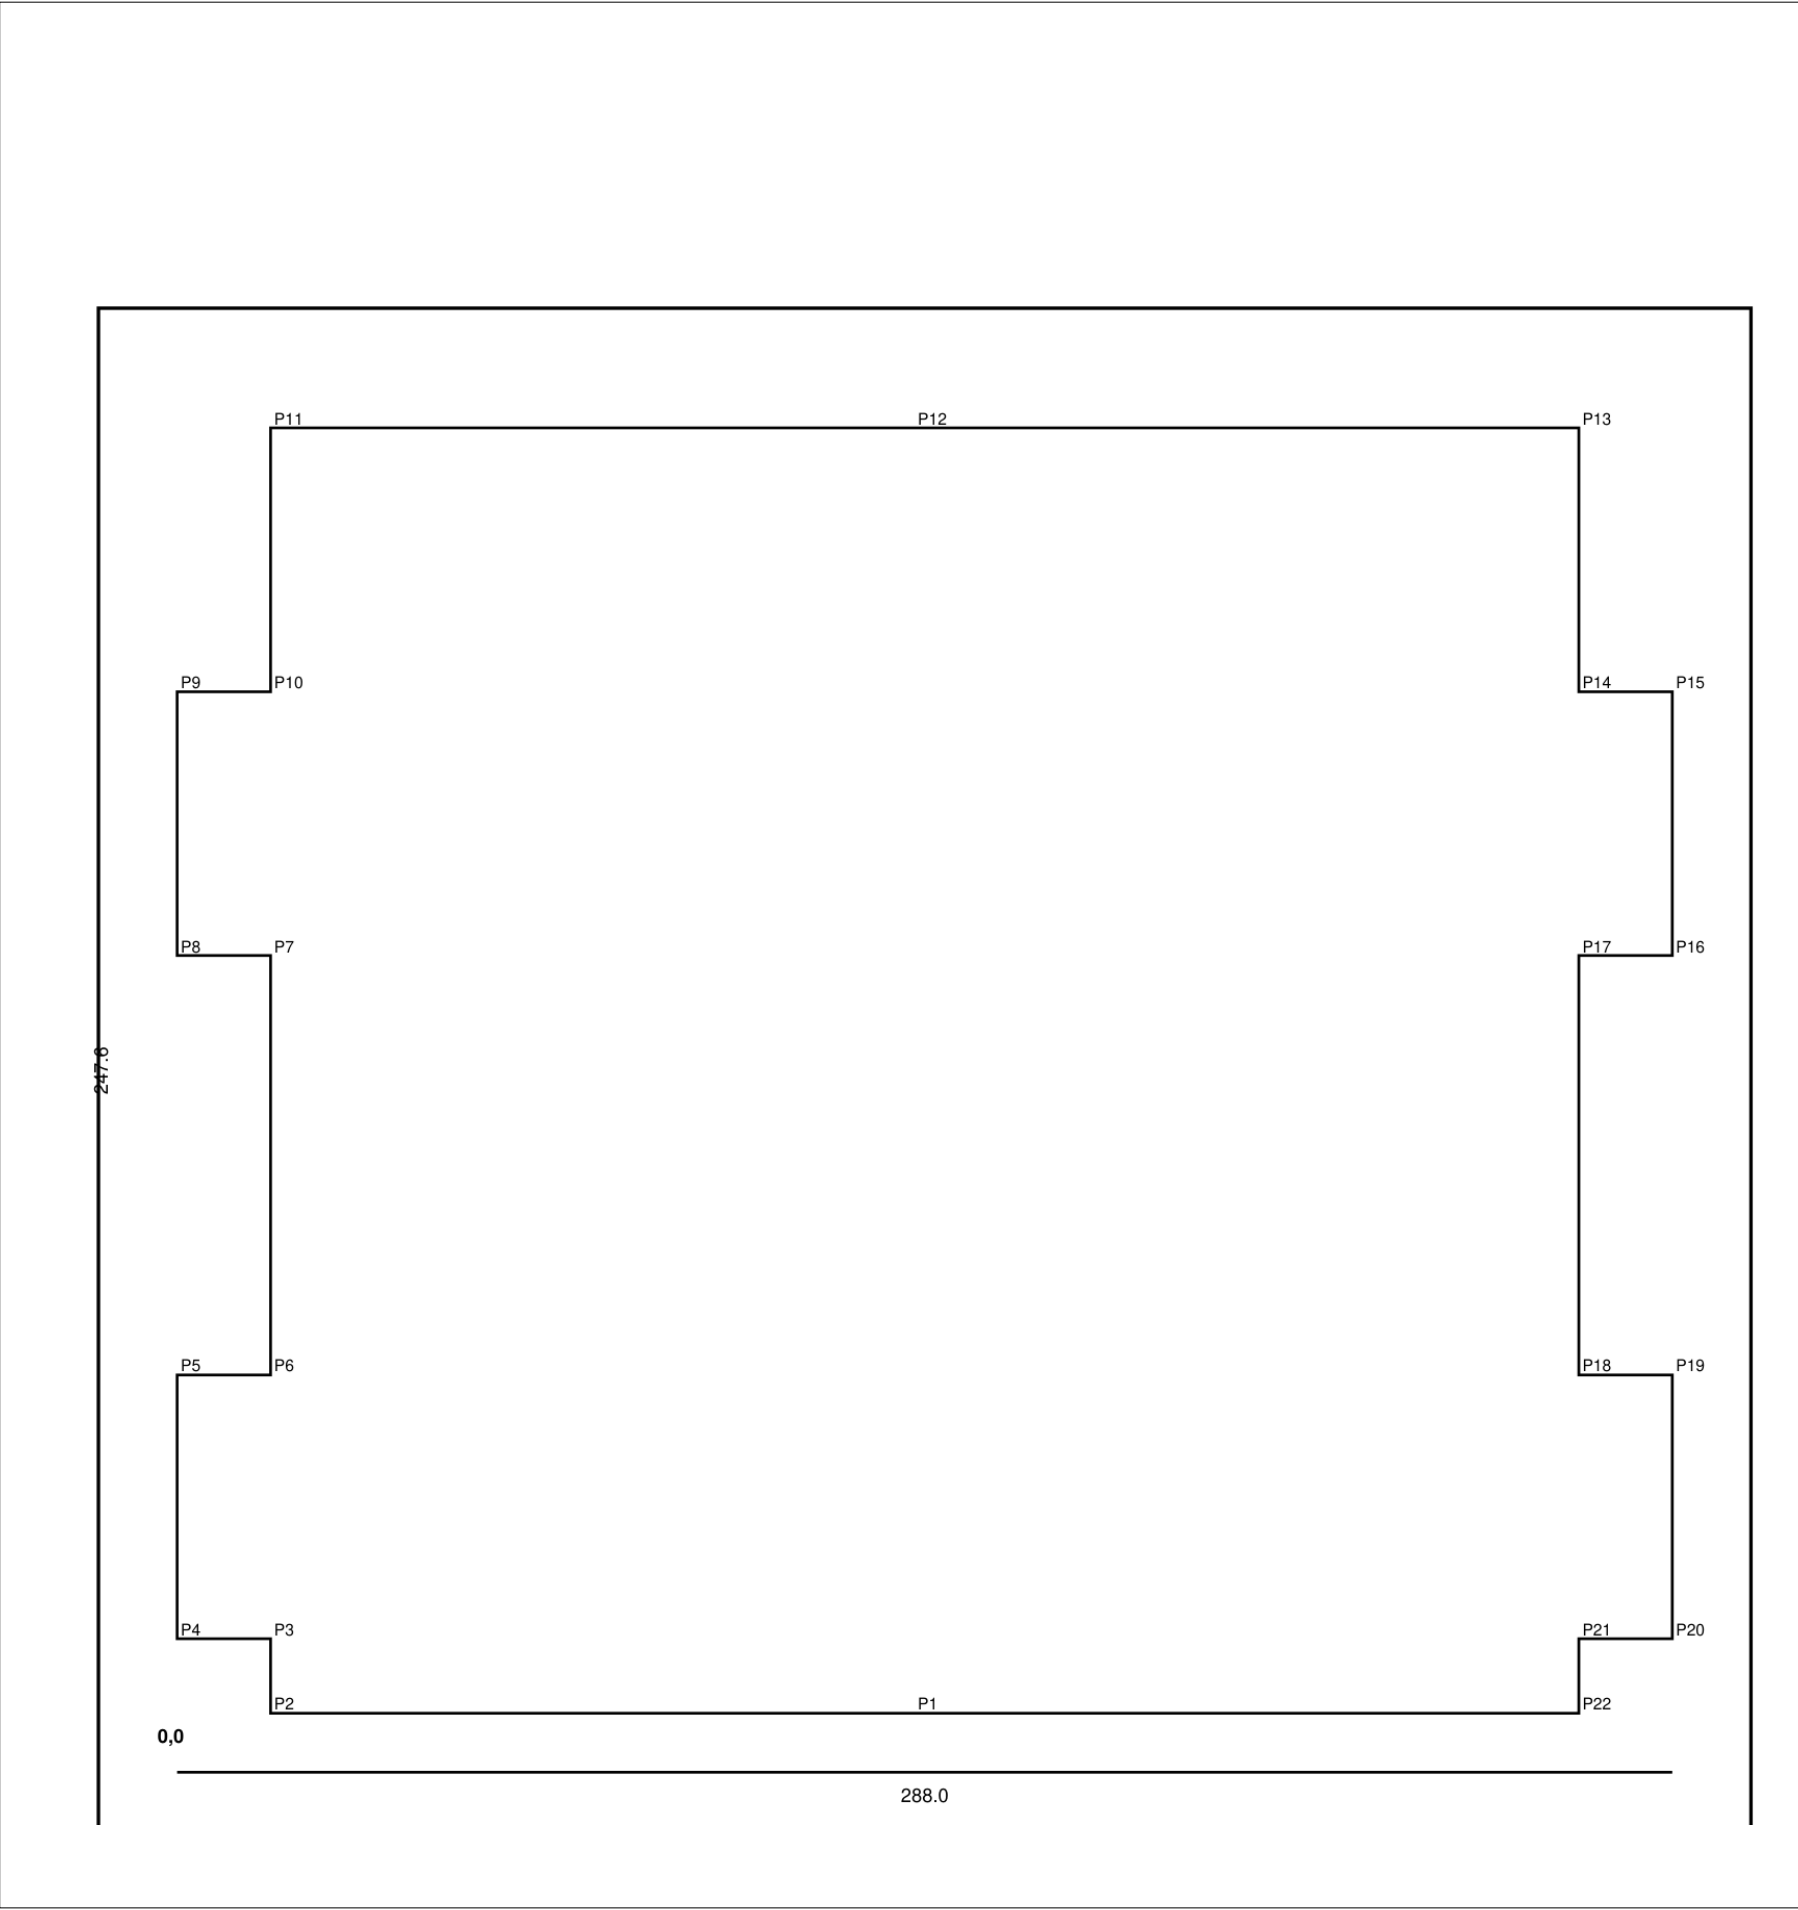

X = horizontal from LEFT edge

Y = vertical UP from BOTTOM edge

Machining features

- No internal cut features

Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

P1 X142.0 Y0.0 LINE

P2 X18.0 Y0.0 LINE

P3 X18.0 Y14.4 LINE

P4 X0.0 Y14.4 LINE

P5 X0.0 Y65.2 LINE

P6 X18.0 Y65.2 LINE

P7 X18.0 Y146.0 LINE

P8 X0.0 Y146.0 LINE

P9 X0.0 Y196.8 LINE

P10 X18.0 Y196.8 LINE

P11 X18.0 Y247.6 LINE

P12 X142.0 Y247.6 LINE

P13 X270.0 Y247.6 LINE

P14 X270.0 Y196.7 LINE

P15 X288.0 Y196.7 LINE

P16 X288.0 Y145.9 LINE

P17 X270.0 Y145.9 LINE

P18 X270.0 Y65.1 LINE

P19 X288.0 Y65.1 LINE


P20 X288.0 Y14.3 LINE

P21 X270.0 Y14.3 LINE

P22 X270.0 Y0.0 LINE

S3-L - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

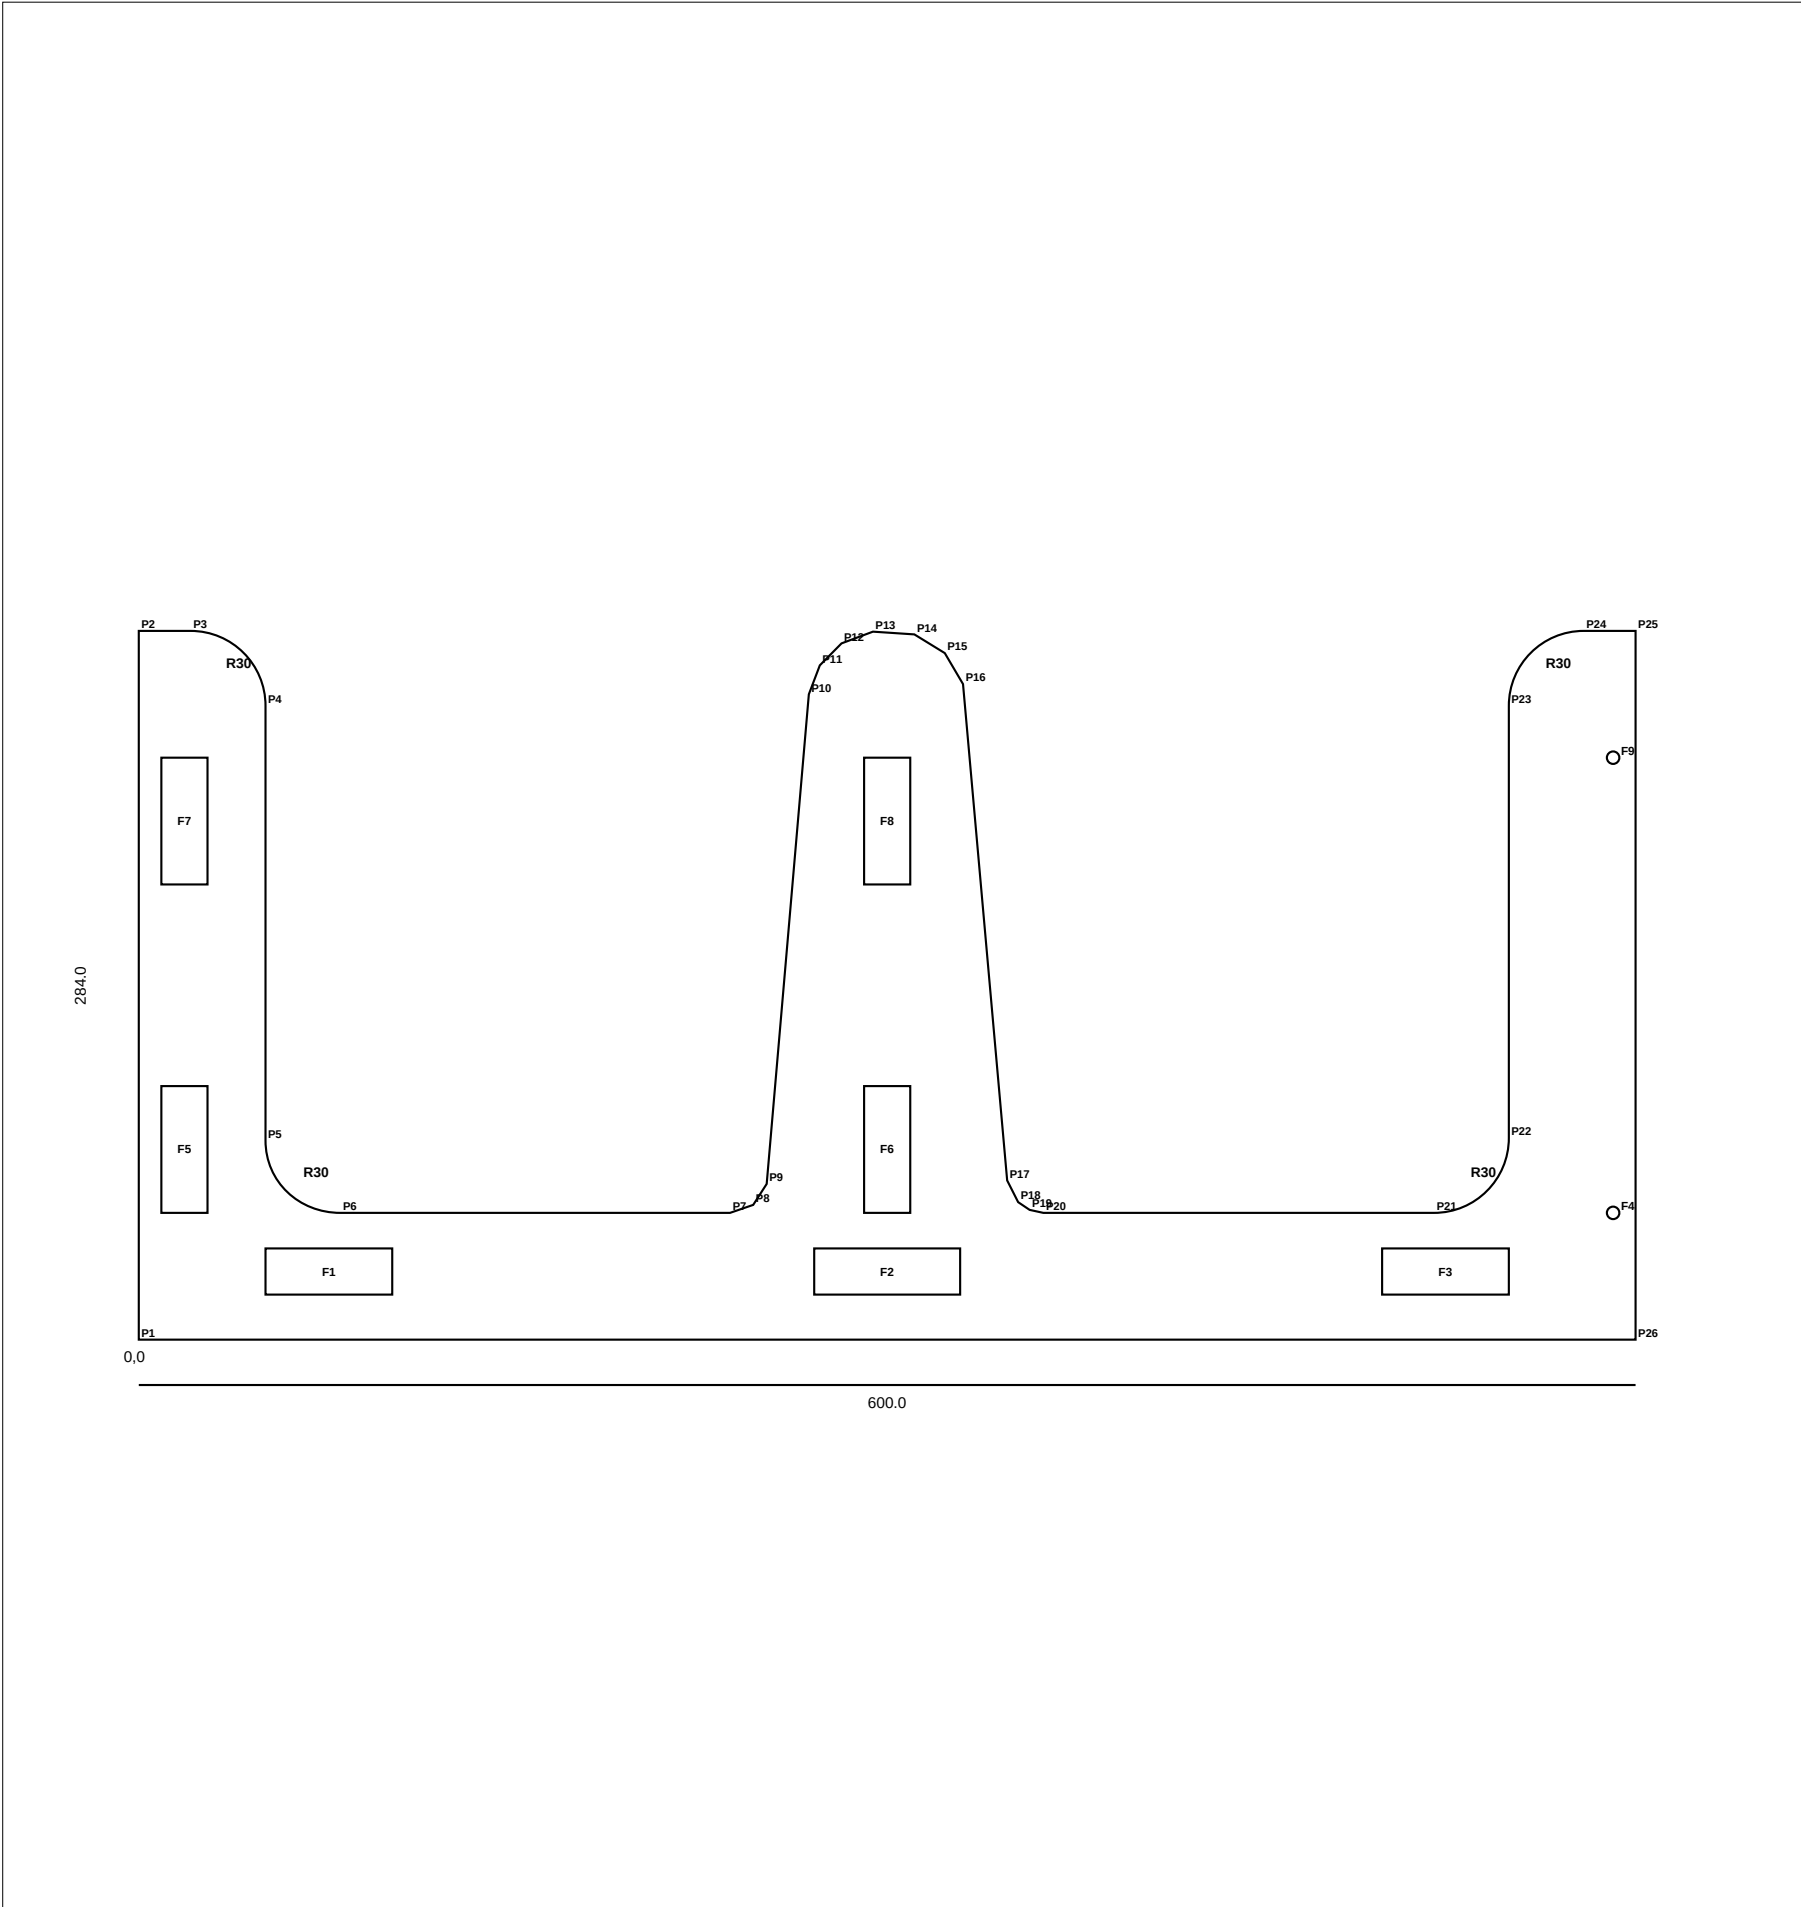

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 50.8 x 18.5 X 76.2 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 300.0 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 523.8 Y 27.3
- F4 Dia 5 x 11 deep X 591.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 18.3 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 300.0 Y 76.2
- F7 slot/cut-out 18.5 x 50.8 X 18.3 Y 207.8
- F8 slot/cut-out 18.5 x 50.8 X 300.0 Y 207.8
- F9 Dia 5 x 11 deep X 591.0 Y 233.2


Outer profile cuts

P points are labelled on the drawing. Join each point to the next as shown.

- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y284.0 LINE
- P3 X20.8 Y284.0 ARC R30 CW
- P4 X50.8 Y254.0 LINE
- P5 X50.8 Y79.8 ARC R30 CW
- P6 X80.8 Y50.8 LINE
- P7 X237.0 Y50.8 LINE
- P8 X246.3 Y54.0 LINE
- P9 X251.7 Y62.4 LINE
- P10 X268.6 Y258.6 LINE
- P11 X273.0 Y270.2 LINE
- P12 X281.7 Y279.0 LINE
- P13 X294.3 Y283.7 LINE
- P14 X310.9 Y282.6 LINE
- P15 X323.1 Y275.1 LINE
- P16 X330.4 Y262.7 LINE
- P17 X348.1 Y63.8 LINE
- P18 X352.5 Y55.1 LINE
- P19 X357.1 Y52.0 LINE
- P20 X362.6 Y50.8 LINE
- P21 X519.2 Y50.8 ARC R30 CW
- P22 X549.2 Y80.8 LINE
- P23 X549.2 Y254.0 ARC R30 CW
- P24 X579.2 Y284.0 LINE
- P25 X600.0 Y284.0 LINE
- P26 X600.0 Y0.0 LINE

S3-M - Part detail

Overall 600.0 x 284.0 mm | 18 mm plywood | datum lower-left = X0 Y0

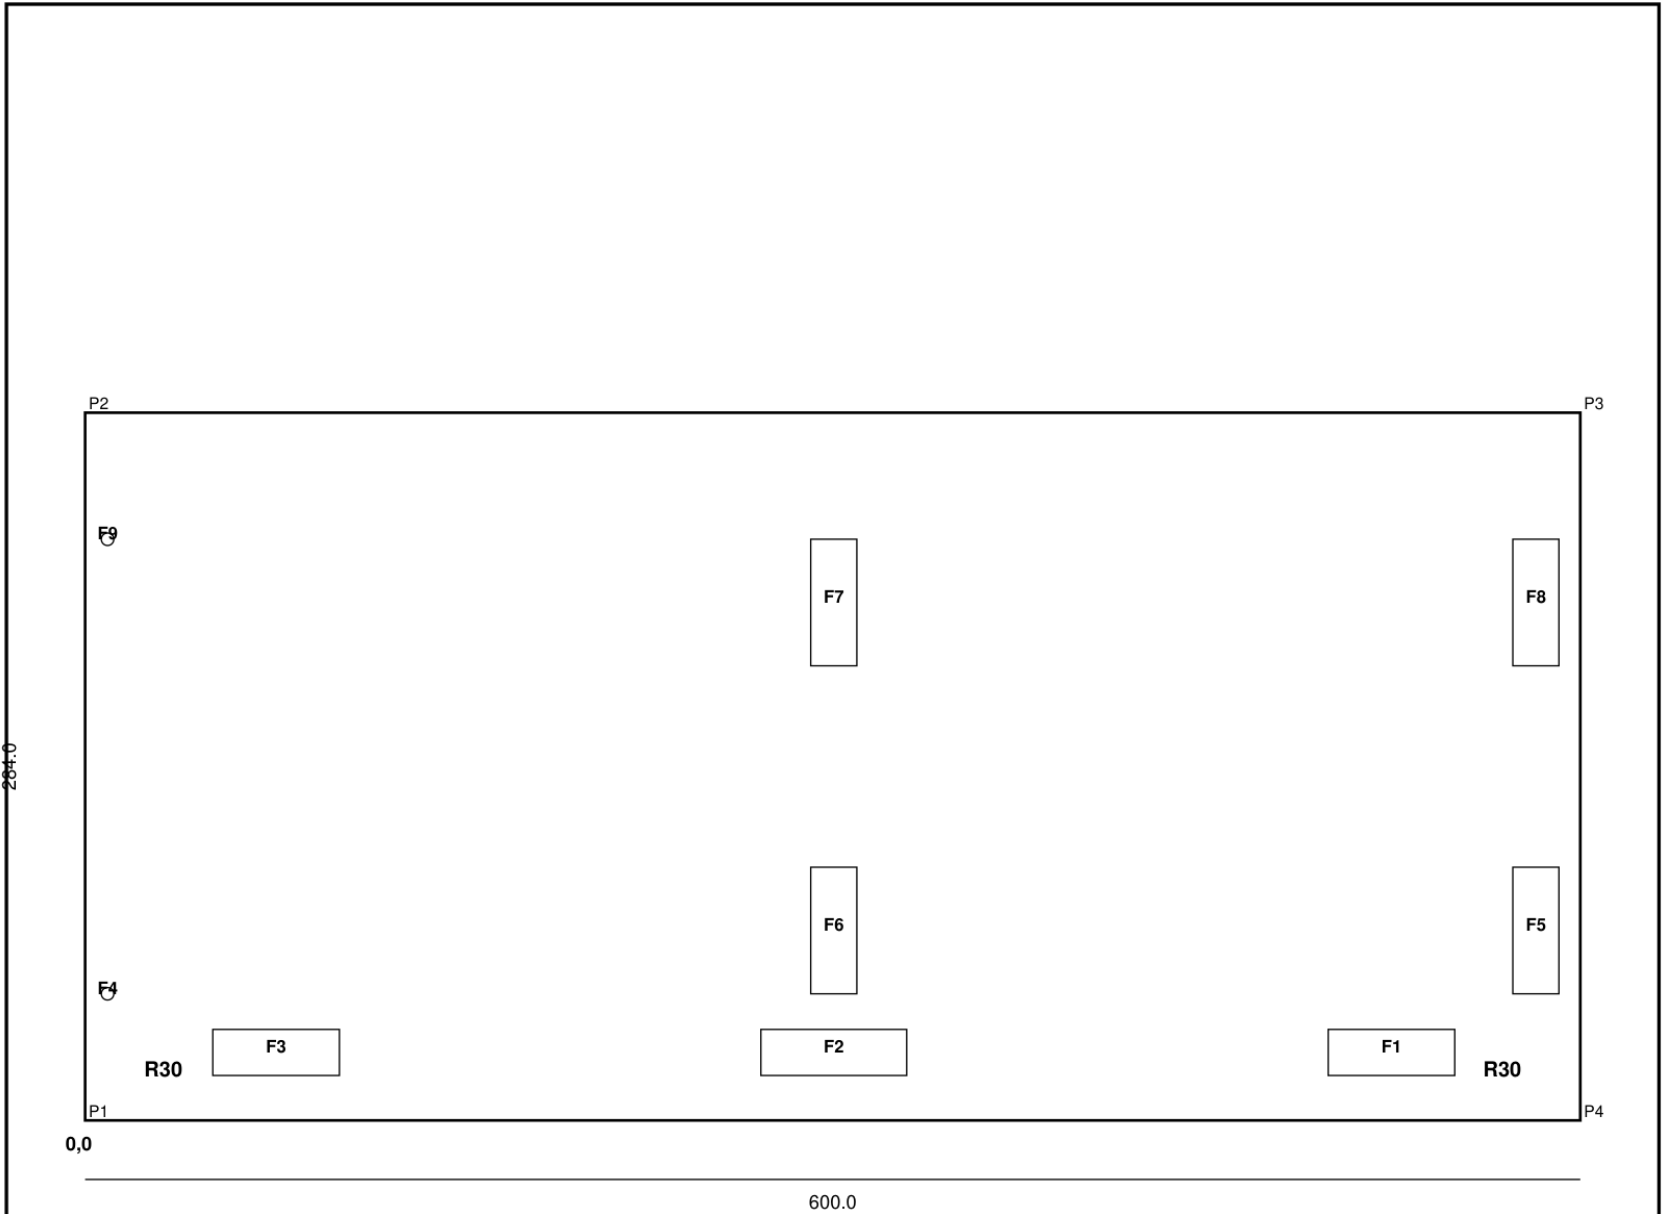

X = horizontal from LEFT edge
Y = vertical UP from BOTTOM edge

Machining features

- F1 slot/cut-out 50.8 x 18.5 X 524.2 Y 27.3
- F2 slot/cut-out 58.5 x 18.5 X 300.4 Y 27.3
- F3 slot/cut-out 50.8 x 18.5 X 76.6 Y 27.3
- F4 Dia 5 x 11 deep X 9.0 Y 50.8
- F5 slot/cut-out 18.5 x 50.8 X 582.2 Y 76.2
- F6 slot/cut-out 18.5 x 50.8 X 300.4 Y 76.2
- F7 slot/cut-out 18.5 x 50.8 X 300.4 Y 207.8
- F8 slot/cut-out 18.5 x 50.8 X 582.2 Y 207.8
- F9 Dia 5 x 11 deep X 9.0 Y 233.2

Outer profile cuts

- P points are labelled on the drawing. Join each point to the next as shown.
- P points are labelled on the drawing. Join each point to the next as shown.
- P1 X0.0 Y0.0 LINE
- P2 X0.0 Y284.0 LINE
- P3 X600.0 Y284.0 LINE
- P4 X600.0 Y0.0 LINE
- Page 37