

Marine Safety Consultants, Inc.

Marine Surveyors and Consultants | Since 1980

26 Water Street, PO Box 615, Fairhaven, MA 02719-0615

phone: 508-996-4110 | fax: 508-990-2094

File No.: 24-0754

Boston Harbor Shipyard and Marina
256 Marginal Street
East Boston, MA 02128

Attn: Marshall Greenland

Condition & Valuation Survey

VESSEL	: PROVIDENCE
OFFICIAL No.	: 1314469
HULL	: C-1305
SERVICE	: Floating Drydock
BUILDER	: Conrad Shipyard, Morgan City, LA
LENGTH	: 120' (120' registered)
BREADTH	: 60' (registered)
PONTOON DEPTH	: 6' (registered)
OVERALL DEPTH	: 22'
LIFTING CAPACITY	: 500 LT
LIGHTSHIP WEIGHT	: 338.5 LT
GROSS TONS	: 362 (simplified)
NET TONS	: 362 (simplified)
BUILT	: 2021
OWNER:	: Biblia Inc. Marine Towing and Transportation 49 Hutchinson Island Road Savannah, GA 31421

THIS IS TO CERTIFY THAT the undersigned surveyor did, on 19 November 2024 attend and complete a survey on the floating drydock PROVIDENCE while afloat at Biblia Inc., in Savannah, GA, at the request of Boston Harbor Shipyard and Marina. The purpose of the survey was to ascertain the condition and valuation of the drydock.

This report indicates, as far as practical, the general condition of the drydock.

Boston, Massachusetts | Portland, Maine | Norfolk, Virginia

corporate office: 26 Water Street, Fairhaven, MA 02719 | 508-996-4110 | fax: 508-990-2094

www.MarineSafetyConsultants.com

SCOPE OF SURVEY

The survey was conducted while the drydock was afloat and therefore the external conditions below the waterline could not be inspected. An internal bottom survey was completed. At the time of the survey, the vessel was nearly even keeled at about 1.75' of draft.

Drydock components will be identified bow to stern, top to bottom, and port to starboard.

Damages/discrepancies are identified as light, moderate or heavy.

Light is deflection of less than 3/4"

Moderate is notable deflection of plate or structure of 3/4" to 1 1/2"

Heavy deflection is of greater than 1 1/2".

VESSEL DESCRIPTION

The PROVIDENCE is a floating drydock having a double-pontoon hull, a raked bow, square stern, and a 46' wide flat/flush deck. Each pontoon consists of four longitudinal wing and bottom ballast tanks. The wing tanks extend 4'-6" above the main deck. Access to the ballast tanks by way of main deck flush mounted hatches.

A total on four Nabrico DF-2 double bits are fixed to the main deck, one on each corner. A total of twenty-eight keel blocks are fixed to the centerline of the main deck. Five side block and tracks are fixed evenly spaced forward and aft amidships. The side blocks are mechanically controlled from the top deck and are used to center over the keel blocks vessels being drydocked.

The port and starboard sides are 14' wide and 16' high enclosed spaces identified as "safety deck voids." These voids extend for 102' along the port/starboard sides centered amidships. The exterior wing walls are flush to the hull. Vertical ladders allow for access to the tops of the safety deck voids on the forward and aft side of each void. Access flush mounted hatches to these spaces are located on the forward and aft sides of the top deck.

Drydocking operation equipment is located atop the safety deck voids. Each top is surrounded by a three-course, safety pipe railing. On each side, within the perimeter of the safety rails are four winches, four valve handwheels, six keel cleats, eight top deck lights on the outboard side, four flood lights facing inboard on the inboard side, vents for each ballast and void, and eleven inboard button chocks. A skid plate mounted generator and control console are located on the starboard top deck.

The maximum waterline for the PROVIDENCE is 18'-7 11/16" with a max draft over the 24" high centerline main deck keel blocks of 10'-7 5/8".

(DRYDOCK) PROVIDENCE
MSC File #: 24-0754

In accordance with JMS Naval Architects “General Arrangement” drawing 19-126-101, Rev 4, the following general notes are listed:

- 1) “Dry dock is designed in accordance with ABS Rules for Building and Classing Steel Floating Dry Docks 2020. The dry dock will not be built under survey by Class.”
- 2) “All welding and weld sizing to be in accordance with ABS Rules for Building and Classing Steel Floating Dry Docks 2020.”
- 3) “All workmanship, materials and components to conform to ABS Rules for Building and Classing Steel Floating Dry Docks 2020. Plates and shapes to be ASTM A-36.”

The following certificate(s) are verified up to date and valid:

USCG Certificate of Documentation : Issue date 22 August 2024
: Expiration date 31 Aug 2025

EXTERNAL CONDITIONS FOUND

Starboard Side Shell

The starboard side shell above the waterline was surveyed from the shore.

Starboard side shell has 100% paint coatings and is in above average condition. Vessel markings, including vessel name and draft markings are clearly visible.

The side shell is divided into two longitudinal strakes above the waterline. Three recessed kevel cleats are fixed to the safety deck – one on centerline and one each forward and aft.

Port Side Shell

Because of the position of the barge at the time of this survey, it was not possible to complete an up-close inspection. The port side shell above the waterline was surveyed from the main deck and top deck.

The port side shell plating above the waterline is 100% coated and in above average condition.

Stern Log

Coatings and markings visible. An internal inspection of the plating, cant frames and associated scantlings reveal no obvious signs of deflection or damage.

Head Log

The head log is in above average condition with 100% paint coatings.

Deck

The main deck is in overall above average condition with nearly 100% paint/skid coatings. No deflection or damage noted.

Corner double bit bollards are fixed to a doubler plate that is fixed to the deck. The port side corners have McDermott MAG-RS-6L4V “TopHat” solar lights mounted to the top of the outside bollard.

Centerline keel blocks and attachment/containment components in above average condition.

Mechanical side blocks, five per side, and associated equipment found in above average condition. These components are buoyant structures and are operated manually while the drydock is being flooded.

Flush ballast and safety deck hatches/gaskets/closing appliances in above average condition.

Top Deck (Port):

No defects noted on port top deck. Soft patches, button chocks, hatches, railings, coatings and vents in above average condition.

Lighting fixtures and wiring in above average condition.

Equipment:

- Four 1HP Emerson ballast pumps
- Four BETTIS M2CP EIM electric actuators
- Four NABRICO DF-529 Manual winches
- Six NABRICO DF-30 kevel cleats

Top Deck (Starboard):

No defects noted on port top deck. Soft patches, button chocks, hatches, railings, coatings and vents in above average condition.

Lighting fixtures and wiring in above average condition.

Equipment:

- Four 1HP Emerson ballast pumps
- Four BETTIS M2CP EIM electric actuators
- Four NABRICO DF-529 Manual winches
- Six NABRICO DF-30 kevel cleats
- 208V Shore Power panel
- One 480V Marathon Generator MAGNSPLUS 363PSL4127-311E
- One Power Panel generator/shore power distribution box

INTERNAL CONDITIONS FOUND

The hull is divided into four transverse rows of ballast wing/bottom tanks. Each tank is divided into five longitudinal bays in the bottom section, and one continuous bay in the wing section. Each tank's top and bottom are longitudinally and transversely framed with shallow transverse steel angles intersecting longitudinal steel girders. The main deck above is supported by vertical and angled steel stanchions welded to the girders.

Port Forepeak Ballast Tank (row 1):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

Headlog plating in average condition. No distortions observed.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

Starboard Forepeak Ballast Tank (row 1):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

Headlog plating in average condition. No distortions observed.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

#2 Port Ballast Tank (row 2):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

Two steel pipe electrical conduits span transversely through this tank. Piping and associated components in above average condition with no defects noted.

#2 Starboard Ballast Tank (row 2):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

Two steel pipe electrical conduits span transversely through this tank. Piping and associated components in above average condition with no defects noted.

#3 Port Ballast Tank (row 3):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

#3 Starboard Ballast Tank (row 3):

Above average condition with nearly 100% coatings.

Moderate deflection found in bay 1 from side shell between #6 and #7 transverse bottom stiffeners. The deflected plates are bowed inward at the weld seam possibly due to improper heat treatment

(DRYDOCK) PROVIDENCE
MSC File #: 24-0754

when fabricated.

Tank is completely dry. Condensation observed due to high humidity.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

#4 Port Ballast Tank (row 4):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

Sternlog plating in average condition. No distortions observed.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

#4 Starboard Ballast Tank (row 4):

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

Tank is completely dry. Condensation observed due to high humidity.

Sternlog plating in average condition. No distortions observed.

10HP Flynt Xylem brand submersible pump located within and reported to be operating properly and in accordance with manufacturer's specifications. Fill valve/piping in average condition.

Port Safety Deck Void:

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

All wiring and equipment in like new condition.

Equipment:

- One Campbell Hausfeld 3450RPM compressor (model 56S34D2MD)
- One Aprilaire Model 1850 dehumidifier

(DRYDOCK) PROVIDENCE
MSC File #: 24-0754

- Five TMS LevelCom 100 digital meters – two indicating draft and 4 indicating ballast tank levels

Starboard Safety Deck Void:

Above average condition with nearly 100% coatings. No defects found in structural scantlings/plating.

All wiring and equipment in like new condition.

Equipment:

- One Campbell Hausfeld 3450RPM compressor (model 56S34D2MD)
- One Aprilaire Model 1850 dehumidifier
- Five TMS LevelCom 100 digital meters – two indicating draft and 4 indicating ballast tank levels
- Two 480V HPS three-phase transformers
- One Newmar PT-25W Phase Three battery charger
- North American 8D-7 commercial marine battery

VALUATION / RATIONALE

In determining the value of the drydock PROVIDENCE, it is understood that this appraisal includes the hull structure, furnishings, all appurtenances, equipment, materials, machinery, tools, and other apparel pertaining to the vessel as found aboard on the date of survey.

The drydock PROVIDENCE is in above average to like-new condition. All exterior and interior coatings are in excellent condition. All machinery, mechanical, and electrical components are well maintained. The control stations and associated operational equipment is in excellent condition.

It is our opinion that a vessel of this class and service, receiving consistent average maintenance, should have a useful life of forty (40) years.

Subject to consideration of the preceding remarks, and considering the age of the vessel, its condition in comparison to vessels of like size, age and service, and in consideration of the current market, the following estimated values are considered appropriate on 19 November 2024:

FAIR MARKET VALUE:	\$3,600,000.00
REPLACEMENT VALUE:	\$4,100,000.00

(DRYDOCK) PROVIDENCE
MSC File #: 24-0754

This report is based on examination of the vessel, and of those parts, spaces and equipment that could be sighted without removals or operation, and is rendered without bias or prejudice. In accepting same, it is agreed that the extent of obligation of this surveyor, with respect thereto, is limited to furnishing a competent survey, and in the making of this report, this surveyor is acting on behalf of the person or firm requesting same and no liability shall attach to this surveyor, for the accuracy, errors and/or omissions therefore.

Naval architecture and marine engineering analysis as usually performed in the design stage of the vessel's construction were not part of this survey and typical subjects such as adequacy of stability and seakeeping were not within the scope of this survey.

Please do not hesitate to contact us with any questions or instructions you may have regarding this matter.

Very truly yours,
MARINE SAFETY CONSULTANTS, INC.

Mark Maloney


Mark Maloney
Marine Surveyor
NAMS Global Associate Surveyor



(DRYDOCK) PROVIDENCE
MSC File #: 24-0754



(DRYDOCK) PROVIDENCE
MSC File #: 24-0754

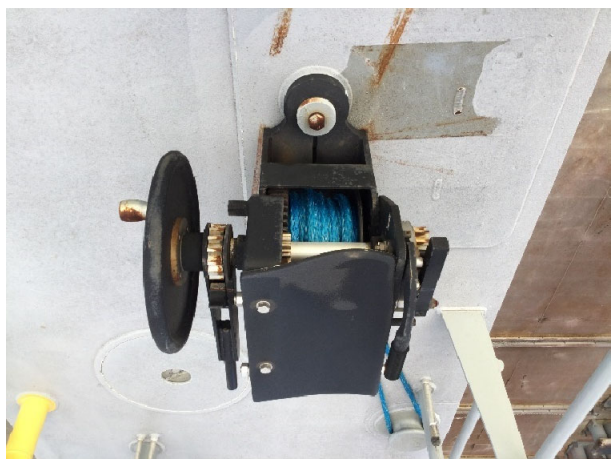

(DRYDOCK) PROVIDENCE
MSC File #: 24-0754



(DRYDOCK) PROVIDENCE
MSC File #: 24-0754



(DRYDOCK) PROVIDENCE
MSC File #: 24-0754



(DRYDOCK) PROVIDENCE
MSC File #: 24-0754

