


Description

Image





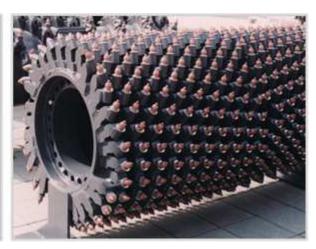

Caption

1. Tungsten carbide tool tip © Hi-Res Images of Chemical Elements at Wikimedia Commons (CC BY 3.0) 2. Carbide Masonry © Byrev at Pixabay [Public domain] 3. Tungsten Carbide tipped cutter drum of a road recycler © Dw1975 at Wikimedia Commons (CC BY-SA 3.0)

The material

Tungsten carbide (WC) is most commonly used in the form of a 'cemented' carbide, or cermet: particles of WC held by a small amount (5-20%) of metallic binder, usually cobalt. Its exceptional hardness and stability make it an attractive material when wear resistance is essential. Properties depend on grain size and shape and the proportion of carbide to metal. Cermets are expensive but, as cutting tools, they survive cutting speeds 10 times those of the best tool steel. Shaping is usually done by pressing, sintering and then grinding; the tool bit is brazed to a shank or blade made from a cheaper steel. Cermets can be vapor-coated with titanium nitride to improve wear resistance even further.

Composition (summary)

WC/ 2 - 10%Co

General properties

Density	952	-	991	lb/ft^3
Price	* 8.46	-	13.2	USD/lb
Date first used	1923			

Mechanical properties

Young's modulus	* 90.6	-	102	10^6 psi
Shear modulus	* 35.2	-	41	10^6 psi
Bulk modulus	52.2	-	59.5	10^6 psi
Poisson's ratio	0.18	-	0.21	
Yield strength (elastic limit)	* 48.6	-	79.8	ksi
Tensile strength	53.7	-	79.8	ksi
Compressive strength	* 485	-	991	ksi
Elongation	0			% strain



Tungsten carbides

Hardness - Vickers	2.2e3	-	3.6e3	HV
Fatigue strength at 10^7 cycles	* 41.3	-	60.9	ksi
Fracture toughness	1.82	-	3.46	ksi.in^0.5
Mechanical loss coefficient (tan delta)	* 5e-5	-	1e-4	

Thermal properties

Melting point	5.12e3	-	5.29e3	F
Maximum service temperature	* 1.38e3	-	1.83e3	F
Minimum service temperature	-460			F
Thermal conductor or insulator?	Good co	ndu	ctor	
Thermal conductivity	31.8	-	50.8	BTU.ft/h.ft^2.F
Specific heat capacity	0.0439	-	0.0697	BTU/lb.℉
Thermal expansion coefficient	2.89	-	3.94	µstrain/℉

Electrical properties

Electrical conductor or insulator?	Poor co	nduc	tor	
Electrical resistivity	20	-	100	μohm.cm

Optical properties

Transparency	Opaque

Critical Materials Risk

High critical material risk? Yes	
-----------------------------------	--

Processability

Moldability	2	-	3
Machinability	1	-	2

Durability: water and aqueous solutions

Water (fresh)	Excellent
Water (salt)	Excellent
Soils, acidic (peat)	Excellent
Soils, alkaline (clay)	Excellent
Wine	Excellent

Durability: acids

Acetic acid (10%)	Excellent
Acetic acid (glacial)	Excellent
Citric acid (10%)	Excellent
Hydrochloric acid (10%)	Excellent
Hydrochloric acid (36%)	Excellent
Hydrofluoric acid (40%)	Limited use



Tungsten carbides

Nitric acid (10%)	Excellent
Nitric acid (70%)	Excellent
Phosphoric acid (10%)	Excellent
Phosphoric acid (85%)	Excellent
Sulfuric acid (10%)	Excellent
Sulfuric acid (70%)	Excellent

Durability: alkalis

Sodium hydroxide (10%)	Excellent
Sodium hydroxide (60%)	Excellent

Durability: fuels, oils and solvents

Amyl acetate	Excellent
Benzene	Excellent
Carbon tetrachloride	Excellent
Chloroform	Excellent
Crude oil	Excellent
Diesel oil	Excellent
Lubricating oil	Excellent
Paraffin oil (kerosene)	Excellent
Petrol (gasoline)	Excellent
Silicone fluids	Excellent
Toluene	Excellent
Turpentine	Excellent
Vegetable oils (general)	Excellent
White spirit	Excellent

Durability: alcohols, aldehydes, ketones

Acetaldehyde	Excellent
Acetone	Excellent
Ethyl alcohol (ethanol)	Excellent
Ethylene glycol	Excellent
Formaldehyde (40%)	Excellent
Glycerol	Excellent
Methyl alcohol (methanol)	Excellent

Durability: halogens and gases

Chlorine gas (dry)	Excellent
Fluorine (gas)	Excellent
O2 (oxygen gas)	Excellent
Sulfur dioxide (gas)	Excellent



Durabilit	v: bui	lt envir	onments

Industrial atmosphere	Excellent
Rural atmosphere	Excellent
Marine atmosphere	Excellent
UV radiation (sunlight)	Excellent

Durability: flammability

Flammability	Non-flammable
--------------	---------------

Durability: thermal environments

Tolerance to cryogenic temperatures	Excellent
Tolerance up to 150 C (302 F)	Excellent
Tolerance up to 250 C (482 F)	Excellent
Tolerance up to 450 C (842 F)	Excellent
Tolerance up to 850 C (1562 F)	Excellent
Tolerance above 850 C (1562 F)	Unacceptable

Primary material production: energy, CO2 and water

Embodied energy, primary production	8.93e3	-	9.87e3	kcal/lb
CO2 footprint, primary production	4.44	-	4.9	lb/lb
Water usage	* 5.73	-	17.3	gal(US)/lb

Material processing: energy

|--|

Material processing: CO2 footprint

|--|--|--|--|--|--|--|--|

Material recycling: energy, CO2 and recycle fraction

Recycle	×
Recycle fraction in current supply	30 - 32 %
Downcycle	✓
Combust for energy recovery	×
Landfill	✓
Biodegrade	×
Toxicity rating	Non-toxic
A renewable resource?	×

Environmental notes

Preparing tungsten carbide products is energy intensive, and cobalt is a comparatively rare element, regarded as strategic because of its unique properties. For this reason, tungsten carbide is, where possible, recycled.

Supporting information

Tungsten carbides



Design guidelines

Tungsten carbide (WC) and cermets - which are 80 to 95% WC - can only be shaped by slitting with diamond tools and by grinding, liming the shapes to which they can economically be formed. They are used only where needed: the tips (but not the shanks) of cutting tools for drilling, sawing, rock cutting. Only diamond-tipped tools are more wear resistant. Technical ceramics are formed by the following steps.(a) Pressing, isostatic pressing, powder extrusion (for bars and tubes) or powder injection molding (for intricate, high-volume parts).(b) Green-machining in the unfired state, using standard tools.(c) Firing or "sintering" typically at 1550 - 1700 C for 12 to 20 hours; the part shrinks by about 20%.(d) Diamond grinding to achieve tighter tolerance and surface finish: +/- 10 microns is achievable. The cost of a ceramic part is greatly increased if it has to be diamond-ground. Thus design for net-shape sintering, eliminating step (d) is highly desirable. The standard tolerance for as-fired dimensions is +/- 1% or 125 microns, whichever is greater.

Technical notes

Tungsten carbide starts as a powder, is pressed with up to 10% of cobalt to the desired shape, then fired at a high temperature under pressure, causing the cobalt to melt and bond the powder particles together.

Typical uses

Cutting tool tips, abrasives, cermets, oil-drilling and stone-cutting equipment, dental

Tradenames

Cermet, Cemented carbide.

Links

Reference

ProcessUniverse

Producers