



SU-8 3000 Permanent Epoxy Negative Photoresist

SU-8 3000 is a high contrast, epoxy based photoresist designed for micromachining and other microelectronic applications, where a thick, chemically and thermally stable image is desired. SU-8 3000 is an improved formulation of SU-8 and SU-8 2000, which has been widely used by MEMS producers for many years. SU-8 3000 allows has been formulated for improved adhesion and reduced coating stress. The viscosity range of SU-8 3000 allows for film thicknesses of 4 to 120 μm in a single coat. SU-8 3000 has excellent imaging characteristics and is capable of producing very high, over 5:1 aspect ratio structures. SU-8 3000 has very high optical transmission above 360 nm, which makes it ideally suited for imaging near vertical sidewalls in very thick films. SU-8 3000 is best suited for permanent applications where it is imaged, cured and left on the device.

Features

- Improved adhesion
- Reduced coating stress
- ·High aspect ratio imaging
- Vertical sidewalls
- •Greater than 100 µm film thickness in a single coat
- Excellent dry etch resistance


Processing Guidelines

SU-8 3000 is most commonly exposed with conventional UV (350-400 nm) radiation, although i-line (365 nm) is recommended. It may also be exposed with e-beam or x-ray radiation. Upon exposure, cross-linking proceeds in two steps (1) formation of a strong acid during the exposure step, followed by (2) acid-catalyzed, thermally driven epoxy cross-linking during the post exposure bake (PEB) step. A normal process is: spin coat, soft bake, expose, PEB, followed by develop.

Substrate Preparation

To obtain maximum process reliability, substrates should be clean and dry prior to applying SU-8 3000 resist. For best results, substrates should be cleaned with a piranha wet etch (using $\rm H_2SO_4$ & $\rm H_2O_2$) followed by a de-ionized water rinse. Substrates may also be cleaned using reactive ion etching (RIE) or any barrel asher supplied with $\rm O_2$. Adhesion promoters are typically not required. For applications that require electroplating it is recommended to pre-treat the substrate with MCC Primer 80/20 (HMDS).

Applications

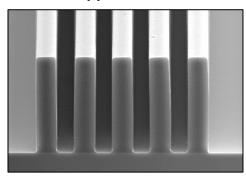

Contact aligner exposure 10 um features, 50 um SU-8 3000 coating

Coat

SU-8 3000 resists are available in five standard viscosities, shown in Table 1. Figure 1 provides the information required to select the appropriate SU-8 3000 resist and spin conditions, to achieve the desired film thickness.

Recommended Program

- (1) Dispense 1ml of resist for each inch(25mm) of substrate diameter
- (2) Spin at 500 rpm for 5-10 sec with acceleration of 100 rpm/second
- (3) Spin at 3000 rpm for 30 sec with acceleration of 300 rpm/second

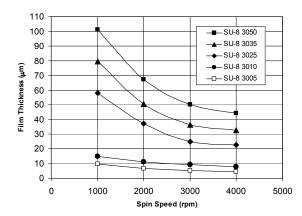


Figure 1. Spin speed vs. Thickness for SU-8 3000 resists (21°C US & EU)





www.microchem.com

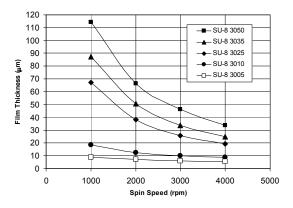


Figure 2. Spin speed vs. Thickness for SU-8 3000 resists (23°C Japan & Asia)

Table 1. SU-8 3000 Viscosity

SU-8 3000	% Solids	Viscosity (cSt)	Density (g/ml)
3005	50	65	1.075
3010	60.4	340	1.106
3025	72.3	4400	1.143
3035	74.4	7400	1.147
3050		12000	1.153
3050	75.5	12000	1.153

Soft Bake

A level hotplate with good thermal control and uniformity is recommended for use during the Soft Bake step of the process. Convection ovens are not recommended. During convection oven baking, a skin may form on the resist. This skin can inhibit the evolution of solvent, resulting in incomplete drying of the film and /or extended bake times. Table 2 shows the recommended Soft Bake temperatures and times for the various SU-8 3000 products at selected film thicknesses.

THICKNESS	SOFT BAKE TIME
microns	minutes @ 95°C
4 - 10	2 - 3
8 - 15	5 - 10
20 - 50	10 - 15
30 - 80	10 - 30
40 - 100	15 - 45

Table 2. Soft Bake Times

Note: To optimize the baking times/conditions, remove the wafer from the hotplate after the prescribed time and allow to cool to room temperature. Then return the wafer to the hotplate. If the film 'wrinkles', leave the wafer on the hotplate for a few more minutes. Repeat the cool-down and heat-up cycle until 'wrinkles' are no longer seen in the film after placing the wafer on the hotplate.

The dispersion curve and Cauchy coefficients are shown in Figure 3. This information is useful for film thickness measurements based on ellipsomety and other optical measurements.

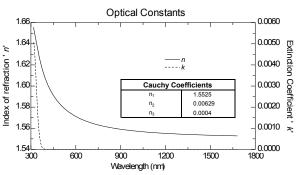


Figure 3. Cauchy Coefficients

Exposure

To obtain vertical sidewalls in the SU-8 3000 resist, we recommend the use of a long pass filter to eliminate UV radiation below 350 nm. With the recommended filter (PL-360-LP) from Omega Optical (www.omegafilters.com) or Asahi Technoglass filters V-42 plus UV-D35 (www.atgc.co.jp), an increase in exposure time of approximately 40% is required to reach the optimum exposure dose.

Note: Optimal exposure will produce a visible latent image within 5-15 seconds after being placed on the PEB hotplate and not before. An exposure matrix experiment should be performed to optimize the exposure dose

THICKNESS	EXPOSURE	
	ENERGY	
microns	mJ/cm ²	
4 - 10	100 - 200	
8 - 15	125 - 200	
20 - 50	150 - 250	
30 - 80	150 - 250	
40 - 100	150 - 250	

Table 3. Exposure Dose

	RELATIVE DOSE
Silicon	1X
Glass	1.5X
Pyrex	1.5X
Indium Tin Oxide	1.5X
Silicon Nitride	1.5 - 2X
Gold	1.5 - 2X
Aluminum	1.5 - 2X
Nickel Iron	1.5 - 2X
Copper	1.5 - 2X
Nickel	1.5 - 2X
Titanium	1.5 - 2X

Table 4. Exposure Doses for Substrates





Post Exposure Bake (PEB)

Should take place directly after exposure. Table 5 shows the recommended times and temperatures

Note: After 1 minute of PEB at 95°C, an image of the mask should be visible in the SU-8 3000 photoresist coating. No visible latent image during or after PEB means that there was insufficient exposure, temperature or both.

THICKNESS	PEB TIME	PEB TIME
	(65°C)*	(95°C)
microns	minutes	minutes
4 - 10	1	1 - 2
8 - 15	1	2 - 4
20 - 50	1	3 - 5
30 - 80	1	3 - 5
40 - 100	1	3 - 5

^{*} Optional step for stress reduction

Table 5. Post Exposure Bake Times

Develop

SU-8 3000 resist has been designed for use in immersion, spray or spray-puddle processes with MicroChem's SU-8 developer. Other solvent based developers such as ethyl lactate and diacetone alcohol may also be used. Strong agitation is also recommended for high aspect ratio and/or thick film structures. The recommended develop times for immersion processes are given in Table 6. These develop times are approximate, since actual dissolution rates can vary widely as a function of agitation

Note: The use of an ultrasonic or megasonic bath is helpful for developing out photoresist vias or holes.

THICKNESS	DEVELOPMENT
	TIME
microns	minutes
4 - 10	1 - 3
8 - 15	4 - 6
20 - 50	5 - 8
30 - 80	6 - 12
40 - 100	7 - 15

Table 6. Development Times for SU-8 Developer

Rinse and Dry

When using SU-8 developer, spray/wash the developed image with fresh developer solution for approximately 10 seconds, followed by a second spray/wash with Isopropyl Alcohol (IPA) for another 10 seconds. Air dry with filtered, pressurized air or nitrogen.

Note: A white film produced during IPA rinse indicates that the substrate has been under developed. Simply immerse or spray the substrate with SU-8 developer to remove the film and complete the development process. Repeat the rinse step.

Physical Properties

(Approximate values)

Adhesion Strength (mPa) Silicon/Glass/Glass & HMDS	69/35/59
Glass Transition Temperature (Tg °C), tan δ peak	200
Thermal Stability (°C @ 5% wt. loss)	
Thermal Conductivity (w/mK)	
Coeff. of Thermal Expansion (CTE ppm)	
Tensile Strength (Mpa)	73
Elongation at break (εb %)	4.8
Young's Modulus (Gpa)	
Dielectric Constant @ 1GHz	
Bulk Resistivity (Ωcm)	
Water Absorption (% 85°C/85 RH)	0.55

Optical Properties

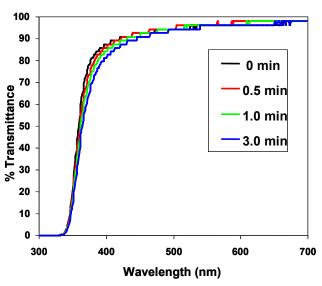


Figure 4. Optical Transmitance after 300°C Hard Bake

Hard Bake (cure)

SU-8 3000 has good mechanical properties. However for applications where the imaged resist is to be left as part of the final device, the resist may be ramp/step hard baked between 150-200°C on a hot plate or in a convection oven to further cross link the material. Bake times vary based on type of bake process and film thickness.





Removal

SU-8 3000 has been designed as a permanent, highly cross-linked epoxy material, which makes it extremely difficult to remove with conventional solvent based resist strippers. MicroChem's Remover PG will swell and lift off minimally cross-linked SU-8 3000. However if OmniCoat (30-100 nm) has been applied, immersion in Remover PG can effect a clean and thorough Lift-Off of the SU-8 3000 material. It will not remove fully cured or hard baked SU-8 3000 without the use of OmniCoat.

To remove minimally cross-linked SU-8 3000, or when using Omnicoat, heat the Remover PG bath to 50-80°C and immerse the substrates for 30-90 minutes. Actual strip time will depend on resist thickness and cross-link density For more information on MicroChem Omnicoat and Remover PG please see the relevant product data sheets.

To re-work fully cross-linked SU-8 3000, wafers can be stripped using oxidizing acid solutions such as piranha etch, plasma ash, RIE, laser ablation and pyrolysis.

Plasma Removal

RIE 200W, 80 sccm O₂, 8 sccm CF₄, 100mTorr, 10°C

Storage

Store SU-8 3000 resists upright and in tightly closed containers in a cool, dry environment away from direct sunlight at a temperature of 40-70°F (4-21°C). Store away from light, acids, heat and sources of ignition. Shelf life is twelve months from date of manufacture.

Disposal

SU-8 3000 resists may be included with other waste containing similar organic solvents to be discarded for destruction or reclaim in accordance with local state and federal regulations. It is the responsibility of the customer to ensure the disposal of SU-8 3000 resists and residues made in observance all federal, state, and local environmental regulations.

Environmental, Health and Safety

Consult the product Material Safety Data Sheet before working with SU-8 3000 resists. Handle with care. Wear chemical goggles, chemical gloves and suitable protective clothing when handling SU-8 3000 resists. Do not get into eyes, or onto skin or clothing. Use with adequate ventilation to avoid breathing vapors or mist. In case of contact with skin, wash affected area with soap and water. In case of contact with eyes, rinse immediately with water and flush for 15 minutes lifting eyelids frequently. Get emergency medical assistance.

The information is based on our experience and is, we believe to be reliable, but may not be complete. We make no guarantee or warranty, expressed or implied, regarding the information, use, handling, storage, or possession of these products, or the application of any process described herein or the results desired, since the conditions of use and handling of these products are beyond our control.