174 MICHIGAN

DOWAGIAC MUNI (C91) 1 NW UTC-5(-4DT) N41°59.58′ W86°07.70′

747 B TPA—1547(800) NOTAM FILE LAN

RWY 09-27: H4700X100 (ASPH) S-30, D-60 MIRL

RWY 09: REIL. PAPI(P4L)—GA 3.0° TCH 35'. Trees.

RWY 27: REIL. PAPI(P4L)—GA 3.0° TCH 35'. Trees. Rgt tfc.

RWY 04-22: 2176X100 (TURF)

RWY 04: Trees.

RWY 22: Thid dsplcd 388'. Tree. Rgt tfc.

SERVICE: FUEL 100LL LGT ACTIVATE MIRL Rwy 09–27; PAPI Rwy 09 and Rwy 27; REIL Rwys 09 and 27—CTAF.

AIRPORT REMARKS: Unattended. Self svc fuel avbl 24 hrs. Deer and birds on and invof arpt. Model RC acft ops E side of Rwy 04–22. Admin bldg access, depress V, then III–II simultaneous, then I. Rwy 04–22 and dspl thld marked with 3′ yellow cones.

AIRPORT MANAGER: 269-591-0054

COMMUNICATIONS: CTAF/UNICOM 122.8

KELLER RCO 122.1R 116.6T (LANSING RADIO)

® SOUTH BEND APP/DEP CON 118.55 (1030–0500Z‡ Sun-Fri, 1030–0445Z‡ Sat), other times ctc

R CHICAGO CENTER APP/DEP CON 127.55


CLEARANCE DELIVERY PHONE: For CD ctc south bend Apch at

574-251-2609. when south bend Apch clsd, for CD ctc Chicago ARTCC at 630-906-8921.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAN.

KEELER (L) (L) VORW/DME 116.6 ELX Chan 113 N42°08.66′ W86°07.36′ 182° 9.1 NM to fld. 794/0E. DME unusable:

155°-010° byd 30 NM blo 3,500°

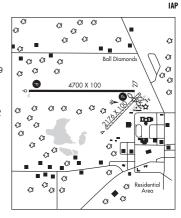

DRUMMOND ISLAND

DRUMMOND ISLAND (DRM)(KDRM) 1 SW UTC-5(-4DT) N46°00.56′ W83°44.64′ 668 B TPA—1668(1000) LRA NOTAM FILE DRM

LAKE HURON L-31C

IAP

CHICAGO

L-281

RWY 08-26: H4000X75 (ASPH) MIRL

RWY 08: PAPI(P2L)—GA 3.0° TCH 35'. Thid dsplcd 650'. Trees.

RWY 26: PAPI(P2L)—GA 3.0° TCH 25'. Thid dsplcd 170'. Road.

RWY 01-19: 2500X150 (TURF)

RWY 01: Trees.

RWY 19: Trees.

SERVICE: S4 FUEL 100LL, MOGAS 0X1, 3 LGT ACTIVATE MIRL Rwy 08–26 and PAPI Rwy 08 and 26—CTAF.

AIRPORT REMARKS: Attended Mon–Sat 1300–22007‡. Birds and deer invof arpt. Occasional golf carts and pedestrians crossing Rwy 08–26 due to golf course on both sides. Drummond Island, Yacht Haven SPB located 1.5 mile north, customs avbl 906–632–8822,

906–632–7221. Rwy 01–19 marked with 3 'yellow cones. Rwy 01–19 center 20' portion of rwy from intersection Rwy 08–26 north to the hangar line is asph; remainder of rwy turf. Flight Notification Service (ADCUS) available.

AIRPORT MANAGER: 906-493-5411

WEATHER DATA SOURCES: AWOS-3 118.325 (906) 493-6410.

COMMUNICATIONS: CTAF/UNICOM 122.8

® TORONTO CENTER APP/DEP CON 132.65

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

RADIO AIDS TO NAVIGATION: NOTAM FILE CIU.

SAULT STE MARIE (H) (H) **VOR/DME** 112.2 SSM Chan 59 N46°24.73′ W84°18.89′ 139° 33.9 NM to fld. 687/4W. VOR unusable:

085°-105° byd 10 NM blo 5,000′

085°-105° byd 20 NM blo 8,000

43 03 03 43 €3 43 Residential €3 €3 Area a M 63 63 03 03 43 €3 Golf 03 €3 63 €3 2500 ~ n **3** 150 0 €3 C3 Golf C3 <u>~</u>3 → Course

Course €3 43 **43** €3 €3 €3 €3 €3 G^G €3 C3 C3 €3 C3 C3 63 **3**