NORTHERN
INDUSTRIAL HYGIENE, INC.
Billings, MT ♦ Helena, MT

201 South 30th Street
Billings, Montana 59101
Phone: 406/245-7766
FAX: 406/254-1428

July 8, 2025

Ms. Laura Landon
Hennebery Eddy Architects, Inc.
921 SW Washington Street STE 250
Portland, OR 97205

RE: Asbestos Survey – 12 Buildings
4 Lazy F Ranch
4 Lazy F Ranch Road
Moose, Wyoming
Northern Project Number 999-5237

Dear Ms. Landon:

This letter report provides the summarized results of the limited asbestos survey conducted by Chris Hust (MTA-5681) and Grant Minkoff (MTA-6488)of Northern Industrial Hygiene, Inc. (Northern) on May 20 and May 11, 2025 at the above referenced site. The survey was conducted to identify potential asbestos-containing materials (ACMs) that will be impacted by the upcoming renovation project. This survey included the interiors, the exterior and the roofs of the 12 client selected buildings on the property.

Overview of Buildings

Harry's Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was moved to the site in 1954 but the construction date of the building is unknow. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log finished walls and wood finished ceilings. Base finishes were not present on the lower walls.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

George's Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed between 1927-1930's. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log finished walls and wood finished ceilings. Base finishes were not present on the lower walls.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

End Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed in 1927. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log finished walls and wood finished ceilings. Wood base finishes were present in the bathroom.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

Mrs. Oliver's Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed in 1927. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log and ceramic tile finished walls and wood finished ceilings. Wood base finishes were present in the bathroom.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

Middle Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed in 1927. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log and ceramic tile finished walls and wood finished ceilings. Wood base finishes were present in the bathroom.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

River Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was moved to the site in 1961 but the construction date of the building is unknow. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log and gypsum board finished walls and wood finished ceilings. Base finishes were not present on the lower walls.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

Nurse's Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed between 1938-1967. The building was previously used for housing.

Typical interior building materials include vinyl sheet and wood finished floors, log, gypsum board, and plastic tile finished walls and wood and gypsum board finished ceilings. Lower walls in the bathroom, hallway, and storage room had vinyl bases.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. The walls of the building were not insulated but ceilings in the center of the building were insulated with fiberglass insulation.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

Main Lodge

The building is a one-story, wood siding, with a concrete foundation with crawlspace and partial basement located under the kitchen, and a pitched roof. The building was constructed in 1927. The building was previously used as the main lodging building on the site.

Typical interior building materials include vinyl sheet and wood finished floors, log and gypsum board finished walls and wood and gypsum board finished ceilings. Vinyl base finishes were present in the kitchen of the building.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

Ice House

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed in 1927. The building was previously used for the storage of ice for the site.

Typical interior building materials include metal floors, metal walls and metal finished ceiling. Base finishes were not present on the lower walls.

Exterior building finish materials consist of wood siding and a rolled asphalt roofing. Both the walls and the roof are insulated with saw dust insulation.

The building does not have a heating system. No water lines were present to the building.

Mouse House

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed between 1938-1967. The building was previously used for storage.

Typical interior building materials include concrete finished floors, wood finished walls and wood finished ceiling. Lower walls are finished with a vinyl base.

Exterior building finish materials consist of wood siding and a rolled asphalt roofing. Both the walls and ceiling of the building are not insulated.

The building does not have a heating system. No water lines were present to the building.

New Cabin

The building is a one-story wood siding, with a concrete masonry unit (CMU) block foundation, and a pitched roof. The building was constructed in 1964. The building was previously used for housing.

Typical interior building materials include wood floors, log walls and wood finished ceiling. Base finishes were not present on the lower walls.

Exterior building finish materials consist of log siding and a rolled asphalt roofing. Both the walls and the roof are not insulated.

The building is heated by a wood burning fireplace. Water lines of the building are not insulated.

3-Bay Garage

The building is a one-story, wood siding, with a slab-on-grade foundation, and a pitched roof. The building was constructed in 1938. The building was previously used as a garage.

Typical interior building materials include concrete floors and log walls. No ceiling was present at the time of the survey. Base finishes were not present on the lower walls.

Exterior building finish materials consist of log siding. No roof was present at the time of the survey. the walls are not insulated.

The building does not have a heating system. No water lines were present to the building.

Asbestos Overview

Asbestos is a trade name for a group of fibrous naturally occurring minerals that were used widely in building materials because of its ability to bind, resist chemicals, insulate, and fireproof. Exposure to elevated levels of asbestos fibers has been documented to cause a variety of diseases including asbestosis and cancer. Consequently, the application, removal, and disposal of asbestos-containing materials is regulated by several agencies.

Asbestos in most building materials poses little threat to human health as long as the asbestos fibers are securely bound within the building material. However, as the materials deteriorate because of time or exposure, or are disturbed because of human or other activities, the potential increases for the fibers to become airborne. When this occurs, the risk to human health increases significantly when the fibers are inhaled.

The Environmental Protection Agency (EPA) National Emission Standards for Hazardous Air Pollutants (NESHAP) defines an asbestos-containing material (ACM) as a material containing greater than (>)1% asbestos and assigns ACM to three categories: regulated asbestos-

containing material (RACM), Category I, and Category II. RACM is defined as an ACM that, when dry, can be crumbled, pulverized or reduced to powder by hand pressure (friable). RACM also includes: Category I and Category II materials that will be (or have been) subjected to sanding, grinding, cutting or abrading, or; Category II materials that have a high probability of becoming (or have become) crumbled, pulverized, or reduced to powder by the forces expected to act on the material in the course of demolition/renovation operations. Category I ACMs are non-friable packings, gaskets, resilient floor covering, and asphalt roofing products. Category II ACMs are non-friable materials, excluding Category I non-friable ACMs, that, when dry, cannot be crumbled, pulverized, or reduced to powder by hand pressure.

The NESHAP requires that the building owner or operator provide notification at least 10 working days prior to commencing renovation activities that will disturb more than 160 square feet (SF) or 260 linear feet (LF) of RACM, or prior to any demolition activities. The NESHAP also requires that RACM be removed prior to renovation/demolition activities that will disturb the material.

The Wyoming Department of Environmental Quality (WDEQ) requires the building owner/operator submit notification at least 10 working days prior to commencing asbestos abatement project involving any amount of RACM.

The Occupational Safety and Health Administration (OSHA) requires that employees that will be exposed to any amount of asbestos be trained in accordance with the provisions of 29 CFR 1926.1101. The OSHA standard also requires that employee exposure to asbestos fibers not exceed either the permissible exposure limit (PEL) of 0.1 fibers per cubic centimeter (f/cc) of air for an eight (8) hour time-weighted average (TWA) or the excursion limit (EL) of 1.0 f/cc for any thirty (30) minute work period.

Survey Procedures

Asbestos Sampling Procedures

The asbestos survey was performed using the applicable portions of the currently recognized standard protocol developed for schools under AHERA, as promulgated in Title 40, Code of Federal Regulations (40 CFR), Part 763 and as amended in the Federal Register. Since the primary concern for this investigation was to identify potential asbestos hazards in the 12 client selected buildings, Northern representatives visually inspected existing conditions considering each construction, addition, or renovation date as separate, unique buildings, if applicable.

Laboratory Analysis of Bulk Asbestos Samples

Bulk samples collected during the survey were assigned bulk sample numbers and entered on sample summary/chain-of-custody forms. The samples were transported to the laboratory by overnight courier under standard chain-of-custody procedures. The analysis was performed in accordance with EPA Method 600/R-93/116, which employs polarized light microscopic

techniques with dispersion staining for identification of mineral forms of asbestos. The quantification of asbestos in the sample is intended to be an estimate only and the limit of detection for this method is approximately 1% by volume.

Survey Findings

Harry's Cabin

A total of 11 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in three of the sampled materials. The confirmed asbestos-containing materials are:

M1.2 Black Penetration Sealant on Roof (2% Chrysotile)

M8.1 White Window Glazing Compound (2% Chrysotile)

M20.3 Transite Panel (65% Chrysotile)

George's Cabin

A total of nine building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in four of the sampled materials. The confirmed asbestos-containing materials are:

F1.1 White VSF-Square & Octagon / Inseparable Mastic (15% Chrysotile)

F1.2 Square & Rectangle VSF / Inseparable Mastic (15% Chrysotile)

M1.1 Black Tar Sealant on Roof (2% Chrysotile)

M8.2 Exterior Window Frame Caulk (3% Chrysotile)

As stated in the Asbestos Overview section above, an asbestos-containing material is defined by state and federal regulations (EPA and OSHA) as any building material containing greater than 1% asbestos. While not meeting that definition, laboratory analysis detected asbestos at 1% or less in the following two materials:

M14.1 Concrete Foundation (Laboratory identified the presence of a small amount of inseparable attached material (<1% Chrysotile)

M20.1 Log Mortar (<1% Chrysotile)

End Cabin

A total of 12 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in one of the sampled materials. The confirmed asbestos-containing material is:

M20.2 Transite Panel (40% Chrysotile)

Mrs. Oliver's Cabin

A total of 14 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in three of the sampled materials. The confirmed asbestos-containing materials are:

M1.2 Grey Sealant on Roof (8% Chrysotile)

M20.3 Transite Panel (20% Chrysotile)

M20.4 Black Felt - Tar/Felt 1 (3% Chrysotile), Felt 2 (ND)

Laboratory analysis detected asbestos at 1% or less in the following three materials:

F1.1 Beige VSF / Inseparable Mastic - VSF/Mastic 1 (<1% Chrysotile), Mastic 2 (ND)

M8.1 White Window Glazing Compound (<1% Chrysotile)

M8.3 Yellow Wall Caulk (<1% Anthophyllite)

Middle Cabin

A total of 13 building materials were identified in the areas included in this limited asbestos survey. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in three of the sampled materials. The confirmed asbestos-containing materials are:

F1.1 Blue VSF with Mastic - VSF (15% Chrysotile), Mastic (ND)

M1.2 Grey Sealant on Roof (3% Chrysotile)

M20.4 Transite Panel (25% Chrysotile)

Laboratory analysis detected asbestos at 1% or less in the following two materials:

M8.1 White Window Glazing Compound (<1% Chrysotile)

M8.3 Yellow Wall Caulk (<1% Chrysotile)

River Cabin

A total of 10 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in two of the sampled materials. The confirmed asbestos-containing materials are:

M8.1 Beam Caulk (10% Chrysotile)

M20.1 Transite Panel (50% Chrysotile)

Laboratory analysis detected asbestos at 1% or less in the following material:

M3.1 Gypsum Wallboard System - Joint Compound (<1% Chrysotile), All Other Layers (ND), Composite of All Layers (<1% Chrysotile)

Nurse's Cabin

A total of 13 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in three of the sampled materials. The confirmed asbestos-containing materials are:

F1.1 White Speckled VSF / Inseparable Mastic (20% Chrysotile)

M1.2 Black Penetration Sealant on Roof (10% Chrysotile)

M20.4 Transite Panel (40% Chrysotile)

Laboratory analysis detected asbestos at 1% or less in the following two materials:

M3.1 Gypsum Wallboard System - Joint Compound (<1% Chrysotile), All Other Layers (ND), Composite of All Layers (<1% Chrysotile)

M12.1 White 4" Vinyl Cove Base with Mastic - Cove Base (ND), Mastic (<1% Anthophyllite)

Main Lodge

A total of 30 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in five of the sampled materials. The confirmed asbestos-containing materials are:

M1.3 Black Chimney Sealant (2% Chrysotile)

M3.1* Gypsum Wallboard System - Joint Compound (2% Chrysotile), All Other Layers (ND), Composite of Layers (<1% Chrysotile)

M8.6 Foundation Sealant (2% Chrysotile)

M8.7 Sewer Pipe Sealant (3% Chrysotile)

S1.1 Light Orange Peel Texture (2% Chrysotile)

*In the Federal Register Volume 59, Number 3 dated Wednesday, January 5, 1994 the EPA issued the "Asbestos NESHAP Clarification Regarding Analysis of Multi-layered Systems". This notice of clarification to the final rule states the following regarding joint compound/wallboard:

When joint compound and/or tape is applied to wallboard it becomes an integral part of the wallboard and in effect becomes one material forming a wall system. Therefore, where a demolition or renovation impacts such a wall system, a composite analysis of the wall system (percent of asbestos in the joint compound, tape and wallboard) should be conducted. If the analysis shows a composite asbestos content of less than one percent, the EPA NESHAP does not regulate the wallboard system. Be advised that all O
S
HA regulations regarding worker exposure to asbestos fibers apply regardless of the percentage of asbestos present in the material analyzed.

Laboratory analysis detected asbestos at 1% or less in the following three materials:

F1.2 Blue Table VSF / Inseparable Mastic (<1% Chrysotile)

M8.1 White Sink Caulks - Beige Caulk (<1% Chrysotile), White Caulk (ND)

M8.4 White Log Caulk (<1% Chrysotile)

Ice House

A total of seven building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in one of the sampled materials. The confirmed asbestos-containing material is:

M1.2 Black Tar Sealant (8% Chrysotile)

Laboratory analysis detected asbestos at 1% or less in the following material:

M12.1 Black 4” Vinyl Cove Base and Mastic - Cove Base (ND), Mastic (<1% Anthophyllite)

Mouse House

A total of three building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos was not present in any of the sampled materials.

New Cabin

A total of 13 building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos content at greater than 1% was confirmed to be present in one of the sampled materials. The confirmed asbestos-containing material is:

M1.2 Black Penetration Sealant on Roof (6% Chrysotile)

Laboratory analysis detected asbestos at 1% or less in the following material:

M8.3 Mortar Caulk (<1% Chrysotile)

3-Bay Garage

A total of two building materials suspect for the presence of asbestos were identified in this building. These materials were sampled following sample collection requirements outlined

under the EPA, AHERA legislation.

Laboratory analytical results reported that asbestos was not present in any of the sampled materials.

For additional information refer to the attached Table Sets 1 and 2 and the attached laboratory reports.

Conclusions

Harry's Cabin

Three of the suspect materials identified and sampled were confirmed to be asbestos-containing materials.

George's Cabin

Four of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. Two other materials have asbestos present at 1% or less.

End Cabin

One of the suspect materials identified and sampled was confirmed to be an asbestos-containing material.

Mrs. Oliver's Cabin

Three of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. Three other materials have asbestos present at 1% or less.

Middle Cabin

Three of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. Two other materials have asbestos present at 1% or less.

River Cabin

Two of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. One other material has asbestos present at 1% or less.

Nurse's Cabin

Three of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. Two other materials have asbestos present at 1% or less.

Main Lodge

Five of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. One of those five materials, the gypsum wallboard system was determined to have a composite result of <1% asbestos. Three other materials have asbestos present at 1% or less.

Ice House

One of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. One other material has asbestos present at 1% or less.

Mouse House

None of the sampled materials contained asbestos.

New Cabin

One of the suspect materials identified and sampled were confirmed to be asbestos-containing materials. One other material has asbestos present at 1% or less.

3 Bay Garage

None of the sampled materials contained asbestos.

Recommendations

Northern offers no recommendations regarding asbestos in the two buildings where no asbestos was identified. Renovation work may proceed in the Mouse House and in the 3-Bay Garage without concern of impacting any asbestos-containing materials.

The remaining 10 buildings had one or more confirmed asbestos-containing materials present. Prior to conducting any demolition or renovation activities that will impact the asbestos-containing materials in these 10 buildings Northern recommends that an accredited asbestos abatement contractor be retained to perform all necessary asbestos abatement work.

Because asbestos is present in the joint compound portion of the gypsum wallboard system at greater than 1% asbestos (2% Chrysotile Asbestos) in the Main Lodge, the material must be abated using properly trained workers following OSHA Class II asbestos abatement requirements. OSHA requirements for potential worker exposure to asbestos fibers also apply during renovation or demolition activities. Specifically, OSHA requires that wet removal methods be employed to control employee exposures except where such methods would be infeasible because of electrical hazards or equipment malfunction. In addition, OSHA requires prompt clean-up and disposal of wastes and debris contaminated with asbestos in leak-tight containers except in the case of roofing materials where other specific procedures are required.

While OSHA requires this waste to be containerized EPA and State of Montana regulations do not require it to be disposed of as asbestos-containing waste because the laboratory composite analysis was less than 1% asbestos. The material therefore may be disposed as general construction waste.

Because it is not common for general contractors to have the required OSHA asbestos training to address removal of this material, Northern recommends that the gypsum wallboard system be also be removed by an accredited asbestos abatement contractor.

Northern further recommends that, following completion of the abatement work, an accredited, third-party company be retained to conduct final clearance visual and air testing in all areas where asbestos is removed.

Laboratory analysis identified asbestos at 1% or less in one or more materials in seven of the buildings. These materials are not considered asbestos containing by State, EPA, and OSHA definition. However, other OSHA regulations regarding potential worker exposure to asbestos fibers apply during renovation or demolition activities. Specifically, OSHA requires that wet removal methods be employed to control employee exposures except where such methods would be infeasible because of electrical hazards or equipment malfunction. In addition, OSHA requires prompt clean-up and disposal of wastes and debris contaminated with asbestos in leak-tight containers except in the case of roofing materials where other specific procedures are required. While OSHA requires this waste to be containerized EPA regulations do not require it to be disposed of as asbestos containing waste.

Limitations

This asbestos survey report was prepared based on information obtained during our on-site observations and interpretation of the laboratory analytical results of bulk samples of building materials collected during the survey. The conclusions of this report are professional opinions based solely upon review of our visual site observations and interpretations of laboratory analyses and field data as described in our report.

This report has been prepared to provide information concerning the absence or presence of asbestos in suspect materials in the 12 client selected buildings at this site. It includes only those materials that were visible and accessible at the time of our inspection. We did not remove any permanent building enclosures or disassemble any equipment.

This report is intended to identify asbestos-containing materials. It is not intended to be used for the purpose of obtaining bids for its removal by abatement contractors. The scope of services provided by Northern may not be appropriate to satisfy the needs of other users, and any use or re-use of this document, or the findings presented herein, is at the sole risk of the user.

Our opinions are intended exclusively for use by Hennebery Eddy Architects. The opinions presented herein apply to the site conditions existing at the time of our survey. Therefore, our opinions and recommendations may not apply to future conditions that may exist at the site that

we have not had the opportunity to evaluate.

We trust this summary report provides sufficient information for planning purposes. We appreciate the opportunity to assist you and look forward to continuing to work with you.

If you have any questions or require additional information, please contact us.

Respectfully submitted,

NORTHERN INDUSTRIAL HYGIENE, INC.

Chris Hust,
EPA Accredited Asbestos Inspector

Grant Minkoff,
EPA Accredited Asbestos Inspector

Attachments:
- Table Sets 1 and 2
- ACM Location Drawings
- Laboratory Analysis Reports
- Inspector Credentials
- Invoice

TABLE 1A
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Harry's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	White w/ Blue Streak Vinyl Sheet Flooring (VSF) / Inseparable Mastic	N	Bathroom	ND
F1.1	Green Roof Felt	N	Roof	ND
M1.2	**Black Penetration Sealant**	**N**	**Roof**	**2% Chrysotile**
M8.1	**White Window Glazing Compound**	**N**	**Exterior**	**2% Chrysotile**
M8.2	White Wall Caulk	N	Living Room	ND
M13.1	White Ceramic Wall Tile with Grout and Mastic	N	Bathroom	All Layers ND
M14.1	Concrete	N	Exterior	ND
M20.1	Log Mortar	N	Exterior	ND
M20.2	Interior Log Mortar	N	Living Room	ND
M20.3	**Transite Panel**	**N**	**Living Room**	**65% Chrysotile**
M20.4	White Ceiling Panel	N	Living Room	ND

TABLE 1B
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - George's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	**White VSF-Square & Octagon / Inseparable Mastic**	**N**	**Entry Room & Bedroom**	**15% Chrysotile**
F1.2	**Square & Rectangle VSF / Inseparable Mastic**	**N**	**Bathroom**	**15% Chrysotile**
M1.1	Green Roof Felt	N	Roof	ND
M1.2	**Black Tar Sealant**	**N**	**Roof**	**15% Chrysotile**
M8.1	White Sink Caulk	N	Bathroom	ND
M8.2	**Exterior Window Frame Caulk**	**N**	**Exterior**	**3% Chrysotile**
M14.1	Concrete Foundation (includes a small amount of inseparable attached m)aterial	N	Exterior	<1% Chrysotile
M20.1	Log Mortar	N	Exterior	<1% Chrysotile
M20.2	Interior Log Mortar	N	Bathroom	ND

TABLE 1C
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - End Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	White Vinyl Sheet Flooring (VSF) / Inseparable Mastic	N	Bathroom	ND
M1.1	Green Roof Felt	N	Roof	ND
M1.2	Black Penetration Sealant	N	Roof	ND
M1.3	Roof Rubber	N	Roof	ND
M8.1	White Window Glazing Compound	N	Exterior	ND
M8.2	Ceiling Caulk	N	Living Room	ND
M13.1	White Ceramic Wall Tile with Caulk, Grout, Mortar and Mastic	N	Living Room	All Layers ND
M14.1	Concrete	N	Exterior	ND
M20.1	Log Mortar	N	Exterior	ND
M20.2	**Transite Panel**	**N**	**Living Room**	**40% Chrysotile**
M20.3	Interior Log Mortar	N	Living Room	ND
M20.4	Black Felt	N	Living Room Ceiling	ND

NS = Material Not Sampled
ND = No Asbestos Detected

Confirmed Asbestos-Containing Materials Shown in Bold Type

TABLE 1D
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Mrs.Oliver's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	Beige Vinyl Sheet Flooring (VSF) / Inseparable Mastic 1 with Mastic 2 (under F3.1 Floor Tile)	N	Bathroom	VSF/Mastic 1 (<1% Chrysotile), Mastic 2 (ND)
F3.1	Green 9"x 9" Floor Tile with Mastic	N	Bathroom	All Layers ND
M1.1	Green Roof Felt	N	Roof	ND
M1.2	**Grey Sealant**	**N**	**Roof**	**8% Chrysotile**
M8.1	White Window Glazing Compound	N	Exterior	<1% Chrysotile
M8.2	Black Ceiling Sealant	N	Bathroom	ND
M8.3	Yellow Wall Caulk	N	Bedroom 1	<1% Anthophyllite
M8.4	White Ceiling Caulk	N	Bedroom 2	ND
M13.1	White Ceramic Wall Tile	N	Bathroom	ND
M14.1	Concrete	N	Exterior	ND
M20.1	Log Mortar	N	Exterior	ND
M20.2	White Ceiling Panel	N	Bedrooms 1 and 2	ND
M20.3	**Transite Panel**	**N**	**Bedroom 2**	**20% Chrysotile**
M20.4	**Black Felt 1 / Inseparable Tar** with Felt 2 (Around Ceiling Penetration)	**N**	**Bedroom 2**	**Tar/Felt 1 (3% Chrysotile)**, Felt 2 (ND)

NS = Material Not Sampled
ND = No Asbestos Detected

Confirmed Asbestos-Containing Materials Shown in Bold Type

TABLE 1E
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Middle Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	**Blue Vinyl Sheet Flooring (VSF)** with Mastic	**N**	**Bathroom**	**VSF (15% Chrysotile),** Mastic (ND)
M1.1	Green Roof Felt	N	Roof	ND
M1.2	**Grey Sealant**	**N**	**Roof**	**3% Chrysotile**
M8.1	White Window Glazing Compound	N	Exterior	<1% Chrysotile
M8.2	Tub Caulk	N	Bathroom	ND
M8.3	Yellow Wall Caulk	N	Bedroom 1	<1% Anthophyllite
M13.1	White Ceramic Wall Tile with Grout and Mastic	N	Bathroom	All Layers ND
M14.1	Concrete	N	Exterior	ND
M20.1	Log Mortar	N	Exterior	ND
M20.2	White Ceiling Panel	N	Bedrooms 1 and 2	ND
M20.3	Black Felt	N	Bedrooms 1 and 2	ND
M20.4	**Transite Panel**	**N**	**Bedroom 1**	**25% Chrysotile**
M20.5	Interior Log Mortar		Bedroom 1	ND

NS = Material Not Sampled
ND = No Asbestos Detected

Confirmed Asbestos-Containing Materials Shown in Bold Type

TABLE 1F
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - River Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	White w/Blue Streaks Vinyl Sheet Flooring (VSF) / Inseparable Mastic	N	Bathroom	ND
M1.1	Green Roof Felt	N	Roof	ND
M3.1	Gypsum Wallboard System	N	Bathroom	Joint Compound (<1% Chrysotile), All Other Layers (ND), Composite (<1% Chrysotile)
M8.1	**Beam Caulk**	**N**	**Living Room**	**10% Chrysotile**
M13.1	White Ceramic Wall Tile with Grout and Mastic	N	Bathroom	All Layers ND
M14.1	Concrete	N	Exterior	ND
M17.1	Concrete Masonry Unit (CMU) Block	N	Exterior	ND
M20.1	**Transite Panel**	**N**	**Living Room**	**50% Chrysotile**
M20.2	Black Felt Above Fireplace	N	Living Room	ND
M20.3	Blue Wall Panel & Adhesive	N	Bathroom	All Layers ND

TABLE 1G
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Nurse's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	**White Speckled Vinyl Sheet Flooring (VSF) / Inseparable Mastic**	**N**	**Bathroom & Room w/2 Closets**	**20% Chrysotile**
M1.1	Green Roof Felt	N	Roof	ND
M1.2	**Black Penetration Sealant**	**N**	**Roof**	**10% Chrysotile**
M3.1	Gypsum Wallboard System	N	Hallway, Bathroom Closet & Room w/2 Closets	Joint Compound (<1% Chrysotile), All Other Layers (ND), Composite (<1% Chrysotile)
M12.1	White 4" Vinyl Cove Base with Mastic	N	Bathroom	Cove Base (ND), Mastic (<1% Anthophyllite)
M13.1	Pink Wall Tile with Mastic	N	Bathroom	All Layers ND
M17.1	Concrete Masonry Unit (CMU) Block and Mortar	N	Exterior	All Layers ND
M19.1	Fiberglass Attic Insulation	N	Attic	ND
M20.1	Log Mortar	N	Exterior	ND
M20.2	White Ceiling Panels	N	South Room	ND
M20.3	Shower Panel Adhesives (Tan and White)	N	Bathroom	All Layers ND
M20.4	**Transite Panel**	**N**	**Living Room**	**40% Chrysotile**
M20.5	Black Felt	N	North Room	ND

TABLE 1H
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Main Lodge
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F1.1	Yellow 6" x 6" Tile Look Vinyl Sheet Flooring (VSF) / Inseparable Mastic	N	Kitchen and Pantry	ND
F1.2	Blue Table VSF / Inseparable Mastic	N	Pantry	<1% Chrysotile
F1.3	Square & Rectangle VSF with Mastic	N	Pantry	All Layers ND
F1.4	VSF Backing / Inseparable Mastic with Leveler (Under VSF F1.1)	N	Pantry	All Layers ND
M1.1	Green Roof Felt	N	Roof	ND
M1.2	Grey Sealant	N	Roof	ND
M1.3	**Black Chimney Sealant**	**N**	**Roof**	**2% Chrysotile**
M1.4	Clear Penetration Sealant with Tar	N	Roof	All Layers ND
M1.5	Roof Tar / Inseparable Membrane	N	Roof	ND
M1.6	Felt Paper Under New Plywood	N	Roof	ND

TABLE 1H
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Main Lodge
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
M3.1	Gypsum Wallboard System	N	Kitchen	**Joint Compound (2% Chrysotile)**, All Other Layers (ND), Composite of Layers (<1% Chrysotile)
M8.1	White and Beige Sink Caulks	N	Kitchen	Beige Caulk (<1% Chrysotile), White Caulk (ND)
M8.2	Log Caulk	N	South Room and Bathroom	ND
M8.3	White Window Glazing Compound with Beige Window Glazing Compound	N	Exterior	All Layers ND
M8.4	White Log Caulk	N	Exterior	<1% Chrysotile
M8.5	Black Log Sealant	N	Exterior	ND
M8.6	**Foundation Sealant**	**N**	**Exterior**	**2% Chrysotile**
M8.7	**Sewer Pipe Sealant**	**N**	**Exterior**	**3% Chrysotile**
M12.1	Tan 4" Vinyl Cove Base with Tan and Brown Mastics	N	Kitchen	All Layers ND
M14.1	Fireplace Concrete	N	Great Room	ND

TABLE 1H
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Main Lodge
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
M14.2	Foundation Concrete	N	Exterior	ND
M14.3	Old Furnace Pad	N	Basement	ND
M14.4	Newer Furnace Pad	N	Basement	ND
M16.1	Fireplace Brick and Mortar	N	Great Room	All Layers ND
M20.1	Rock Chimney Mortar	N	Great Room and Exterior	ND
M20.2	Interior Log Mortar	N	Living Room and Great Room	ND
M20.3	Foam Fill	N	Great Room	ND
M20.4	Fiberboard Wall	N	Bathroom	ND
M20.5	Exterior Log Mortar	N	Exterior	ND
S1.1	**Light Orange Peel Texture**	**Y**	**Kitchen**	**2% Chrysotile**

TABLE 1I
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Ice House
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
M1.1	Green Felt Roof	N	Roof	ND
M1.2	**Black Tar Sealant**	**N**	**Chimney**	**8% Chrysotile**
M1.3	Red Chimney Tape	N	Chimney	ND
M12.1	Black 4" Vinyl Cove Base with Mastic	N	Interior	Cove Base (ND), Mastic (<1% Anthophyllite)
M14.1	Concrete Floor	N	Interior	ND
M17.1	Concrete Masonry Unit (CMU) Foundation	N	Exterior	ND
M20.1	Log Mortar	N	Exterior	ND

TABLE 1J
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - Mouse House
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
M1.1	Green Felt Roof	N	Roof	ND
M8.1	White Caulk	N	Interior	ND
M14.1	Concrete Masonry Unit (CMU) Foundation	N	Exterior	ND

TABLE 1K
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

4 Lazy F Ranch - New Cabin
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
M1.1	Green Roof Felt	N	Roof	ND
M1.2	**Black Penetration Sealant**	**N**	**Roof**	**6% Chrysotile**
M1.3	Roof Tar / Inseparable Rubber	N	Roof	ND
M8.1	White Window Glazing Compound	N	Exterior	ND
M8.2	Tan Window Frame Caulk	N	Exterior	ND
M8.3	Mortar Caulk	N	Exterior	<1% Chrysotile
M8.4	White Shower Caulk	N	Bathroom	ND
M13.1	White Ceramic Wall Tile with Grout, Mastics and Leveler	N	Bathroom	All Layers ND
M14.1	Concrete Foundation (White and Gray Layers) with Coating	N	Living Room	All Layers ND
M14.2	Fireplace Pad Concrete	N	Living Room	ND
M16.1	Brick and Mortar	N	Living Room	All Layers ND
M17.1	Concrete Masonry Unit (CMU) Block & Mortar	N	Exterior	All Layers ND
M20.1	Log Mortar	N	Exterior	ND

NS = Material Not Sampled
ND = No Asbestos Detected

Confirmed Asbestos-Containing Materials Shown in Bold Type

TABLE 1L
SUMMARY OF MATERIALS SUSPECTED TO CONTAIN ASBESTOS AND LABORATORY RESULTS

Lazy F Ranch-3 Bay Garage
4 Lazy F Ranch Road
Moose, Wyoming

HA #	Material Description	Friable (Y/N)	Sample Locations	Laboratory Results
F8.1	Leveler (2 Layers)	N	Foundation	All Layers ND
M14.1	Concrete	N	Foundation	ND

TABLE 2A
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Harry's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M1.2	Black Penetration Sealant on Roof (2% Chrysotile)	II	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
M8.1	White Window Glazing Compound (2% Chrysotile)	II	
M20.3	Transite Panel (65% Chrysotile)	II	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2B
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - George's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
F1.1	White Vinyl Sheet Flooring (VSF) - Square & Octagon / Inseparable Mastic (15% Chrysotile)	I	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
F1.2	Square & Rectangle VSF / Inseparable Mastic (15% Chrysotile)	I	
M1.2	Black Tar Sealant on Roof (2% Chrysotile)	II	
M8.2	Exterior Window Frame Caulk (3% Chrysotile)	II	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2C
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - End Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M20.2	Transite Panel (40% Chrysotile)	II	If the material will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2D
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Mrs. Oliver's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M1.2	Grey Sealant (8% Chrysotile)	II	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
M20.3	Transite Panel (20% Chrysotile)	II	
M20.4	Black Felt 1 / Inseparable Tar (3% Chrysotile), Felt 2 (ND)	II	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2E
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Middle Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
F1.1	Blue Vinyl Sheet Flooring (VSF) with Mastic - VSF (15% Chrysotile), Mastic (ND)	I	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
M1.2	Grey Sealant on Roof (3% Chrysotile)	II	
M20.4	Transite Panel (25% Chrysotile)	II	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2F
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - River Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M8.1	Beam Caulk (10% Chrysotile)	II	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
M20.1	Transite Panel (50% Chrysotile)	II	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2G
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Nurse's Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
F1.1	White Speckled Vinyl Sheet Flooring (VSF) / Inseparable Mastic (20% Chrysotile)	I	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
M1.2	Black Penetration Sealant on Roof (10% Chrysotile)	I	
M20.4	Transite Panel (40% Chrysotile)	II	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2H
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Main Lodge
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M1.3	Black Chimney Sealant on Roof (2% Chrysotile)	II	If the materials will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.
M8.6	Foundation Sealant (2% Chrysotile)	II	
M8.7	Sewer Pipe Sealant (3% Chrysotile)	II	
S1.1	Light Orange Peel Texture (2% Chrysotile)	RACM	

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2H
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Main Lodge
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	Asbestos NESHAP Category	Asbestos OSHA Work Class	Recommended Response Action
M3.1	Gypsum Wallboard System (Wallboard and Tape - ND / Joint Compound - 2% Asbestos / Composite of Layers - <1% Asbestos)	Not Applicable (Composite of Layers <1%)	II	Retain accredited asbestos abatement contractor to remove following OSHA Class II work practices prior to conducting any renovation or demolition work that will impact this asbestos-containing material. EPA allows material to be disposed as general construction waste however check with local landfill for site specific requirements.

Asbestos NESHAP Category Definition

Category I: Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.

Category II: All nonfriable ACM, excluding Category I materials.

RACM: Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II material that has a high probability of becoming friable.

OSHA Asbestos Work Class Definition

Class I asbestos work means activities involving the removal of TSI and friable surfacing ACM and PACM

Class II asbestos work means activities involving the removal of ACM which is not TSI or surfacing material. This includes, but is not limited to, the removal of asbestos-containing wallboard, floor tile and sheeting, roofing and siding shingles, and construction mastics.

ACM - Asbestos-containing material TSI = Thermal System Insulation PACM = Presumed asbestos-containing material

TABLE 2I
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Ice House
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M1.2	Black Tar Sealant on Roof (8% Chrysotile)	II	If the material will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2J
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - Mouse House
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
No asbestos was detected in any of the suspect materials identified and sampled.			

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.	ACM = Asbestos Containing Material
Category II	All nonfriable ACM, excluding Category I materials.	ND = No Asbestos Detected
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.	

TABLE 2K
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

4 Lazy F Ranch - New Cabin
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
M1.2	Black Penetration Sealant on Roof (6% Chrysotile)	II	If the material will be impacted by renovation or demolition, retain an accredited asbestos abatement contractor to abate prior to disturbance.

Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

TABLE 2L
SUMMARY OF CONFIRMED OR ASSUMED ASBESTOS-CONTAINING MATERIALS AND RECOMMENDED RESPONSE ACTION

Lazy F Ranch - 3 Bay Garage
4 Lazy F Ranch Road
Moose, Wyoming

Material Number	Material Description	NESHAP Category	Recommended Response Action
No asbestos was detected in any of the suspect materials identified and sampled.			


Category I	Nonfriable ACM such as packings, gaskets, resilient floor covering, and asphalt roofing products.
Category II	All nonfriable ACM, excluding Category I materials.
RACM	Friable ACM; Category I material that has become friable; Category I material that will be subjected to sanding, grinding, cutting, or abrading; or Category II, material that has a high probability of becoming friable.

ACM = Asbestos Containing Material

ND = No Asbestos Detected

ACM Location Drawing
4 Lazy F Ranch - End Cabin
Moose, Wyoming

N

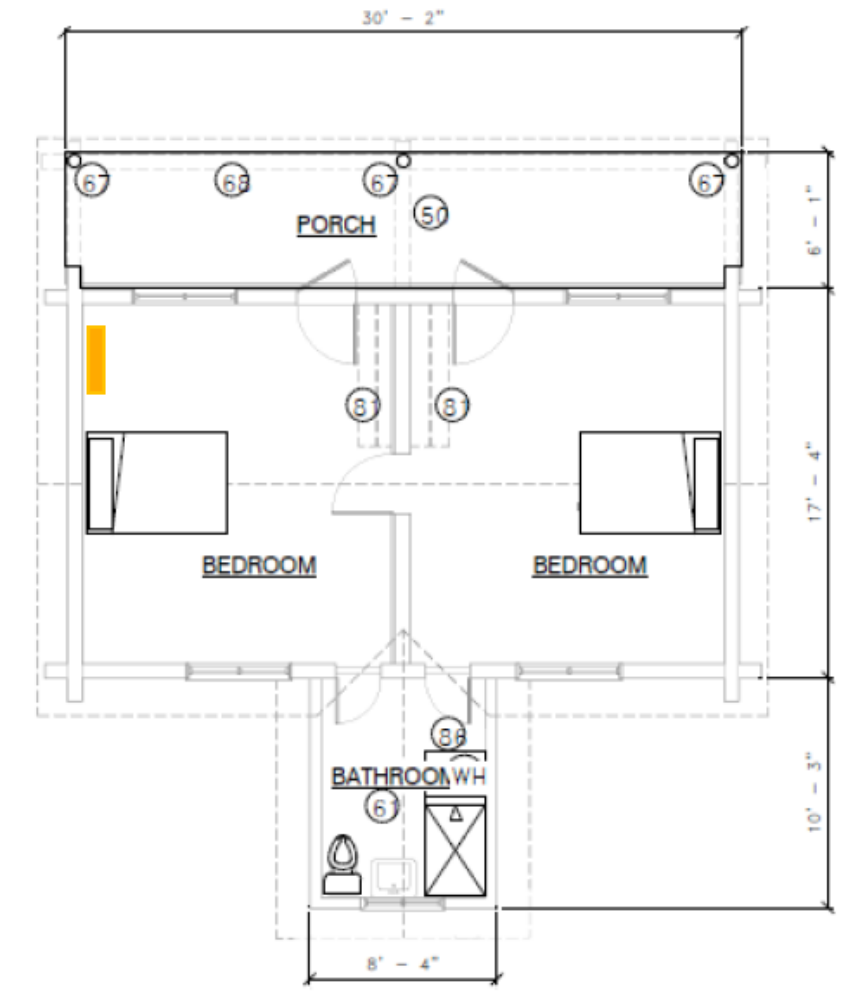


2 END CABIN (HS-407) FLOOR PLAN
1/4" = 1'-0"

ACM Transite Panel

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - George's Cabin
Moose, Wyoming

N →

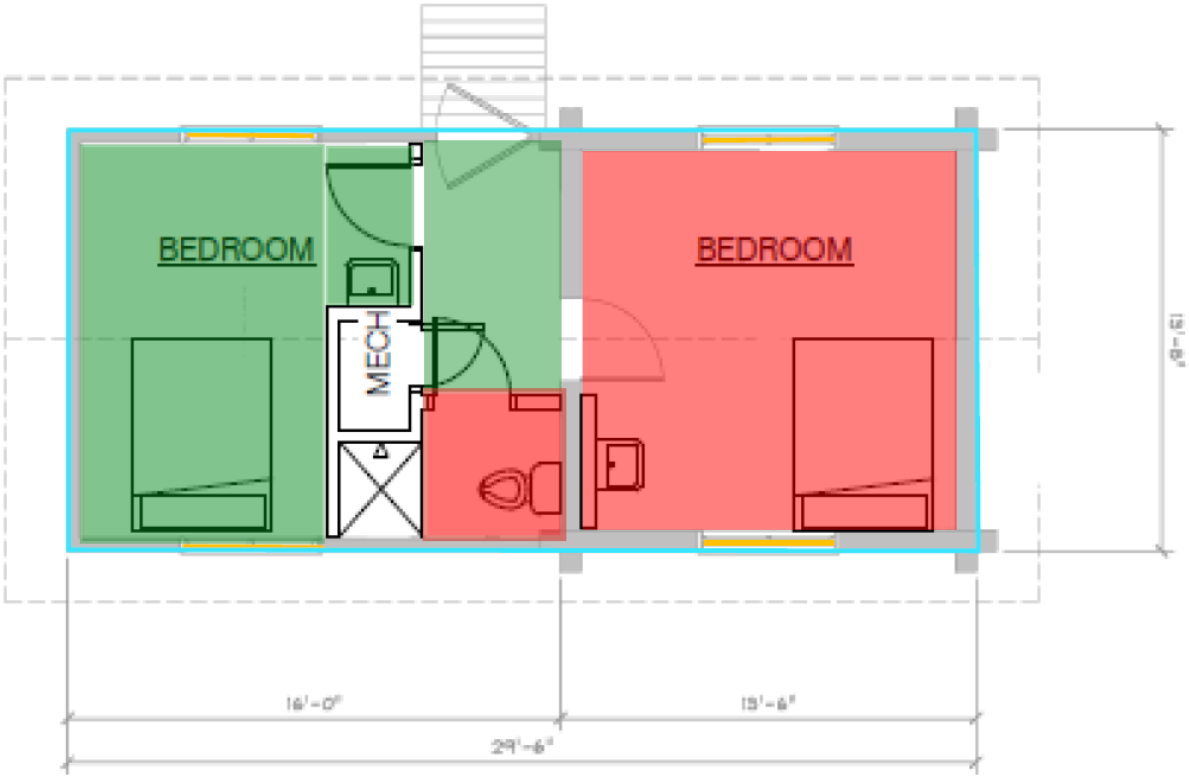

2 GEORGES CABIN (HS-404) FLOOR PLAN
1/4" = 1'-0"

ACM White Vinyl Sheet Flooring Square & Octagon / Inseparable Mastic


ACM Square and Rectangle Vinyl Sheet Flooring / Inseparable Mastic

ACM Exterior Window Frame Caulk

ACM Black Tar Sealant (Roof)

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - Harry's Cabin
Moose, Wyoming

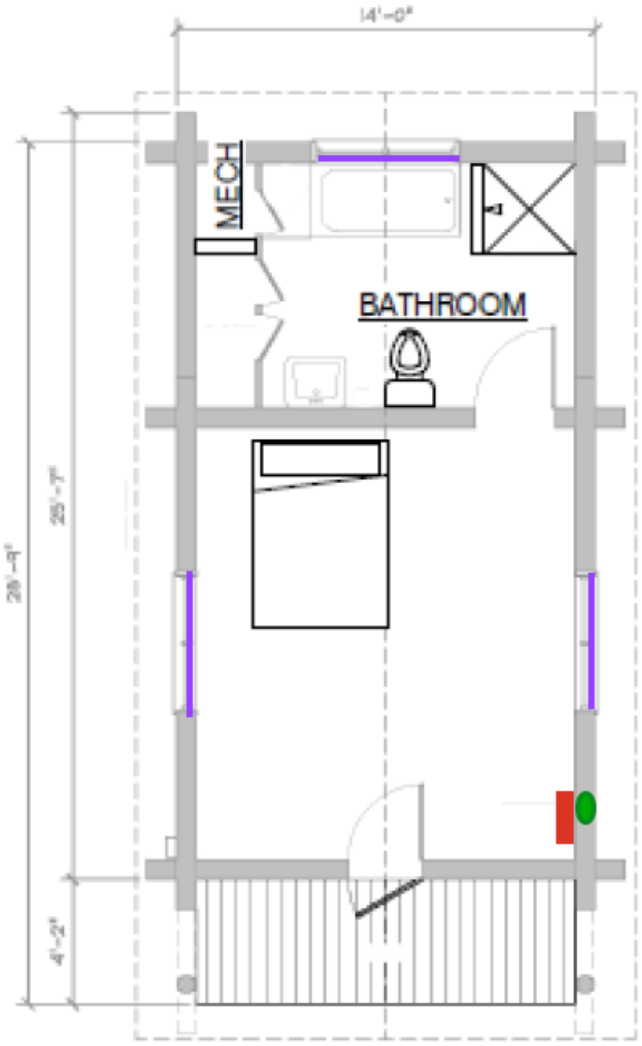

N

2 HARRY'S CABIN (HS-410) FLOOR PLAN
1/4" = 1'-0"


ACM Black Penetration Sealant (Roof)

ACM White Window Glazing Compound

ACM Transite Panel

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - Ice House
Moose, Wyoming

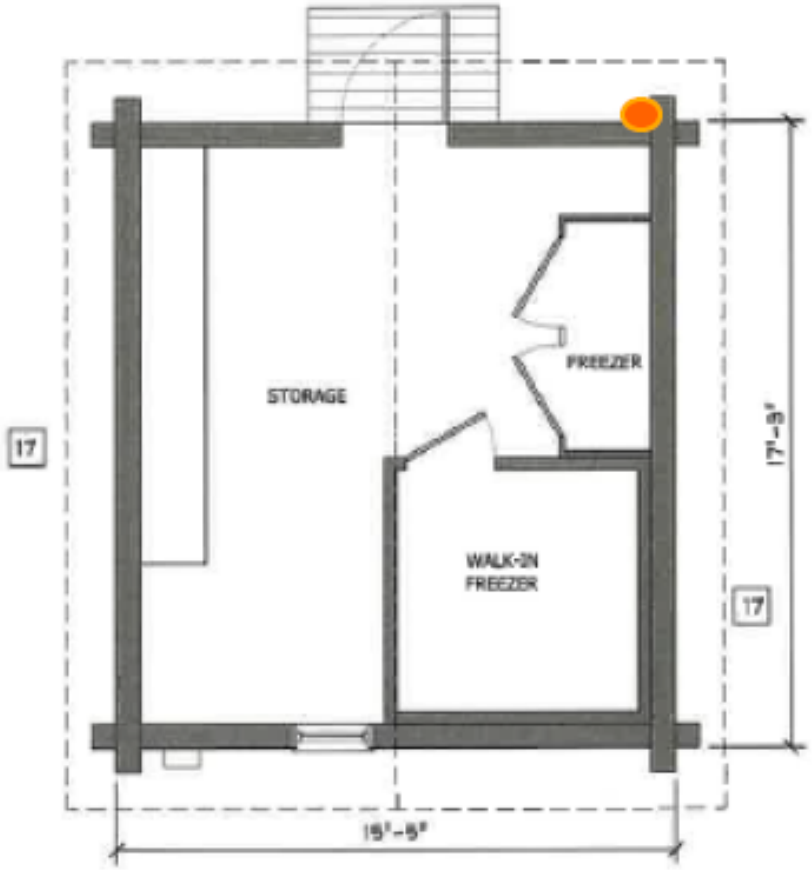


N

ACM Black Tar Sealant (Roof)

NORTHERN
INDUSTRIAL HYGIENE, INC.

ACM Drawing Location
4 Lazy F Ranch - Main Lodge
Moose, Wyoming

N

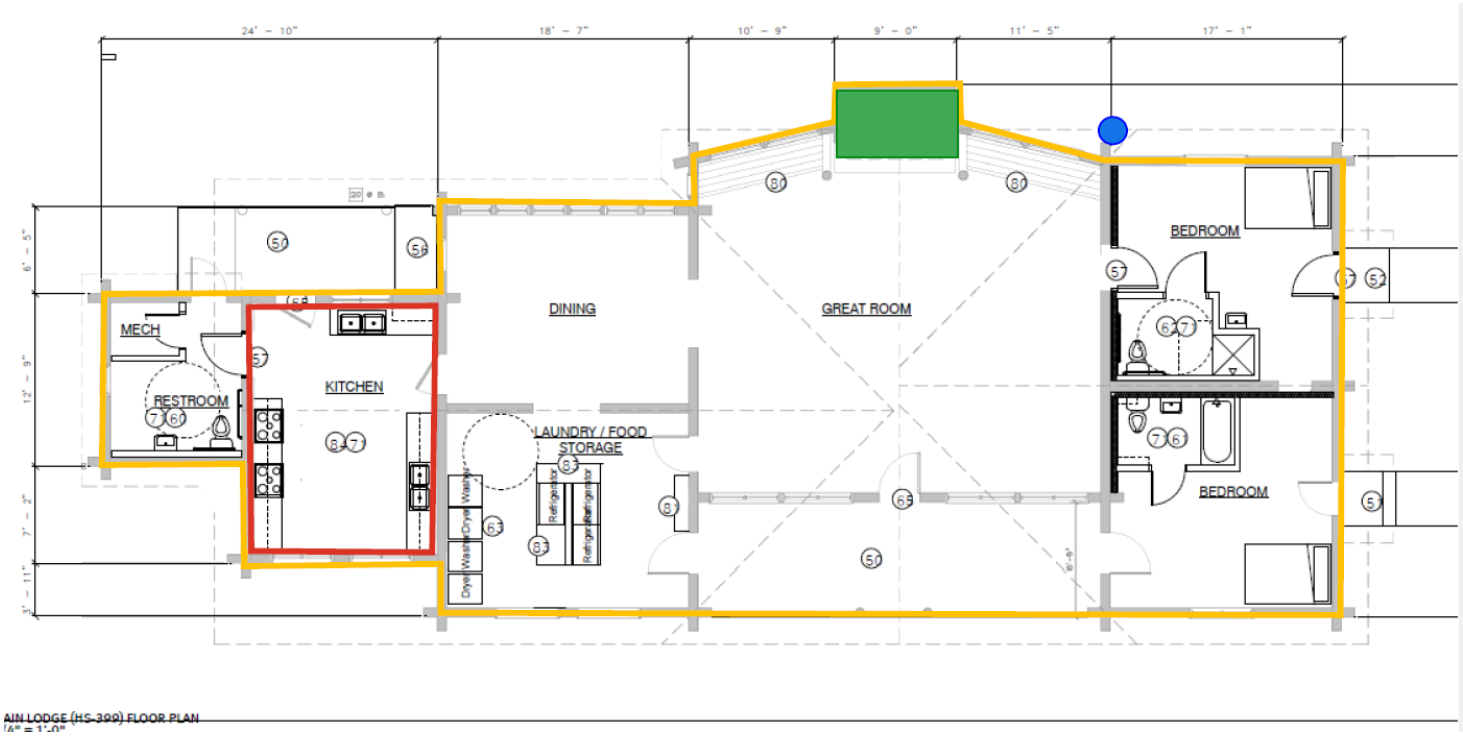

AIN LODGE (HS-399) FLOOR PLAN
'A" = 1'-0"

ACM Light Orange Peel Wall Texture

ACM Black Chimney Sealant (Roof)

ACM Foundation Sealant


ACM Sewer Pipe Sealant

Gypsum Wallboard System has 2% Asbestos in the Joint Compound Layer. Composite of all Layers is <1% Asbestos. EPA NESHAP does not Consider this to be an ACM, However Removal Falls Under OSHA Class II Asbestos Work Practices.

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - Middle Cabin
Moose, Wyoming

N

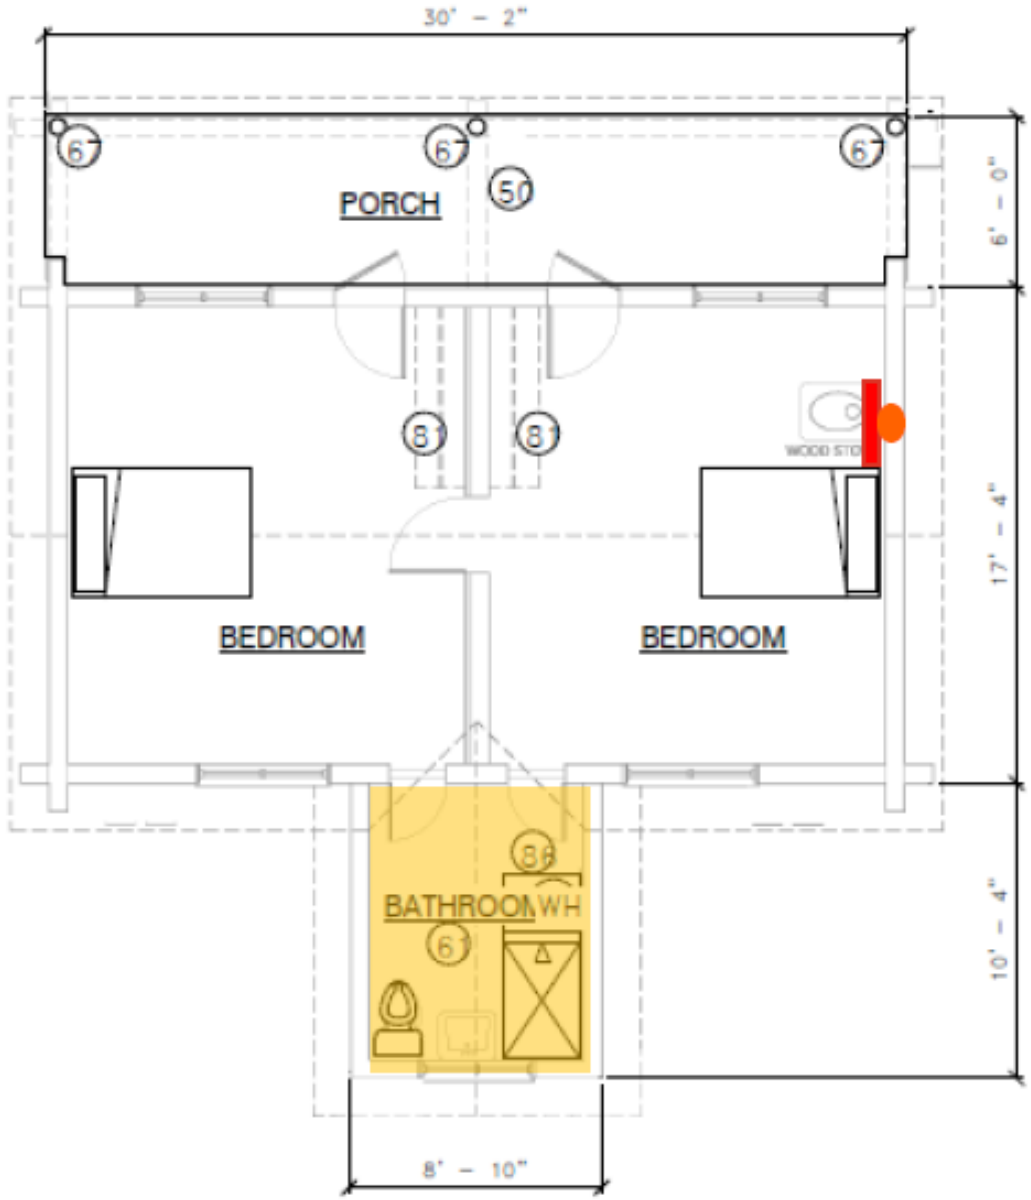

2 MIDDLE CABIN (HS-408) FLOOR PLAN
1/4" = 1'-0"

ACM Transite Panel


ACM Blue Vinyl Sheet Flooring (Mastic - ND)

ACM Grey Sealant (Roof)

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - Mrs. Oliver's Cabin
Moose, Wyoming

N

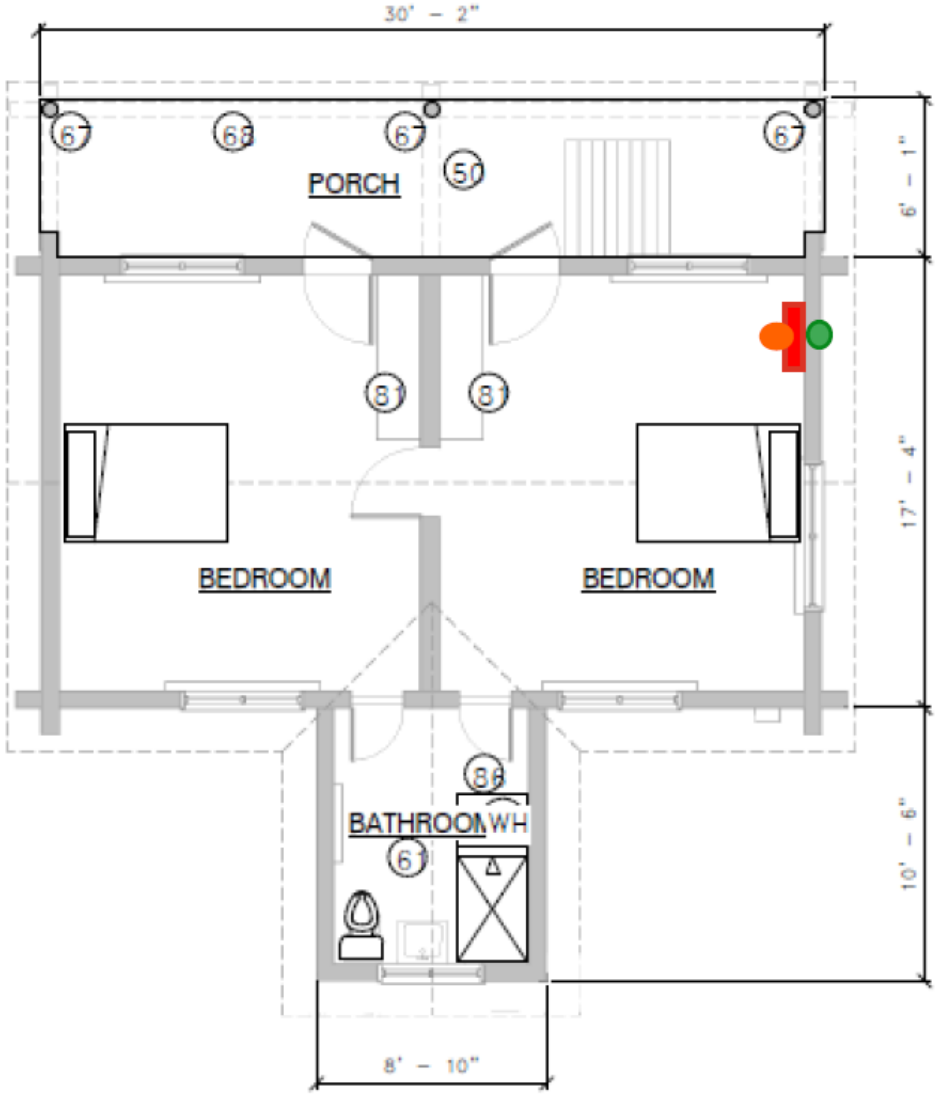

2 MRS OLIVER'S CABIN (HS-409) FLOOR PLAN
1/4" = 1'-0"

ACM Transite Panel ACM


Grey Sealant (Roof)

ACM Black Felt / Inseparable Tar

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - New Cabin
Moose, Wyoming

N

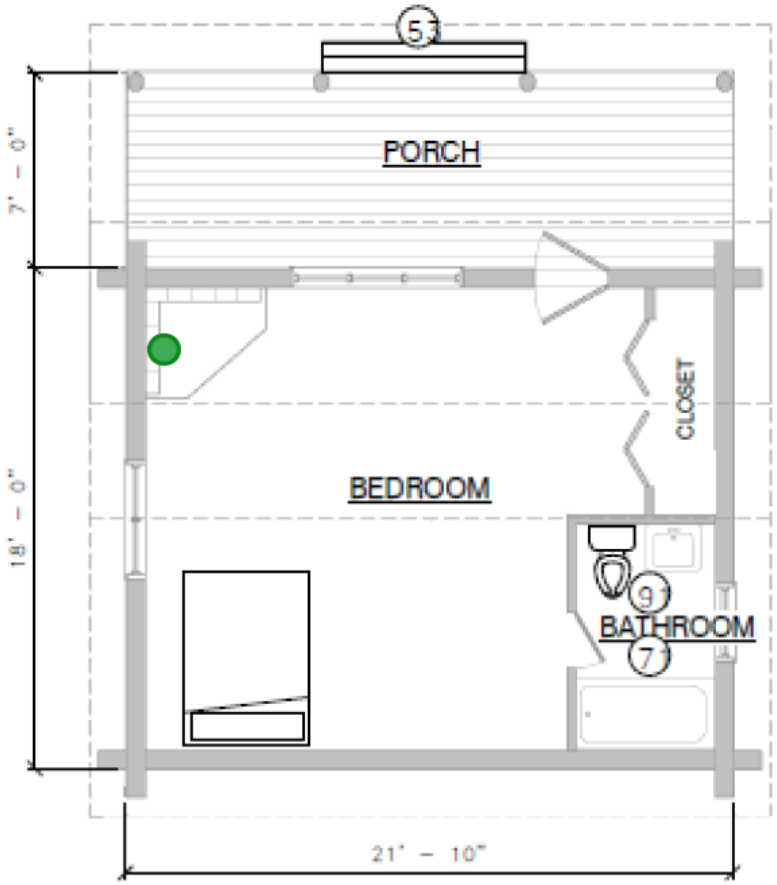


2 NEW CABIN (HS-411) FLOOR PLAN
1/4" = 1'-0"

ACM Black Penetration Sealant (Roof)

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - Nurse's Cabin
Moose, Wyoming

N

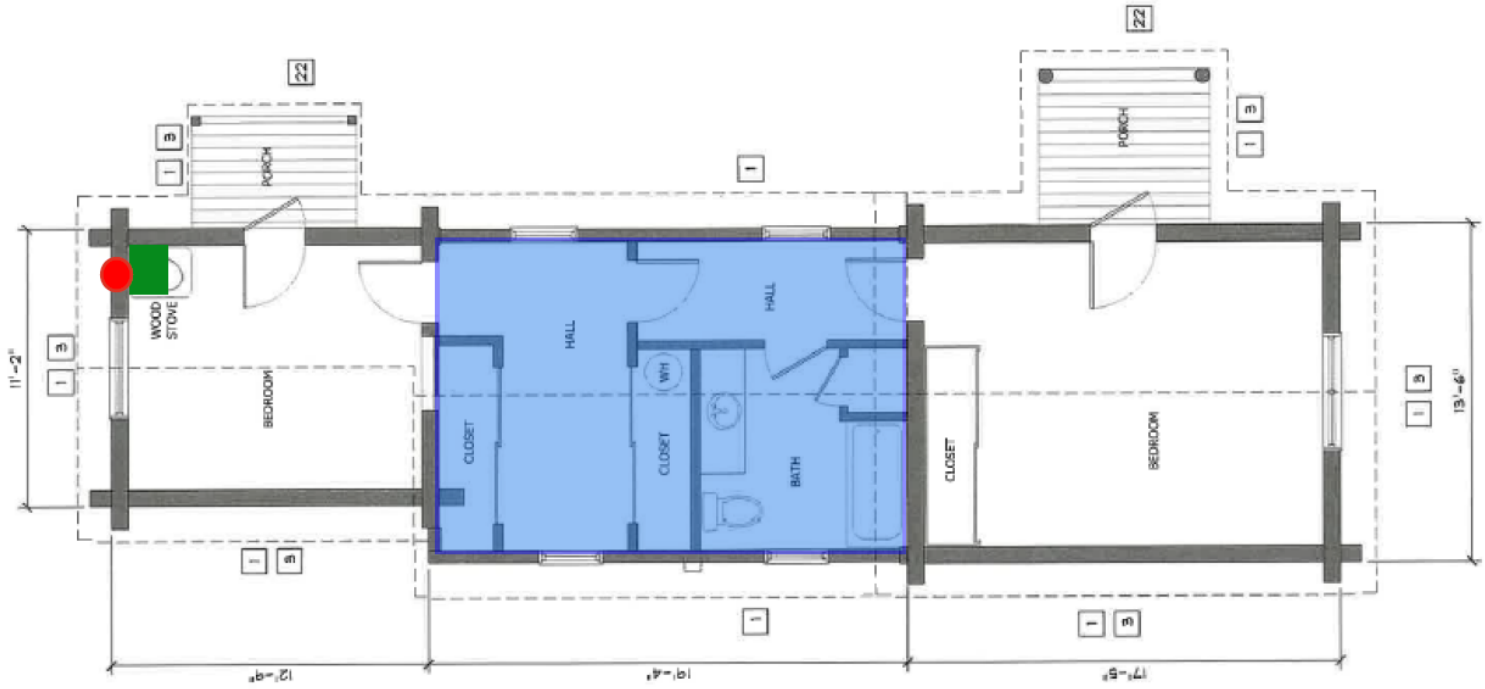

ACM White Speckled Vinyl Sheet Flooring / Inseparable Mastic


ACM Black Penetration Sealant (Roof)

ACM Transite Panel

NORTHERN INDUSTRIAL HYGIENE, INC.

ACM Location Drawing
4 Lazy F Ranch - River Cabin
Moose, Wyoming

N

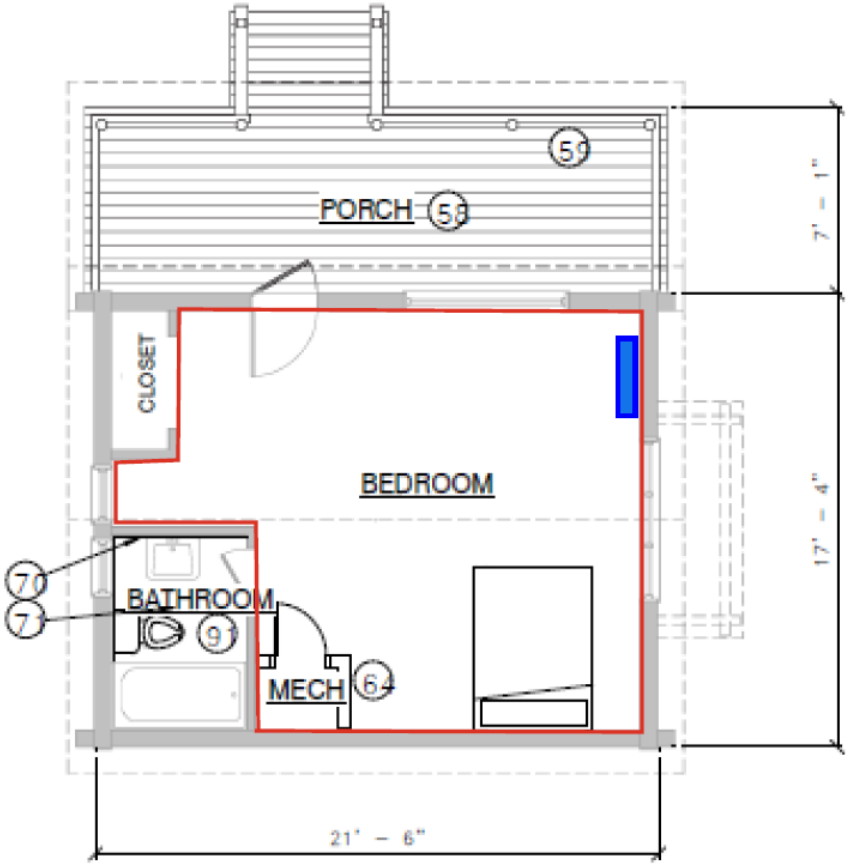

2 RIVER CABIN (HS-400) - FLOOR PLAN
1/4" = 1'-0"

ACM Beam Caulk

ACM Transite Panel

NORTHERN INDUSTRIAL HYGIENE, INC.

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017

Tel/Fax: (602) 276-4344 / (602) 276-4053

http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503737
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention:	Chris Hust	**Phone:**	(406) 245-7766
	Northern Industrial Hygiene, Inc.	**Fax:**	(406) 254-1428
	201 South 30th Street	**Received Date:**	05/27/2025 9:55 AM
	Billings, MT 59101	**Analysis Date:**	05/28/2025
		Collected Date:	05/20/2025

Project: 999-5237 / Lazy F Ranch - Moose, WY 3 Bay Garage

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
F8.1A-Leveler 1 *122503737-0001*	Leveler	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
F8.1A-Leveler 2 *122503737-0001A*	Leveler	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
F8.1B-Leveler 1 *122503737-0002*	Leveler	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
F8.1B-Leveler 2 *122503737-0002A*	Leveler	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1A *122503737-0003*	Concrete	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B *122503737-0004*	Concrete	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Analyst(s)

Cara Blount (3)

Caleigh Border (3)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 19:21:47

OrderID: 122503737

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503737

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-5237 / Lazy F Ranch - Moose, WY 3 Bay Garage
Purchase Order:
EMSL LIMS Project ID: (If applicable, EMSL will provide)
US State where samples collected: WY
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name: Grant Minkoff
Sampled By Signature: [signature]
Date Sampled: 5-20-25
No. of Samples in Shipment: 4

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)
☐ PLM EPA NOB (<1%)
☐ POINT COUNT
  ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
☐ POINT COUNT w/ GRAVIMETRIC
  ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
☐ NIOSH 9002 (<1%)
☐ NYS 198.1 (Friable - NY)
☐ NYS 198.6 NOB (Non-Friable - NY)
☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

☐ TEM EPA NOB
☐ NYS NOB 198.4 (Non-Friable - NY)
☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
F8.1A		Foundation	Leveler
B			"
M14.1A			Concrete
B			"

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment: Fed Ex		Sample Condition Upon Receipt:	
Relinquished by: Grant Minkoff	Date/Time: 5-23-25 16:30	Received by: Erica Furphy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

Page 1 of 1

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503747
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention:	Chris Hust	**Phone:**	(406) 245-7766
	Northern Industrial Hygiene, Inc.	**Fax:**	(406) 254-1428
	201 South 30th Street	**Received Date:**	05/27/2025 9:55 AM
	Billings, MT 59101	**Analysis Date:**	05/29/2025 - 05/30/2025
		Collected Date:	05/20/2025
Project:	999-5237 / Lazy F Ranch Moose, WY End Cabin		

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
F1.1A-Vinyl Sheet Flooring/ Mastic *122503747-0001* *Materials are inseparable.*	White Vinyl Sheet Flooring & Mastic	Various Fibrous Heterogeneous	20% Cellulose 2% Glass	78% Non-fibrous (Other)	None Detected
F1.1B-Vinyl Sheet Flooring/ Mastic *122503747-0002* *Materials are inseparable.*	White Vinyl Sheet Flooring & Mastic	Various Fibrous Heterogeneous	20% Cellulose 2% Glass	78% Non-fibrous (Other)	None Detected
M1.1A *122503747-0003*	Green Roof Felt	Various Fibrous Homogeneous	10% Synthetic 2% Glass	88% Non-fibrous (Other)	None Detected
M1.1B *122503747-0004*	Green Roof Felt	Various Fibrous Homogeneous	10% Synthetic 2% Glass	88% Non-fibrous (Other)	None Detected
M1.2A *122503747-0005*	Black Penetration Sealant	Black Fibrous Homogeneous	10% Cellulose	90% Non-fibrous (Other)	None Detected
M1.2B *122503747-0006*	Black Penetration Sealant	Black Fibrous Homogeneous	10% Cellulose	90% Non-fibrous (Other)	None Detected
M1.3A *122503747-0007*	Roof Rubber	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M1.3B *122503747-0008*	Roof Rubber	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M8.1A *122503747-0009*	White Window Glazing	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.1B *122503747-0010*	White Window Glazing	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.2A *122503747-0011*	Ceiling Caulk	Beige Non-Fibrous Homogeneous	<1% Wollastonite 2% Fibrous (Other)	98% Non-fibrous (Other)	None Detected
M8.2B *122503747-0012*	Ceiling Caulk	Beige Non-Fibrous Homogeneous	<1% Wollastonite 2% Fibrous (Other)	98% Non-fibrous (Other)	None Detected
M13.1A-Caulk *122503747-0013*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Ceramic Tile *122503747-0013A*	White Ceramic Wall Tile & Grout	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Grout *122503747-0013B*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 20:07:39

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503747
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M13.1A-Mastic *122503747-0013C*	White Ceramic Wall Tile & Grout	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Caulk *122503747-0014*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Ceramic Tile *122503747-0014A*	White Ceramic Wall Tile & Grout	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Grout *122503747-0014B*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Mortar *122503747-0014C*	White Ceramic Wall Tile & Grout	Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Mastic *122503747-0014D*	White Ceramic Wall Tile & Grout	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1A *122503747-0015*	Concrete	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B *122503747-0016*	Concrete	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1A *122503747-0017*	Log Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1B *122503747-0018*	Log Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.2A *122503747-0019*	Transite Panel	Gray Fibrous Homogeneous	30% Cellulose	30% Non-fibrous (Other)	**40% Chrysotile**
M20.2B *122503747-0020*	Transite Panel				**Positive Stop (Not Analyzed)**
M20.3A *122503747-0021*	Interior Log Mortar	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.3B *122503747-0022*	Interior Log Mortar	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.4A *122503747-0023*	Black Felt	Black Fibrous Homogeneous	80% Cellulose	20% Non-fibrous (Other)	None Detected
M20.4B *122503747-0024*	Black Felt	Black Fibrous Homogeneous	80% Cellulose	20% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 20:07:39

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503747
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Analyst(s)
Cara Blount (15)
Emma Campbell (15)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 20:07:39

OrderID: 122503747

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503747

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-523[illegible] / Lazy F Ranch Moose, WY End Cabin
Purchase Order:
EMSL LIMS Project ID: (If applicable, EMSL will provide)
US State where samples collected: WY
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name: Grant Minkoff
Sampled By Signature: [signature]
Date Sampled: 5-20-25
No. of Samples in Shipment: 24

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

- ☒ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)
- ☐ POINT COUNT
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ POINT COUNT w/ GRAVIMETRIC
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ NIOSH 9002 (<1%)
- ☐ NYS 198.1 (Friable - NY)
- ☐ NYS 198.6 NOB (Non-Friable - NY)
- ☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (Non-Friable - NY)
- ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
F1.1A		Bathroom	White Vinyl Sheet Flooring + Mastic
B		↓	↓
M1.1A		Roof	Green Roof Felt
B		↓	↓
M1.2A		↓	Black Penetration Sealant
B		↓	↓
M1.3A		↓	Roof Rubber
B		↓	↓
M8.1A		Exterior	White Window Glazing
B		↓	↓

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment: Fed Ex
Sample Condition Upon Receipt:

Relinquished by: Grant Minkoff	Date/Time: 5-23-25 16:30	Received by: Erica Fuphy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

OrderID: 122503747

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

122503747

EMSL Analytical, Inc.
Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
M8.2A		Living Room	Ceiling Caulk
B		〃	〃
M13.1A		Bathroom	White Ceramic Wall Tile + Grout
B		〃	〃
M14.1A		Exterior	Concrete
B		〃	〃
M20.1A		Exterior	Log Mortar
B		〃	〃
M20.2A		Living Room	Transite Panel
B		〃	〃
M20.3A		Living Room	Interior Log Mortar
B		〃	〃
M20.4A		Living Room Ceiling	Black Felt
B		〃	〃

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: Erica Fyphy	Date/Time: 5/27/25 9:55
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 09/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order: 122503741
Customer ID: NIHI62
Customer PO:
Project ID:

Attention: Chris Hust
Northern Industrial Hygiene, Inc.
201 South 30th Street
Billings, MT 59101

Phone: (406) 245-7766
Fax: (406) 254-1428
Received Date: 05/27/2025 9:55 AM
Analysis Date: 05/28/2025 - 05/29/2025
Collected Date: 05/20/2025

Project: 999-5237 / Lazy F Ranch - George's Cabin

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
F1.1A-VSF/ Mastic *122503741-0001* *Materials are inseparable.*	White VSF - Square & Octagon Pattern	Various Fibrous Heterogeneous	5% Cellulose	80% Non-fibrous (Other)	**15% Chrysotile**
F1.1B-VSF/ Mastic *122503741-0002* *Materials are inseparable.*	White VSF - Square & Octagon Pattern				**Positive Stop (Not Analyzed)**
F1.2A-VSF/ Mastic *122503741-0003* *Materials are inseparable.*	Square & Rectangle VSF	Various Fibrous Heterogeneous	3% Cellulose	82% Non-fibrous (Other)	**15% Chrysotile**
F1.2B-VSF/ Mastic *122503741-0004* *Materials are inseparable.*	Square & Rectangle VSF				**Positive Stop (Not Analyzed)**
M1.1A-Shingle *122503741-0005*	Green Roof Felt	Various Fibrous Heterogeneous	10% Synthetic 2% Glass	88% Non-fibrous (Other)	None Detected
M1.1A-Tar *122503741-0005A*	Green Roof Felt	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M1.1B-Shingle *122503741-0006*	Green Roof Felt	Various Fibrous Heterogeneous	10% Synthetic 2% Glass	88% Non-fibrous (Other)	None Detected
M1.1B-Tar *122503741-0006A*	Green Roof Felt	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M1.2A *122503741-0007*	Black Tar Sealant	Black Fibrous Homogeneous		85% Non-fibrous (Other)	**15% Chrysotile**
M1.2B *122503741-0008*	Black Tar Sealant				**Positive Stop (Not Analyzed)**
M8.1A *122503741-0009*	White Sink Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.1B *122503741-0010*	White Sink Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.2A *122503741-0011*	Exterior Window Caulk	Brown Fibrous Homogeneous		97% Non-fibrous (Other)	**3% Chrysotile**
M8.2B *122503741-0012*	Exterior Window Caulk				**Positive Stop (Not Analyzed)**
M14.1A *122503741-0013*	Concrete Foundation	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 19:29:39

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017

Tel/Fax: (602) 276-4344 / (602) 276-4053

http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503741
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M14.1B *122503741-0014*	Concrete Foundation	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	**<1% Chrysotile**
Result includes a small amount of inseparable attached material.					
M20.1A *122503741-0015*	Log Mortar	Gray Fibrous Homogeneous	<1% Hair	100% Non-fibrous (Other)	**<1% Chrysotile**
M20.1B *122503741-0016*	Log Mortar	Gray Fibrous Homogeneous	<1% Hair	100% Non-fibrous (Other)	**<1% Chrysotile**
M20.2A *122503741-0017*	Interior Log Mortar	Brown Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.2B *122503741-0018*	Interior Log Mortar	Brown Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Analyst(s)

Cara Blount (10)

Nezzarae Choate (6)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 19:29:39

OrderID: 122503748

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503748

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-5237 / Lazy F Ranch - Middle Cabin
Purchase Order:
EMSL LIMS Project ID: (If applicable, EMSL will provide)
US State where samples collected: WY
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name: Chris Hust
Sampled By Signature: Christopher Hust
Date Sampled: 5-20-25
No. of Samples in Shipment: 26

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

- ☒ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)
- ☐ POINT COUNT
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ POINT COUNT w/ GRAVIMETRIC
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ NIOSH 9002 (<1%)
- ☐ NYS 198.1 (Friable - NY)
- ☐ NYS 198.6 NOB (Non-Friable - NY)
- ☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (Non-Friable - NY)
- ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
F1.1A		Bathroom	Blue VSF
B		〃	〃
M1.1A		Roof	Green Roof Felt
B		〃	〃
M1.2A		Roof	Gray Sealant
B		〃	〃
M8.1A		Exterior	White Window Glazing
B		〃	〃
M8.2A		Bathroom	Tub Caulk
B			〃

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: Christopher Hust	Date/Time: 5-22-25 5pm	Received by: Erica Fuqua	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ **AGREE TO ELECTRONIC SIGNATURE** (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

122503748

EMSL Analytical, Inc.
Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
M8.3 A		Bedroom 1	Yellow Wall Caulk
B		〃	〃
M13.1A		Bathroom	White Ceramic Wall Tile
B		〃	〃
M14.1A		Exterior	Concrete
B		〃	〃
M20.1 A		Exterior	Log Mortar
B		〃	〃
M20.2A		Bedroom 1	white Ceiling Panel
B		Bedroom 2	〃
M20.3 A		Bedroom 1	Black Felt
B		Bedroom 2	〃
M20.4A		Bedroom 1	Transite Panel
B		〃	〃
M20.5A		Bedroom 1	Interior Log Mortar
B		〃	〃

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: Erica Fuqua	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 09/14/2021

☐ **AGREE TO ELECTRONIC SIGNATURE** (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503738
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention:	Chris Hust	**Phone:**	(406) 245-7766
	Northern Industrial Hygiene, Inc.	**Fax:**	(406) 254-1428
	201 South 30th Street	**Received Date:**	05/27/2025 9:55 AM
	Billings, MT 59101	**Analysis Date:**	05/28/2025
		Collected Date:	05/20/2025
Project:	999-5237 / Lazy F Ranch - Mouse House		

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M1.1A *122503738-0001*	Green Felt Roof	Black/Green Fibrous Heterogeneous	45% Cellulose 5% Synthetic	50% Non-fibrous (Other)	None Detected
M1.1B *122503738-0002*	Green Felt Roof	Black/Green Fibrous Heterogeneous	45% Cellulose 5% Synthetic	50% Non-fibrous (Other)	None Detected
M8.1A *122503738-0003*	White Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.1B *122503738-0004*	White Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1A *122503738-0005*	CMU Foundation	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B *122503738-0006*	CMU Foundation	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Analyst(s)
Cara Blount (3)
Jose Madril (3)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 19:23:32

OrderID: 122503738

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503738

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-5237/Lazy F Ranch - Mouse House

Purchase Order:

EMSL LIMS Project ID: (If applicable, EMSL will provide)

US State where samples collected: WY

State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)

Sampled By Name: Chris Hust

Sampled By Signature: Christopher Hust

Date Sampled: 5-20-2025

No. of Samples in Shipment: 6

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

- ☒ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)
- ☐ POINT COUNT
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ POINT COUNT w/ GRAVIMETRIC
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ NIOSH 9002 (<1%)
- ☐ NYS 198.1 (Friable - NY)
- ☐ NYS 198.6 NOB (Non-Friable - NY)
- ☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (Non-Friable - NY)
- ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
M1.1A		Roof	Green Felt Roof
B		〃	〃
M8.1A		Interior	White Caulk
B		〃	〃
M14.1A		Exterior	CMU Foundation
B		〃	〃

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: Christopher Hust	Date/Time: 5-22-25 5pm	Received by: Erica Fuglsby	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017

Tel/Fax: (602) 276-4344 / (602) 276-4053

http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503750
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention: Chris Hust
Northern Industrial Hygiene, Inc.
201 South 30th Street
Billings, MT 59101

Project: 999-5237 / Lazy F Ranch - Mrs. Olivers Cabin

Phone:	(406) 245-7766
Fax:	(406) 254-1428
Received Date:	05/27/2025 9:55 AM
Analysis Date:	05/29/2025 - 06/03/2025
Collected Date:	05/20/2025

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
F1.1A-VSF/ Mastic 1 *122503750-0001* *Materials are inseparable.*	Beige VSF Under F3.1	Various Fibrous Heterogeneous	40% Cellulose	60% Non-fibrous (Other)	**<1% Chrysotile**
F1.1A-Mastic 2 *122503750-0001A* *Mastics are inseparable.*	Beige VSF Under F3.1	Brown/Red Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
F1.1B-VSF/ Mastic *122503750-0002* *Materials are inseparable.*	Beige VSF Under F3.1	Various Fibrous Heterogeneous	40% Cellulose	60% Non-fibrous (Other)	None Detected
F3.1A-Floor Tile *122503750-0003*	Green 9" x 9" Floor Tile	Green Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
F3.1B-Floor Tile *122503750-0004*	Green 9" x 9" Floor Tile	Green Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
F3.1B-Mastic *122503750-0004A*	Green 9" x 9" Floor Tile	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M1.1A *122503750-0005*	Green Roof Felt	Various Fibrous Heterogeneous	10% Synthetic	90% Non-fibrous (Other)	None Detected
M1.1B *122503750-0006*	Green Roof Felt	Various Fibrous Heterogeneous	10% Synthetic	90% Non-fibrous (Other)	None Detected
M1.2A *122503750-0007*	Gray Sealant	Black Fibrous Homogeneous		92% Non-fibrous (Other)	**8% Chrysotile**
M1.2B *122503750-0008*	Gray Sealant				**Positive Stop (Not Analyzed)**
M8.1A *122503750-0009*	White Window Glazing	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	**<1% Chrysotile**
M8.1B *122503750-0010*	White Window Glazing	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	**<1% Chrysotile**
M8.2A *122503750-0011*	Black Ceiling Sealant	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.2B *122503750-0012*	Black Ceiling Sealant	Black Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.3A *122503750-0013*	Yellow Wall Caulk	White/Yellow Non-Fibrous Homogeneous	2% Wollastonite 2% Fibrous (Other)	96% Non-fibrous (Other)	**<1% Anthophyllite**

Initial report from: 06/03/2025 11:18:04

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503750
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M8.3B *122503750-0014*	Yellow Wall Caulk	White/Yellow Non-Fibrous Homogeneous	2% Wollastonite 2% Fibrous (Other)	96% Non-fibrous (Other)	**<1% Anthophyllite**
M8.4A *122503750-0015*	White Ceiling Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.4B *122503750-0016*	White Ceiling Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Ceramic Tile *122503750-0017*	White Ceramic Wall Tile	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Grout *122503750-0017A*	White Ceramic Wall Tile	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Mastic *122503750-0017B* *Mastics are inseparable.*	White Ceramic Wall Tile	Brown/Yellow Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Ceramic Tile *122503750-0018*	White Ceramic Wall Tile	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Grout *122503750-0018A*	White Ceramic Wall Tile	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Mastic *122503750-0018B* *Materials are inseparable.*	White Ceramic Wall Tile	Brown/Yellow Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M14.1A *122503750-0019*	Concrete	Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B *122503750-0020*	Concrete	Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1A *122503750-0021*	Log Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1B *122503750-0022*	Log Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.2A *122503750-0023*	White Ceiling Panel	Various Fibrous Heterogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
M20.2B *122503750-0024*	White Ceiling Panel	Various Fibrous Heterogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
M20.3A *122503750-0025*	Transite Panel	Various Fibrous Heterogeneous		80% Non-fibrous (Other)	**20% Chrysotile**
M20.3B *122503750-0026*	Transite Panel				**Positive Stop (Not Analyzed)**
M20.4A-Tar/ Felt 1 *122503750-0027* *Materials are inseparable.*	Black Felt	Various Fibrous Heterogeneous	20% Cellulose	77% Non-fibrous (Other)	**3% Chrysotile**

Initial report from: 06/03/2025 11:18:04

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503750
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M20.4A-Felt 2 *122503750-0027A*	Black Felt	Black Fibrous Homogeneous	10% Glass	90% Non-fibrous (Other)	None Detected
M20.4B-Tar/ Felt 1 *122503750-0028* *Materials are inseparable.*	Black Felt				**Positive Stop (Not Analyzed)**
M20.4B-Felt 2 *122503750-0028A*	Black Felt	Black Fibrous Homogeneous	10% Glass	90% Non-fibrous (Other)	None Detected

Analyst(s)
Caleigh Border (18)
Erica Furphy (1)
Nezzarae Choate (14)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/03/2025 11:18:04

OrderID: 122503750

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503750

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-5237/Lazy F Ranch - Mrs. Olivers Cabin
Purchase Order:
EMSL LIMS Project ID: (If applicable, EMSL will provide)
US State where samples collected: WY
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name: Chris Hust
Sampled By Signature: Christy Hust
Date Sampled: 5-20-25
No. of Samples in Shipment: 28

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

- ☒ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)
- ☐ POINT COUNT
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ POINT COUNT w/ GRAVIMETRIC
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ NIOSH 9002 (<1%)
- ☐ NYS 198.1 (Friable - NY)
- ☐ NYS 198.6 NOB (Non-Friable - NY)
- ☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (Non-Friable - NY)
- ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
F1.1A		Bathroom	Beige VSF under F3.1
B		〃	〃
F3.1A		Bathroom	Green 9"X9" Floor Tile
B		〃	〃
M1.1A		Roof	Green Roof felt
B			〃
M1.2A		Roof	Grey Sealant
B		〃	〃
IW8.1A		Exterior	White window Glazing
B		〃	〃

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by: Christy Hust	Date/Time: 5-22-25 5pm	Received by: Erica Furphy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ **AGREE TO ELECTRONIC SIGNATURE** (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

122503750

EMSL Analytical, Inc.
Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
M8.2A		Bathroom	Black Ceiling Sealant
B		〃	〃
M8.3A		Bedroom 1	Yellow wall Caulk
B		〃	〃
M8.4A		Bedroom 2	white Ceiling Caulk
B		〃	〃
M13.1A		Bathroom	white Ceramic wall Tile
B		〃	〃
M14.1A		Exterior	Concrete
B		〃	〃
M20.1A		Exterior	Log Mortar
B		〃	〃
M20.2A		Bedroom 1	white Ceiling Panel
B		Bedroom 2	〃
M20.3A		Bedroom 2	Transite Panel
B		〃	〃
M20.4A		Bedroom 2	Black Felt
B		〃	〃

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time: 5-22-25	Received by: Erica Fundy	Date/Time: 5/23/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 09/14/2021

☐ I AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503749
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention:	Chris Hust	**Phone:**	(406) 245-7766
	Northern Industrial Hygiene, Inc.	**Fax:**	(406) 254-1428
	201 South 30th Street	**Received Date:**	05/27/2025 9:55 AM
	Billings, MT 59101	**Analysis Date:**	05/29/2025 - 05/30/2025
		Collected Date:	05/21/2025

Project: 999-5237 / Lazy F Ranch - Moose, WY New Cabin

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M1.1A *122503749-0001*	Green Roof Felt	Black/Green Fibrous Heterogeneous	50% Cellulose	50% Non-fibrous (Other)	None Detected
M1.1B *122503749-0002*	Green Roof Felt	Black/Green Fibrous Heterogeneous	50% Cellulose	50% Non-fibrous (Other)	None Detected
M1.2A *122503749-0003*	Black Penetration Sealant	Black Fibrous Homogeneous		94% Non-fibrous (Other)	**6% Chrysotile**
M1.2B *122503749-0004*	Black Penetration Sealant				**Positive Stop (Not Analyzed)**
M1.3A-Tar/ Rubber *122503749-0005* *Materials are inseparable.*	Roof Tar / Rubber	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M1.3B-Tar/ Rubber *122503749-0006* *Materials are inseparable.*	Roof Tar / Rubber	Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M8.1A *122503749-0007*	White Window Glazing Compound	White/Green Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.1B *122503749-0008*	White Window Glazing Compound	White/Green Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.2A *122503749-0009*	Window Frame Caulk	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.2B *122503749-0010*	Window Frame Caulk	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.3A *122503749-0011*	Mortar Caulk	White/Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	**<1% Chrysotile**
M8.4B *122503749-0012*	Mortar Caulk	White/Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	**<1% Chrysotile**
M8.4A *122503749-0013*	White Shower Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M8.4B *122503749-0014*	White Shower Caulk	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Ceramic Tile *122503749-0015*	White Ceramic Wall Tile & Grout	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Grout *122503749-0015A*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 20:15:43

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017

Tel/Fax: (602) 276-4344 / (602) 276-4053

http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503749
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M13.1A-Mastic/ Leveler *122503749-0015B* *Materials are inseparable.*	White Ceramic Wall Tile & Grout	Gray/Yellow Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Ceramic Tile *122503749-0016*	White Ceramic Wall Tile & Grout	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Grout/ Mastic 1 *122503749-0016A* *Materials are inseparable.*	White Ceramic Wall Tile & Grout	White/Black Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Mastic 2 *122503749-0016B*	White Ceramic Wall Tile & Grout	Yellow Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1A-Concrete 1 *122503749-0017*	Concrete Foundation	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1A-Concrete 2 *122503749-0017A*	Concrete Foundation	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B-Coating *122503749-0018*	Concrete Foundation	Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B-Concrete *122503749-0018A*	Concrete Foundation	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.2A *122503749-0019*	Fireplace Pad Concrete	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.2B *122503749-0020*	Fireplace Pad Concrete	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M16.1A-Brick *122503749-0021*	Brick & Mortar	Orange Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M16.1A-Mortar *122503749-0021A*	Brick & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M16.1B-Brick *122503749-0022*	Brick & Mortar	Orange Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M16.1B-Mortar *122503749-0022A*	Brick & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1A-CMU *122503749-0023*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1A-Mortar *122503749-0023A*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1B-CMU *122503749-0024*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1B-Mortar *122503749-0024A*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1A *122503749-0025*	Log Mortar	Brown/Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 20:15:43

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503749
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M20.1B *122503749-0026*	Log Mortar	Brown/Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected

Analyst(s)
Cara Blount (17)
Caleigh Border (18)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 20:15:43

OrderID: 122503749

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503749

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-523[illegible] / Lazy F Ranch - Moose, WY New Cabin
Purchase Order:
EMSL LIMS Project ID: (If applicable, EMSL will provide)
US State where samples collected: WY
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name: Grant Minkoff
Sampled By Signature: [signature]
Date Sampled: 5-21-25
No. of Samples in Shipment: 26

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

☒ PLM EPA 600/R-93/116 (<1%)
☐ PLM EPA NOB (<1%)
☐ POINT COUNT
  ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
☐ POINT COUNT w/ GRAVIMETRIC
  ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
☐ NIOSH 9002 (<1%)
☐ NYS 198.1 (Friable - NY)
☐ NYS 198.6 NOB (Non-Friable - NY)
☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

☐ TEM EPA NOB
☐ NYS NOB 198.4 (Non-Friable - NY)
☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
M1.1A		Roof	Green Roof Felt
B			
M1.2A			Black Penetration Sealant
B			
M1.3A			Roof Tar/Rubber
B			
M8.1A		Exterior	White Window Glazing Compound
B			
M8.2A		Exterior	Window Frame Caulk
B			

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment: Fed Ex		Sample Condition Upon Receipt:	
Relinquished by: Grant Minkoff	Date/Time: 5-23-25 16:30	Received by: Erica Furphy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

122503749

EMSL Analytical, Inc.
Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
M8.3 A		Exterior	Mortar Caulk
B		"	"
M8.4 A		Bathroom	White Shower Caulk
B		"	"
M13.1A		Bathroom	White Ceramic Wall Tile + Grout
B		"	"
M14.1 A		Exterior	Concrete Foundation
B		"	"
M14.2 A		Living Room	Fireplace Pad Concrete
B		"	"
M16.1 A		Living Room	Brick + Mortar
B		"	"
M17.1A		Exterior	CMU Block + Mortar
B		"	"
M20.1A		Exterior	Log Mortar
B		"	"

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: Erica Furphy	Date/Time: 5/27/25 9:55
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 09/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503781
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention:	Chris Hust	**Phone:**	(406) 245-7766
	Northern Industrial Hygiene, Inc.	**Fax:**	(406) 254-1428
	201 South 30th Street	**Received Date:**	05/27/2025 9:55 AM
	Billings, MT 59101	**Analysis Date:**	05/29/2025 - 05/30/2025
		Collected Date:	05/20/2025

Project: 999-5237 / Lazy F Ranch - Moose, WY Nurse's Cabin

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
F1.1A-VSF/ Mastic *122503781-0001* *Materials are inseparable.*	White Speckled VSF & Mastic	Various Fibrous Heterogeneous	2% Cellulose	78% Non-fibrous (Other)	**20% Chrysotile**
F1.1B-VSF/ Mastic *122503781-0002* *Materials are inseparable.*	White Speckled VSF & Mastic				**Positive Stop (Not Analyzed)**
M1.1A-Felt/ Tar *122503781-0003* *Materials are inseparable.*	Green Roof Felt	Various Fibrous Heterogeneous	20% Synthetic	80% Non-fibrous (Other)	None Detected
M1.1B-Felt/ Tar *122503781-0004* *Materials are inseparable.*	Green Roof Felt	Various Fibrous Heterogeneous	20% Synthetic	80% Non-fibrous (Other)	None Detected
M1.2A *122503781-0005*	Black Penetration Sealant	Black Fibrous Homogeneous		90% Non-fibrous (Other)	**10% Chrysotile**
M1.2B *122503781-0006*	Black Penetration Sealant				**Positive Stop (Not Analyzed)**
M3.1A-Tape *122503781-0007*	Gypsum Wallboard System	Beige Fibrous Homogeneous	99% Cellulose	1% Non-fibrous (Other)	None Detected
M3.1A-Joint Compound *122503781-0007A*	Gypsum Wallboard System	Beige Non-Fibrous Homogeneous		20% Ca Carbonate 80% Non-fibrous (Other)	**<1% Chrysotile**
M3.1A-Gypsum Wallboard *122503781-0007B*	Gypsum Wallboard System	Brown/White Fibrous Heterogeneous	10% Cellulose	85% Gypsum 5% Non-fibrous (Other)	None Detected
M3.1A-Composite *122503781-0007C* *This is a composite result of wallboard, jt. compound, and tape.*	Gypsum Wallboard System	Various Fibrous Heterogeneous	20% Cellulose	10% Ca Carbonate 65% Gypsum 5% Non-fibrous (Other)	**<1% Chrysotile**
M3.1B-Tape *122503781-0008*	Gypsum Wallboard System	Beige Fibrous Homogeneous	99% Cellulose	1% Non-fibrous (Other)	None Detected
M3.1B-Joint Compound *122503781-0008A*	Gypsum Wallboard System	Beige Non-Fibrous Homogeneous		20% Ca Carbonate 80% Non-fibrous (Other)	**<1% Chrysotile**
M3.1B-Gypsum Wallboard *122503781-0008B*	Gypsum Wallboard System	Brown/White Fibrous Heterogeneous	10% Cellulose	85% Gypsum 5% Non-fibrous (Other)	None Detected
M3.1B-Composite *122503781-0008C* *This is a composite result of wallboard, jt. compound, and tape.*	Gypsum Wallboard System	Various Fibrous Heterogeneous	20% Cellulose	10% Ca Carbonate 60% Gypsum 10% Non-fibrous (Other)	**<1% Chrysotile**

Initial report from: 06/02/2025 20:33:44

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order: 122503781
Customer ID: NIHI62
Customer PO:
Project ID:

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M3.1C-Tape *122503781-0009*	Gypsum Wallboard System	Beige Fibrous Homogeneous	99% Cellulose	1% Non-fibrous (Other)	None Detected
M3.1C-Joint Compound *122503781-0009A*	Gypsum Wallboard System	Beige Non-Fibrous Homogeneous		20% Ca Carbonate 80% Non-fibrous (Other)	**<1% Chrysotile**
M3.1C-Gypsum Wallboard *122503781-0009B*	Gypsum Wallboard System	Brown/White Fibrous Heterogeneous	10% Cellulose	85% Gypsum 5% Non-fibrous (Other)	None Detected
M3.1C-Composite *122503781-0009C* *This is a composite result of wallboard, jt. compound, and tape.*	Gypsum Wallboard System	Various Non-Fibrous Heterogeneous	20% Cellulose	10% Ca Carbonate 65% Gypsum 5% Non-fibrous (Other)	**<1% Chrysotile**
M12.1A-Cove Base *122503781-0010*	White 4" Vinyl Cove Base & Mastic	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M12.1A-Mastic *122503781-0010A*	White 4" Vinyl Cove Base & Mastic	Brown Non-Fibrous Homogeneous		100% Non-fibrous (Other)	**<1% Anthophyllite**
M12.1B-Cove Base *122503781-0011*	White 4" Vinyl Cove Base & Mastic	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M12.1B-Mastic *122503781-0011A*	White 4" Vinyl Cove Base & Mastic	Brown Non-Fibrous Homogeneous	2% Wollastonite	98% Non-fibrous (Other)	**<1% Anthophyllite**
M13.1A-Tile *122503781-0012*	Pink Wall Tile & Mastic	Pink Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Mastic *122503781-0012A*	Pink Wall Tile & Mastic	Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Tile *122503781-0013*	Pink Wall Tile & Mastic	Pink Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Mastic *122503781-0013A*	Pink Wall Tile & Mastic	Beige Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1A-Block *122503781-0014*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1A-Mortar *122503781-0014A*	CMU Block & Mortar	Tan Non-Fibrous Homogeneous		<1% Mica 100% Non-fibrous (Other)	None Detected
M17.1B-Block *122503781-0015*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1B-Mortar *122503781-0015A*	CMU Block & Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M19.1A *122503781-0016*	Fiberglass Attic Insulation	Pink Fibrous Homogeneous	99% Glass	1% Non-fibrous (Other)	None Detected
M19.1B *122503781-0017*	Fiberglass Attic Insulation	Pink Fibrous Homogeneous	99% Glass	1% Non-fibrous (Other)	None Detected
M19.1C *122503781-0018*	Fiberglass Attic Insulation	Pink Fibrous Homogeneous	99% Glass	1% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 20:33:44

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503781
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M20.1A *122503781-0019*	Log Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1B *122503781-0020*	Log Mortar	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.2A *122503781-0021*	White Ceiling Panels	Tan/White Fibrous Heterogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
M20.2B *122503781-0022*	White Ceiling Panels	Tan/White Fibrous Heterogeneous	95% Cellulose	5% Non-fibrous (Other)	None Detected
M20.3A-Adhesive 1 *122503781-0023*	Shower Panel Adhesive	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.3A-Adhesive 2 *122503781-0023A*	Shower Panel Adhesive	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.3B-Adhesive 1 *122503781-0024*	Shower Panel Adhesive	Tan Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.3B-Adhesive 2 *122503781-0024A*	Shower Panel Adhesive	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.4A *122503781-0025*	Transite Panel	Gray Fibrous Homogeneous	40% Cellulose	20% Non-fibrous (Other)	**40% Chrysotile**
M20.4B *122503781-0026*	Transite Panel				**Positive Stop (Not Analyzed)**
M20.5A *122503781-0027*	Black Felt	Black Fibrous Homogeneous	80% Cellulose	20% Non-fibrous (Other)	None Detected
M20.5B *122503781-0028*	Black Felt	Black Fibrous Homogeneous	80% Cellulose	20% Non-fibrous (Other)	None Detected

Analyst(s)
Emma Campbell (25)
Nezzarae Choate (17)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 20:33:44

OrderID: 122503781

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only: 122503781

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No:	999-5237 / Lazy F Ranch-Moose, WY Nurse's Cabin	Purchase Order:	
EMSL LIMS Project ID: (If applicable, EMSL will provide)		US State where samples collected:	WY
State of Connecticut (CT) must select project location:	☐ Commercial (Taxable) ☐ Residential (Non-Taxable)		
Sampled By Name:	Grant Minkoff	Sampled By Signature:	Grant Minkoff
Date Sampled:	5-20-25	No. of Samples in Shipment	28

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

- ☒ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)
- ☐ POINT COUNT
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ POINT COUNT w/ GRAVIMETRIC
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ NIOSH 9002 (<1%)
- ☐ NYS 198.1 (Friable - NY)
- ☐ NYS 198.6 NOB (Non-Friable - NY)
- ☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (Non-Friable - NY)
- ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
F1.1A		Bathroom	White Speckled VSF w Mastic
B		Room w/ 2 closets	"
M1.1A		Roof	Green Roof Felt
B		"	"
M1.2A		"	Black Penetration Sealant
B		"	"
M3.1A		Hallway	Gypsum Wallboard System
B		Bathroom Closet	"
C		Room w/ 2 closets	"
M12.1A		Bathroom	White 4" Vinyl Cove Base w Mastic

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment:	Fed Ex	Sample Condition Upon Receipt:	
Relinquished by:	Grant Minkoff	Date/Time: 5-23-25 16:30	Received by: Erica Fuglsby
Date/Time: 5/27/25 955			
Relinquished by:		Date/Time:	Received by:
Date/Time			

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

OrderID: 122503781

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

122503781

EMSL Analytical, Inc.
Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
M12.1B		Bathroom	White 4" Vinyl Cove Base + Mastic
M13.1A		"	Pink Wall Tile + Mastic
B		"	"
M17.1A		Exterior	CMU Block + Mortar
B		"	"
M19.1A		Attic	Fiberglass Attic Insulation
B		"	"
C		"	"
M20.1A		Exterior	Log Mortar
B		"	"
M20.2A		S. Room	White Ceiling Panels
B		"	"
M20.3A		Bathroom	Shower Panel Adhesive
B		"	"
M20.4A		Living Room	Transite Panel
B		"	"
M20.5A		N Room	Black Felt
B		"	"

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: Erica Furphy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 09/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503745
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Attention:	Chris Hust	**Phone:**	(406) 245-7766
	Northern Industrial Hygiene, Inc.	**Fax:**	(406) 254-1428
	201 South 30th Street	**Received Date:**	05/27/2025 9:55 AM
	Billings, MT 59101	**Analysis Date:**	05/28/2025 - 05/29/2025
		Collected Date:	05/20/2025

Project: 999-5237 / Lazy F Ranch - Moose, WY River Cabin

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
F1.1A-VSF/ Mastic *122503745-0001* *Materials are inseparable.*	White W/ Blue Streaks VSF & Mastic	Various Fibrous Heterogeneous	30% Cellulose	70% Non-fibrous (Other)	None Detected
F1.1B-VSF/ Mastic *122503745-0002* *Materials are inseparable.*	White W/ Blue Streaks VSF & Mastic	Black/Beige Fibrous Heterogeneous	30% Cellulose	70% Non-fibrous (Other)	None Detected
M1.1A *122503745-0003*	Green Roof Felt	Black/Green Fibrous Heterogeneous	50% Cellulose	50% Non-fibrous (Other)	None Detected
M1.1B *122503745-0004*	Green Roof Felt	Black/Green Fibrous Heterogeneous	50% Cellulose	50% Non-fibrous (Other)	None Detected
M3.1A-Tape *122503745-0005*	Gypsum Wallboard System	Beige Fibrous Homogeneous	99% Cellulose	1% Non-fibrous (Other)	None Detected
M3.1A-Joint Compound *122503745-0005A*	Gypsum Wallboard System	White Non-Fibrous Homogeneous		20% Ca Carbonate 80% Non-fibrous (Other)	**<1% Chrysotile**
M3.1A-Gypsum Wallboard *122503745-0005B*	Gypsum Wallboard System	Brown/White Fibrous Heterogeneous	10% Cellulose	85% Gypsum 5% Non-fibrous (Other)	None Detected
M3.1A-Composite *122503745-0005C* *This is a composite result of wallboard, jt. compound, and tape.*	Gypsum Wallboard System	Various Fibrous Heterogeneous	20% Cellulose	5% Ca Carbonate 65% Gypsum 10% Non-fibrous (Other)	**<1% Chrysotile**
M3.1B-Tape *122503745-0006*	Gypsum Wallboard System	Beige Fibrous Homogeneous	99% Cellulose	1% Non-fibrous (Other)	None Detected
M3.1B-Joint Compound *122503745-0006A*	Gypsum Wallboard System	White Non-Fibrous Homogeneous		20% Ca Carbonate 80% Non-fibrous (Other)	**<1% Chrysotile**
M3.1B-Gypsum Wallboard *122503745-0006B*	Gypsum Wallboard System	Brown/White Fibrous Heterogeneous	10% Cellulose	85% Gypsum 5% Non-fibrous (Other)	None Detected
M3.1B-Composite *122503745-0006C* *This is a composite result of wallboard, jt. compound, and tape.*	Gypsum Wallboard System	Various Fibrous Heterogeneous	20% Cellulose	5% Ca Carbonate 65% Gypsum 10% Non-fibrous (Other)	**<1% Chrysotile**
M3.1C-Tape *122503745-0007*	Gypsum Wallboard System	Beige Fibrous Homogeneous	99% Cellulose	1% Non-fibrous (Other)	None Detected
M3.1C-Joint Compound *122503745-0007A*	Gypsum Wallboard System	White Non-Fibrous Homogeneous		20% Ca Carbonate 80% Non-fibrous (Other)	**<1% Chrysotile**

Initial report from: 06/02/2025 19:44:21

EMSL Analytical, Inc.

3356 West Catalina Drive Phoenix, AZ 85017

Tel/Fax: (602) 276-4344 / (602) 276-4053

http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503745
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M3.1C-Gypsum Wallboard *122503745-0007B*	Gypsum Wallboard System	Brown/White Fibrous Heterogeneous	10% Cellulose	85% Gypsum 5% Non-fibrous (Other)	None Detected
M3.1C-Composite *122503745-0007C* *This is a composite result of wallboard, jt. compound, and tape.*	Gypsum Wallboard System	Various Fibrous Heterogeneous	20% Cellulose	5% Ca Carbonate 65% Gypsum 10% Non-fibrous (Other)	**<1% Chrysotile**
M8.1A *122503745-0008*	Beam Caulk	Gray Fibrous Homogeneous		90% Non-fibrous (Other)	**10% Chrysotile**
M8.1B *122503745-0009*	Beam Caulk				**Positive Stop (Not Analyzed)**
M13.1A-Ceramic Tile *122503745-0010*	White Ceramic Wall Tile & Grout	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Grout *122503745-0010A*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1A-Mastic *122503745-0010B* *Mastics are inseparable.*	White Ceramic Wall Tile & Grout	Tan/Yellow Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Ceramic Tile *122503745-0011*	White Ceramic Wall Tile & Grout	White Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Grout *122503745-0011A*	White Ceramic Wall Tile & Grout	White Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M13.1B-Mastic *122503745-0011B* *Mastics are inseparable.*	White Ceramic Wall Tile & Grout	Tan/Yellow Non-Fibrous Heterogeneous		100% Non-fibrous (Other)	None Detected
M14.1A *122503745-0012*	Concrete	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M14.1B *122503745-0013*	Concrete	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1A *122503745-0014*	CMU Block	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M17.1B *122503745-0015*	CMU Block	Gray Non-Fibrous Homogeneous		100% Non-fibrous (Other)	None Detected
M20.1A *122503745-0016*	Transite Panel	Gray Fibrous Homogeneous	30% Cellulose	20% Non-fibrous (Other)	**50% Chrysotile**
M20.1B *122503745-0017*	Transite Panel				**Positive Stop (Not Analyzed)**
M20.2A *122503745-0018*	Black Felt Above Fireplace	Black Fibrous Homogeneous	80% Cellulose	20% Non-fibrous (Other)	None Detected
M20.2B *122503745-0019*	Black Felt Above Fireplace	Black Fibrous Homogeneous	80% Cellulose	20% Non-fibrous (Other)	None Detected

Initial report from: 06/02/2025 19:44:21

EMSL Analytical, Inc.
3356 West Catalina Drive Phoenix, AZ 85017
Tel/Fax: (602) 276-4344 / (602) 276-4053
http://www.EMSL.com / phoenixlab@emsl.com

EMSL Order:	122503745
Customer ID:	NIHI62
Customer PO:	
Project ID:	

Test Report: Asbestos Analysis of Bulk Materials via AHERA Method 40CFR 763 Subpart E Appendix E supplemented with EPA 600/R-93/116 using Polarized Light Microscopy

			Non-Asbestos		Asbestos
Sample	**Description**	**Appearance**	**% Fibrous**	**% Non-Fibrous**	**% Type**
M20.3A-Panel/ Adhesive *122503745-0020* *Materials are inseparable.*	Blue Wall Panel & Adhesive	Various Fibrous Heterogeneous	40% Cellulose 10% Synthetic	50% Non-fibrous (Other)	None Detected
M20.3B-Panel/ Adhesive *122503745-0021* *Materials are inseparable.*	Blue Wall Panel & Adhesive	Various Fibrous Heterogeneous	40% Cellulose 10% Synthetic	50% Non-fibrous (Other)	None Detected

Analyst(s)
Cara Blount (13)
Jose Madril (19)

Erica Furphy, Asbestos Supervisor
or Other Approved Signatory

EMSL maintains liability limited to cost of analysis. Interpretation and use of test results are the responsibility of the client. This report relates only to the samples reported above, and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. The report reflects the samples as received. Results are generated from the field sampling data (sampling volumes and areas, locations, etc.) provided by the client on the Chain of Custody. Samples are within quality control criteria and met method specifications unless otherwise noted. The above analyses were performed in general compliance with Appendix E to Subpart E of 40 CFR (previously EPA 600/M4-82-020 “Interim Method”) but augmented with procedures outlined in the 1993 (”final”) version of the method. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Estimation of uncertainty is available on request.

Samples analyzed by EMSL Analytical, Inc. Phoenix, AZ NVLAP Lab Code 200811-0, AZ0937, CO AL-19027, CA 2761, TX 300484, HI L-14-004, LA 05113

Initial report from: 06/02/2025 19:44:21

OrderID: 122503745

EMSL Analytical, Inc.

Asbestos Bulk Building Materials - Chain of Custody

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

EMSL Order Number / Lab Use Only: 122503745

Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Customer Information		Billing Information	
Customer ID:		Billing ID:	
Company Name:	Northern Industrial Hygiene, Inc.	Company Name:	Northern Industrial Hygiene, Inc.
Contact Name:	Chris Hust	Billing Contact:	Patty Dinardi
Street Address:	201 South 30th Street	Street Address:	201 South 30th Street
City, State, Zip:	Billings MT 59101	City, State, Zip:	Billings MT
Country:	US	Country:	US
Phone:	406-245-7766	Phone:	406-245-7766
Email(s) for Report:	chust@northernih.com	Email(s) for Invoice:	

Project Information

Project Name/No: 999-5237 / Lazy F Ranch - Moose, WY River Cabin
Purchase Order:
EMSL LIMS Project ID: (If applicable, EMSL will provide)
US State where samples collected: WY
State of Connecticut (CT) must select project location: ☐ Commercial (Taxable) ☐ Residential (Non-Taxable)
Sampled By Name: Grant Minkoff
Sampled By Signature:
Date Sampled: 5-20-25
No. of Samples in Shipment: 21

Turn-Around-Time (TAT)

☐ 3 Hour ☐ 6 Hour ☐ 24 Hour ☐ 32 Hour ☐ 48 Hour ☐ 72 Hour ☐ 96 Hour ☒ 1 Week ☐ 2 Week

Please call ahead for large projects and/or turnaround times 6 Hours or Less. *32 Hour TAT available for select tests only; samples must be submitted by 11:30am.

Test Selection

PLM - Bulk (reporting limit)

- ☒ PLM EPA 600/R-93/116 (<1%)
- ☐ PLM EPA NOB (<1%)
- ☐ POINT COUNT
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ POINT COUNT w/ GRAVIMETRIC
  - ☐ 400 (<0.25%) ☐ 1,000 (<0.1%)
- ☐ NIOSH 9002 (<1%)
- ☐ NYS 198.1 (Friable - NY)
- ☐ NYS 198.6 NOB (Non-Friable - NY)
- ☐ NYS 198.8 (Vermiculite SM-V)

TEM - Bulk

- ☐ TEM EPA NOB
- ☐ NYS NOB 198.4 (Non-Friable - NY)
- ☐ TEM EPA 600/R-93/116 w Milling Prep (0.1%)

Other Tests (please specify)

☒ Positive Stop - Clearly Identified Homogeneous Areas (HA)

Sample Number	HA Number	Sample Location	Material Description
F1.1A		Bathroom	white w/ Blue Streaks VSF + Mastic
B		"	"
M1.1A		Roof	Green Roof Felt
B		"	"
M3.1A		Bathroom	Gypsum Wallboard System
B		"	"
C		"	"
M8.1A		Living Room	Beam Caulk
B		"	"
M13.1A		Bathroom	White Ceramic Wall Tile + Grout

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Method of Shipment: Fed Ex		Sample Condition Upon Receipt:	
Relinquished by: Grant Minkoff	Date/Time: 5-23-25 16:30	Received by: Erica Fuglsy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 9/14/2021

☐ AGREE TO ELECTRONIC SIGNATURE (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

(14) efx: 7917 7464 5831

OrderID: 122503745

EMSL ANALYTICAL, INC.
LABORATORY • PRODUCTS • TRAINING

Asbestos Bulk Building Materials - Chain of Custody

EMSL Order Number / Lab Use Only

EMSL Analytical, Inc.
Phoenix, AZ 85017
PHONE: (602) 276-4344
EMAIL: phoenixlab@emsl.com

Additional Pages of the Chain of Custody are only necessary if needed for additional sample information

Special Instructions and/or Regulatory Requirements (Sample Specifications, Processing Methods, Limits of Detection, etc.)

Sample Number	HA Number	Sample Location	Material Description
M13.1 B		Bathroom	White ceramic wall tile + Grout
M14.1 A		Exterior	Concrete
B			
M17.1 A			CMU Block
B			
M20.1 A		Living Room	Transite Panel
B			
M20.2 A			Black Felt Above Fireplace
B			
M20.3 A		Bathroom	Blue Wall Panel + Adhesive
B			

Method of Shipment:		Sample Condition Upon Receipt:	
Relinquished by:	Date/Time:	Received by: Erica Furphy	Date/Time: 5/27/25 955
Relinquished by:	Date/Time:	Received by:	Date/Time

Controlled Document - Asbestos Bulk R7 09/14/2021

☐ **AGREE TO ELECTRONIC SIGNATURE** (By checking, I consent to signing this Chain of Custody document by electronic signature.)

EMSL Analytical, Inc.'s Laboratory Terms and Conditions are incorporated into this Chain of Custody by reference in their entirety. Submission of samples to EMSL Analytical, Inc. constitutes acceptance and acknowledgment of all terms and conditions by Customer.

CHRISTOPHER HUST

has met the requirements of Montana Administrative Rule 17.74.362 and/or 17.74.363 for accreditation in the following asbestos occupation(s) through the specified expiration date(s).

MTA-5681

Asbestos Inspector	02/07/2026
Project Contractor/Supervisor	02/21/2026

MT DEQ Asbestos Control Program

GRANT MINKOFF

has met the requirements of Montana Administrative Rule 17.74.362 and/or 17.74.363 for accreditation in the following asbestos occupation(s) through the specified expiration date(s).

MTA-6488

Asbestos Inspector	08/02/2025
Project Contractor/Supervisor	07/19/2025

MT DEQ Asbestos Control Program