


SHOP DRAWINGS — ELECTRICAL / AGL SCOPE

RECTIFICATION OF TWY E BETWEEN E4 & E6 (ADIA)
AGL WORKS AT THREE (3) MILLING LOCATIONS — FIELD CONDITION SCOPE

Document No.	[XXX-ELE-SHD-1001 / 1002 / 1003] · Revision P05 — PRINT / SUBMISSION ISSUE
Basis of scope	Field verification sheets: Document_3 (LOC-01) · Second_milling_area rev _1 (LOC-02/03)
Base layer	As-built AGL asset survey assets_20260726120533.xlsx — UTM 40N (EPSG:32640)
Sheets	1 of 4 Cover · 2 of 4 Location 1 · 3 of 4 Location 2 · 4 of 4 Location 3 · Annex A Scope Table
Prepared by	Mohammed — AGL Team Leader, ADB SAFEGATE AGL Team · Issued 28.07.2026

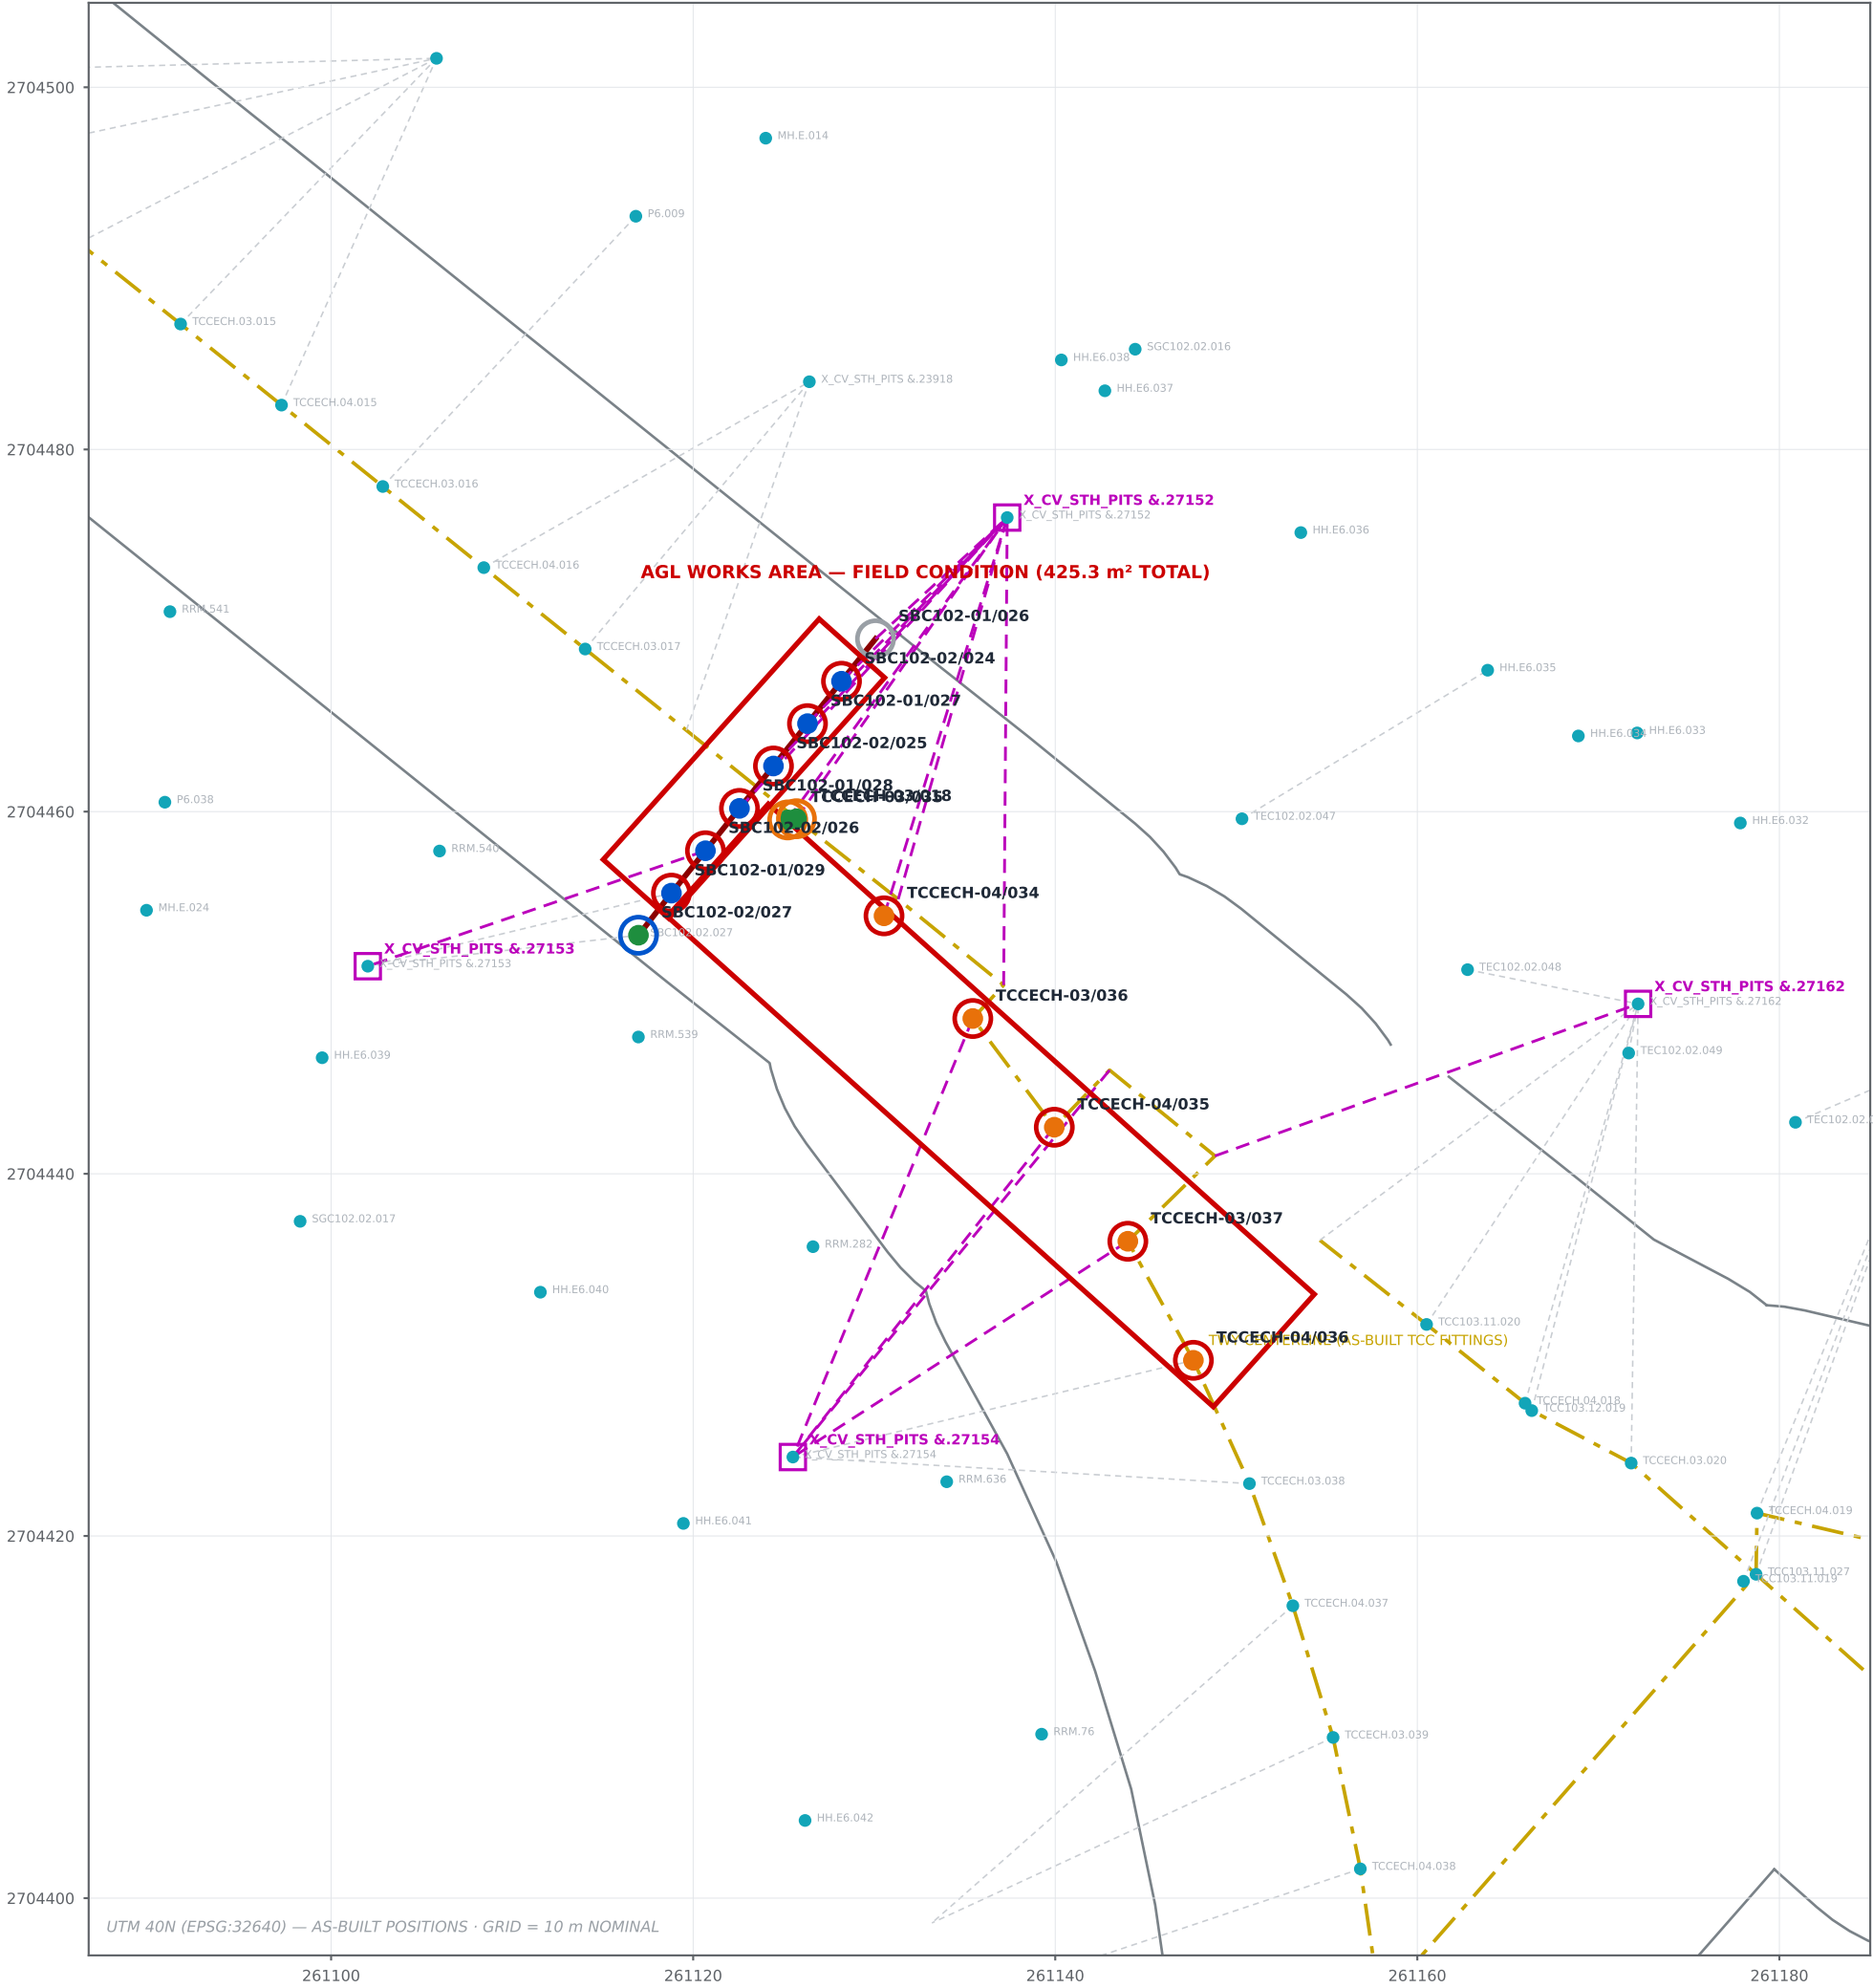

LOCATION 1 — 1001 · REV P05 (PRINT ISSUE)

SCOPE PER FIELD SHEET Document_3 — FIELD CONDITION GOVERNS

Scale 1:250 @ A1 equiv. · UTM 40N · Issued 28.07.2026 · Prepared: Mohammed, AGL Team Leader — ADB SAFEGATE

SCOPE / QUANTITIES (PER FIELD VERIFICATION)

CORE OUT SHALLOW BASE + NEW CABLE: 11 No.

VIA DUCT (6): SBC102-02/024, 01/027, 02/025, 01/028, 02/026, 01/029

VIA SAWCUT (5): TCCECH-04/034, 03/036, 04/035, 03/037, 04/036

NEW SECONDARY CABLE ONLY: 3 No.

SBC102-02/027 (DUCT) · TCCECH-03/035, 03/018 (SAWCUT — bases OK, verify at cut line)

FIELD VERIFIED NOT AFFECTED: SBC102-01/026 (no works)

TCC103 FITTINGS NOT IN FIELD SCOPE — SHOWN AS EXISTING ONLY

ISOLATE CIRCUITS: SBC102.01/.02, TCCECH.03/.04


SITE RECORD 23.07.2026: 9 cored + 2 reinstatement already worked

GENERAL NOTES

- All asset positions as-built (asset survey assets_20260726120533.xlsx, UTM 40N / EPSG:32640).
- AGL works area (red) per field condition — rectangular strips aligned to stop bar / centerline around field-verified affected assets.
Coring at Location 1 only.
- Secondary cables: no joints — full manhole-to-light replacement. Confirm routes vs AGL duct-layout CAD (Rev B) before works.
- Isolate, lock out & prove dead all listed circuits at CCR under permit before any cutting, coring or excavation.
- Reinstatement setting-out by civil survey from as-built E/N, checked against adjacent undisturbed fittings before coring.
- Taxiway centerline & stop bar alignments derived from as-built AGL fitting positions (TCC / SBC). Edge / pavement boundary indicative at 23 m width from as-built CL — confirm on site.

LEGEND — WORKS ACTIONS (THIS SHEET)

- CORE OUT + NEW CABLE (DUCT) — outer red / inner blue
- CORE OUT + NEW CABLE (SAWCUT) — outer red / inner orange
- NEW SEC. CABLE ONLY (DUCT) — outer blue / inner green
- NEW SEC. CABLE ONLY (SAWCUT) — outer orange / inner green
- FIELD VERIFIED — NOT AFFECTED (grey)
- EXISTING AGL ASSET (AS-BUILT)
- INDICATIVE DUCT — LIGHT TO NEAREST MH/HH
- SECONDARY DUCT RUN CROSSING CUT (INDICATIVE)
- AGL WORKS AREA — FIELD CONDITION (GOVERNING)
- AGL FEED MANHOLE / HANDHOLE
- TAXIWAY CENTERLINE (AS-BUILT, THROUGH TCC FITTINGS)
- STOP BAR (AS-BUILT, THROUGH SBC FITTINGS)

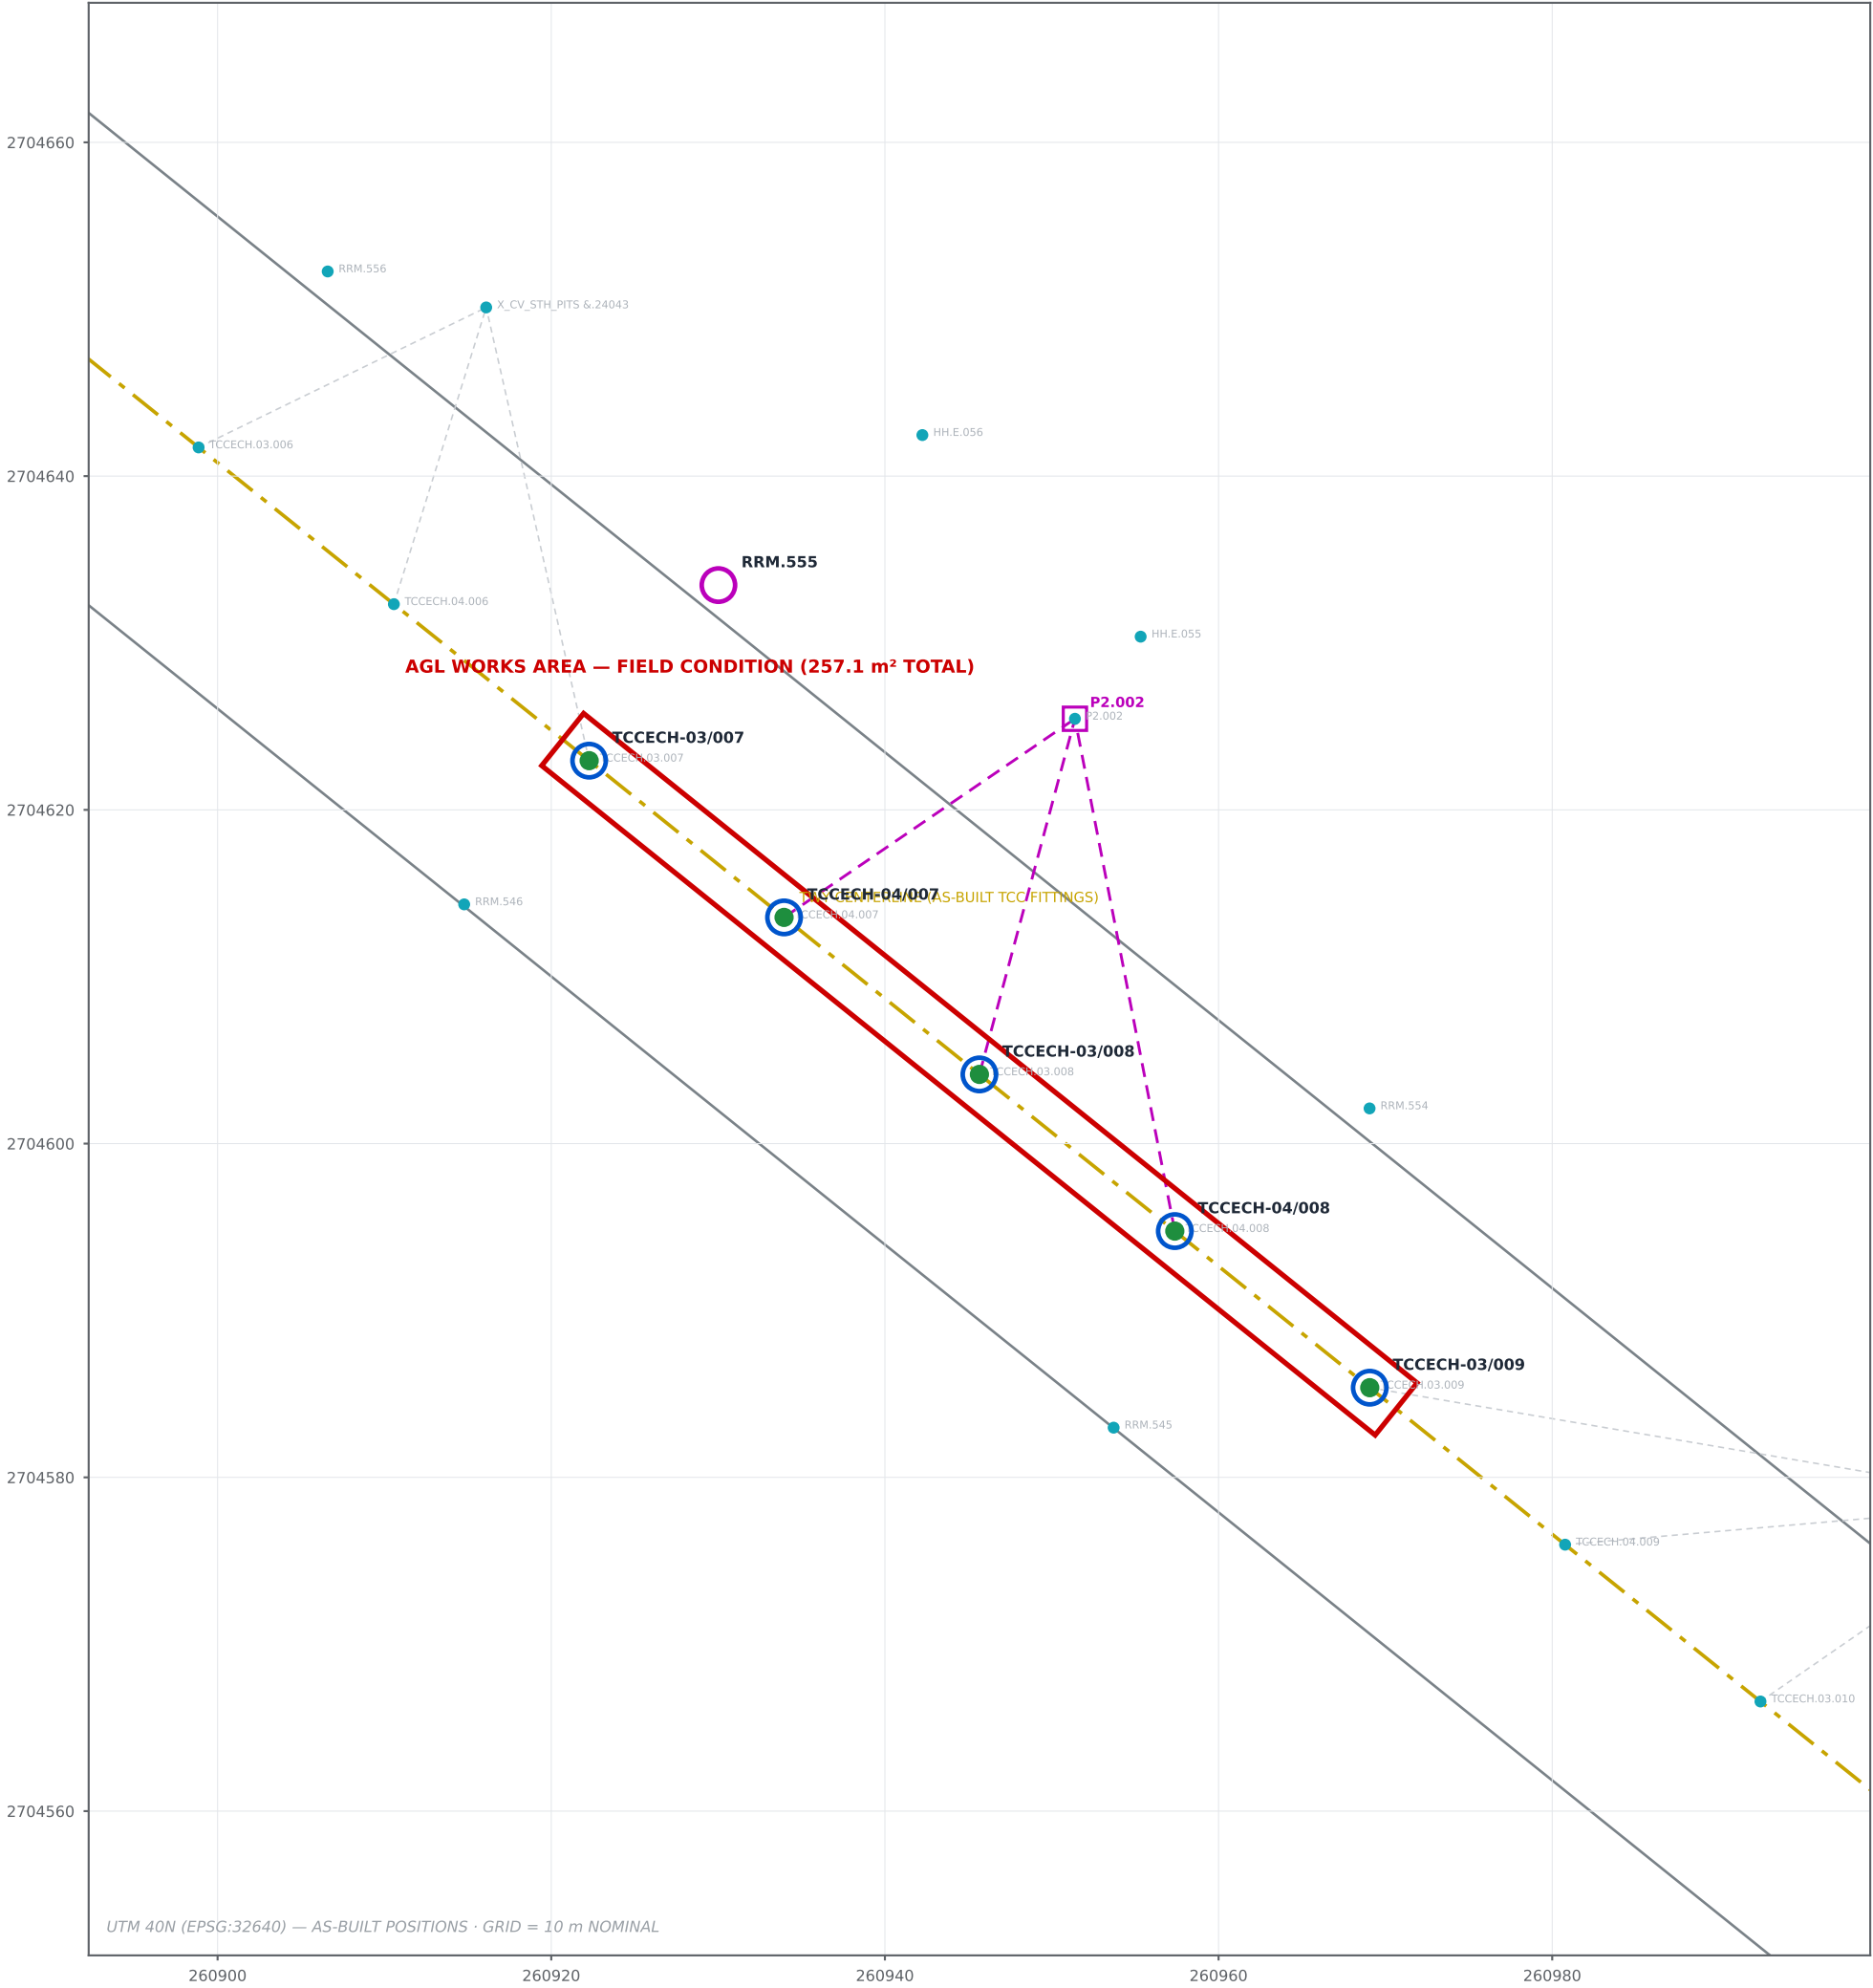

LOCATION 2 — 1002 · REV P05 (PRINT ISSUE)

SCOPE PER FIELD SHEET Second_milling_area rev_1 — FIELD CONDITION GOVERNS

Scale 1:250 @ A1 equiv. · UTM 40N · Issued 28.07.2026 · Prepared: Mohammed, AGL Team Leader — ADB SAFEGATE

SCOPE / QUANTITIES (PER FIELD VERIFICATION)

NEW SECONDARY CABLE ONLY (VIA DUCT): 5 No.

TCCECH-03/007, 04/007, 03/008, 04/008, 03/009

NO SHALLOW BASES AFFECTED AT THIS LOCATION

RRM.555 (0.41 m from cut): REMOVE / PROTECT BEFORE SAWCUT,

RE-FIX AFTER PAVING


ISOLATE CIRCUITS: TCCECH.03, TCCECH.04

GENERAL NOTES

- All asset positions as-built (asset survey assets_20260726120533.xlsx, UTM 40N / EPSG:32640).
- AGL works area (red) per field condition — rectangular strips aligned to stop bar / centerline around field-verified affected assets. Coring at Location 1 only.
- Secondary cables: no joints — full manhole-to-light replacement. Confirm routes vs AGL duct-layout CAD (Rev B) before works.
- Isolate, lock out & prove dead all listed circuits at CCR under permit before any cutting, coring or excavation.
- Reinstatement setting-out by civil survey from as-built E/N, checked against adjacent undisturbed fittings before coring.
- Taxiway centerline & stop bar alignments derived from as-built AGL fitting positions (TCC / SBC). Edge / pavement boundary indicative at 23 m width from as-built CL — confirm on site.

LEGEND — WORKS ACTIONS (THIS SHEET)

- NEW SEC. CABLE ONLY (DUCT) — outer blue / inner green
- RRM — REMOVE / PROTECT / RE-FIX (magenta / white)
- EXISTING AGL ASSET (AS-BUILT)
- INDICATIVE DUCT — LIGHT TO NEAREST MH/HH
- SECONDARY DUCT RUN CROSSING CUT (INDICATIVE)
- AGL WORKS AREA — FIELD CONDITION (GOVERNING)
- AGL FEED MANHOLE / HANDHOLE
- TAXIWAY CENTERLINE (AS-BUILT, THROUGH TCC FITTINGS)
- TWY EDGE / PAVEMENT BOUNDARY (INDICATIVE 23 m — CONFIRM ON SITE)

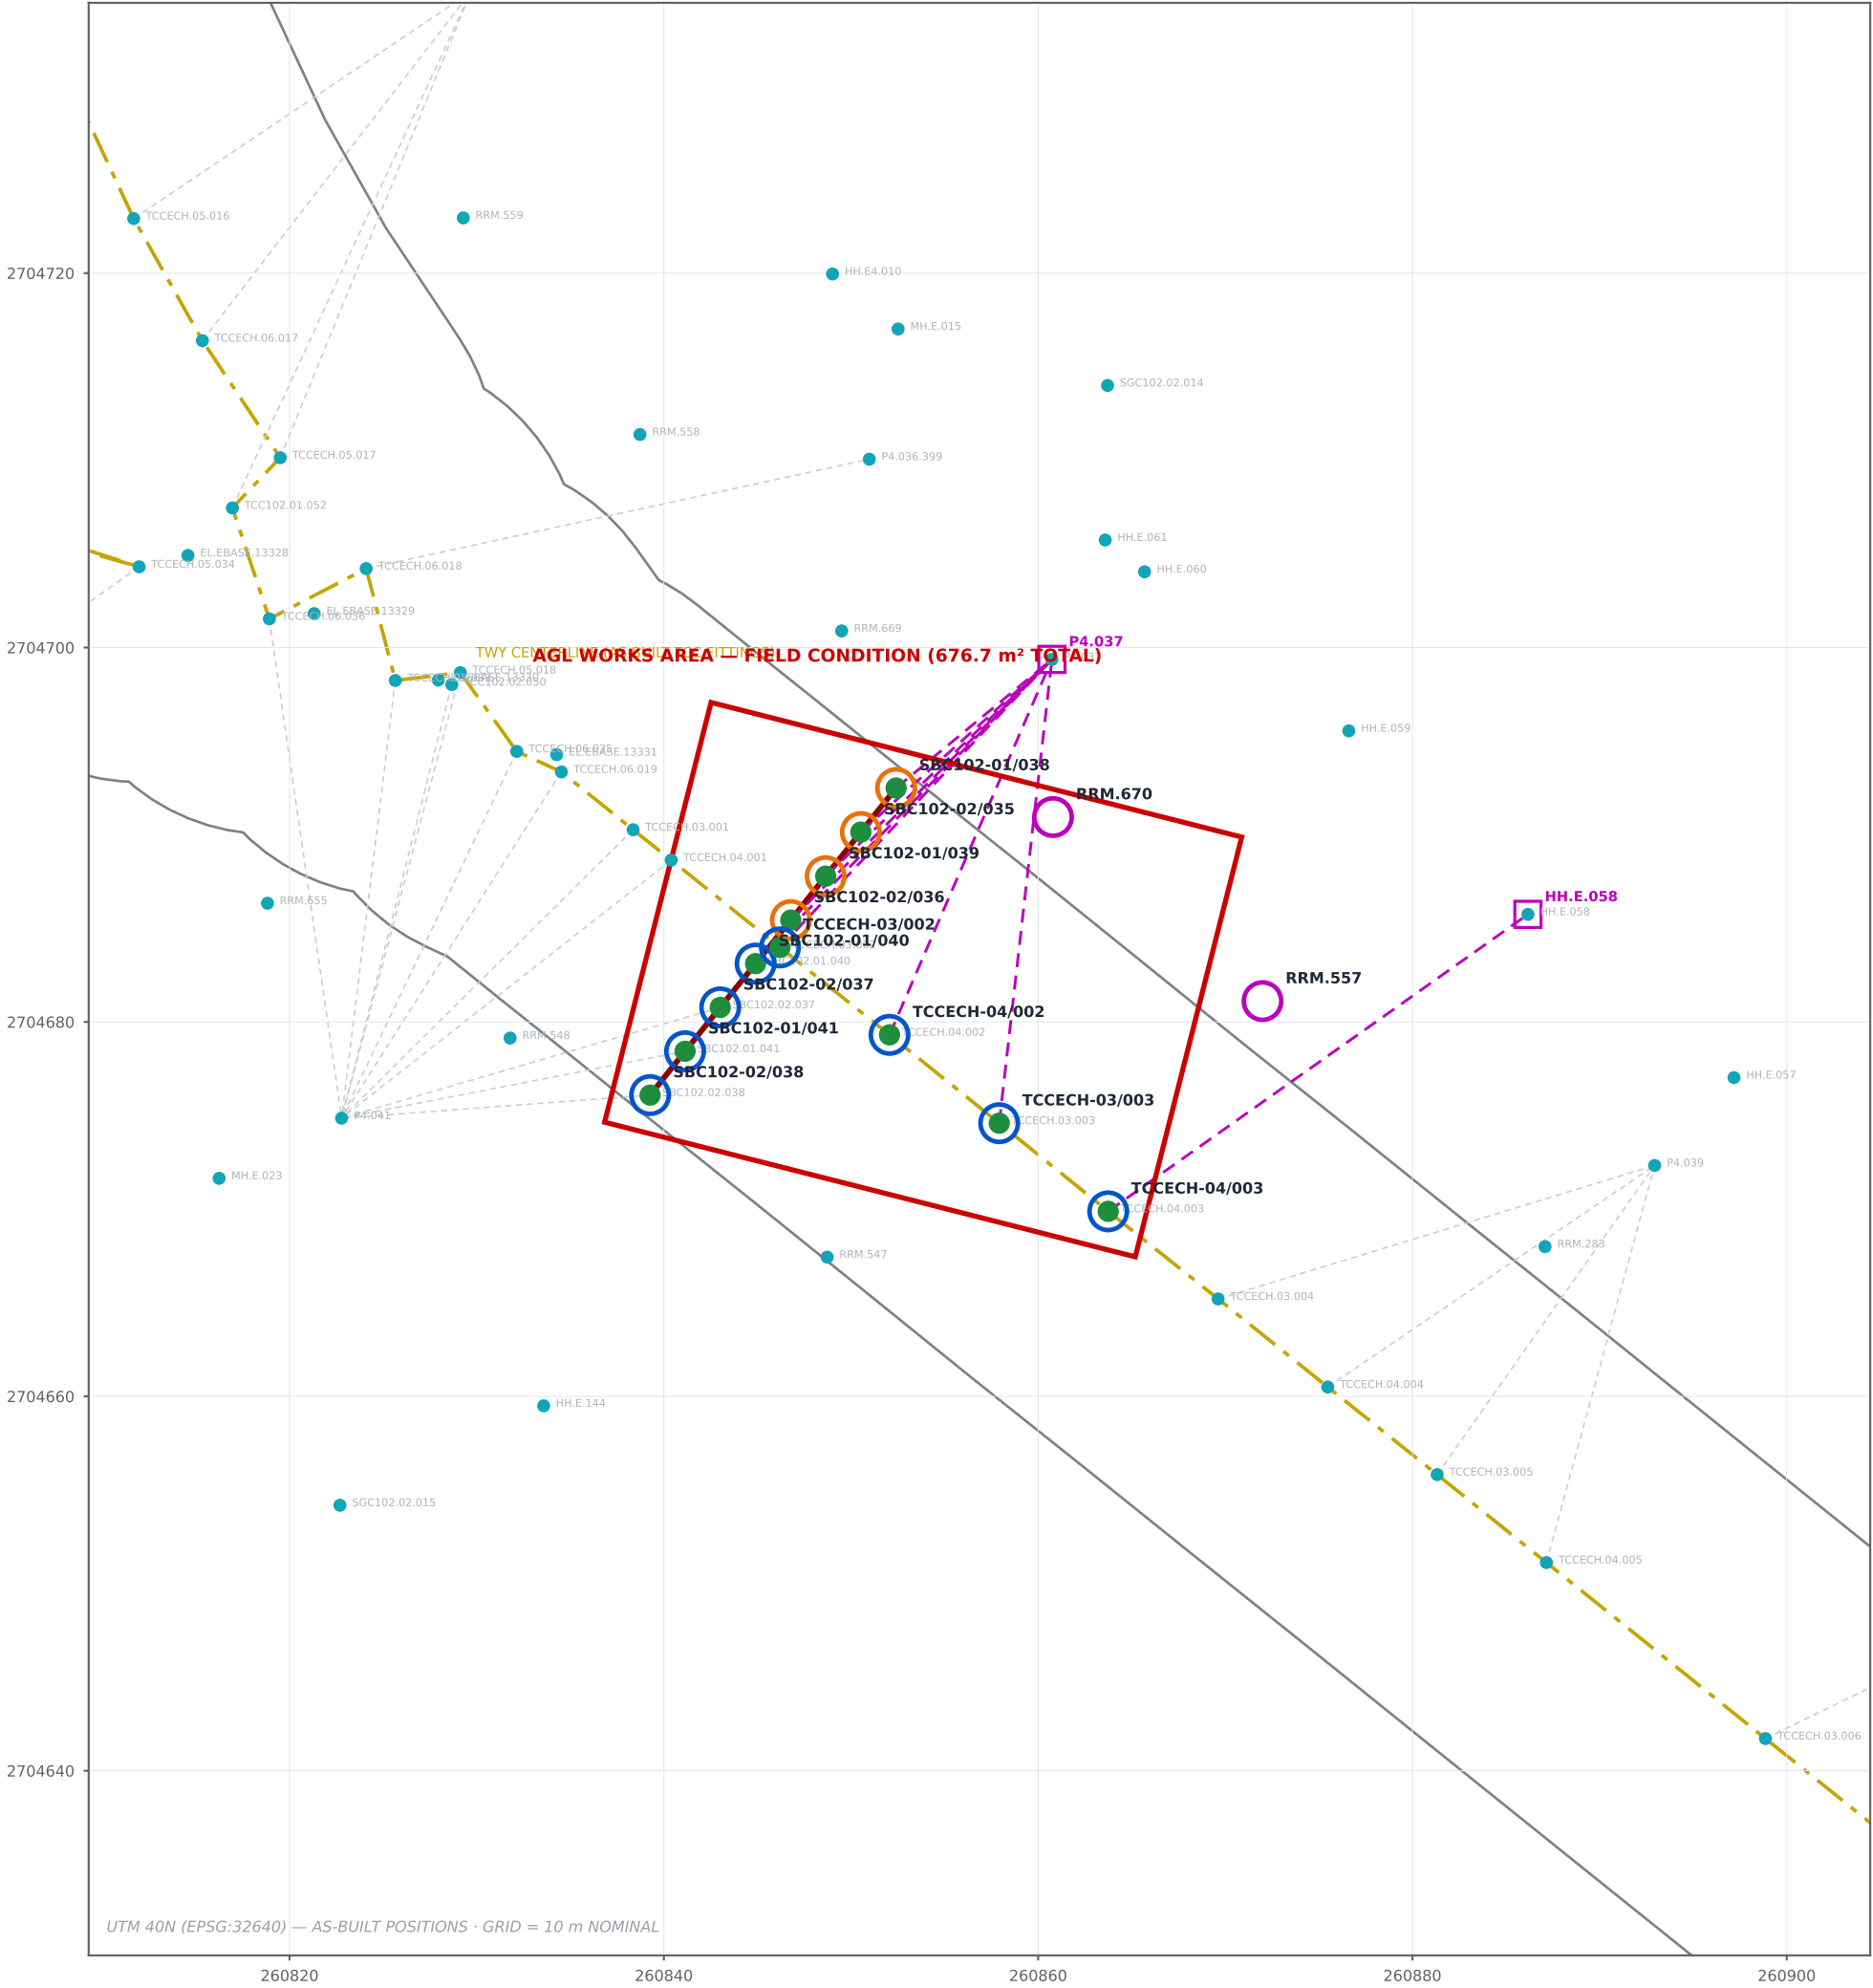

LOCATION 3 — 1003 · REV P05 (PRINT ISSUE)

SCOPE PER FIELD SHEET Second_milling_area rev_1 — FIELD CONDITION GOVERNS (supersedes earlier all-NO rev_1)

Scale 1:250 @ A1 equiv. · UTM 40N · Issued 28.07.2026 · Prepared: Mohammed, AGL Team Leader — ADB SAFEGATE

SCOPE / QUANTITIES (PER FIELD VERIFICATION)

NO CORING AT THIS LOCATION — SECONDARY CABLES ONLY (12 RUNS)

NEW CABLE VIA SAWCUT: 4 No. — SBC102-01/038, 01/039, 02/035, 02/036

(EP7 STOP BAR — bases flagged per field rev_1: remove fitting & protect base during works, NO coring)

NEW SECONDARY CABLE ONLY (VIA DUCT): 8 No.

SBC102-01/040, 01/041, 02/037, 02/038,
TCCECH-03/002, 04/002, 03/003, 04/003

RRM.557 (0.07 m — treat as within works) & RRM.670:

REMOVE / PROTECT / RE-FIX

ISOLATE CIRCUITS: SBC102.01/.02, TCCECH.03/.04

GENERAL NOTES

- All asset positions as-built (asset survey assets_20260726120533.xlsx, UTM 40N / EPSG:32640).
- AGL works area (red) per field condition — rectangular strips aligned to stop bar / centerline around field-verified affected assets.
Coring at Location 1 only.
- Secondary cables: no joints — full manhole-to-light replacement. Confirm routes vs AGL duct-layout CAD (Rev B) before works.
- Isolate, lock out & prove dead all listed circuits at CCR under permit before any cutting, coring or excavation.
- Reinstatement setting-out by civil survey from as-built E/N, checked against adjacent undisturbed fittings before coring.
- Taxiway centerline & stop bar alignments derived from as-built AGL fitting positions (TCC / SBC). Edge / pavement boundary indicative at 23 m width from as-built CL — confirm on site.

LEGEND — WORKS ACTIONS (THIS SHEET)

- NEW SEC. CABLE ONLY (SAWCUT) — outer orange / inner green
- NEW SEC. CABLE ONLY (DUCT) — outer blue / inner green
- RRM — REMOVE / PROTECT / RE-FIX (magenta / white)
- EXISTING AGL ASSET (AS-BUILT)
- INDICATIVE DUCT — LIGHT TO NEAREST MH/HH
- SECONDARY DUCT RUN CROSSING CUT (INDICATIVE)
- AGL WORKS AREA — FIELD CONDITION (GOVERNING)
- AGL FEED MANHOLE / HANDHOLE
- TAXIWAY CENTERLINE (AS-BUILT, THROUGH TCC FITTINGS)
- STOP BAR (AS-BUILT, THROUGH SBC FITTINGS)
- TWY EDGE / PAVEMENT BOUNDARY (INDICATIVE 23 m — CONFIRM ON SITE)

ANNEX A — CONSOLIDATED FIELD-GOVERNED SCOPE · TWY E (E4-E6) · REV P05

Loc	Asset	Works Action	Route	Remarks
LOC-01	SBC102-02/024	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-01/027	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-02/025	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-01/028	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-02/026	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-01/029	CORE OUT + NEW CABLE	Duct	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-04/034	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-03/036	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-04/035	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-03/037	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	TCCECH-04/036	CORE OUT + NEW CABLE	Sawcut	Core out shallow base + full manhole-to-light cable replacement
LOC-01	SBC102-02/027	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-01	TCCECH-03/035	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-01	TCCECH-03/018	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-01	SBC102-01/026	NOT AFFECTED	—	Field verified — no works
LOC-02	TCCECH-03/007	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-04/007	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-03/008	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-04/008	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	TCCECH-03/009	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-02	RRM.555	RRM REMOVE / PROTECT	—	Remove / protect before sawcut, re-fix after paving
LOC-03	SBC102-01/038	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-03	SBC102-01/039	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-03	SBC102-02/035	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-03	SBC102-02/036	NEW CABLE ONLY	Sawcut	Full manhole-to-light cable replacement
LOC-03	SBC102-01/040	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	SBC102-01/041	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	SBC102-02/037	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	SBC102-02/038	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-03/002	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-04/002	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-03/003	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	TCCECH-04/003	NEW CABLE ONLY	Duct	Full manhole-to-light cable replacement
LOC-03	RRM.557	RRM REMOVE / PROTECT	—	Remove / protect before sawcut, re-fix after paving
LOC-03	RRM.670	RRM REMOVE / PROTECT	—	Remove / protect before sawcut, re-fix after paving

Totals: 11 core-outs (Location 1 only — no coring at Locations 2/3) · 31 secondary cable runs · 3 RRM's · 1 field-verified not affected.