
## IP-15 Error code 34 (pg 1 of 2)


EC-34: Insufficient tests left XX

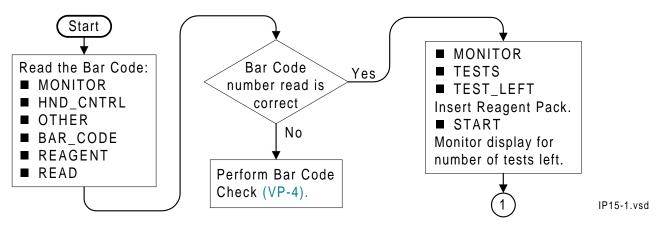

Troubleshooting LCx <sup>®</sup> Analyzer Service Manual (Text P/N 47278-10	or code 34	2 - 66
	1	

Chapter	Manual	CD Main	Index
Contents	Contents	Screen	

## IP-15 (pg 2 of 2)

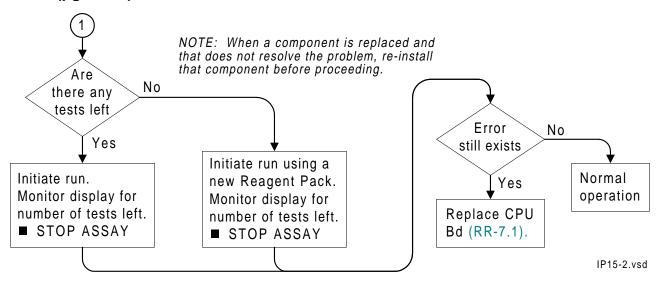

2 Troubleshooting IP-15: Error code 34 2 - 67 LCx® Analyzer Service Manual (Text P/N 47278-102)

Chapter Manual Contents Contents	CD Main Screen	Index
----------------------------------	-------------------	-------