VP-44: RS-232 COM PORT TEST (pg 1 of 1)




Time: 2-5 minutes

Purpose: To verify that Communication Port operates properly

- 1. Install Loopback Tool on COM 1 port (closest to Power Cord) (Figure VP44). NOTE: If Loopback Tool is not available, short pins 2 & 3, 4 & 5, 6 & 20.
- 2. Perform UART Test:
 - UTILITY
 - OTHER
 - OTHER
 - SERVICE
 - OTHER
 - UART

- UART DIAGNOSTICS test runs.
 - 4. Remove Loopback Connector or shorts.
 - 5. Repeat procedure for COM 2 port.
 - 6. Return to READY menu:
 - EXIT
 - EXIT
 - EXIT

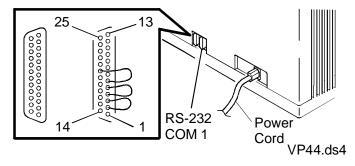

Verification Procedures
LCx[®] Analyzer Service Manual (Text P/N 47278-102)

Chapter Contents	Manual Contents	CD Main Screen	Index

VP-44: RS-232 COM Port Test

5 - 84