
IP-4 Assay results incorrect/Controls out of range (pg 1 of 5)



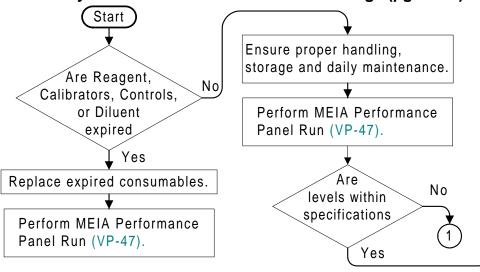


Contact CSC with results. Problem may be related to Dry Bath or Thermal Cycler operation.

NOTE: When a component is replaced and that does not resolve the problem, re-install that component before proceeding.

IP4-1.vsd

2 Troubleshooting IP-4: Assay results incorrect/Controls out of range 2 - 40 LCx® Analyzer Service Manual (Text P/N 47278-102)


Chapter	Manual	CD Main	Index
Contents	Contents	Screen	

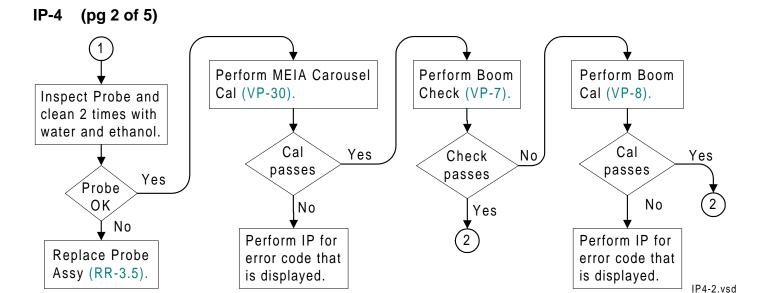

2 Troubleshooting IP-4: Assay results incorrect/Controls out of range 2 - 41 LCx[®] Analyzer Service Manual (Text P/N 47278-102)

Chapter	Manual	CD Main	Index
Contents	Contents	Screen	


IP-4 (pg 3 of 5)

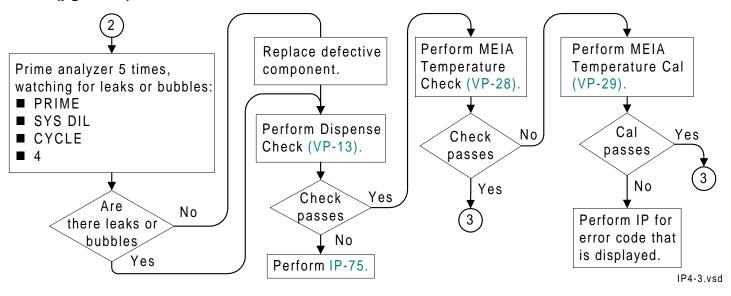

2 Troubleshooting IP-4: Assay results incorrect/Controls out of range 2 - 42 LCx® Analyzer Service Manual (Text P/N 47278-102)


Chapter	Manual	CD Main	Index
Contents	Contents	Screen	


IP-4 (pg 4 of 5)

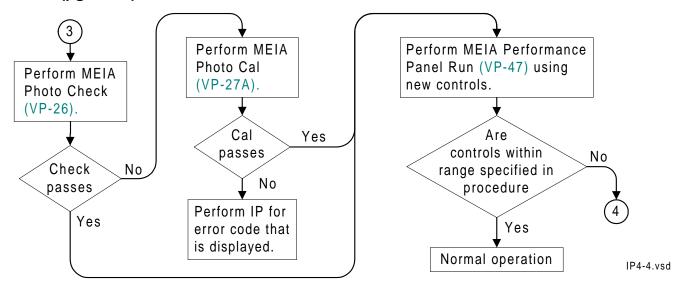

2 Troubleshooting IP-4: Assay results incorrect/Controls out of range 2 - 43 LCx[®] Analyzer Service Manual (Text P/N 47278-102)

Chapter	Manual	CD Main	Index
Contents	Contents	Screen	



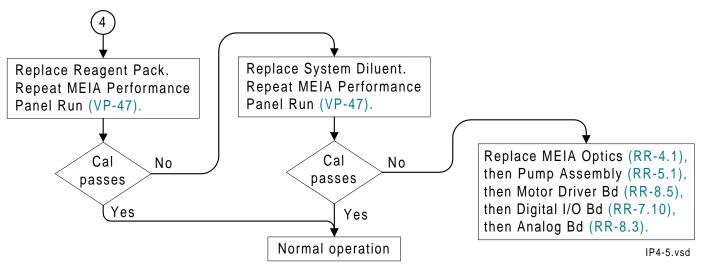

2 Troubleshooting IP-4: Assay results incorrect/Controls out of range 2 - 44 LCx[®] Analyzer Service Manual (Text P/N 47278-102)

Chapter	Manual	CD Main	Index
Contents	Contents	Screen	