MSHA Narrative Cause, Factor, and Action Analysis

100-Narrative Severity-Stratified Hugging Face Pilot

Generated October 02, 2026 at 01:44

```
Model: Qwen/Qwen2.5-7B-Instruct
GPU: Tesla T4
Prompt version: MSHA_HF_CAUSE_FACTOR_ACTION_V2.0
Records classified: 100

Purpose:
Convert narrative text into one reported causal mechanism, one
contributing-factor category, and one preliminary action category.

Important limitation:
The extracted categories are model-generated decision-support labels.
They are not verified root-cause findings or approved corrective actions.
Records marked for review require qualified human evaluation.
```

Executive Summary

This report evaluates a 100-record sample selected across five injury severity groups. The model assigned one cause, one contributing factor, and one preliminary action category to each narrative.

Successful classifications: 80
Failed classifications: 20
Records requiring review: 88
Narratives near the source-field limit: 0

Most frequently assigned cause: INSUFFICIENT_INFORMATION (20 records)
Most frequently assigned factor: NOT_STATED (53 records)
Most frequently assigned action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT (34 records)

These frequencies describe the sampled records and model assignments. They should not be generalized to the complete MSHA dataset until the sample classifications have been manually reviewed and validated.

Methodology and Interpretation

Sampling:
The code attempted to select 20 narratives from each of five injury severity groups. If a group contained fewer than 20 eligible records, remaining sample positions were filled from the unselected dataset.

Classification:
Qwen2.5-7B-Instruct was loaded locally in 4-bit mode on the Azure ML GPU. The model was restricted to controlled cause, factor, and action taxonomies.

Evidence:
The cause and factor evidence fields were required to contain literal narrative excerpts. Automatic evidence validation confirms only that the words occur in the narrative; it does not prove that the excerpt semantically supports the assigned category.

Review flags:
A record was marked for review when it was truncated, low confidence, low support, missing a factor, failed evidence validation, had an unusual factor-action relationship, required investigation, or contained a model reviewer note.

Corrective actions:
Recommended actions are preliminary categories for analytical and research purposes. They require review by qualified safety, technical, engineering, and operational personnel.

Severity-Stratified Sample Design

SEVERITY_GROUP	AVAILABLE_RECORDS	INITIAL_TARGET	INITIAL_SELECTED	FINAL_SELECTED
1_FATALITY	1213	20	20	20
2_PERMANENT_DISABILITY	2483	20	20	20
3_DAYS_AWAY	181361	20	20	20
4_RESTRICTED_OR_TRANSF	43563	20	20	20
5_NO_LOST_TIME_OR_OTHE	46323	20	20	20

Final Sample Counts by Severity

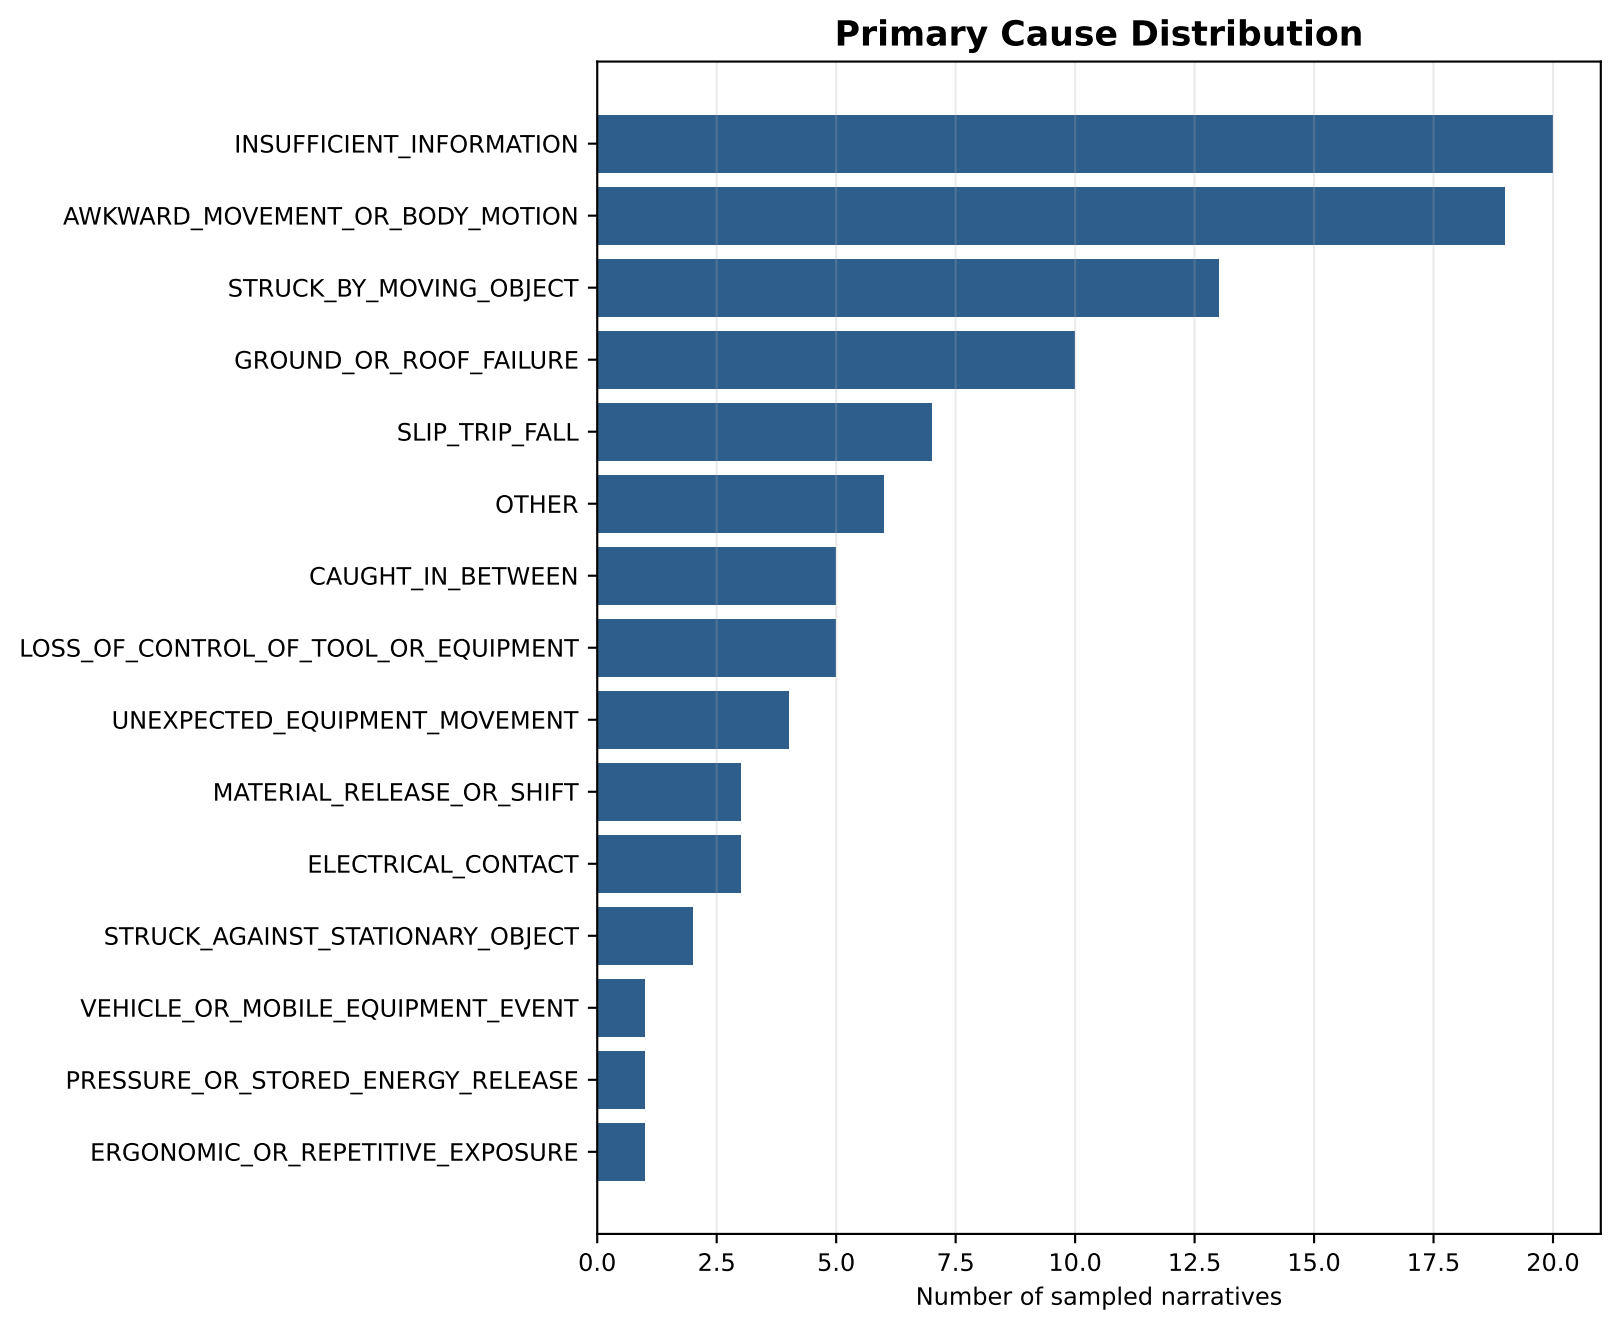
SEVERITY_GROUP	COUNT
1_FATALITY	20
2_PERMANENT_DISABILITY	20
3_DAYS_AWAY	20
4_RESTRICTED_OR_TRANSFERRED	20
5_NO_LOST_TIME_OR_OTHER	20

Processing and Quality Summary

MEASURE	VALUE
Records processed	100.0
Successful classifications	80.0
Failed classifications	20.0
Records requiring review	88.0
Truncated or near-limit narratives	0.0
Invalid cause evidence	30.0
Invalid factor evidence	35.0
Factor-action alignment flags	42.0
Mean processing seconds	24.84

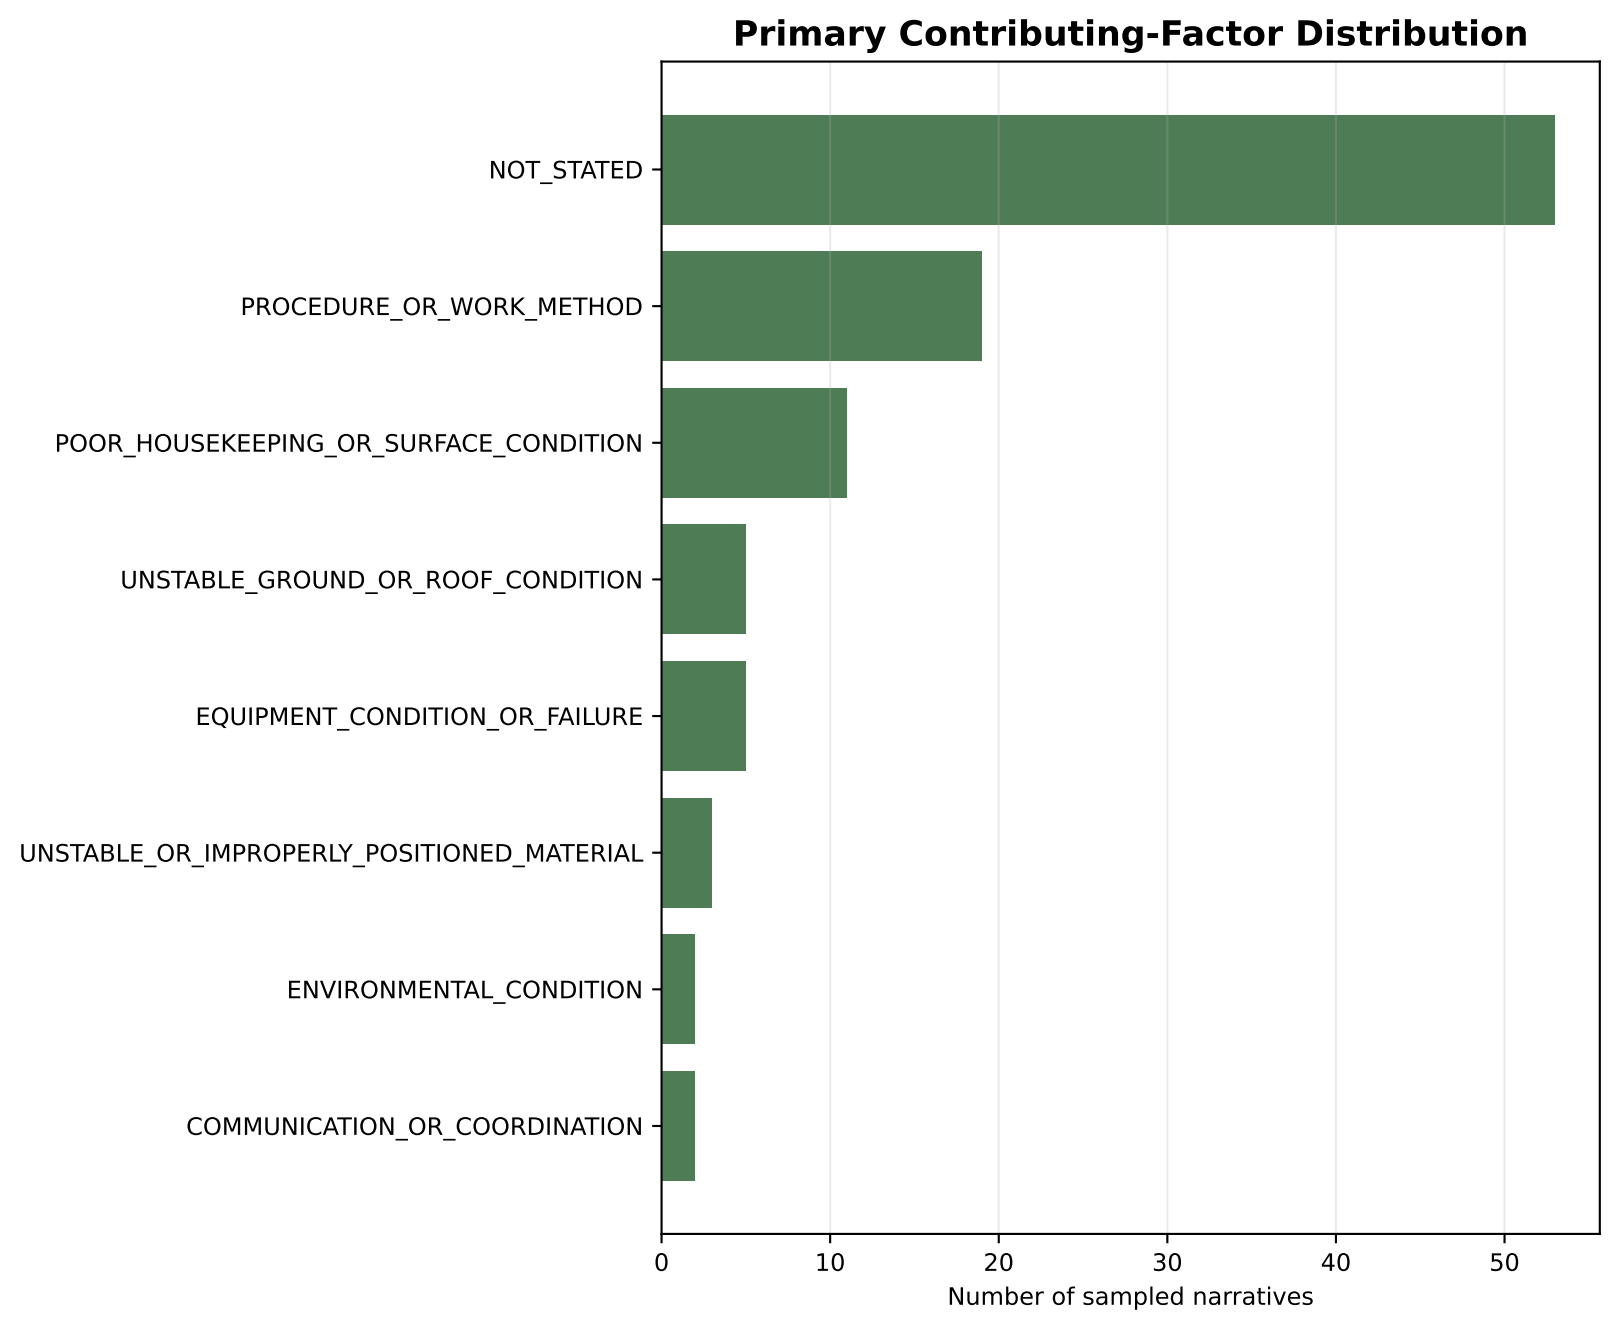
Primary Cause Distribution

PRIMARY_CAUSE_CATEGORY	COUNT
INSUFFICIENT_INFORMATION	20
AWKWARD_MOVEMENT_OR_BODY_MOTION	19
STRUCK_BY_MOVING_OBJECT	13
GROUND_OR_ROOF_FAILURE	10
SLIP_TRIP_FALL	7
OTHER	6
LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT	5
CAUGHT_IN_BETWEEN	5
UNEXPECTED_EQUIPMENT_MOVEMENT	4
MATERIAL_RELEASE_OR_SHIFT	3
ELECTRICAL_CONTACT	3
STRUCK_AGAINST_STATIONARY_OBJECT	2
PRESSURE_OR_STORED_ENERGY_RELEASE	1
VEHICLE_OR_MOBILE_EQUIPMENT_EVENT	1
ERGONOMIC_OR_REPETITIVE_EXPOSURE	1


Primary Cause Distribution
INSUFFICIENT_INFORMATION
AWKWARD_MOVEMENT_OR_BODY_MOTION
STRUCK_BY_MOVING_OBJECT
GROUND_OR_ROOF_FAILURE
SLIP_TRIP_FALL
OTHER
CAUGHT_IN_BETWEEN
LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
UNEXPECTED_EQUIPMENT_MOVEMENT
MATERIAL_RELEASE_OR_SHIFT
ELECTRICAL_CONTACT
STRUCK_AGAINST_STATIONARY_OBJECT
VEHICLE_OR_MOBILE_EQUIPMENT_EVENT
PRESSURE_OR_STORED_ENERGY_RELEASE
ERGONOMIC_OR_REPETITIVE_EXPOSURE
0.0
2.5
5.0
7.5
10.0
12.5
15.0
17.5
20.0
Number of sampled narratives

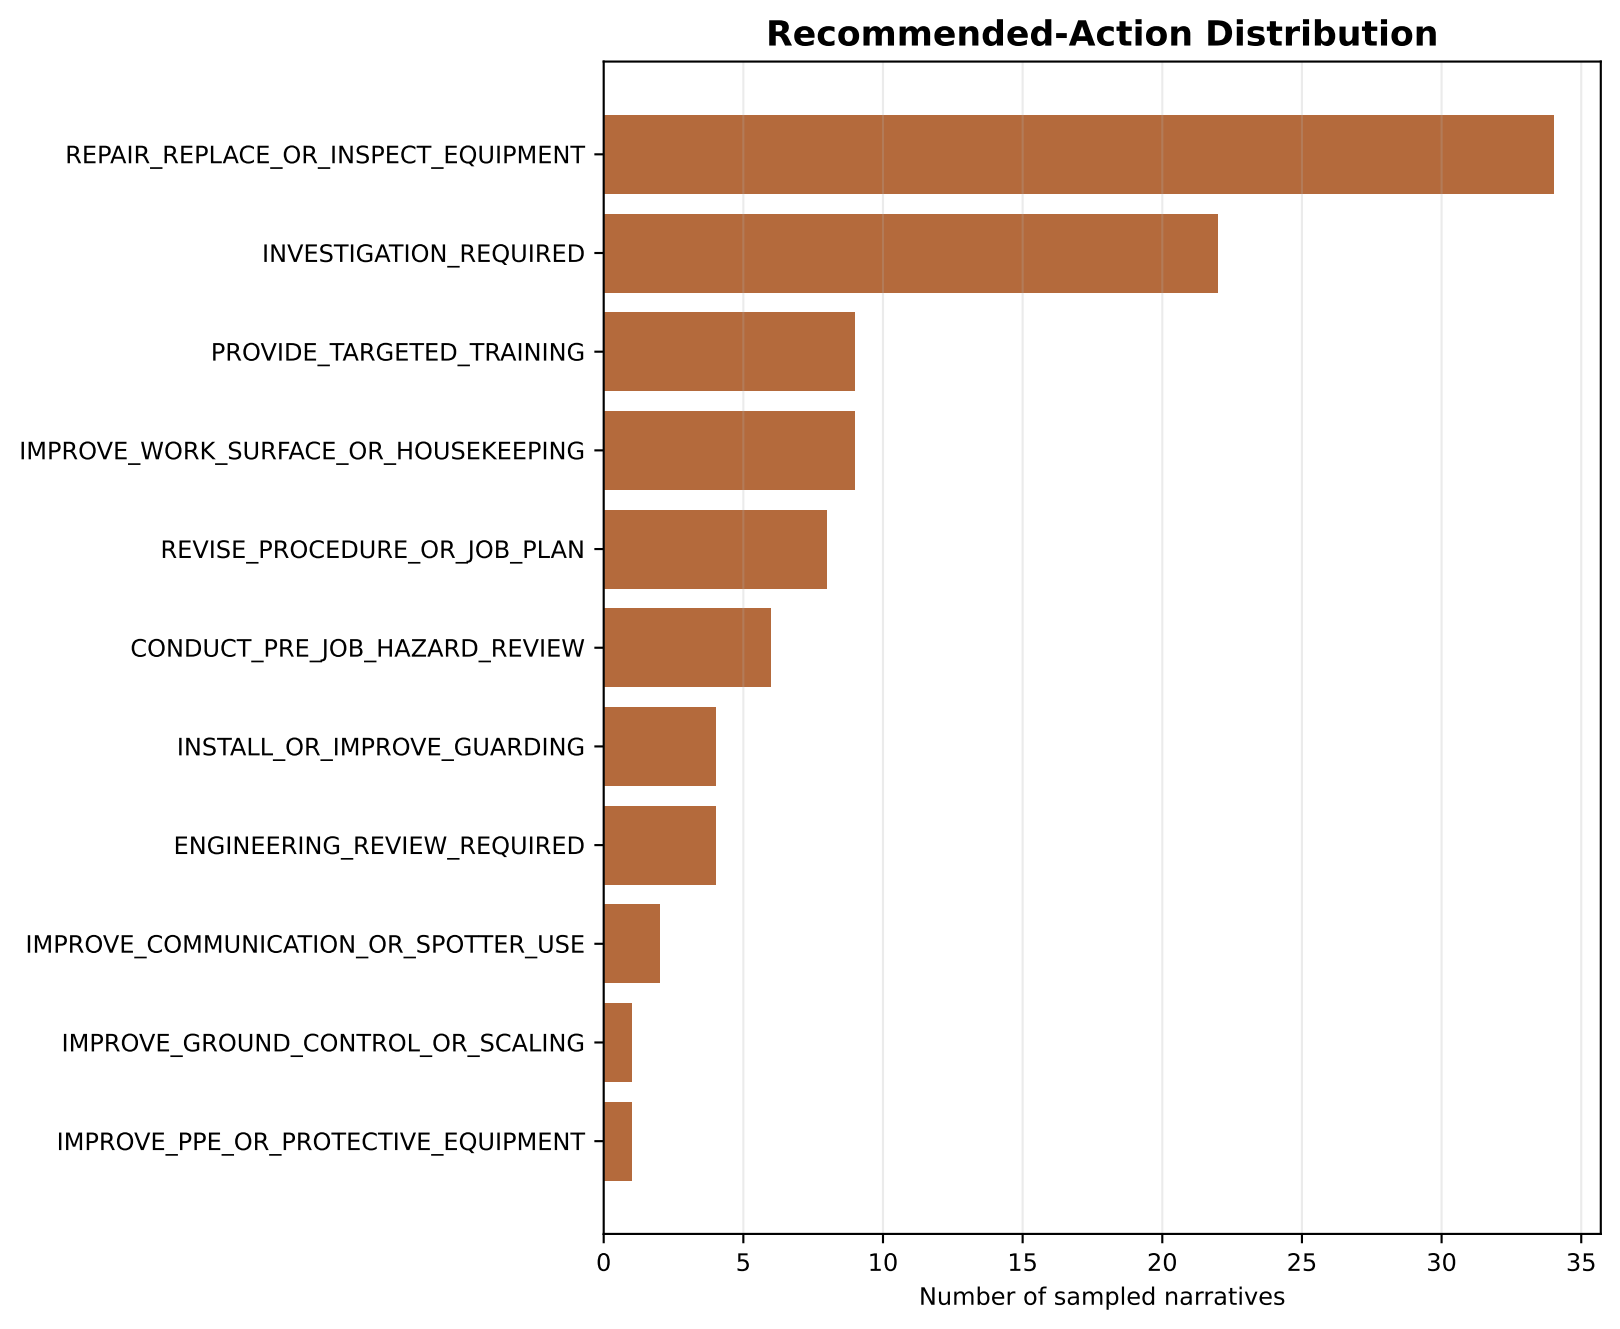
Primary Contributing-Factor Distribution

PRIMARY_CONTRIBUTING_FACTOR	COUNT
NOT_STATED	53
PROCEDURE_OR_WORK_METHOD	19
POOR_HOUSEKEEPING_OR_SURFACE_CONDITION	11
EQUIPMENT_CONDITION_OR_FAILURE	5
UNSTABLE_GROUND_OR_ROOF_CONDITION	5
UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL	3
COMMUNICATION_OR_COORDINATION	2
ENVIRONMENTAL_CONDITION	2


Primary Contributing-Factor Distribution
NOT_STATED
PROCEDURE_OR_WORK_METHOD
POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
UNSTABLE_GROUND_OR_ROOF_CONDITION
EQUIPMENT_CONDITION_OR_FAILURE
UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL
ENVIRONMENTAL_CONDITION
COMMUNICATION_OR_COORDINATION
0
10
20
30
40
50
Number of sampled narratives

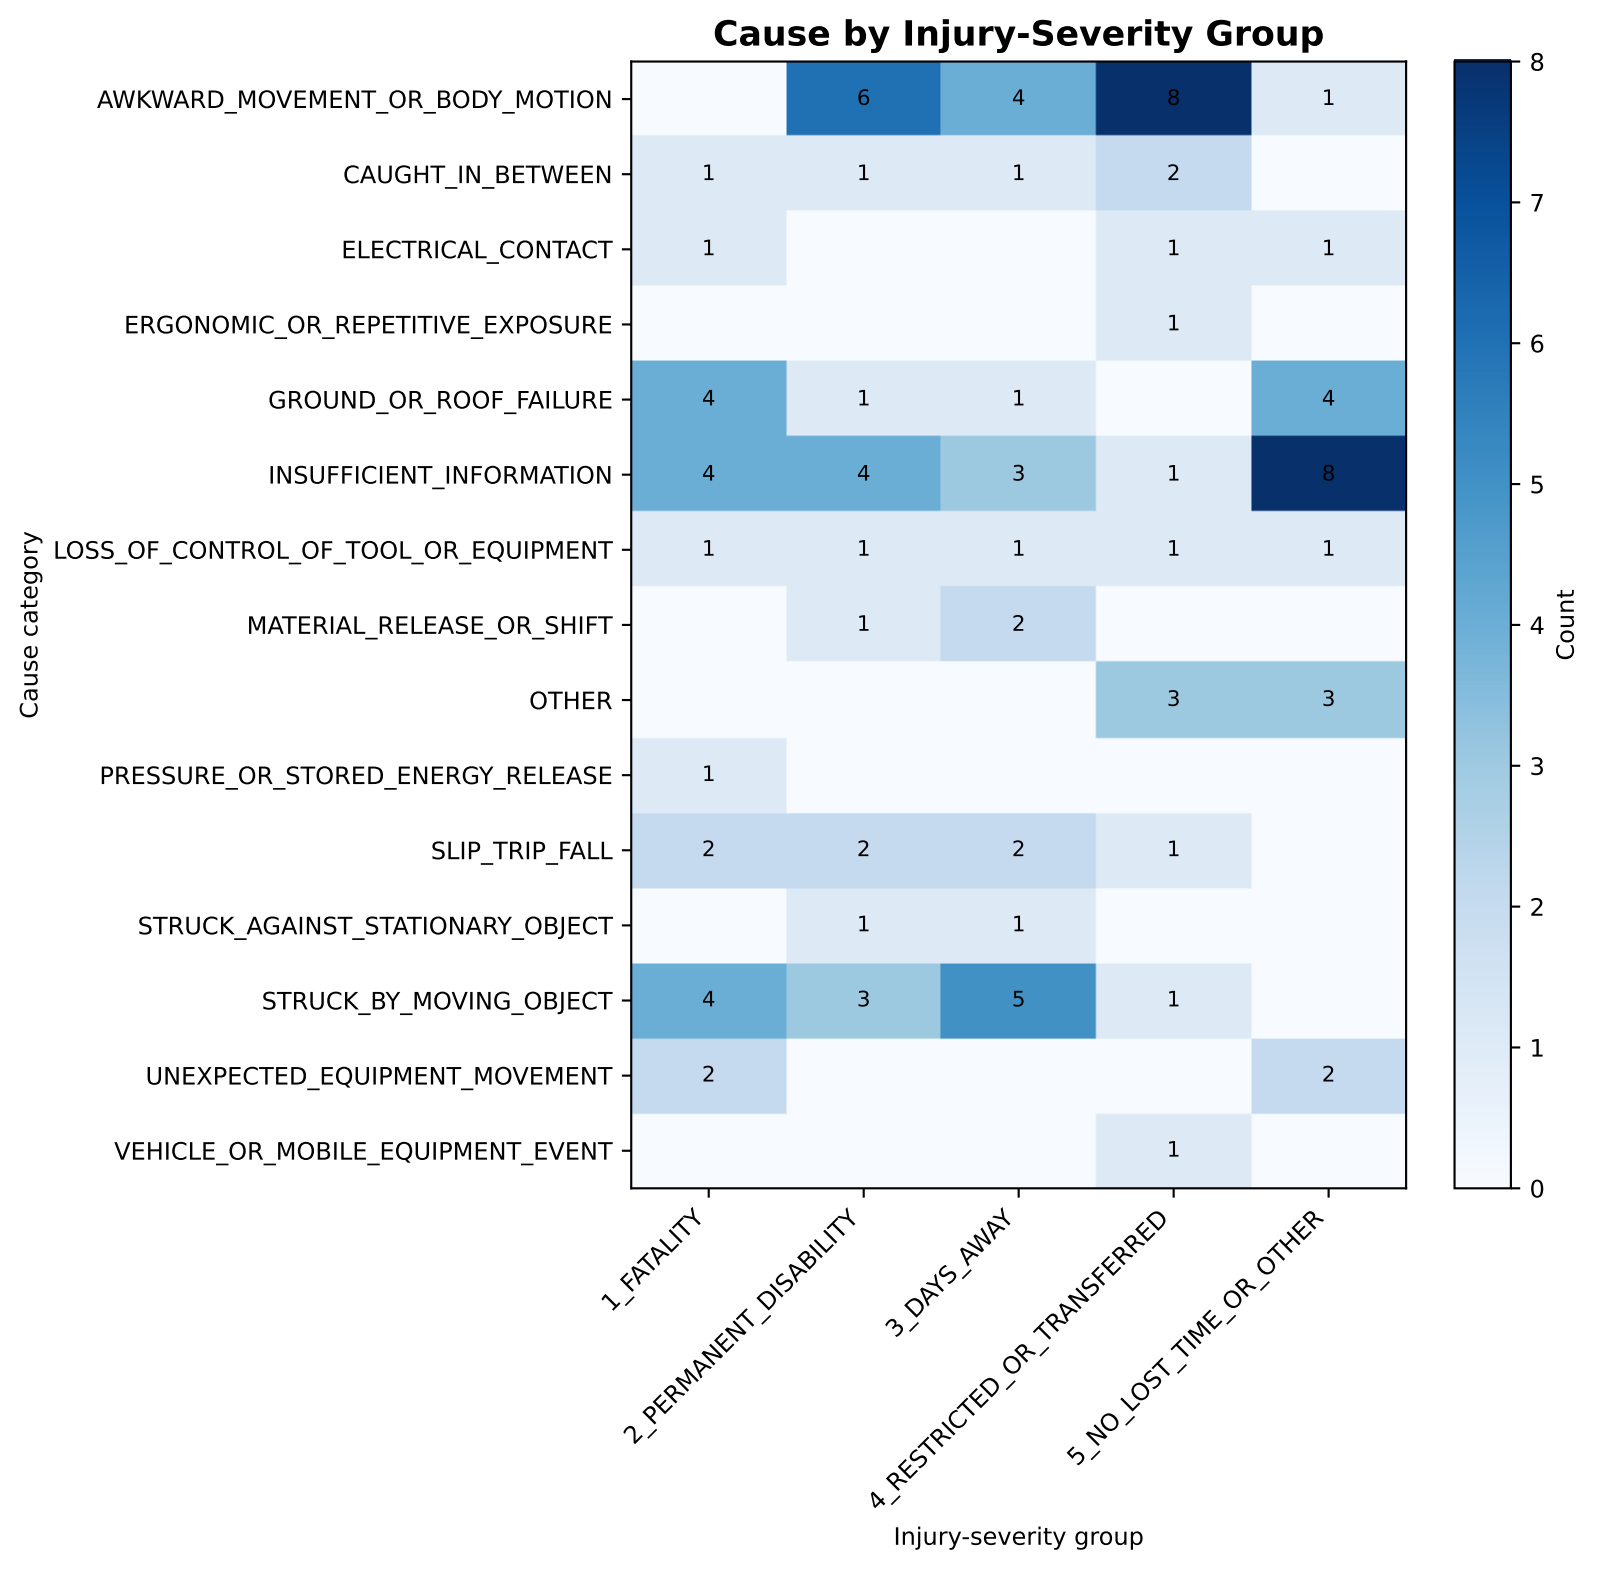
Recommended-Action Distribution

RECOMMENDED_ACTION_CATEGORY	COUNT
REPAIR_REPLACE_OR_INSPECT_EQUIPMENT	34
INVESTIGATION_REQUIRED	22
IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING	9
PROVIDE_TARGETED_TRAINING	9
REVISE_PROCEDURE_OR_JOB_PLAN	8
CONDUCT_PRE_JOB_HAZARD_REVIEW	6
ENGINEERING_REVIEW_REQUIRED	4
INSTALL_OR_IMPROVE_GUARDING	4
IMPROVE_COMMUNICATION_OR_SPOTTER_USE	2
IMPROVE_GROUND_CONTROL_OR_SCALING	1
IMPROVE_PPE_OR_PROTECTIVE_EQUIPMENT	1


Recommended-Action Distribution
REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
INVESTIGATION_REQUIRED
PROVIDE_TARGETED_TRAINING
IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
REVISE_PROCEDURE_OR_JOB_PLAN
CONDUCT_PRE_JOB_HAZARD_REVIEW
INSTALL_OR_IMPROVE_GUARDING
ENGINEERING_REVIEW_REQUIRED
IMPROVE_COMMUNICATION_OR_SPOTTER_USE
IMPROVE_GROUND_CONTROL_OR_SCALING
IMPROVE_PPE_OR_PROTECTIVE_EQUIPMENT
0
5
10
15
20
25
30
35
Number of sampled narratives

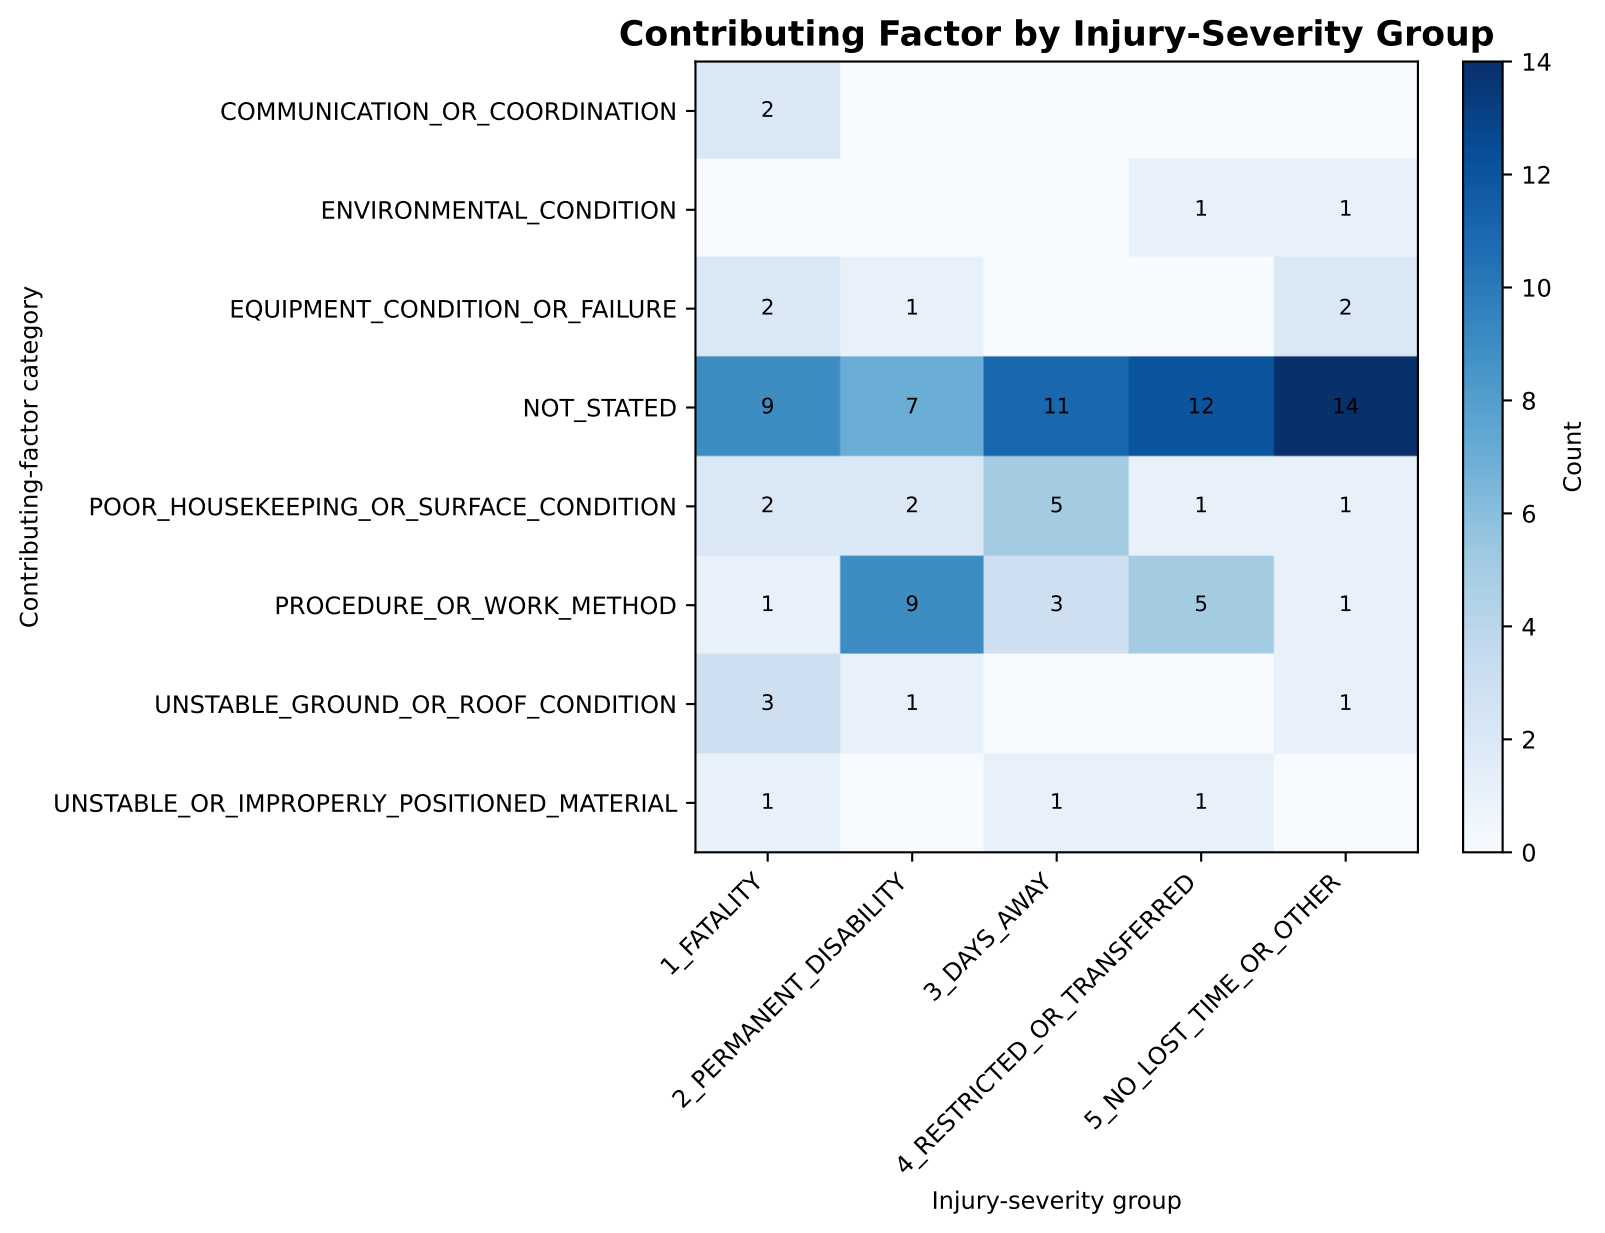
Cause by Injury-Severity Group

PRIMARY_CAUSE_CATEG	1_FATALITY	2_PERMANENT_DISABILI	3_DAYS_AWAY	4_RESTRICTED_OR_TRAI	5_NO_LOST_TIME_OR_OTHE
AWKWARD_MOVEMENT_OF	0	6	4	8	1
CAUGHT_IN_BETWEEN	1	1	1	2	0
ELECTRICAL_CONTACT	1	0	0	1	1
ERGONOMIC_OR_REPETITI	0	0	0	1	0
GROUND_OR_ROOF_FAILUR	4	1	1	0	4
INSUFFICIENT_INFORMATIC	4	4	3	1	8
LOSS_OF_CONTROL_OF_TC	1	1	1	1	1
MATERIAL_RELEASE_OR_SH	0	1	2	0	0
OTHER	0	0	0	3	3
PRESSURE_OR_STORED_EN	1	0	0	0	0
SLIP_TRIP_FALL	2	2	2	1	0
STRUCK_AGAINST_STATION	0	1	1	0	0
STRUCK_BY_MOVING_OBJE	4	3	5	1	0
UNEXPECTED_EQUIPMENT_	2	0	0	0	2
VEHICLE_OR_MOBILE_EQU	0	0	0	1	0


Cause by Injury-Severity Group
AWKWARD_MOVEMENT_OR_BODY_MOTION
CAUGHT_IN_BETWEEN
ELECTRICAL_CONTACT
ERGONOMIC_OR_REPETITIVE_EXPOSURE
GROUND_OR_ROOF_FAILURE
INSUFFICIENT_INFORMATION
LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
MATERIAL_RELEASE_OR_SHIFT
OTHER
PRESSURE_OR_STORED_ENERGY_RELEASE
SLIP_TRIP_FALL
STRUCK_AGAINST_STATIONARY_OBJECT
STRUCK_BY_MOVING_OBJECT
UNEXPECTED_EQUIPMENT_MOVEMENT
VEHICLE_OR_MOBILE_EQUIPMENT_EVENT
Cause category
1_FATALITY
2_PERMANENT_DISABILITY
3_DAYS_AWAY
4_RESTRICTED_OR_TRANSFERRED
5_NO_LOST_TIME_OR_OTHER
Injury-severity group
Count
0
1
2
3
4
5
6
7
8

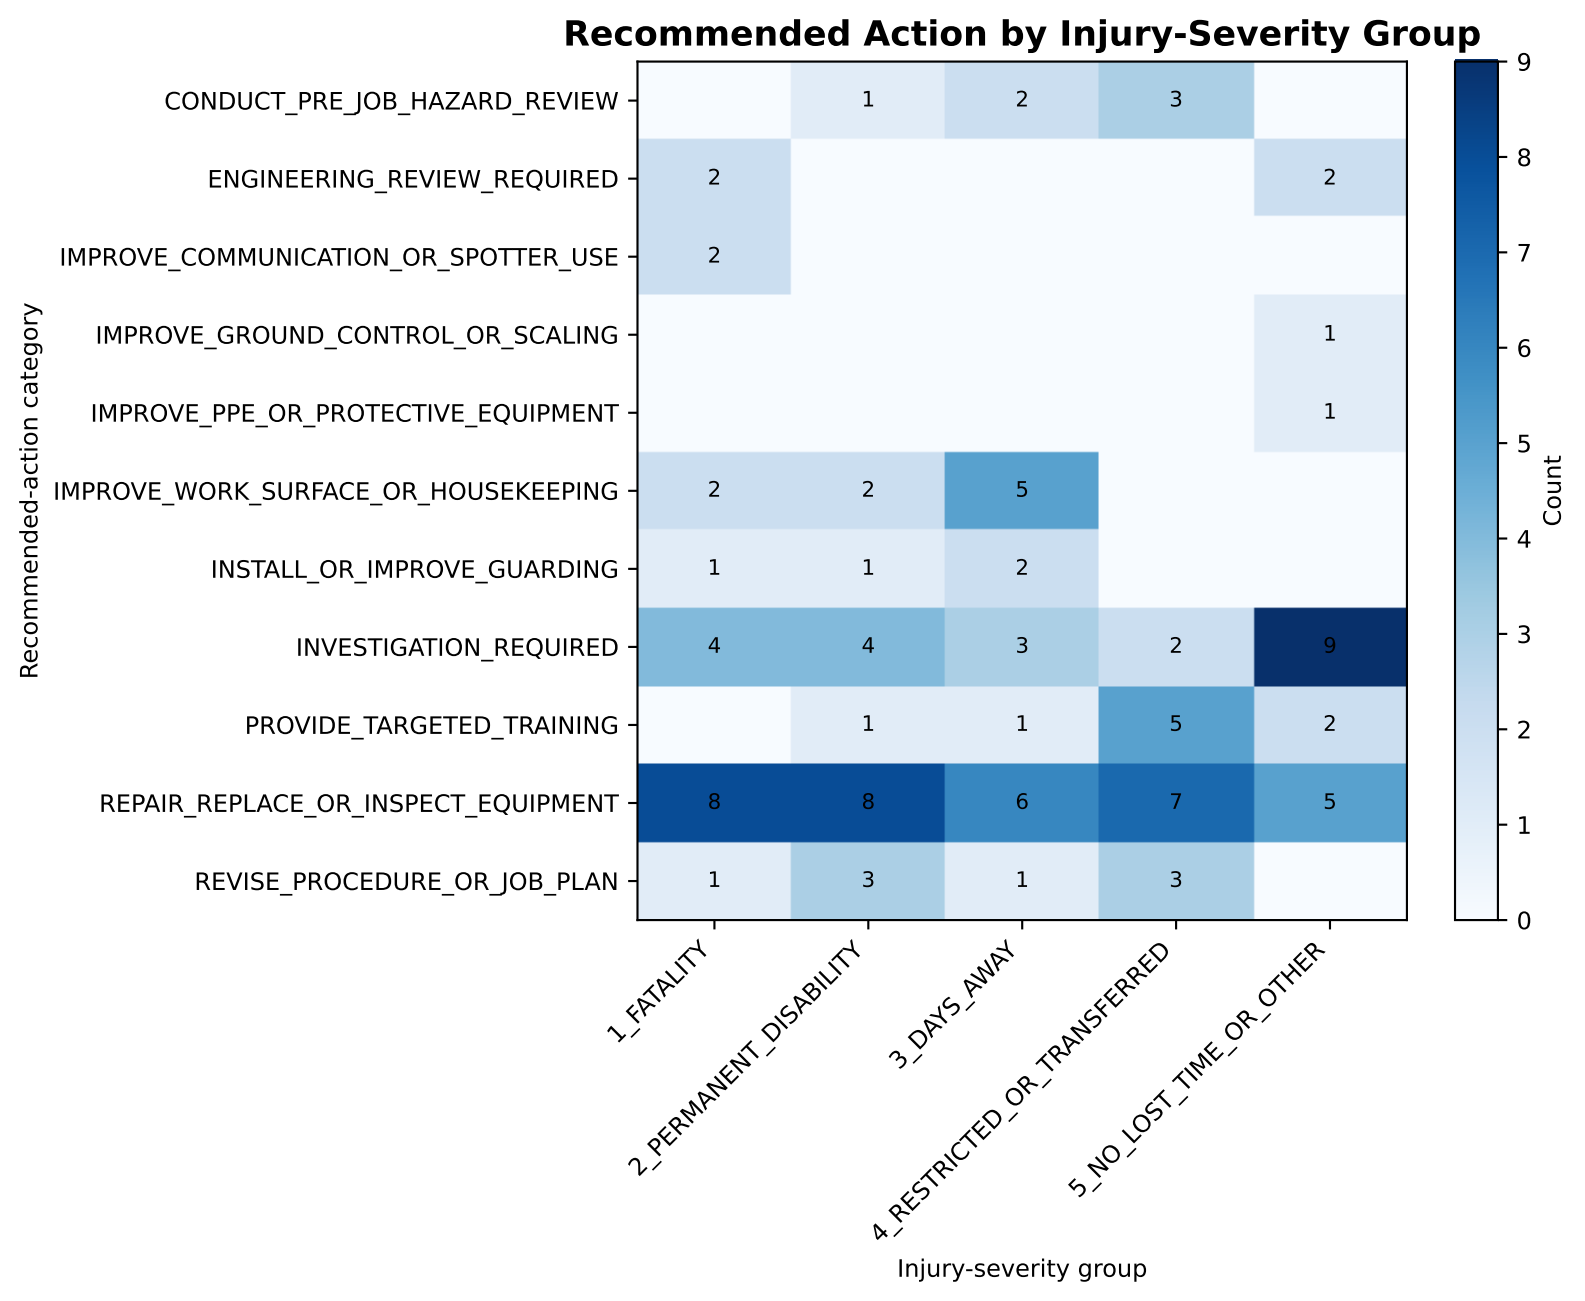
Contributing Factor by Injury-Severity Group

PRIMARY_CONTRIBUTIN	1_FATALITY	2_PERMANENT_DISABILI	3_DAYS_AWAY	4_RESTRICTED_OR_TRAI	5_NO_LOST_TIME_OR_OTHE
COMMUNICATION_OR_COO	2	0	0	0	0
ENVIRONMENTAL_CONDITI	0	0	0	1	1
EQUIPMENT_CONDITION_O	2	1	0	0	2
NOT_STATED	9	7	11	12	14
POOR_HOUSEKEEPING_OR_	2	2	5	1	1
PROCEDURE_OR_WORK_M	1	9	3	5	1
UNSTABLE_GROUND_OR_R	3	1	0	0	1
UNSTABLE_OR_IMPROPERL	1	0	1	1	0


Contributing Factor by Injury-Severity Group
COMMUNICATION_OR_COORDINATION
ENVIRONMENTAL_CONDITION
EQUIPMENT_CONDITION_OR_FAILURE
NOT_STATED
POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
PROCEDURE_OR_WORK_METHOD
UNSTABLE_GROUND_OR_ROOF_CONDITION
UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL
Contributing-factor category
2
1
1
2
1
2
9
7
11
12
14
2
2
5
1
1
1
9
3
5
1
3
1
1
1
1
1_FATALITY
2_PERMANENT_DISABILITY
3_DAYS_AWAY
4_RESTRICTED_OR_TRANSFERRED
5_NO_LOST_TIME_OR_OTHER
Injury-severity group
Count
0
2
4
6
8
10
12
14

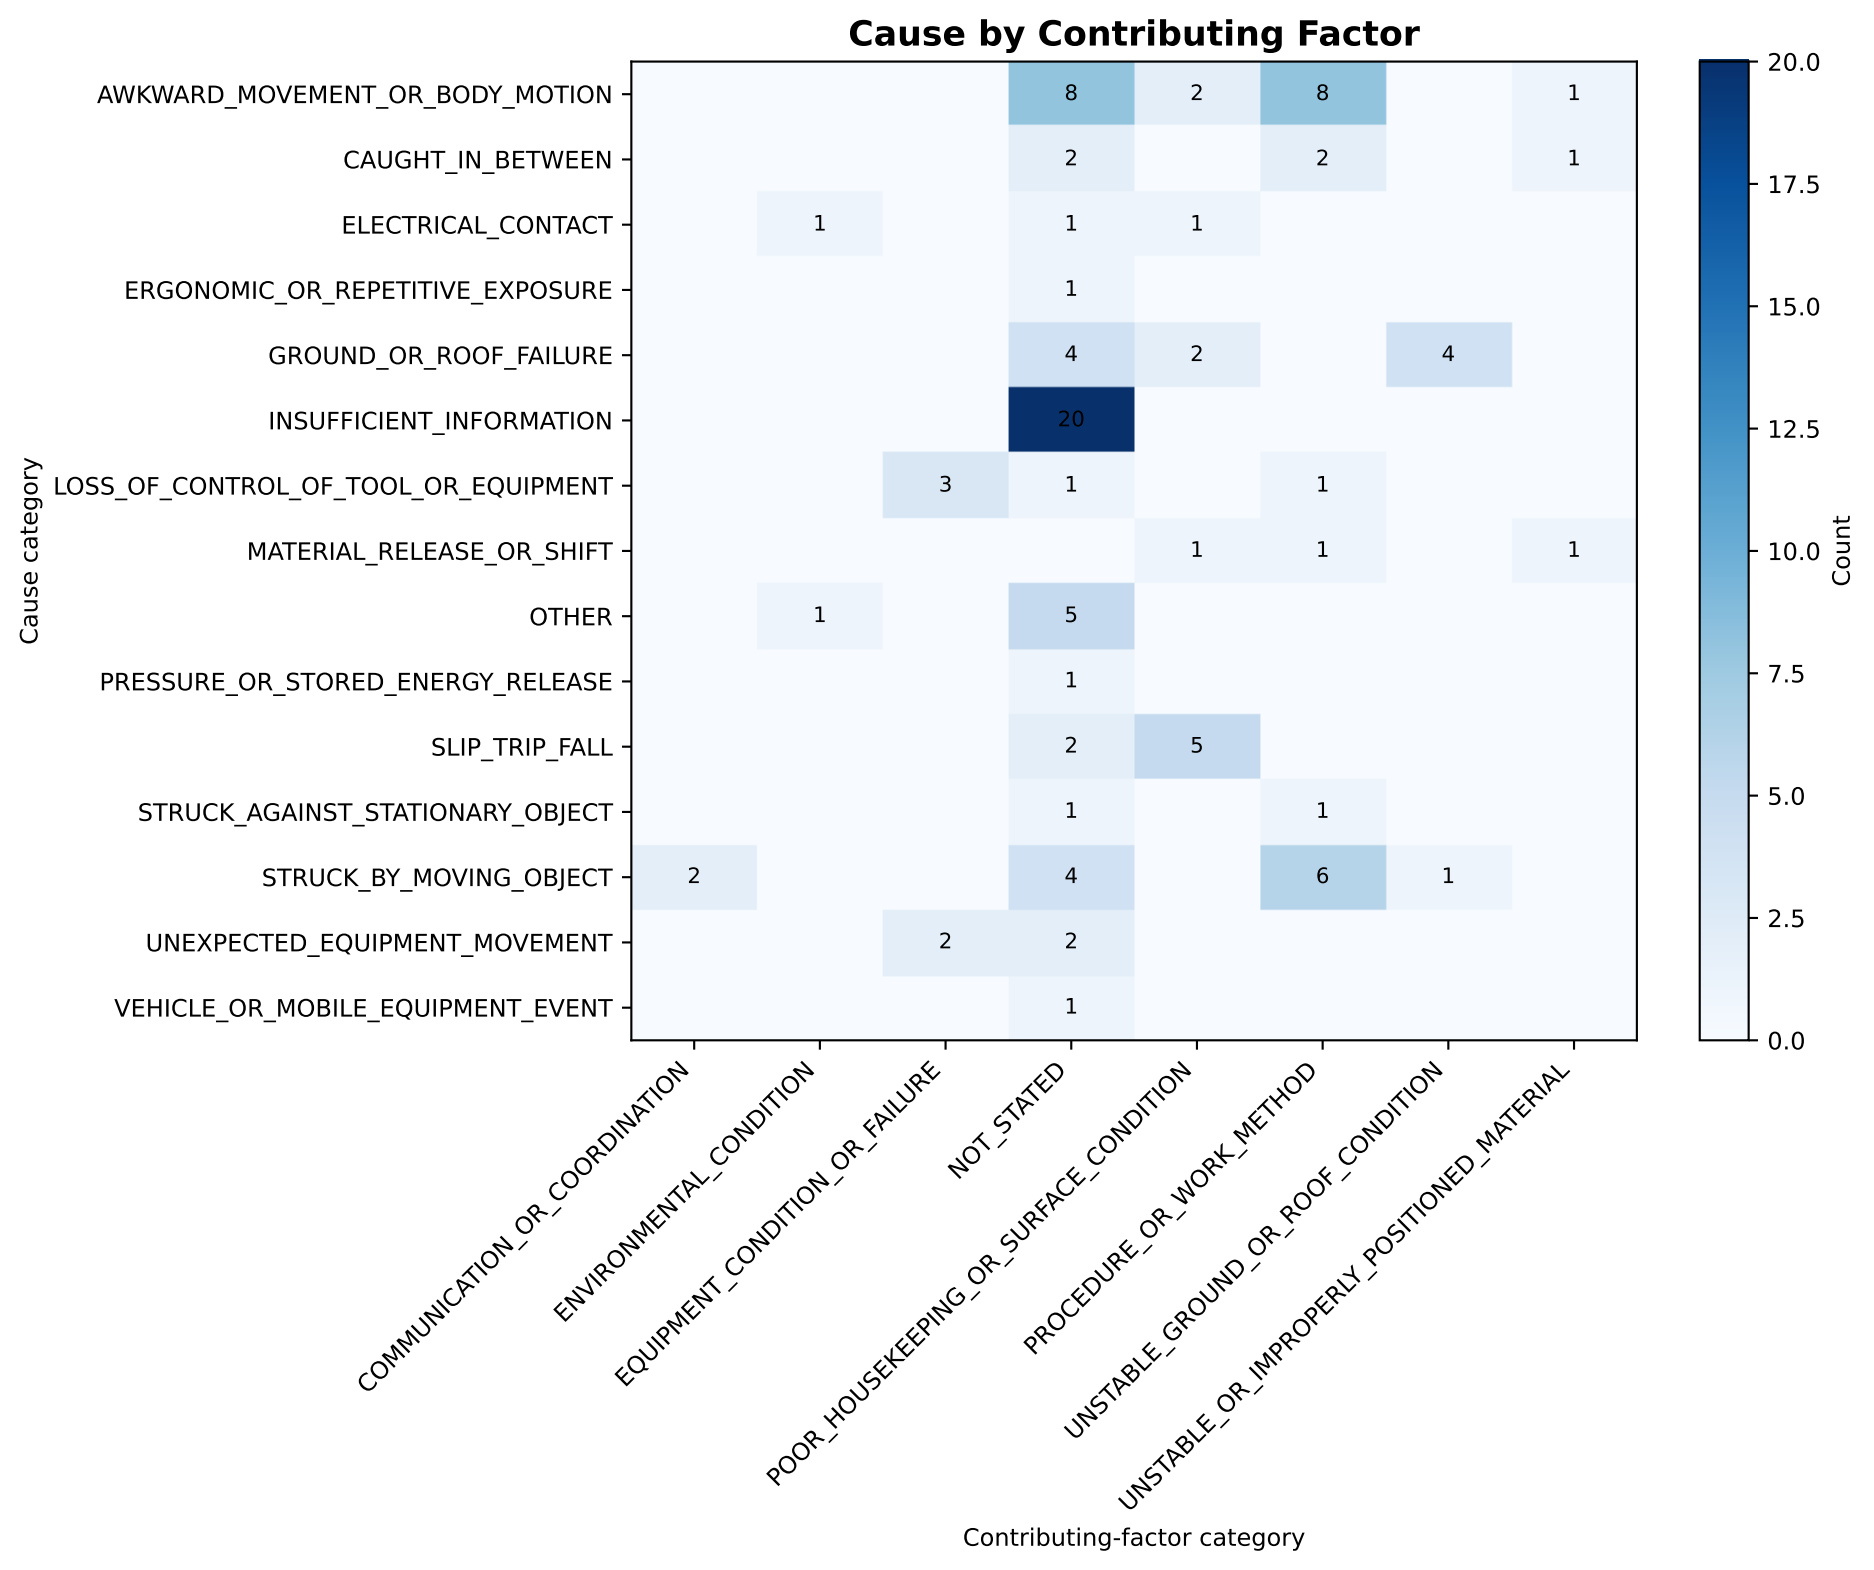
Recommended Action by Injury-Severity Group

RECOMMENDED_ACTION	1_FATALITY	2_PERMANENT_DISABILI	3_DAYS_AWAY	4_RESTRICTED_OR_TRAN	5_NO_LOST_TIME_OR_OTHE
CONDUCT_PRE_JOB_HAZAR	0	1	2	3	0
ENGINEERING_REVIEW_RE	2	0	0	0	2
IMPROVE_COMMUNICATION	2	0	0	0	0
IMPROVE_GROUND_CONTR	0	0	0	0	1
IMPROVE_PPE_OR_PROTEC	0	0	0	0	1
IMPROVE_WORK_SURFACE_	2	2	5	0	0
INSTALL_OR_IMPROVE_GUA	1	1	2	0	0
INVESTIGATION_REQUIRED	4	4	3	2	9
PROVIDE_TARGETED_TRAIN	0	1	1	5	2
REPAIR_REPLACE_OR_INSP	8	8	6	7	5
REVISE_PROCEDURE_OR_JO	1	3	1	3	0


Recommended Action by Injury-Severity Group
CONDUCT_PRE_JOB_HAZARD_REVIEW
ENGINEERING_REVIEW_REQUIRED
IMPROVE_COMMUNICATION_OR_SPOTTER_USE
IMPROVE_GROUND_CONTROL_OR_SCALING
IMPROVE_PPE_OR_PROTECTIVE_EQUIPMENT
IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
INSTALL_OR_IMPROVE_GUARDING
INVESTIGATION_REQUIRED
PROVIDE_TARGETED_TRAINING
REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
REVISE_PROCEDURE_OR_JOB_PLAN
Recommended-action category
1_FATALITY
2_PERMANENT_DISABILITY
3_DAYS_AWAY
4_RESTRICTED_OR_TRANSFERRED
5_NO_LOST_TIME_OR_OTHER
Injury-severity group
Count
0
1
2
3
4
5
6
7
8
9

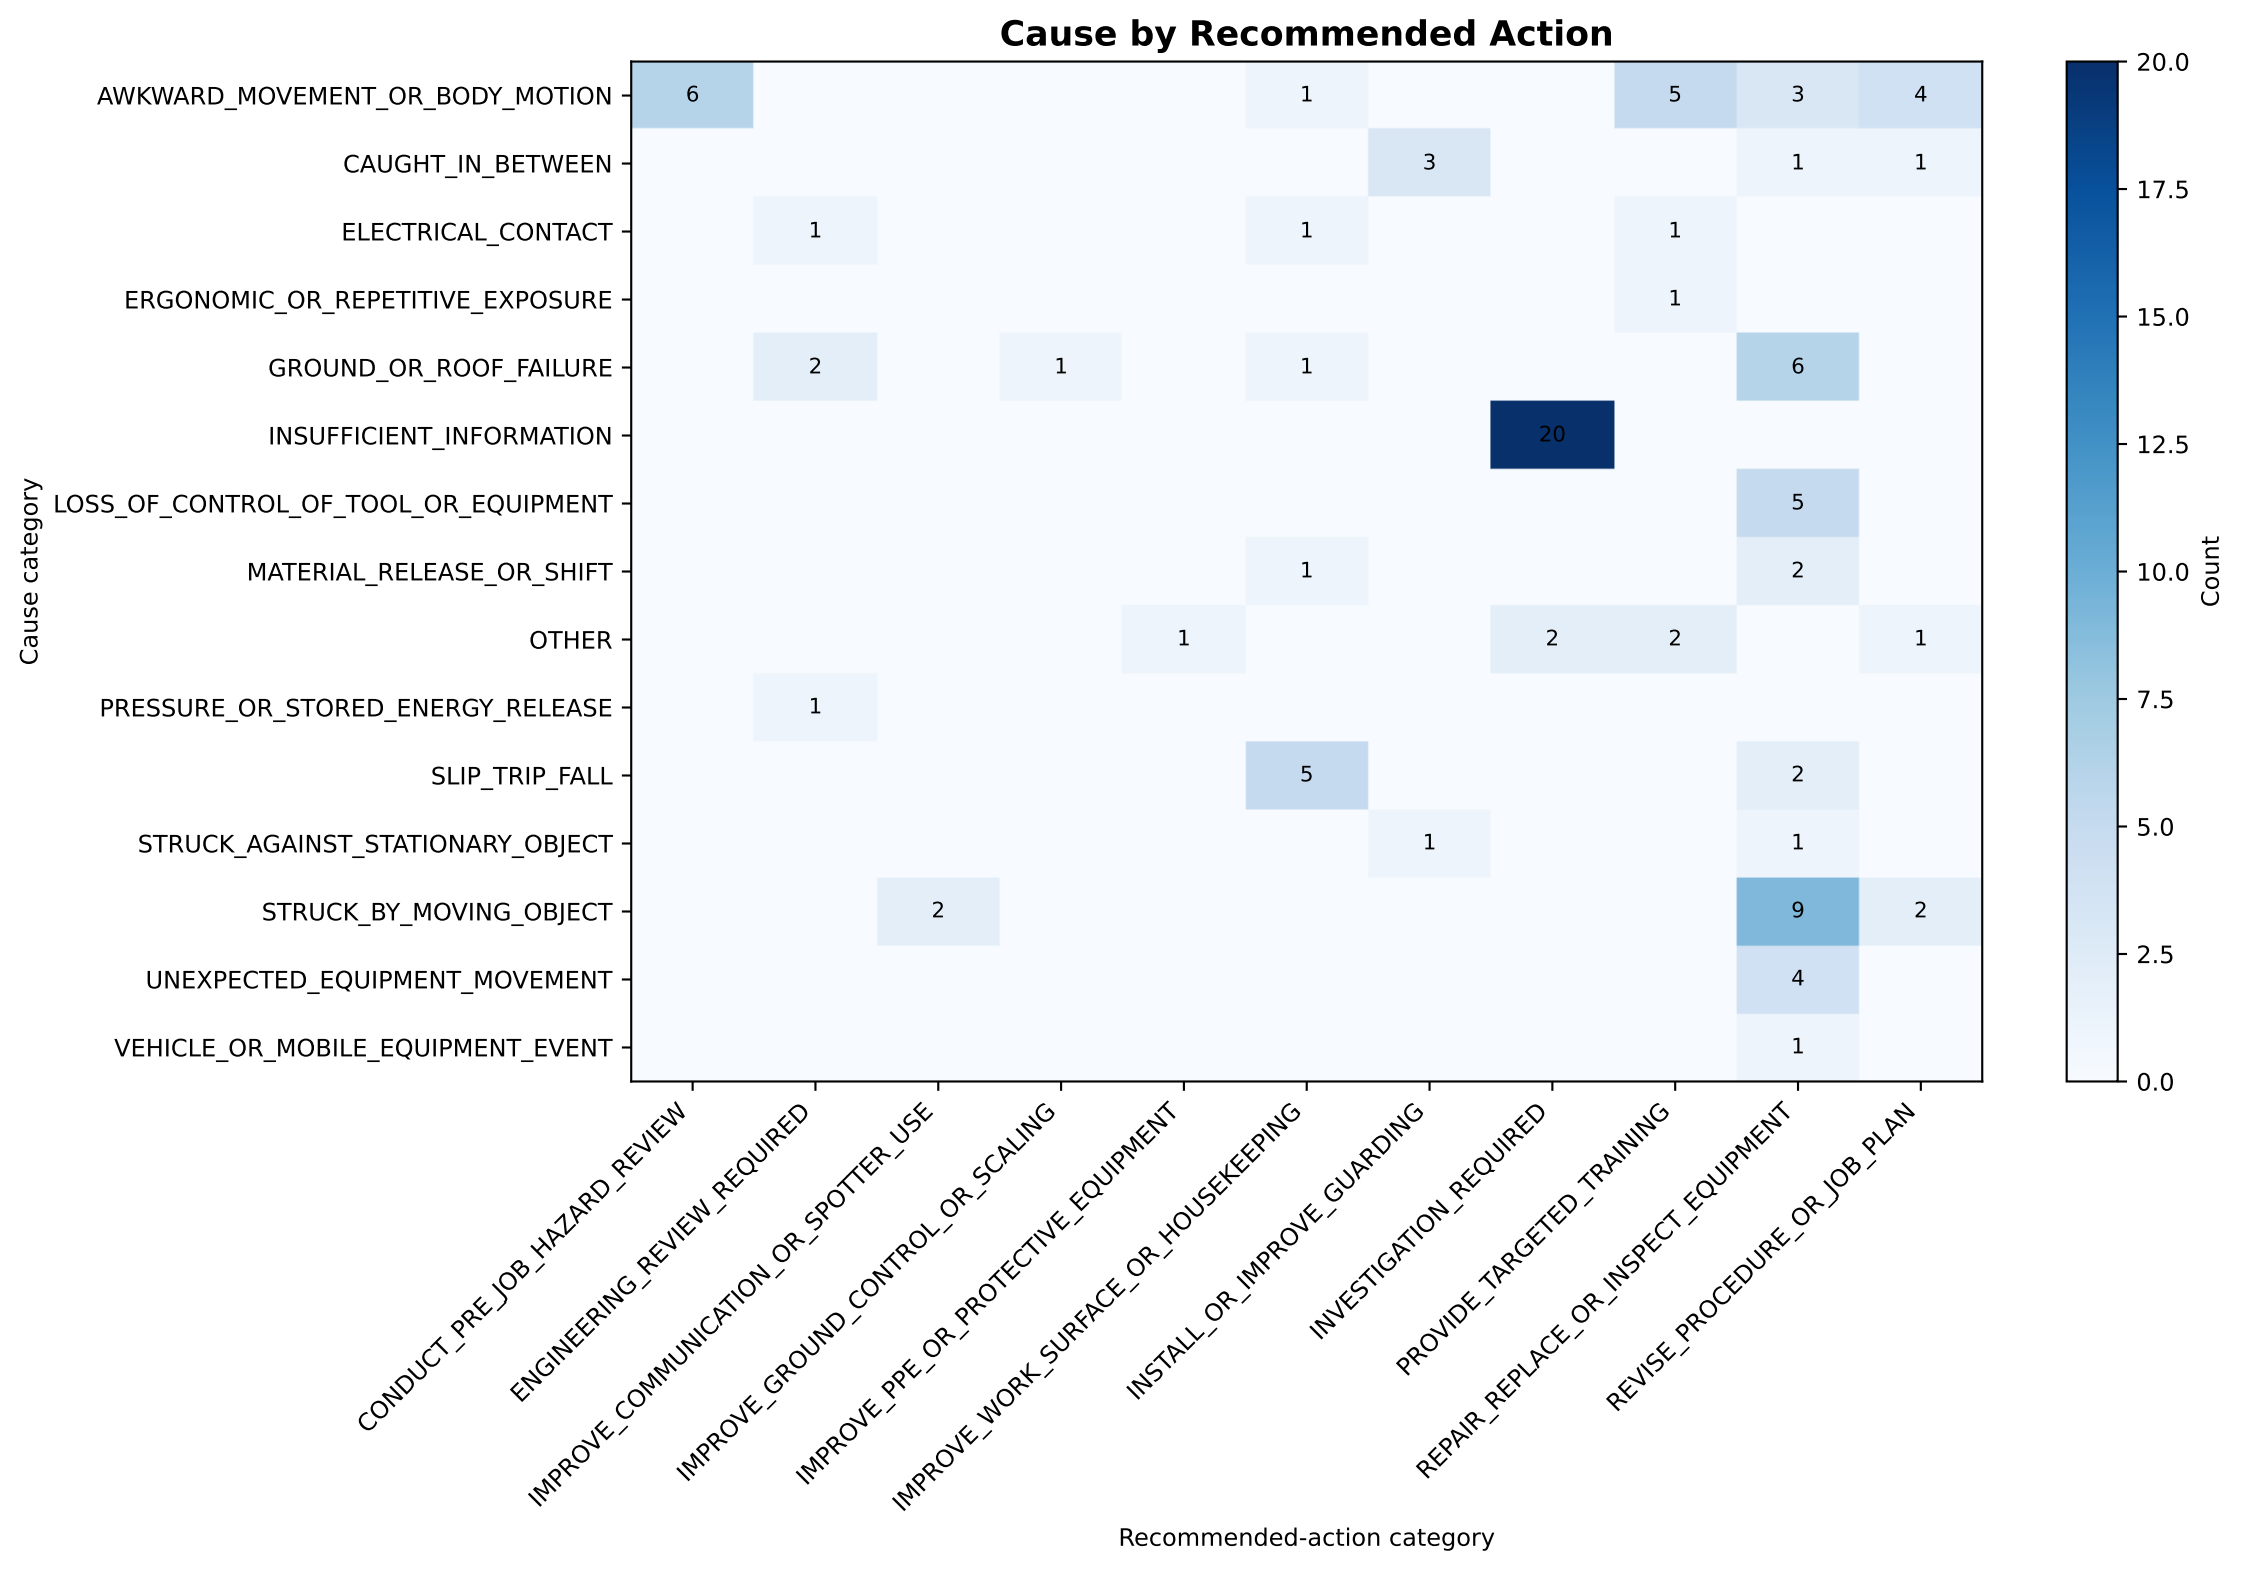
Cause by Contributing Factor

PRIMARY_CAUSE_	COMMUNICATION_	ENVIRONMENTAL_	EQUIPMENT_COND	NOT_STATED	POOR_HOUSEKEEI	PROCEDURE_OR_V	UNSTABLE_GROUI	UNSTABLE_OR_IMP	TRC
AWKWARD_MOVEME	0	0	0	8	2	8	0	1	
CAUGHT_IN_BETWE	0	0	0	2	0	2	0	1	
ELECTRICAL_CONTA	0	1	0	1	1	0	0	0	
ERGONOMIC_OR_RE	0	0	0	1	0	0	0	0	
GROUND_OR_ROOF_	0	0	0	4	2	0	4	0	
INSUFFICIENT_INFOI	0	0	0	20	0	0	0	0	
LOSS_OF_CONTROL_	0	0	3	1	0	1	0	0	
MATERIAL_RELEASE	0	0	0	0	1	1	0	1	
OTHER	0	1	0	5	0	0	0	0	
PRESSURE_OR_STOI	0	0	0	1	0	0	0	0	
SLIP_TRIP_FALL	0	0	0	2	5	0	0	0	
STRUCK_AGAINST_S	0	0	0	1	0	1	0	0	
STRUCK_BY_MOVINC	2	0	0	4	0	6	1	0	
UNEXPECTED_EQUIF	0	0	2	2	0	0	0	0	
VEHICLE_OR_MOBIL	0	0	0	1	0	0	0	0	


Cause by Contributing Factor
Cause category
AWKWARD_MOVEMENT_OR_BODY_MOTION
CAUGHT_IN_BETWEEN
ELECTRICAL_CONTACT
ERGONOMIC_OR_REPETITIVE_EXPOSURE
GROUND_OR_ROOF_FAILURE
INSUFFICIENT_INFORMATION
LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
MATERIAL_RELEASE_OR_SHIFT
OTHER
PRESSURE_OR_STORED_ENERGY_RELEASE
SLIP_TRIP_FALL
STRUCK_AGAINST_STATIONARY_OBJECT
STRUCK_BY_MOVING_OBJECT
UNEXPECTED_EQUIPMENT_MOVEMENT
VEHICLE_OR_MOBILE_EQUIPMENT_EVENT
8 2 8 1
2 2 1
1 1 1
1
4 2 4
20
3 1 1
1 1 1
1 5
1
2 5
1 1
2 4 6 1
2 2
1
COMMUNICATION_OR_COORDINATION
ENVIRONMENTAL_CONDITION
EQUIPMENT_CONDITION_OR_FAILURE
NOT_STATED
POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
PROCEDURE_OR_WORK_METHOD
UNSTABLE_GROUND_OR_ROOF_CONDITION
UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL
Contributing-factor category
Count
20.0
17.5
15.0
12.5
10.0
7.5
5.0
2.5
0.0

Cause by Recommended Action

PRIMARY_CAU	CONDUCT_PR	ENGINEERING	IMPROVE_CO	IMPROVE_GR	IMPROVE_PPE	IMPROVE_WO	INSTALL_OR_I	INVESTIGATIO	PROVIDE_TAR	REPAIR_REPL	REVISE_PROCE	D
AWKWARD_MO	6	0	0	0	0	1	0	0	5	3	4	
CAUGHT_IN_BE	0	0	0	0	0	0	3	0	0	1	1	
ELECTRICAL_C	0	1	0	0	0	1	0	0	1	0	0	
ERGONOMIC_O	0	0	0	0	0	0	0	0	1	0	0	
GROUND_OR_F	0	2	0	1	0	1	0	0	0	6	0	
INSUFFICIENT_	0	0	0	0	0	0	0	20	0	0	0	
LOSS_OF_CON	0	0	0	0	0	0	0	0	0	5	0	
MATERIAL_REL	0	0	0	0	0	1	0	0	0	2	0	
OTHER	0	0	0	0	1	0	0	2	2	0	1	
PRESSURE_OR_	0	1	0	0	0	0	0	0	0	0	0	
SLIP_TRIP_FALL	0	0	0	0	0	5	0	0	0	2	0	
STRUCK_AGAIN	0	0	0	0	0	0	1	0	0	1	0	
STRUCK_BY_MO	0	0	2	0	0	0	0	0	0	9	2	
UNEXPECTED_I	0	0	0	0	0	0	0	0	0	4	0	
VEHICLE_OR_M	0	0	0	0	0	0	0	0	0	1	0	


Cause by Recommended Action
Cause category
AWKWARD_MOVEMENT_OR_BODY_MOTION
CAUGHT_IN_BETWEEN
ELECTRICAL_CONTACT
ERGONOMIC_OR_REPETITIVE_EXPOSURE
GROUND_OR_ROOF_FAILURE
INSUFFICIENT_INFORMATION
LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
MATERIAL_RELEASE_OR_SHIFT
OTHER
PRESSURE_OR_STORED_ENERGY_RELEASE
SLIP_TRIP_FALL
STRUCK_AGAINST_STATIONARY_OBJECT
STRUCK_BY_MOVING_OBJECT
UNEXPECTED_EQUIPMENT_MOVEMENT
VEHICLE_OR_MOBILE_EQUIPMENT_EVENT
6 1 5 3 4
3 1 1
1 1 1
1
2 1 1 6
20
5
1 2
1 2 2 1
1
5 2
1 1
2 9 2
4
1
CONDUCT_PRE_JOB_HAZARD_REVIEW
ENGINEERING_REVIEW_REQUIRED
IMPROVE_COMMUNICATION_OR_SPOTTER_USE
IMPROVE_GROUND_CONTROL_OR_SCALING
IMPROVE_PPE_OR_PROTECTIVE_EQUIPMENT
IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
INSTALL_OR_IMPROVE_GUARDING
INVESTIGATION_REQUIRED
PROVIDE_TARGETED_TRAINING
REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
REVISE_PROCEDURE_OR_JOB_PLAN
Recommended-action category
Count
20.0
17.5
15.0
12.5
10.0
7.5
5.0
2.5
0.0

Records Requiring Human Review

SOURCE_RECOR	SEVERITY_GROU	PRIMARY_CAUSI	PRIMARY_CONT	RECOMMENDED	CAUSE_SUPPOR	FACTOR_SUPPO	ACTION_SUPPOI	FACTOR_ACTION	PROCESSING_STA	ACTU
220001530005	1_FATALITY	PRESSURE_OR_ST	NOT_STATED	ENGINEERING_RE	HIGH	LOW	HIGH	True	SUCCESS	
220001960001	1_FATALITY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220012850001	1_FATALITY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220042380045	1_FATALITY	SLIP_TRIP_FALL	POOR_HOUSEKEE	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220052980006	1_FATALITY	SLIP_TRIP_FALL	NOT_STATED	IMPROVE_WORK_	HIGH	LOW	HIGH	True	SUCCESS	
220062990029	1_FATALITY	GROUND_OR_ROC	UNSTABLE_GROU	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220073550024	1_FATALITY	UNEXPECTED_EQ	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220101720027	1_FATALITY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220103070029	1_FATALITY	STRUCK_BY_MOVI	COMMUNICATION_	IMPROVE_COMMU	HIGH	HIGH	HIGH	True	SUCCESS	
220161460015	1_FATALITY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220203080009	1_FATALITY	GROUND_OR_ROC	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220203110003	1_FATALITY	STRUCK_BY_MOVI	COMMUNICATION_	IMPROVE_COMMU	HIGH	HIGH	HIGH	True	SUCCESS	
220203530009	1_FATALITY	GROUND_OR_ROC	NOT_STATED	ENGINEERING_RE	HIGH	LOW	HIGH	True	SUCCESS	
220210410011	1_FATALITY	CAUGHT_IN_BETV	UNSTABLE_OR_IM	INSTALL_OR_IMPR	HIGH	HIGH	HIGH	False	SUCCESS	
220211600020	1_FATALITY	GROUND_OR_ROC	UNSTABLE_GROU	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	

Records Requiring Human Review (continued)

SOURCE_RECOR	SEVERITY_GROU	PRIMARY_CAUSI	PRIMARY_CONT	RECOMMENDED	CAUSE_SUPPOR	FACTOR_SUPPO	ACTION_SUPPOI	FACTOR_ACTION	PROCESSING_STA	AU
220253290017	1_FATALITY	ELECTRICAL_CON	POOR_HOUSEKEE	IMPROVE_WORK_	LOW	LOW	LOW	True	SUCCESS	
220261490017	1_FATALITY	STRUCK_BY_MOVI	UNSTABLE_GROU	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220002310036	2_PERMANENT_DI	STRUCK_AGAINST	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220002560021	2_PERMANENT_DI	STRUCK_BY_MOVI	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220051860040	2_PERMANENT_DI	CAUGHT_IN_BETV	NOT_STATED	INSTALL_OR_IMPR	HIGH	LOW	HIGH	True	SUCCESS	
220052780030	2_PERMANENT_DI	SLIP_TRIP_FALL	POOR_HOUSEKEE	IMPROVE_WORK_	HIGH	HIGH	HIGH	True	SUCCESS	
220060090018	2_PERMANENT_DI	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220063490004	2_PERMANENT_DI	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220071420034	2_PERMANENT_DI	AWKWARD_MOVE	PROCEDURE_OR_	PROVIDE_TARGET	HIGH	MEDIUM	HIGH	False	SUCCESS	
220082750009	2_PERMANENT_DI	AWKWARD_MOVE	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	MEDIUM	HIGH	False	SUCCESS	
220100340004	2_PERMANENT_DI	STRUCK_BY_MOVI	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220100780003	2_PERMANENT_DI	MATERIAL_RELEA	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	MEDIUM	HIGH	False	SUCCESS	
220110320038	2_PERMANENT_DI	GROUND_OR_ROC	UNSTABLE_GROU	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220141980016	2_PERMANENT_DI	AWKWARD_MOVE	PROCEDURE_OR_	REVISE_PROCEDU	HIGH	MEDIUM	HIGH	True	SUCCESS	
220150970006	2_PERMANENT_DI	STRUCK_BY_MOVI	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	

Records Requiring Human Review (continued)

SOURCE_RECOR	SEVERITY_GROU	PRIMARY_CAUSI	PRIMARY_CONT	RECOMMENDED	CAUSE_SUPPOR	FACTOR_SUPPO	ACTION_SUPPOI	FACTOR_ACTION	PROCESSING_STA	AU
220201610001	2_PERMANENT_DI	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220250060021	2_PERMANENT_DI	AWKWARD_MOVE	NOT_STATED	CONDUCT_PRE_JO	HIGH	LOW	MEDIUM	True	SUCCESS	
220261210001	2_PERMANENT_DI	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220010460020	3_DAYS_AWAY	MATERIAL_RELEAS	UNSTABLE_OR_IM	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220051530030	3_DAYS_AWAY	STRUCK_BY_MOVI	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220052800054	3_DAYS_AWAY	STRUCK_BY_MOVI	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220060410036	3_DAYS_AWAY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220063060074	3_DAYS_AWAY	CAUGHT_IN_BETV	NOT_STATED	INSTALL_OR_IMPR	HIGH	LOW	HIGH	True	SUCCESS	
220071290009	3_DAYS_AWAY	AWKWARD_MOVE	NOT_STATED	PROVIDE_TARGET	HIGH	LOW	HIGH	True	SUCCESS	
220082100006	3_DAYS_AWAY	STRUCK_BY_MOVI	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220093360021	3_DAYS_AWAY	STRUCK_BY_MOVI	PROCEDURE_OR_	REVISE_PROCEDU	HIGH	LOW	HIGH	True	SUCCESS	
220100990012	3_DAYS_AWAY	AWKWARD_MOVE	POOR_HOUSEKEE	IMPROVE_WORK_	HIGH	HIGH	HIGH	True	SUCCESS	
220101660022	3_DAYS_AWAY	LOSS_OF_CONTRO	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220110460001	3_DAYS_AWAY	AWKWARD_MOVE	NOT_STATED	CONDUCT_PRE_JO	HIGH	LOW	HIGH	True	SUCCESS	
220132130027	3_DAYS_AWAY	AWKWARD_MOVE	NOT_STATED	CONDUCT_PRE_JO	HIGH	LOW	HIGH	True	SUCCESS	

Records Requiring Human Review (continued)

SOURCE_RECOR	SEVERITY_GROU	PRIMARY_CAUSI	PRIMARY_CONT	RECOMMENDED	CAUSE_SUPPOR	FACTOR_SUPPO	ACTION_SUPPOI	FACTOR_ACTION	PROCESSING_STA	AU
220163020007	3_DAYS_AWAY	SLIP_TRIP_FALL	POOR_HOUSEKEE	IMPROVE_WORK_	HIGH	HIGH	HIGH	True	SUCCESS	
220180020010	3_DAYS_AWAY	STRUCK_AGAINST	NOT_STATED	INSTALL_OR_IMPR	HIGH	LOW	HIGH	True	SUCCESS	
220190720007	3_DAYS_AWAY	STRUCK_BY_MOVI	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220233180018	3_DAYS_AWAY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220242290019	3_DAYS_AWAY	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220001330006	4_RESTRICTED_O	AWKWARD_MOVE	PROCEDURE_OR_	CONDUCT_PRE_JO	HIGH	HIGH	HIGH	True	SUCCESS	
220011420012	4_RESTRICTED_O	SLIP_TRIP_FALL	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220012140018	4_RESTRICTED_O	OTHER	NOT_STATED	INVESTIGATION_R	LOW	LOW	HIGH	True	SUCCESS	
220012820180	4_RESTRICTED_O	CAUGHT_IN_BETW	PROCEDURE_OR_	REVISE_PROCEDU	HIGH	HIGH	HIGH	True	SUCCESS	
220013440119	4_RESTRICTED_O	OTHER	NOT_STATED	REVISE_PROCEDU	LOW	LOW	MEDIUM	True	SUCCESS	
220040200101	4_RESTRICTED_O	STRUCK_BY_MOVI	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220051100002	4_RESTRICTED_O	AWKWARD_MOVE	PROCEDURE_OR_	PROVIDE_TARGET	HIGH	HIGH	HIGH	False	SUCCESS	
220130350040	4_RESTRICTED_O	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220133010009	4_RESTRICTED_O	AWKWARD_MOVE	POOR_HOUSEKEE	REPAIR_REPLACE_	HIGH	LOW	HIGH	False	SUCCESS	
220150140007	4_RESTRICTED_O	VEHICLE_OR_MOB	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	

Records Requiring Human Review (continued)

SOURCE_RECOR	SEVERITY_GROU	PRIMARY_CAUSI	PRIMARY_CONT	RECOMMENDED	CAUSE_SUPPOR	FACTOR_SUPPO	ACTION_SUPPOI	FACTOR_ACTION	PROCESSING_STA	AU
220151350022	4_RESTRICTED_O	ERGONOMIC_OR_	NOT_STATED	PROVIDE_TARGET	HIGH	LOW	HIGH	True	SUCCESS	
220152400099	4_RESTRICTED_O	AWKWARD_MOVE	NOT_STATED	REVISE_PROCEDU	HIGH	LOW	HIGH	True	SUCCESS	
220171170001	4_RESTRICTED_O	OTHER	NOT_STATED	PROVIDE_TARGET	LOW	LOW	HIGH	True	SUCCESS	
220180080020	4_RESTRICTED_O	LOSS_OF_CONTRO	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	MEDIUM	HIGH	False	SUCCESS	
220180860003	4_RESTRICTED_O	AWKWARD_MOVE	UNSTABLE_OR_IM	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220212740023	4_RESTRICTED_O	CAUGHT_IN_BETW	PROCEDURE_OR_	REPAIR_REPLACE_	HIGH	HIGH	HIGH	False	SUCCESS	
220223350003	4_RESTRICTED_O	AWKWARD_MOVE	NOT_STATED	CONDUCT_PRE_JO	HIGH	LOW	HIGH	True	SUCCESS	
220243050001	4_RESTRICTED_O	AWKWARD_MOVE	NOT_STATED	CONDUCT_PRE_JO	HIGH	LOW	HIGH	True	SUCCESS	
220261420003	4_RESTRICTED_O	AWKWARD_MOVE	NOT_STATED	PROVIDE_TARGET	HIGH	LOW	HIGH	True	SUCCESS	
220000380081	5_NO_LOST_TIME_	GROUND_OR_ROO	POOR_HOUSEKEE	IMPROVE_GROUN	HIGH	MEDIUM	HIGH	False	SUCCESS	
220001570177	5_NO_LOST_TIME_	AWKWARD_MOVE	PROCEDURE_OR_	PROVIDE_TARGET	HIGH	MEDIUM	HIGH	False	SUCCESS	
220002620079	5_NO_LOST_TIME_	GROUND_OR_ROO	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220011300055	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220012110011	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220022960021	5_NO_LOST_TIME_	UNEXPECTED_EQ	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	

Records Requiring Human Review (continued)

SOURCE_RECOR	SEVERITY_GROU	PRIMARY_CAUSI	PRIMARY_CONT	RECOMMENDED	CAUSE_SUPPOR	FACTOR_SUPPO	ACTION_SUPPOI	FACTOR_ACTION	PROCESSING_STA	AU
220030290025	5_NO_LOST_TIME_	ELECTRICAL_CON	NOT_STATED	ENGINEERING_RE	HIGH	LOW	HIGH	True	SUCCESS	
220030840060	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220033000095	5_NO_LOST_TIME_	GROUND_OR_ROC	NOT_STATED	REPAIR_REPLACE_	HIGH	LOW	HIGH	True	SUCCESS	
220040330042	5_NO_LOST_TIME_	OTHER	NOT_STATED	PROVIDE_TARGET	LOW	LOW	HIGH	True	SUCCESS	
220090900020	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220092160035	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220101800005	5_NO_LOST_TIME_	GROUND_OR_ROC	UNSTABLE_GROU	ENGINEERING_RE	HIGH	HIGH	HIGH	True	SUCCESS	
220121110005	5_NO_LOST_TIME_	LOSS_OF_CONTRO	EQUIPMENT_CON	REPAIR_REPLACE_	HIGH	HIGH	HIGH	True	SUCCESS	
220151190100	5_NO_LOST_TIME_	OTHER	NOT_STATED	INVESTIGATION_R	LOW	LOW	HIGH	True	SUCCESS	
220162160021	5_NO_LOST_TIME_	OTHER	ENVIRONMENTAL_	IMPROVE_PPE_OR	HIGH	HIGH	HIGH	True	SUCCESS	
220163090038	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220211580015	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	
220212040019	5_NO_LOST_TIME_	INSUFFICIENT_INF	NOT_STATED	INVESTIGATION_R	LOW	LOW	LOW	False	FAILED	

All Record Classifications

SOURCE_RECORD_ID	SEVERITY_GROUP	PRIMARY_CAUSE_CATE	PRIMARY_CONTRIBUTI	RECOMMENDED_ACTIO	REVIEW_REQUIRED	PROCESSING_STATUS
220000310001	1_FATALITY	STRUCK_BY_MOVING_OBJ	PROCEDURE_OR_WORK_I	REVISE_PROCEDURE_OR_	False	SUCCESS
220001530005	1_FATALITY	PRESSURE_OR_STORED_I	NOT_STATED	ENGINEERING_REVIEW_R	True	SUCCESS
220001960001	1_FATALITY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220012850001	1_FATALITY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220020280001	1_FATALITY	UNEXPECTED_EQUIPMEN	EQUIPMENT_CONDITION_	REPAIR_REPLACE_OR_INS	False	SUCCESS
220042380045	1_FATALITY	SLIP_TRIP_FALL	POOR_HOUSEKEEPING_O	REPAIR_REPLACE_OR_INS	True	SUCCESS
220052980006	1_FATALITY	SLIP_TRIP_FALL	NOT_STATED	IMPROVE_WORK_SURFAC	True	SUCCESS
220062990029	1_FATALITY	GROUND_OR_ROOF_FAILU	UNSTABLE_GROUND_OR_	REPAIR_REPLACE_OR_INS	True	SUCCESS
220073550024	1_FATALITY	UNEXPECTED_EQUIPMEN	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220101720027	1_FATALITY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220103070029	1_FATALITY	STRUCK_BY_MOVING_OBJ	COMMUNICATION_OR_CO	IMPROVE_COMMUNICATIO	True	SUCCESS
220161460015	1_FATALITY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220192110010	1_FATALITY	LOSS_OF_CONTROL_OF_T	EQUIPMENT_CONDITION_	REPAIR_REPLACE_OR_INS	False	SUCCESS
220203080009	1_FATALITY	GROUND_OR_ROOF_FAILU	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220203110003	1_FATALITY	STRUCK_BY_MOVING_OBJ	COMMUNICATION_OR_CO	IMPROVE_COMMUNICATIO	True	SUCCESS
220203530009	1_FATALITY	GROUND_OR_ROOF_FAILU	NOT_STATED	ENGINEERING_REVIEW_R	True	SUCCESS
220210410011	1_FATALITY	CAUGHT_IN_BETWEEN	UNSTABLE_OR_IMPROPEF	INSTALL_OR_IMPROVE_GU	True	SUCCESS
220211600020	1_FATALITY	GROUND_OR_ROOF_FAILU	UNSTABLE_GROUND_OR_	REPAIR_REPLACE_OR_INS	True	SUCCESS

All Record Classifications (continued)

SOURCE_RECORD_ID	SEVERITY_GROUP	PRIMARY_CAUSE_CATE	PRIMARY_CONTRIBUTI	RECOMMENDED_ACTIO	REVIEW_REQUIRED	PROCESSING_STATUS
220253290017	1_FATALITY	ELECTRICAL_CONTACT	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	True	SUCCESS
220261490017	1_FATALITY	STRUCK_BY_MOVING_OBJ	UNSTABLE_GROUND_OR_	REPAIR_REPLACE_OR_INS	True	SUCCESS
220002310036	2_PERMANENT_DISABILIT	STRUCK_AGAINST_STATIC	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220002560021	2_PERMANENT_DISABILIT	STRUCK_BY_MOVING_OBJ	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220011440009	2_PERMANENT_DISABILIT	AWKWARD_MOVEMENT_O	PROCEDURE_OR_WORK_I	REVISE_PROCEDURE_OR_	False	SUCCESS
220051860040	2_PERMANENT_DISABILIT	CAUGHT_IN_BETWEEN	NOT_STATED	INSTALL_OR_IMPROVE_GU	True	SUCCESS
220052780030	2_PERMANENT_DISABILIT	SLIP_TRIP_FALL	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	True	SUCCESS
220060090018	2_PERMANENT_DISABILIT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220063490004	2_PERMANENT_DISABILIT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220071420034	2_PERMANENT_DISABILIT	AWKWARD_MOVEMENT_O	PROCEDURE_OR_WORK_I	PROVIDE_TARGETED_TRA	True	SUCCESS
220082750009	2_PERMANENT_DISABILIT	AWKWARD_MOVEMENT_O	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220100340004	2_PERMANENT_DISABILIT	STRUCK_BY_MOVING_OBJ	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220100780003	2_PERMANENT_DISABILIT	MATERIAL_RELEASE_OR_S	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220110320038	2_PERMANENT_DISABILIT	GROUND_OR_ROOF_FAILU	UNSTABLE_GROUND_OR_	REPAIR_REPLACE_OR_INS	True	SUCCESS
220141980016	2_PERMANENT_DISABILIT	AWKWARD_MOVEMENT_O	PROCEDURE_OR_WORK_I	REVISE_PROCEDURE_OR_	True	SUCCESS
220150970006	2_PERMANENT_DISABILIT	STRUCK_BY_MOVING_OBJ	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220180390004	2_PERMANENT_DISABILIT	SLIP_TRIP_FALL	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	False	SUCCESS
220182710020	2_PERMANENT_DISABILIT	LOSS_OF_CONTROL_OF_T	EQUIPMENT_CONDITION_	REPAIR_REPLACE_OR_INS	False	SUCCESS

All Record Classifications (continued)

SOURCE_RECORD_ID	SEVERITY_GROUP	PRIMARY_CAUSE_CATE	PRIMARY_CONTRIBUTI	RECOMMENDED_ACTIO	REVIEW_REQUIRED	PROCESSING_STATUS
220201610001	2_PERMANENT_DISABILIT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220240670016	2_PERMANENT_DISABILIT	AWKWARD_MOVEMENT_C	PROCEDURE_OR_WORK_I	REVISE_PROCEDURE_OR_	False	SUCCESS
220250060021	2_PERMANENT_DISABILIT	AWKWARD_MOVEMENT_C	NOT_STATED	CONDUCT_PRE_JOB_HAZA	True	SUCCESS
220261210001	2_PERMANENT_DISABILIT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220010460020	3_DAYS_AWAY	MATERIAL_RELEASE_OR_S	UNSTABLE_OR_IMPROPEF	REPAIR_REPLACE_OR_INS	True	SUCCESS
220031900010	3_DAYS_AWAY	MATERIAL_RELEASE_OR_S	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	False	SUCCESS
220051530030	3_DAYS_AWAY	STRUCK_BY_MOVING_OBJ	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220052800054	3_DAYS_AWAY	STRUCK_BY_MOVING_OBJ	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220060410036	3_DAYS_AWAY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220063060074	3_DAYS_AWAY	CAUGHT_IN_BETWEEN	NOT_STATED	INSTALL_OR_IMPROVE_GU	True	SUCCESS
220071290009	3_DAYS_AWAY	AWKWARD_MOVEMENT_C	NOT_STATED	PROVIDE_TARGETED_TRA	True	SUCCESS
220082100006	3_DAYS_AWAY	STRUCK_BY_MOVING_OBJ	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220093360021	3_DAYS_AWAY	STRUCK_BY_MOVING_OBJ	PROCEDURE_OR_WORK_I	REVISE_PROCEDURE_OR_	True	SUCCESS
220100990012	3_DAYS_AWAY	AWKWARD_MOVEMENT_C	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	True	SUCCESS
220101660022	3_DAYS_AWAY	LOSS_OF_CONTROL_OF_T	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220110460001	3_DAYS_AWAY	AWKWARD_MOVEMENT_C	NOT_STATED	CONDUCT_PRE_JOB_HAZA	True	SUCCESS
220111150019	3_DAYS_AWAY	GROUND_OR_ROOF_FAILU	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	False	SUCCESS
220132130027	3_DAYS_AWAY	AWKWARD_MOVEMENT_C	NOT_STATED	CONDUCT_PRE_JOB_HAZA	True	SUCCESS

All Record Classifications (continued)

SOURCE_RECORD_ID	SEVERITY_GROUP	PRIMARY_CAUSE_CATE	PRIMARY_CONTRIBUTI	RECOMMENDED_ACTIO	REVIEW_REQUIRED	PROCESSING_STATUS
220163020007	3_DAYS_AWAY	SLIP_TRIP_FALL	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	True	SUCCESS
220180020010	3_DAYS_AWAY	STRUCK_AGAINST_STATIC	NOT_STATED	INSTALL_OR_IMPROVE_GU	True	SUCCESS
220190720007	3_DAYS_AWAY	STRUCK_BY_MOVING_OBJ	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220220610014	3_DAYS_AWAY	SLIP_TRIP_FALL	POOR_HOUSEKEEPING_O	IMPROVE_WORK_SURFAC	False	SUCCESS
220233180018	3_DAYS_AWAY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220242290019	3_DAYS_AWAY	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220001330006	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_O	PROCEDURE_OR_WORK_I	CONDUCT_PRE_JOB_HAZA	True	SUCCESS
220011420012	4_RESTRICTED_OR_TRAN	SLIP_TRIP_FALL	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220012140018	4_RESTRICTED_OR_TRAN	OTHER	NOT_STATED	INVESTIGATION_REQUIRE	True	SUCCESS
220012820180	4_RESTRICTED_OR_TRAN	CAUGHT_IN_BETWEEN	PROCEDURE_OR_WORK_I	REVISE_PROCEDURE_OR_	True	SUCCESS
220013440119	4_RESTRICTED_OR_TRAN	OTHER	NOT_STATED	REVISE_PROCEDURE_OR_	True	SUCCESS
220021540078	4_RESTRICTED_OR_TRAN	ELECTRICAL_CONTACT	ENVIRONMENTAL_CONDI	PROVIDE_TARGETED_TRA	False	SUCCESS
220040200101	4_RESTRICTED_OR_TRAN	STRUCK_BY_MOVING_OBJ	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220051100002	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_O	PROCEDURE_OR_WORK_I	PROVIDE_TARGETED_TRA	True	SUCCESS
220130350040	4_RESTRICTED_OR_TRAN	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220133010009	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_O	POOR_HOUSEKEEPING_O	REPAIR_REPLACE_OR_INS	True	SUCCESS
220150140007	4_RESTRICTED_OR_TRAN	VEHICLE_OR_MOBILE_EQ	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220151350022	4_RESTRICTED_OR_TRAN	ERGONOMIC_OR_REPETIT	NOT_STATED	PROVIDE_TARGETED_TRA	True	SUCCESS

All Record Classifications (continued)

SOURCE_RECORD_ID	SEVERITY_GROUP	PRIMARY_CAUSE_CATE	PRIMARY_CONTRIBUTI	RECOMMENDED_ACTIO	REVIEW_REQUIRED	PROCESSING_STATUS
220152400099	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_C	NOT_STATED	REVISE_PROCEDURE_OR_	True	SUCCESS
220171170001	4_RESTRICTED_OR_TRAN	OTHER	NOT_STATED	PROVIDE_TARGETED_TRA	True	SUCCESS
220180080020	4_RESTRICTED_OR_TRAN	LOSS_OF_CONTROL_OF_T	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220180860003	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_C	UNSTABLE_OR_IMPROPEF	REPAIR_REPLACE_OR_INS	True	SUCCESS
220212740023	4_RESTRICTED_OR_TRAN	CAUGHT_IN_BETWEEN	PROCEDURE_OR_WORK_I	REPAIR_REPLACE_OR_INS	True	SUCCESS
220223350003	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_C	NOT_STATED	CONDUCT_PRE_JOB_HAZA	True	SUCCESS
220243050001	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_C	NOT_STATED	CONDUCT_PRE_JOB_HAZA	True	SUCCESS
220261420003	4_RESTRICTED_OR_TRAN	AWKWARD_MOVEMENT_C	NOT_STATED	PROVIDE_TARGETED_TRA	True	SUCCESS
220000380081	5_NO_LOST_TIME_OR_OT	GROUND_OR_ROOF_FAILU	POOR_HOUSEKEEPING_O	IMPROVE_GROUND_CONT	True	SUCCESS
220001570177	5_NO_LOST_TIME_OR_OT	AWKWARD_MOVEMENT_C	PROCEDURE_OR_WORK_I	PROVIDE_TARGETED_TRA	True	SUCCESS
220002620079	5_NO_LOST_TIME_OR_OT	GROUND_OR_ROOF_FAILU	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220011300055	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220012110011	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220022960021	5_NO_LOST_TIME_OR_OT	UNEXPECTED_EQUIPMEN	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220030290025	5_NO_LOST_TIME_OR_OT	ELECTRICAL_CONTACT	NOT_STATED	ENGINEERING_REVIEW_R	True	SUCCESS
220030840060	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220033000095	5_NO_LOST_TIME_OR_OT	GROUND_OR_ROOF_FAILU	NOT_STATED	REPAIR_REPLACE_OR_INS	True	SUCCESS
220040330042	5_NO_LOST_TIME_OR_OT	OTHER	NOT_STATED	PROVIDE_TARGETED_TRA	True	SUCCESS

All Record Classifications (continued)

SOURCE_RECORD_ID	SEVERITY_GROUP	PRIMARY_CAUSE_CATE	PRIMARY_CONTRIBUTI	RECOMMENDED_ACTIO	REVIEW_REQUIRED	PROCESSING_STATUS
220090900020	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220092160035	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220101800005	5_NO_LOST_TIME_OR_OT	GROUND_OR_ROOF_FAILU	UNSTABLE_GROUND_OR_	ENGINEERING_REVIEW_R	True	SUCCESS
220121110005	5_NO_LOST_TIME_OR_OT	LOSS_OF_CONTROL_OF_T	EQUIPMENT_CONDITION_	REPAIR_REPLACE_OR_INS	True	SUCCESS
220151190100	5_NO_LOST_TIME_OR_OT	OTHER	NOT_STATED	INVESTIGATION_REQUIRE	True	SUCCESS
220162160021	5_NO_LOST_TIME_OR_OT	OTHER	ENVIRONMENTAL_CONDI	IMPROVE_PPE_OR_PROTE	True	SUCCESS
220163090038	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220163540019	5_NO_LOST_TIME_OR_OT	UNEXPECTED_EQUIPMEN	EQUIPMENT_CONDITION_	REPAIR_REPLACE_OR_INS	False	SUCCESS
220211580015	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED
220212040019	5_NO_LOST_TIME_OR_OT	INSUFFICIENT_INFORMAT	NOT_STATED	INVESTIGATION_REQUIRE	True	FAILED

Detailed Classification - 220000310001

Record 1 of 100

Source record ID: 220000310001
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: MACHINERY
MSHA accident type: Struck by... NEC
Coal/metal indicator: M
Narrative characters: 120
Narrative may be truncated: False

FULL NARRATIVE

DEMOLITION OF STEEL STRUCTURE USING CUT PULL AND DROP METHOD. A PIECE BECAME LOOSE AND ROLLED UNTIL IT HIT THE DECEASED.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: A piece became loose and rolled until it hit the deceased.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: DEMOLITION OF STEEL STRUCTURE USING CUT PULL AND DROP METHOD

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent loose pieces from rolling and striking workers.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.174

Detailed Classification - 220001530005

Record 2 of 100

Source record ID: 220001530005
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: IGNITION OR EXPLOSION OF GAS OR DUST
MSHA accident type: Contact with hot objects or substances
Coal/metal indicator: C
Narrative characters: 226
Narrative may be truncated: False

FULL NARRATIVE

EMPLOYEE CONTACTED A 20 INCH HIGH PRESSURE GAS LINE WITH HIS LOADER BUCKET WHILE REMOVING OVERBURDEN. AN EXPLOSION OCCURRED IN WHICH HE WAS BURNED WHILE TRYING TO GET AWAY. HE PASSED AWAY AS A RESULT OF THESE BURNS ON 5-19-00.

LLM CLASSIFICATION

Primary cause: PRESSURE_OR_STORED_ENERGY_RELEASE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: EMPLOYEE CONTACTED A 20 INCH HIGH PRESSURE GAS LINE WITH HIS LOADER BUCKET

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: ENGINEERING_REVIEW_REQUIRED
Action support: HIGH
Action confidence: 1.0
Action rationale: An engineering review is needed to identify and mitigate the risk of contact with high-pressure gas lines.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.315

Detailed Classification - 220001960001

Record 3 of 100

Source record ID: 220001960001
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: MACHINERY
MSHA accident type: Struck against stationary object
Coal/metal indicator: M
Narrative characters: 329
Narrative may be truncated: False

FULL NARRATIVE

A FATAL ACCIDENT OCCURRED ON OR NEAR THIS CLAIM WHEN A BULLDOZER OVERTURNED ON A STEEP GRADE. ACCORDING TO WHITNESSES THE INDPENDENT CONTRACTOR BECAME OVERLY AGGRESSIVE. ATTEMPTING TO PUSH A B OULDER DOWN A HILL LOSING CONTROL OF THE DOZER. INVETIGATES INDICATE THE DRIVER WAS NOT WEARING A SEAT BELT AT THE TIME OF THE ACCIDENT.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, Invalid recommended-action category: REQUIRE_USE_OF_PERSONAL_PROTECTIVE_EQUIPMENT [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 49.457

Detailed Classification - 220012850001

Record 4 of 100

Source record ID: 220012850001
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: ELECTRICAL
MSHA accident type: Contact with electrical current
Coal/metal indicator: M
Narrative characters: 84
Narrative may be truncated: False

FULL NARRATIVE

INDIVIDUAL CAME INTO CONTACT WITH OVERHEAD POWERLINE CAUSING DEATH BY ELECTRICUTION.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 39.115

Detailed Classification - 220020280001

Record 5 of 100

Source record ID: 220020280001
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: C
Narrative characters: 199
Narrative may be truncated: False

FULL NARRATIVE

WORKER WAS OPERATING A CAT D60 DOZER AND WAS MAKING A PAD TO PLACE A 6" GORMAN-RUPP WATER PUMP ON. DOZER TILTED OVER, WORKER WAS PINNED UNDER DOZER. HE RECEIVED MASSIVE INJURIES FROM WEIGHT OF DOZER.

LLM CLASSIFICATION

Primary cause: UNEXPECTED_EQUIPMENT_MOVEMENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: DOZER TILTED OVER, WORKER WAS PINNED UNDER DOZER

Primary contributing factor: EQUIPMENT_CONDITION_OR_FAILURE
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: DOZER TILTED OVER, WORKER WAS PINNED UNDER DOZER

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the dozer to prevent unexpected movements.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 28.136

Detailed Classification - 220042380045

Record 6 of 100

Source record ID: 220042380045
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall to lower level, NEC
Coal/metal indicator: M
Narrative characters: 381
Narrative may be truncated: False

FULL NARRATIVE
---
(3) MINERS WERE WORKING TO INSTALL & MOVE A NEW CONVEYOR BELT. PILAR WAS FEEDING THE BELT OFF THE ROLL TOWARD THE HEAD PULLEY. VICTIM WAS PULLING THE BELTING TOWARDS THE TAIL PULLEY WITH A 3/4" ROPE ATTACHED TO THE LACING HOLES W/3 STRANDS OF WIRE. THE PULL ROPE DETACHED FROM THE WIRE & HE FELL BACKWARDS ONTO A CONCRETE SLAB. HE WAS 12'ABOVE THE GROUND, FALL PROTECTION NOT WORN.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: False
Cause evidence: "THE PULL ROPE DETACHED FROM THE WIRE & HE FELL BACKWARDS"

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 0.8
Factor evidence valid: False
Factor evidence: "HE FELL BACKWARDS ONTO A CONCRETE SLAB"

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.9
Action rationale: Repair or inspect the pull rope to prevent detachment.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.822

Detailed Classification - 220052980006

Record 7 of 100

Source record ID: 220052980006
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall to lower level, NEC
Coal/metal indicator: M
Narrative characters: 270
Narrative may be truncated: False

FULL NARRATIVE

Employee was looking at sump pump with another employee. He fell backwards through an open hole, falling about 12 ft. into the sump, hitting the back of his head on the way down. He was transported by company ambulance to NNRH ER where he was pronounced dead on arrival.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: Employee fell backwards through an open hole, falling about 12 ft. into the sump.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: Improve housekeeping to ensure all openings are properly covered or guarded.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.018

Detailed Classification - 220062990029

Record 8 of 100

Source record ID: 220062990029
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: FALL OF FACE/RIB/PILLAR/SIDE/HIGHWALL
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 373
Narrative may be truncated: False

FULL NARRATIVE

The miner operator on the east mains, left section, MMU 007-0, received fatal crushing injuries when portions of the right rib and corner fell unexpectedly. This occurred suddenly while the miner operator was cleaning the second cut in the 5 to 6 crosscut. The rib anomaly was approx 8.5' X 4.5' X 4.5' in the 5 to 6 crosscut and fell pinning operator against shuttle car.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: rib anomaly was approx 8.5' X 4.5' X 4.5' in the 5 to 6 crosscut and fell pinning operator against shuttle car

Primary contributing factor: UNSTABLE_GROUND_OR_ROOF_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: rib anomaly was approx 8.5' X 4.5' X 4.5' in the 5 to 6 crosscut and fell pinning operator against shuttle car

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the unstable rib to prevent future collapses

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 16.719

Detailed Classification - 220073550024

Record 9 of 100

Source record ID: 220073550024
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: POWERED HAULAGE
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: C
Narrative characters: 381
Narrative may be truncated: False

FULL NARRATIVE

A truck got stuck. The loader backed up to the truck to pull it out. The loader operator and the truck operator both got out to hook the chain up. The loader rolled back and crushed the truck operator between the truck and loader. THIS PERSON IS NOT AN EMPLOYEE OF OURS, WE DO NOT HAVE HIS INFORMATION. The loader impacted the loader operator in the back, he moved out of the way.

LLM CLASSIFICATION

Primary cause: UNEXPECTED_EQUIPMENT_MOVEMENT
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: The loader rolled back and crushed the truck operator between the truck and loader.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.8
Action rationale: Inspect and secure the loader to prevent unexpected movement.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 40.026

Detailed Classification - 220101720027

Record 10 of 100

Source record ID: 220101720027
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Struck by falling object
Coal/metal indicator: M
Narrative characters: 74
Narrative may be truncated: False

FULL NARRATIVE

Employee was barring down in raise, when a slab fell and crushed employee.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 39.686

Detailed Classification - 220103070029

Record 11 of 100

Source record ID: 220103070029
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: POWERED HAULAGE
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: M
Narrative characters: 170
Narrative may be truncated: False

FULL NARRATIVE

Haul truck was dumping a load of dirt when the dozer operator approched from blind side to get driver's attention when he was struck by the truck and was fatally injured.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: haul truck was dumping a load of dirt when the dozer operator approached from blind side to get driver's attention when he was struck by the truck and was fatally injured

Primary contributing factor: COMMUNICATION_OR_COORDINATION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: dozer operator approached from blind side to get driver's attention

Recommended action: IMPROVE_COMMUNICATION_OR_SPOTTER_USE
Action support: HIGH
Action confidence: 1.0
Action rationale: Improving communication and using a spotter can prevent similar incidents

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.559

Detailed Classification - 220161460015

Record 12 of 100

Source record ID: 220161460015
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: POWERED HAULAGE
MSHA accident type: Struck against stationary object
Coal/metal indicator: C
Narrative characters: 108
Narrative may be truncated: False

FULL NARRATIVE

Diesel Motor operator was found on the motor unresponsive, the exact cause of death is unknown at this time.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'....', 'reviewer_note': ''}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 37.246

Detailed Classification - 220192110010

Record 13 of 100

Source record ID: 220192110010
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: MACHINERY
MSHA accident type: Struck by falling object
Coal/metal indicator: M
Narrative characters: 267
Narrative may be truncated: False

FULL NARRATIVE

Workers removing a jaw crusher motor. As the hammer attachment was being positioned towards the crusher motor, the hydraulic hammer attachment fell from the excavator quick coupler. The hammer attachment struck the victim in the head pining them to the work platform.

LLM CLASSIFICATION

Primary cause: LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: hydraulic hammer attachment fell from the excavator quick coupler

Primary contributing factor: EQUIPMENT_CONDITION_OR_FAILURE
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: hydraulic hammer attachment fell from the excavator quick coupler

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Repair or inspect the excavator quick coupler to prevent future failures.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.494

Detailed Classification - 220203080009

Record 14 of 100

Source record ID: 220203080009
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 49
Narrative may be truncated: False

FULL NARRATIVE

Feather edge false roof fall resulting in a death

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Feather edge false roof fall

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the roof to prevent future falls.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 24.444

Detailed Classification - 220203110003

Record 15 of 100

Source record ID: 220203110003
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: M
Narrative characters: 267
Narrative may be truncated: False

FULL NARRATIVE

Task was to remove screen flare. Employee was loosening bolts, changed work location, dangerously close to excavator, without warning or eye contact with excavator operator. Excavator rotated, bucket of excavator struck employee in the upper chest resulting in death.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Excavator rotated, bucket of excavator struck employee in the upper chest resulting in death.

Primary contributing factor: COMMUNICATION_OR_COORDINATION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: Employee was dangerously close to excavator, without warning or eye contact with excavator operator.

Recommended action: IMPROVE_COMMUNICATION_OR_SPOTTER_USE
Action support: HIGH
Action confidence: 1.0
Action rationale: To improve communication and coordination between workers and machinery operators.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.859

Detailed Classification - 220203530009

Record 16 of 100

Source record ID: 220203530009
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Struck by falling object
Coal/metal indicator: M
Narrative characters: 102
Narrative may be truncated: False

FULL NARRATIVE

Roof fell at the 700' level at intersection H-13 striking two miners. The miners were fatally injured.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Roof fell at the 700' level at intersection H-13 striking two miners.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: ENGINEERING_REVIEW_REQUIRED
Action support: HIGH
Action confidence: 1.0
Action rationale: An engineering review is needed to determine the cause of the roof fall and prevent future occurrences.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 26.831

Detailed Classification - 220210410011

Record 17 of 100

Source record ID: 220210410011
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: POWERED HAULAGE
MSHA accident type: Caught in, under or between running or meshing objects
Coal/metal indicator: M
Narrative characters: 63
Narrative may be truncated: False

FULL NARRATIVE

Miner removed an area guard and got entangled in a tail pulley.

LLM CLASSIFICATION

Primary cause: CAUGHT_IN_BETWEEN
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Miner removed an area guard and got entangled in a tail pulley.

Primary contributing factor: UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: Miner removed an area guard

Recommended action: INSTALL_OR_IMPROVE_GUARDING
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future entanglements, the guard should be reinstalled and improved.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.42

Detailed Classification - 220211600020

Record 18 of 100

Source record ID: 220211600020
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: FALL OF FACE/RIB/PILLAR/SIDE/HIGHWALL
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 274
Narrative may be truncated: False

FULL NARRATIVE

An EE was fatally injured when coal and rock material fell from the mine rib while rib bolting, and pinned the injured against the continuous mining machine. The rock and coal material measured approximately 6.3'x3.2'x2.0'. The miner was trained in the task being performed.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: coal and rock material fell from the mine rib while rib bolting, and pinned the injured against the continuous mining machine.

Primary contributing factor: UNSTABLE_GROUND_OR_ROOF_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: The rock and coal material measured approximately 6.3'x3.2'x2.0'.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the rib bolting equipment to prevent future material falls.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 29.305

Detailed Classification - 220253290017

Record 19 of 100

Source record ID: 220253290017
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by falling object
Coal/metal indicator: M
Narrative characters: 191
Narrative may be truncated: False

FULL NARRATIVE

The employee was pressure washing silo #6 and was found with their head and right arm in the silo with salt buildup on their head and right arm. The employee was pronounced dead at the scene.

LLM CLASSIFICATION

Primary cause: ELECTRICAL_CONTACT
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence: salt buildup on their head and right arm

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence: salt buildup on their head and right arm

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: LOW
Action confidence: 0.0
Action rationale: Improve housekeeping to reduce the presence of salt and other debris.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.008

Detailed Classification - 220261490017

Record 20 of 100

Source record ID: 220261490017
Severity group: 1_FATALITY
Degree of injury: FATALITY
MSHA classification: FALL OF FACE/RIB/PILLAR/SIDE/HIGHWALL
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 284
Narrative may be truncated: False

FULL NARRATIVE

Employee was setting a post at 24xcut in 7 South #6 track entry, to barricade off an area of concern. While tightening up a post a piece of rock dislodged from the upper portion of the rib and fell striking the employee. The employee suffered fatal injuries as a result of this event.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: While tightening up a post a piece of rock dislodged from the upper portion of the rib and fell striking the employee.

Primary contributing factor: UNSTABLE_GROUND_OR_ROOF_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: The rock dislodged from the upper portion of the rib.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and secure loose or unstable rock to prevent future dislodgement.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.295

Detailed Classification - 220002310036

Record 21 of 100

Source record ID: 220002310036
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Caught in, under or between NEC
Coal/metal indicator: M
Narrative characters: 191
Narrative may be truncated: False

FULL NARRATIVE

ON SOUTH END HALF DECK OF PRESS FLOOR, TAKING DOWN AN AIR BLOW DOWN POT, WHEN IT ROLLED AND JAMMED HIS RIGHT INDEX FINGER AGAINST THE MID BAR OF THE HAND RAIL. DISTAL TIP OF FINGER AMPUTATED.

LLM CLASSIFICATION

Primary cause: STRUCK_AGAINST_STATIONARY_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: TAKING DOWN AN AIR BLOW DOWN POT, WHEN IT ROLLED AND JAMMED HIS RIGHT INDEX FINGER AGAINST THE MID BAR OF THE HAND RAIL.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: TAKING DOWN AN AIR BLOW DOWN POT, WHEN IT ROLLED AND JAMMED HIS RIGHT INDEX FINGER AGAINST THE MID BAR OF THE HAND RAIL.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the hand rail to prevent future jams.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 16.156

Detailed Classification - 220002560021

Record 22 of 100

Source record ID: 220002560021
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 151
Narrative may be truncated: False

FULL NARRATIVE

THE INJURED WAS OPERATING THE CONT. MNER WITH A REMOTE BOX AND SITTING UNDER A KETTLE BOTTOM. THE KETTLE BOTTOM FELL STRIKING HIM IN THE HAND & FINGER.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: THE KETTLE BOTTOM FELL STRIKING HIM IN THE HAND & FINGER.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Repair or inspect the kettle bottom to prevent future failures.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 26.06

Detailed Classification - 220011440009

Record 23 of 100

Source record ID: 220011440009
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: MACHINERY
MSHA accident type: Struck by... NEC
Coal/metal indicator: M
Narrative characters: 85
Narrative may be truncated: False

FULL NARRATIVE

EMPLOYEE REPORTS WHILE UNPINNING DIVERTER CHUTE, SOMETHING SLIPPED, SMASHING FINGERS.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: MEDIUM
Cause confidence: 0.8
Cause evidence valid: True
Cause evidence: EMPLOYEE REPORTS WHILE UNPINNING DIVERTER CHUTE, SOMETHING SLIPPED, SMASHING FINGERS.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: EMPLOYEE REPORTS WHILE UNPINNING DIVERTER CHUTE, SOMETHING SLIPPED, SMASHING FINGERS.

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: MEDIUM
Action confidence: 0.8
Action rationale: Need to revise procedure to prevent awkward movements during unpinning.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 15.242

Detailed Classification - 220051860040

Record 24 of 100

Source record ID: 220051860040
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between NEC
Coal/metal indicator: C
Narrative characters: 107
Narrative may be truncated: False

FULL NARRATIVE

WHILE PUTTING UP ROOF BOLTS, EMPLOYEE GOT HIS LITTLE FINGER CAUGHT IN CLAMP THAT HOLDS ROOF BOLTS IN PLACE.

LLM CLASSIFICATION

Primary cause: CAUGHT_IN_BETWEEN
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: WHILE PUTTING UP ROOF BOLTS, EMPLOYEE GOT HIS LITTLE FINGER CAUGHT IN CLAMP THAT HOLDS ROOF BOLTS IN PLACE.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: INSTALL_OR_IMPROVE_GUARDING
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future finger entanglements, improve guarding around the bolt clamps.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.736

Detailed Classification - 220052780030

Record 25 of 100

Source record ID: 220052780030
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 350
Narrative may be truncated: False

FULL NARRATIVE

Ee was carrying a acetylene bottle from last open break toward tool cars. He tripped over half header and fell face first toward the mine floor. The actylene bottle fell against ee rt. hand.His rt middle finger was cut off at 1st joint and his rt. ring finger was cut and mashed. Finger was put in ice and sent to hospital. Unable to reattach finger.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: He tripped over half header and fell face first toward the mine floor.

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: Half header on the ground causing him to trip.

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: Improve the work surface to reduce tripping hazards.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.431

Detailed Classification - 220060090018

Record 26 of 100

Source record ID: 220060090018
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in pulling or pushing objects
Coal/metal indicator: C
Narrative characters: 360
Narrative may be truncated: False

FULL NARRATIVE

Employee was helping move dragline trail cable & was pulling on rope holding cable to attach to hilift when he felt a pain/tear in right side groin. Stated he already had a hernia condition before this injury. This accident was not reportable until surgery was required by a doctor on a visit on 1/3/06. Surgery scheduled for 1/20/06, will result in loss time.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 46.148

Detailed Classification - 220063490004

Record 27 of 100

Source record ID: 220063490004
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in pulling or pushing objects
Coal/metal indicator: C
Narrative characters: 168
Narrative may be truncated: False

FULL NARRATIVE

Became a lost time accident on 12/12/2006. Employee was moving a miner cable when he felt pain an hour later, worked until 12/01/2006 before seeking medical attention.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, Invalid primary cause category: [type=value_error, input_value={'primary_cause_category'... or recommend actions.'}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 35.563

Detailed Classification - 220071420034

Record 28 of 100

Source record ID: 220071420034
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 312
Narrative may be truncated: False

FULL NARRATIVE

Employee was helping mechanic move some 10" x 10" x 4" wood blocks that was blocking tires while he was using to chock wheels. He said that he felt something pull but did not think it was anything until next day. Sent him to the Dr. They said pulled muscle. Then on 5/16/07, he went back and they found a hernia.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.8
Cause evidence valid: True
Cause evidence: Employee was helping mechanic move some 10" x 10" x 4" wood blocks that was blocking tires while he was using to chock wheels.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.7
Factor evidence valid: True
Factor evidence: He said that he felt something pull but did not think it was anything until next day.

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.9
Action rationale: To prevent future muscle pulls and hernias, provide targeted training on proper lifting techniques and chocking procedures.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 15.616

Detailed Classification - 220082750009

Record 29 of 100

Source record ID: 220082750009
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 233
Narrative may be truncated: False

FULL NARRATIVE

When attempting to raise the top cover of the belt tail piece, it slipped out of employee's hands causing it to fall on his left hand that resulted in an injury that required amputation of the distal phalange of his left ring finger.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: When attempting to raise the top cover of the belt tail piece, it slipped out of employee's hands

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: employee's hands

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.9
Action rationale: To prevent future hand injuries from similar incidents

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.156

Detailed Classification - 220100340004

Record 30 of 100

Source record ID: 220100340004
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between running or meshing objects
Coal/metal indicator: M
Narrative characters: 375
Narrative may be truncated: False

FULL NARRATIVE

The employee was cutting small pieces of steel in the metal shear. He was using a piece of metal to push the pieces into place. Rams, which hold the metal flat just before the cut, came down forcing the metal he was holding to crush the tip of his finger between the metal and the table surface of the shear. The tip of his left middle finger was lost due to tissue damage.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Rams, which hold the metal flat just before the cut, came down forcing the metal he was holding to crush the tip of his finger between the metal and the table surface of the shear.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: He was using a piece of metal to push the pieces into place.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Repair or inspect the metal shear to prevent rams from coming down unexpectedly.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 15.09

Detailed Classification - 220100780003

Record 31 of 100

Source record ID: 220100780003
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: C
Narrative characters: 120
Narrative may be truncated: False

FULL NARRATIVE

The employee attempted to catch a Duke that was falling over. The duke pinched his finger against the face conveyor pan.

LLM CLASSIFICATION

Primary cause: MATERIAL_RELEASE_OR_SHIFT
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: The employee attempted to catch a Duke that was falling over.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: The duke pinched his finger against the face conveyor pan.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.9
Action rationale: Repair or inspect the duke and face conveyor pan to prevent future pinching incidents.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.197

Detailed Classification - 220110320038

Record 32 of 100

Source record ID: 220110320038
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: FALL OF FACE/RIB/PILLAR/SIDE/HIGHWALL
MSHA accident type: Struck by rolling or sliding object
Coal/metal indicator: C
Narrative characters: 344
Narrative may be truncated: False

FULL NARRATIVE

Employee was taking a left-handed lift on the #2 pillar section. He backed the miner out to check a leaking boom swing hose. He and a miner helper were on the offside of the miner checking the leak when a rib rolled and struck employee on his lower left leg. He received multiple fractures to the left foot. *Doctors had to amputate below knee.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: rib rolled and struck employee on his lower left leg

Primary contributing factor: UNSTABLE_GROUND_OR_ROOF_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: rib rolled and struck employee on his lower left leg

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Repair or inspect the equipment to prevent rib failures.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.037

Detailed Classification - 220141980016

Record 33 of 100

Source record ID: 220141980016
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDTOOLS (NONPOWERED)
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 342
Narrative may be truncated: False

FULL NARRATIVE

Employee was pulling and lifting rocks with a hooked tool to remove the jam. Originally diagnosed as a left inguinal strain, returned to normal duty as a truck driver. 7/16/14 follow up doctor's visit indicated aggravation of the injury, employee placed on temporary modified duty with restrictions on driving, lifting and repetitive bending.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: Employee was pulling and lifting rocks with a hooked tool to remove the jam.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: False
Factor evidence: Employee was placed on temporary modified duty with restrictions on driving, lifting and repetitive bending.

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: HIGH
Action confidence: 0.8
Action rationale: Need to revise the procedure to avoid awkward movements and lifting.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 28.685

Detailed Classification - 220150970006

Record 34 of 100

Source record ID: 220150970006
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: POWERED HAULAGE
MSHA accident type: Caught in, under or between running or meshing objects
Coal/metal indicator: M
Narrative characters: 233
Narrative may be truncated: False

FULL NARRATIVE

EE was checking equipment before lunch he opened the door on the hopper while it was running and put his hand in the belt area. The belt got his coat sleeves under the belt and roller and pulled his hand between the roller and frame.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: EE opened the door on the hopper while it was running and put his hand in the belt area.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: EE put his hand in the belt area while the equipment was running.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and secure the belt to prevent clothing from getting caught.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.729

Detailed Classification - 220180390004

Record 35 of 100

Source record ID: 220180390004
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Caught in, under or between NEC
Coal/metal indicator: M
Narrative characters: 356
Narrative may be truncated: False

FULL NARRATIVE

EE slipped getting of 725 haul truck catching wedding ring on the no slip grips on steps, tearing finger. EE was transported to hospital but surgery was put off due to doctor being needed in a more urgent matter. On 12/20/17 EE was operated on where they cleaned up wound & removed top digit of left ring finger. All went well & EE on way home at 2:30 pm.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: EE slipped getting of 725 haul truck catching wedding ring on the no slip grips on steps

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: EE slipped getting of 725 haul truck catching wedding ring on the no slip grips on steps

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: Improve the surface to prevent similar slips in the future

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.601

Detailed Classification - 220182710020

Record 36 of 100

Source record ID: 220182710020
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: FALLING/SLIDING/ROLLING MATERIALS
MSHA accident type: Struck by falling object
Coal/metal indicator: M
Narrative characters: 212
Narrative may be truncated: False

FULL NARRATIVE

Trailer gate was chained open to the right side of trailer. Employee was standing behind trailer washing trailer out. Chain holding trailer gate gave way and swung down striking employee's right ankle and foot.

LLM CLASSIFICATION

Primary cause: LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Chain holding trailer gate gave way and swung down striking employee's right ankle and foot.

Primary contributing factor: EQUIPMENT_CONDITION_OR_FAILURE
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: Trailer gate was chained open to the right side of trailer.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Repair or replace the chain to prevent future failures.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.473

Detailed Classification - 220201610001

Record 37 of 100

Source record ID: 220201610001
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: MACHINERY
MSHA accident type: Struck by flying object
Coal/metal indicator: C
Narrative characters: 201
Narrative may be truncated: False

FULL NARRATIVE

Piece of rock or other material flew back & struck miner man in left eye as miner man was cutting second lift out of 8 head. Miner man was positioned about 8 ft. past tail boom in 8 right intersection.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 42.604

Detailed Classification - 220240670016

Record 38 of 100

Source record ID: 220240670016
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: C
Narrative characters: 298
Narrative may be truncated: False

FULL NARRATIVE

While assisting in loading continuous miner cable into the boom of the machine, via the use of a scoop, using a steel sheave wheel and nylon cable. The employee placed their left hand onto the cable and pulled fingers into the sheave wheel, resulting in injury to three of the fingers on left hand.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: The employee placed their left hand onto the cable and pulled fingers into the sheave wheel, resulting in injury to three of the fingers on left hand.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: Assisting in loading continuous miner cable into the boom of the machine, via the use of a scoop, using a steel sheave wheel and nylon cable.

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future similar incidents, the procedure for handling cables should be revised.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 32.668

Detailed Classification - 220250060021

Record 39 of 100

Source record ID: 220250060021
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in pulling or pushing objects
Coal/metal indicator: M
Narrative characters: 140
Narrative may be truncated: False

FULL NARRATIVE

Employee was at 071-01 pan feeder pulling a rock to unplug. While pulling the rock the employee felt a pop near their belly button. Hernia.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: Employee was at 071-01 pan feeder pulling a rock to unplug. While pulling the rock the employee felt a pop near their belly button. Hernia.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: CONDUCT_PRE_JOB_HAZARD_REVIEW
Action support: MEDIUM
Action confidence: 0.8
Action rationale: To review the task and identify potential hazards before performing the job.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 29.37

Detailed Classification - 220261210001

Record 40 of 100

Source record ID: 220261210001
Severity group: 2_PERMANENT_DISABILITY
Degree of injury: PERM TOT OR PERM PRTL DISABLTY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between running or meshing objects
Coal/metal indicator: M
Narrative characters: 124
Narrative may be truncated: False

FULL NARRATIVE

While applying belt dressing to a head pulley EE's hand was caught in the head pulley and caused the loss of EE's left hand.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 39.314

Detailed Classification - 220010460020

Record 41 of 100

Source record ID: 220010460020
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Caught in, under or between NEC
Coal/metal indicator: M
Narrative characters: 61
Narrative may be truncated: False

FULL NARRATIVE

LOADING BLOCK ON TRAILER-2 BLOCKS CAME TOGETHER-PINCHED FOOT.

LLM CLASSIFICATION

Primary cause: MATERIAL_RELEASE_OR_SHIFT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: LOADING BLOCK ON TRAILER-2 BLOCKS CAME TOGETHER-PINCHED FOOT

Primary contributing factor: UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: BLOCKS CAME TOGETHER

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and secure the trailer blocks to prevent future pinching incidents.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.596

Detailed Classification - 220031900010

Record 42 of 100

Source record ID: 220031900010
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: POWERED HAULAGE
MSHA accident type: Caught in, under or between NEC
Coal/metal indicator: M
Narrative characters: 93
Narrative may be truncated: False

FULL NARRATIVE

GREASING BEARING AND CHECKED LINE UNDER DIRT AND GLOVE GOT CAUGHT IN ROLLER ON CONVEYOR BELT.

LLM CLASSIFICATION

Primary cause: MATERIAL_RELEASE_OR_SHIFT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: GREASING BEARING AND CHECKED LINE UNDER DIRT AND GLOVE GOT CAUGHT IN ROLLER ON CONVEYOR BELT

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: DIRT AND GLOVE GOT CAUGHT IN ROLLER ON CONVEYOR BELT

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: Improve work surface to reduce dirt and debris

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.817

Detailed Classification - 220051530030

Record 43 of 100

Source record ID: 220051530030
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: MACHINERY
MSHA accident type: Struck against a moving object
Coal/metal indicator: C
Narrative characters: 362
Narrative may be truncated: False

FULL NARRATIVE

EMPLOYEE WAS PUSHING COAL WITH THE DION DOZER ON THE RAW COAL PILE. HE WAS IN REVERSE SECOND GEAR WHEN HE STRUCK THE CONCRETE TRUCK DUMP PAD. HE WAS TREATED BY EMS AND TRANSPORTED TO BOONE MEMORIAL WHERE XRAYS WERE NEGATIVE AND RELEASED BACK TO WORK. ON 5/23/05 HE WAS STILL EXPERIENCING BACK PAIN. HE RETURNED TO BOONE MEMORIAL AND SAW DR AND REFERED ON 5/25/05

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: HE WAS IN REVERSE SECOND GEAR WHEN HE STRUCK THE CONCRETE TRUCK DUMP PAD.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: EMPLOYEE WAS PUSHING COAL WITH THE DION DOZER ON THE RAW COAL PILE.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the dozer to prevent future incidents.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.507

Detailed Classification - 220052800054

Record 44 of 100

Source record ID: 220052800054
Severity group: 3_DAYS_AWAY
Degree of injury: NO DYS AWY FRM WRK,NO RSTR ACT
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by rolling or sliding object
Coal/metal indicator: C
Narrative characters: 139
Narrative may be truncated: False

FULL NARRATIVE

EMPLOYEE WAS IN THE PROCESS OF MOVING A STACK OF 6"X 6" TIMBERS, WHEN THE TIMBER ROLLED ONTO END OF HIS RIGHT MIDDLE FINGER, FRACTURING IT.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: EMPLOYEE WAS IN THE PROCESS OF MOVING A STACK OF 6"X 6" TIMBERS, WHEN THE TIMBER ROLLED ONTO END OF HIS RIGHT MIDDLE FINGER, FRACTURING IT.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: EMPLOYEE WAS IN THE PROCESS OF MOVING A STACK OF 6"X 6" TIMBERS

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and secure the timbers to prevent rolling.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 15.539

Detailed Classification - 220060410036

Record 45 of 100

Source record ID: 220060410036
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 342
Narrative may be truncated: False

FULL NARRATIVE

The injured was operating the continuous miner in #6 left when a large piece of rock fell onto the mach. He then turned to run and was struck by a second piece of rock that fell from between the last two rows of bolts. Rock was 75"long by 52"wide by 6"thick. Taken to hospital, being treated for fractures to right leg, left ankle and pelvis.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, Invalid contributing-factor category: UNSTATED [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 42.469

Detailed Classification - 220063060074

Record 46 of 100

Source record ID: 220063060074
Severity group: 3_DAYS_AWAY
Degree of injury: NO DYS AWY FRM WRK,NO RSTR ACT
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: C
Narrative characters: 249
Narrative may be truncated: False

FULL NARRATIVE

EE was changing the right front brake chamber on a water truck. The brake chamber bracket fell and caught his finger between it and the frame, cutting his finger. He was taken to a local emergency room, where he received stitches for the laceration.

LLM CLASSIFICATION

Primary cause: CAUGHT_IN_BETWEEN
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: The brake chamber bracket fell and caught his finger between it and the frame, cutting his finger.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: INSTALL_OR_IMPROVE_GUARDING
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future incidents, install proper guarding around the brake chamber area.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 26.709

Detailed Classification - 220071290009

Record 47 of 100

Source record ID: 220071290009
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 156
Narrative may be truncated: False

FULL NARRATIVE

Employee was lifting a ladder down from a rack and twisted the wrong way and felt a pull in his back. He was evaluated on 5/2/07 and was taken off of work.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: Employee was lifting a ladder down from a rack and twisted the wrong way and felt a pull in his back.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.8
Action rationale: To prevent future awkward movements and back injuries, targeted training should be provided.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.395

Detailed Classification - 220082100006

Record 48 of 100

Source record ID: 220082100006
Severity group: 3_DAYS_AWAY
Degree of injury: NO DYS AWY FRM WRK,NO RSTR ACT
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by falling object
Coal/metal indicator: M
Narrative characters: 113
Narrative may be truncated: False

FULL NARRATIVE

Employee was assisting in the removal of an ice chunk from a belt, when the chunk fell and hit him on the finger.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Employee was assisting in the removal of an ice chunk from a belt, when the chunk fell and hit him on the finger.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and secure the belt to prevent ice chunks from falling and injuring workers.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 12.261

Detailed Classification - 220093360021

Record 49 of 100

Source record ID: 220093360021
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 362
Narrative may be truncated: False

FULL NARRATIVE

Injured employee was moving timbers from the roadway and leaning them against the rib when one of the timbers (6" x 6" x 8') fell over and struck him on the inside of his right elbow. He was transported to the ER by EMS. X-Rays were negative for fractures. Diagnosed with tissue bruising. Employee suffered an injury to the same elbow in 2003 at another company.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Injured employee was moving timbers from the roadway and leaning them against the rib when one of the timbers (6" x 6" x 8') fell over and struck him on the inside of his right elbow.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: LOW
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: Employee suffered an injury to the same elbow in 2003 at another company.

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: HIGH
Action confidence: 0.9
Action rationale: To prevent future timber falls and strikes, the procedure for moving and securing timbers should be revised.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 32.21

Detailed Classification - 220100990012

Record 50 of 100

Source record ID: 220100990012
Severity group: 3_DAYS_AWAY
Degree of injury: DYS AWY FRM WRK & RESTRCTD ACT
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall to the walkway or working surface
Coal/metal indicator: C
Narrative characters: 355
Narrative may be truncated: False

FULL NARRATIVE

EE was walking in parking lot,tripped on gravel falling on left knee.EE reported falling awkward and twisted knee.EE worked until 4am at which time pain and swelling hindered walking.EE refused ambulance transportation.EE RTW on RD on 3/12/10. On 3/14/10 mine mgt. decided EE was not to RTW until released to full duty. EE quit on own terms on 3/21/2010.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: False
Cause evidence: EE was walking in parking lot, tripped on gravel falling on left knee.

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 0.9
Factor evidence valid: False
Factor evidence: EE was walking in parking lot, tripped on gravel falling on left knee.

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 0.9
Action rationale: Improve the surface condition to prevent tripping hazards.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.191

Detailed Classification - 220101660022

Record 51 of 100

Source record ID: 220101660022
Severity group: 3_DAYS_AWAY
Degree of injury: NO DYS AWY FRM WRK,NO RSTR ACT
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by... NEC
Coal/metal indicator: M
Narrative characters: 135
Narrative may be truncated: False

FULL NARRATIVE

Injured worker was removing a gearmotor from the main spray tower tipping valves when the unit fell onto the injured workers left foot.

LLM CLASSIFICATION

Primary cause: LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Injured worker was removing a gearmotor from the main spray tower tipping valves when the unit fell onto the injured workers left foot.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the equipment to prevent future failures.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.031

Detailed Classification - 220110460001

Record 52 of 100

Source record ID: 220110460001
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: OTHER
MSHA accident type: Bodily reaction, NEC
Coal/metal indicator: M
Narrative characters: 222
Narrative may be truncated: False

FULL NARRATIVE

E-TECH was troubleshooting electrical problem with belt conveyor. Working in Major Control Center, motor starter bucket. Bending down on knees for work, went to stand up and left knee popped. Knee is real stiff now & sore!

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: Bending down on knees for work, went to stand up and left knee popped.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: CONDUCT_PRE_JOB_HAZARD_REVIEW
Action support: HIGH
Action confidence: 0.8
Action rationale: To prevent future awkward movements and injuries during troubleshooting tasks.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.115

Detailed Classification - 220111150019

Record 53 of 100

Source record ID: 220111150019
Severity group: 3_DAYS_AWAY
Degree of injury: DYS AWY FRM WRK & RESTRCTD ACT
MSHA classification: FALLING/SLIDING/ROLLING MATERIALS
MSHA accident type: Caught in, under or between collapsing material or buildings
Coal/metal indicator: M
Narrative characters: 169
Narrative may be truncated: False

FULL NARRATIVE

EE was climbing on grout sand pile pulling weeds when the sand pile caved in causing the EE to fall both legs were covered in sand and his left knee was twisted in fall.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: the sand pile caved in causing the EE to fall

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: EE was climbing on grout sand pile pulling weeds

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future collapses of unstable sand piles

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 12.961

Detailed Classification - 220132130027

Record 54 of 100

Source record ID: 220132130027
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 60
Narrative may be truncated: False

FULL NARRATIVE
---
he was bringing a roller to change it and his knee gave out.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: he was bringing a roller to change it and his knee gave out

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: CONDUCT_PRE_JOB_HAZARD_REVIEW
Action support: HIGH
Action confidence: 1.0
Action rationale: To review the work procedure and identify potential hazards.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 25.864

Detailed Classification - 220163020007

Record 55 of 100

Source record ID: 220163020007
Severity group: 3_DAYS_AWAY
Degree of injury: DYS AWY FRM WRK & RESTRCTD ACT
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall to the walkway or working surface
Coal/metal indicator: M
Narrative characters: 176
Narrative may be truncated: False

FULL NARRATIVE

Before regular work shift started employee tripped and fell in parking lot requiring 5 stitches to right hand, 3 stitches to the right side of the head and a dislocated finger.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Before regular work shift started employee tripped and fell in parking lot

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: poor housekeeping or surface condition

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: Improve the surface condition to prevent future trips and falls

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.086

Detailed Classification - 220180020010

Record 56 of 100

Source record ID: 220180020010
Severity group: 3_DAYS_AWAY
Degree of injury: NO DYS AWY FRM WRK,NO RSTR ACT
MSHA classification: STRIKING OR BUMPING
MSHA accident type: Struck against stationary object
Coal/metal indicator: C
Narrative characters: 221
Narrative may be truncated: False

FULL NARRATIVE

Employee struck head on a pin board while walking back to ram car. EE later went to a Chiropractor. This incident was originally filed by 7000-1 on 12/22/17 but failed to go through due to an error. This is a resubmittal.

LLM CLASSIFICATION

Primary cause: STRUCK_AGAINST_STATIONARY_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Employee struck head on a pin board while walking back to ram car.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: INSTALL_OR_IMPROVE_GUARDING
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future head injuries from striking stationary objects.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 26.014

Detailed Classification - 220190720007

Record 57 of 100

Source record ID: 220190720007
Severity group: 3_DAYS_AWAY
Degree of injury: NO DYS AWY FRM WRK,NO RSTR ACT
MSHA classification: MACHINERY
MSHA accident type: Struck by flying object
Coal/metal indicator: C
Narrative characters: 185
Narrative may be truncated: False

FULL NARRATIVE

While employee was running the shearer towards the headgate from the headgate side of the shearer, coal/rock riccocheted from the cutting drum, off the cow, and got into employee's eye.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: coal/rock riccocheted from the cutting drum, off the cow, and got into employee's eye

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the cutting drum to prevent ricochet

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 26.127

Detailed Classification - 220220610014

Record 58 of 100

Source record ID: 220220610014
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall from machine
Coal/metal indicator: M
Narrative characters: 110
Narrative may be truncated: False

FULL NARRATIVE

While stepping down the ladder of the haul truck, employee slipped off step and fell and landed on the ground.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: While stepping down the ladder of the haul truck, employee slipped off step and fell and landed on the ground.

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: While stepping down the ladder of the haul truck, employee slipped off step and fell and landed on the ground.

Recommended action: IMPROVE_WORK_SURFACE_OR_HOUSEKEEPING
Action support: HIGH
Action confidence: 1.0
Action rationale: Improve the surface condition to prevent future slips.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.31

Detailed Classification - 220233180018

Record 59 of 100

Source record ID: 220233180018
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: POWERED HAULAGE
MSHA accident type: Struck against a moving object
Coal/metal indicator: C
Narrative characters: 258
Narrative may be truncated: False

FULL NARRATIVE

Employee was riding in a mantrip when the mantrip slid into the rib causing EE to bump the SCSR against the inside of the mantrip resulting in a bruise of EE's left hip. EE went to the doctor and was given restrictions and started missing work on 11/02/2023.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 39.309

Detailed Classification - 220242290019

Record 60 of 100

Source record ID: 220242290019
Severity group: 3_DAYS_AWAY
Degree of injury: DAYS AWAY FROM WORK ONLY
MSHA classification: MACHINERY
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 350
Narrative may be truncated: False

FULL NARRATIVE

While using center bolter in 6 West 1-2 crosscut at 39 block a rock fell from the top and struck left hand as they were reaching for a stick of resin that was in a glue box placed on the bolter tray above the bolter controls, resulting in a contusion. No problems with compliance or equipment issues, job skills, proficiency, training, or PPE issues.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 40.706

Detailed Classification - 220001330006

Record 61 of 100

Source record ID: 220001330006
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall from ladders
Coal/metal indicator: M
Narrative characters: 367
Narrative may be truncated: False

FULL NARRATIVE

EMPLOYEE WAS CLIMBING DOWN LADDER ON FRONT END LOADER. HE WAS CARRYING HIS LUCH BOX IN HIS LEFT HAND, WHICH IS CONTRARY TP PLANT 3 POINT RULE. HIS FOOT CAUGHT ON ONE OF THE RUNGS, LOST BALANCE AND GRIP WITH LUNCH BOX HAND, SPINNING HIM AROUND WITH REMAINING RIGHT HAND, CAUSING HIM TO LOSE GRIP WITH RIGHT HAND, AND THEN FALLING TO GROUND LANDING ON HIP AND BUTTOCKS.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: HE WAS CARRYING HIS LUNCH BOX IN HIS LEFT HAND, WHICH IS CONTRARY TO PLANT 3 POINT RULE.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: HE WAS CLIMBING DOWN LADDER ON FRONT END LOADER. HIS FOOT CAUGHT ON ONE OF THE RUNGS, LOST BALANCE AND GRIP WITH LUNCH BOX HAND, SPINNING HIM AROUND WITH REMAINING RIGHT HAND, CAUSING HIM TO LOSE GRIP WITH RIGHT HAND, AND THEN FALLING TO GROUND.

Recommended action: CONDUCT_PRE_JOB_HAZARD_REVIEW
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future similar incidents, a pre-job hazard review should be conducted.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 18.455

Detailed Classification - 220011420012

Record 62 of 100

Source record ID: 220011420012
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between NEC
Coal/metal indicator: M
Narrative characters: 365
Narrative may be truncated: False

FULL NARRATIVE

AFTER A FOREIGN MATERIAL PASSES THRU THE IMPACTOR, THE EE WENT TO REPAIR THE DAMAGE. WHILE REMOVING THE 2" THICK STEEL WALL SECTIONS, ONE OF THE SECTIONS SLIPPED AND HIT THE EE'S RT. HAND. THE HAND SWELLED & WAS BLEEDING. THE EE WAS TRANSFERRED TO LOCAL ER. TENDONS DAMAGED & STITCHES FOR THE CUT. THE EE RETURNED TO WORK THE NEXT MORNING W/ 2 DAYS RESTRICTED DUTY.

LLM CLASSIFICATION

Primary cause: SLIP_TRIP_FALL
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: WHILE REMOVING THE 2" THICK STEEL WALL SECTIONS, ONE OF THE SECTIONS SLIPPED AND HIT THE EE'S RT. HAND.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Repair or inspect the steel wall sections to prevent future slippage.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.833

Detailed Classification - 220012140018

Record 63 of 100

Source record ID: 220012140018
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 227
Narrative may be truncated: False

FULL NARRATIVE

EE REPORTED ON 7-23 THAT HE HAD A HERNIA AND WAS TO RECEIVE MEDICAL TREATMENT THE NEXT DAY. EE COULD NOT STATE WHEN OR HOW THE ILLNESS OCCURRED BUT BELIEVE IT DEVELOPED OVER TIME. COULD NOT CI T ANY CONTRIBUTING SPECIFIC EVENT.

LLM CLASSIFICATION

Primary cause: OTHER
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: HIGH
Action confidence: 0.0
Action rationale: Further investigation is needed to determine the cause of the hernia.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 23.028

Detailed Classification - 220012820180

Record 64 of 100

Source record ID: 220012820180
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Fall to the walkway or working surface
Coal/metal indicator: M
Narrative characters: 372
Narrative may be truncated: False

FULL NARRATIVE

EE WAS REPAIRING THE BIRD NETTING ON THE S-1 SOLUTION POND WHEN HIS FOOT BECAME ENTANGLED IN THENETTING AND HE FELL TWISTING HIS RIGHT KNEE. INITIALLY HE DID NOT SEEK MEDICAL ATTENTION BUT WHE N PAIN IN KNEE DID NOT IMPROVE HE WAS SEEN BY A DOCTOR IN AUGUST AND ORTHOSCOPIC SURGERY WAS PERFORMED ON 9/20. HE RETURNED NEXT SCHEDULED SHIFTWITH NO DAYS LOST, LIGHT DUTY ONLY.

LLM CLASSIFICATION

Primary cause: CAUGHT_IN_BETWEEN
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: EE WAS REPAIRING THE BIRD NETTING ON THE S-1 SOLUTION POND WHEN HIS FOOT BECAME ENTANGLED IN THE NETTING AND HE FELL TWISTING HIS RIGHT KNEE.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: EE WAS REPAIRING THE BIRD NETTING ON THE S-1 SOLUTION POND WHEN HIS FOOT BECAME ENTANGLED IN THE NETTING AND HE FELL TWISTING HIS RIGHT KNEE.

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: HIGH
Action confidence: 1.0
Action rationale: Revising the procedure to prevent entanglement risks.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 35.97

Detailed Classification - 220013440119

Record 65 of 100

Source record ID: 220013440119
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 124
Narrative may be truncated: False

FULL NARRATIVE

EMPLOYEE WAS REMOVING PIECE OF ASPHALT FROM DE-ENERGIZED CONVEYER, WITH ONE HAND. IN TURN HE SUFFERED A BICEP TENDON STRAIN.

LLM CLASSIFICATION

Primary cause: OTHER
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence: EMPLOYEE WAS REMOVING PIECE OF ASPHALT FROM DE-ENERGIZED CONVEYER, WITH ONE HAND. IN TURN HE SUFFERED A BICEP TENDON STRAIN.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: MEDIUM
Action confidence: 0.0
Action rationale: Review the procedure for safe removal of asphalt from conveyers to prevent tendon strains.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 44.377

Detailed Classification - 220021540078

Record 66 of 100

Source record ID: 220021540078
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: MACHINERY
MSHA accident type: Contact with hot objects or substances
Coal/metal indicator: M
Narrative characters: 209
Narrative may be truncated: False

FULL NARRATIVE

EE WAS CUTTING A HOLE IN A STEEL PLATE. IT WAS WINDY & SPARKS FROM THE TORCH BLEW BACK & BURNT THROUGH HIS CLOTHES & BURNED HIS BELLY. WENT TO DOCTOR ON 5-1-02. HAD 2ND DEGREE BURN & PLACED ON RESTRICTED DUTY.

LLM CLASSIFICATION

Primary cause: ELECTRICAL_CONTACT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: EE WAS CUTTING A HOLE IN A STEEL PLATE. IT WAS WINDY & SPARKS FROM THE TORCH BLEW BACK & BURNT THROUGH HIS CLOTHES & BURNED HIS BELLY.

Primary contributing factor: ENVIRONMENTAL_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: IT WAS WINDY & SPARKS FROM THE TORCH BLEW BACK & BURNT THROUGH HIS CLOTHES & BURNED HIS BELLY.

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future incidents due to environmental conditions.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 16.396

Detailed Classification - 220040200101

Record 67 of 100

Source record ID: 220040200101
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by falling object
Coal/metal indicator: C
Narrative characters: 187
Narrative may be truncated: False

FULL NARRATIVE

While removing cutting edges off a 24H blade, a 4' section of cutting edge fell, striking the ee's left hand, fracturing the left index finger and thumb. The thumb also received stitches.

LLM CLASSIFICATION

Primary cause: STRUCK_BY_MOVING_OBJECT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: a 4' section of cutting edge fell, striking the ee's left hand

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the blade to prevent future cutting edge detachment

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 24.94

Detailed Classification - 220051100002

Record 68 of 100

Source record ID: 220051100002
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 307
Narrative may be truncated: False

FULL NARRATIVE

Employee was carrying small jackhammer on left shoulder in route to another worksite. Jackhammer started to slip off shoulder and employee caught it causing strain to left shoulder. Employee advised on how to carry tools correctly, to know limitations, and to ask for help or use carts to transport tools.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: Jackhammer started to slip off shoulder and employee caught it causing strain to left shoulder.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: Employee advised on how to carry tools correctly, to know limitations, and to ask for help or use carts to transport tools.

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.9
Action rationale: To improve the employee's understanding of proper tool handling and to prevent future strains.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.481

Detailed Classification - 220130350040

Record 69 of 100

Source record ID: 220130350040
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: STEPPING OR KNEELING ON OBJECT
MSHA accident type: Rubbed or abraded
Coal/metal indicator: M
Narrative characters: 337
Narrative may be truncated: False

FULL NARRATIVE

On 1-18-13, employee was working on a cone crusher assembly after repair. Was working on his knees. His left knee started to hurt him. Used ice & Heat - got no relief. Reported to his supervisor on 1-23, went to his family doctor on 1-24. Was sent to company clinic on 1-28-13. Diagnosed with pain/sprain to his left knee. Is restricted.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 38.505

Detailed Classification - 220133010009

Record 70 of 100

Source record ID: 220133010009
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: MACHINERY
MSHA accident type: Caught in, under or between running or meshing objects
Coal/metal indicator: C
Narrative characters: 331
Narrative may be truncated: False

FULL NARRATIVE

Employee was working at new office/bath house for new #7 north portal. Employee cut his left index finger with 4.5" angle grinder while cutting a 4" vertical PVC pipe below grade. Finger was cut when his glove was caught between blade and guard while he was stopping his cut. Employee received six stitches at urgent care facility.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: Employee cut his left index finger with 4.5" angle grinder while cutting a 4" vertical PVC pipe below grade. Finger was cut when his glove was caught between blade and guard while he was stopping his cut.

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: LOW
Factor confidence: 0.7
Factor evidence valid: False
Factor evidence: Employee's glove was caught between blade and guard.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.8
Action rationale: Repair or inspect the angle grinder to prevent future glove entanglements.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 15.589

Detailed Classification - 220150140007

Record 71 of 100

Source record ID: 220150140007
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: POWERED HAULAGE
MSHA accident type: Struck against a moving object
Coal/metal indicator: M
Narrative characters: 149
Narrative may be truncated: False

FULL NARRATIVE

Employee was driving articulating 40ton haul truck on haul road with a fully loaded box. Turned a corner and the box rolled over. Cab stayed upright.

LLM CLASSIFICATION

Primary cause: VEHICLE_OR_MOBILE_EQUIPMENT_EVENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Turned a corner and the box rolled over.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the box to prevent future rollovers.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 25.752

Detailed Classification - 220151350022

Record 72 of 100

Source record ID: 220151350022
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: POWERED HAULAGE
MSHA accident type: Struck against a moving object
Coal/metal indicator: M
Narrative characters: 84
Narrative may be truncated: False

FULL NARRATIVE
---
employee complains of stiff and soreness of neck and back, 2 years of wear and tear.

LLM CLASSIFICATION

Primary cause: ERGONOMIC_OR_REPETITIVE_EXPOSURE
Cause support: HIGH
Cause confidence: 0.8
Cause evidence valid: True
Cause evidence: employee complains of stiff and soreness of neck and back, 2 years of wear and tear

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.8
Action rationale: Provide targeted training to improve ergonomics and reduce repetitive strain injuries.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.178

Detailed Classification - 220152400099

Record 73 of 100

Source record ID: 220152400099
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 72
Narrative may be truncated: False

FULL NARRATIVE

Employee felt strain in chest muscle when attempting to turn pump sheave

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Employee felt strain in chest muscle when attempting to turn pump sheave

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REVISE_PROCEDURE_OR_JOB_PLAN
Action support: HIGH
Action confidence: 1.0
Action rationale: Revise procedure to reduce awkward movements

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 38.709

Detailed Classification - 220171170001

Record 74 of 100

Source record ID: 220171170001
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 319
Narrative may be truncated: False

FULL NARRATIVE

Shoveling out the rock and grease accumulation around the bucket boom of a 992K and felt discomfort in forearm. Still had movement. Sent for examination. First doctor returned employee to work with no PT. At a check up a second doctor recommended PT on 4/20/2017 with sessions starting 4/21/2017. At work on light duty.

LLM CLASSIFICATION

Primary cause: OTHER
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.0
Action rationale: The employee was placed on light duty and recommended PT, indicating a need for targeted training on proper lifting and ergonomic techniques.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 25.0

Detailed Classification - 220180080020

Record 75 of 100

Source record ID: 220180080020
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Struck by rolling or sliding object
Coal/metal indicator: M
Narrative characters: 210
Narrative may be truncated: False

FULL NARRATIVE

EE was attempting to remove a fan blade from FA-1301 and was struck in the face with the blade. EE had the fan locked and tagged out. The fan slid off the shaft as EE was removing it and was struck in the face.

LLM CLASSIFICATION

Primary cause: LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: False
Cause evidence: The fan slid off the shaft as EE was removing it.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: False
Factor evidence: EE had the fan locked and tagged out but the fan still slid off the shaft.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.9
Action rationale: To prevent future loss of control of the fan blade during removal.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.652

Detailed Classification - 220180860003

Record 76 of 100

Source record ID: 220180860003
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 326
Narrative may be truncated: False

FULL NARRATIVE

Employee was working inside a silo on an engineered scaffold platform. There was an opening between the outside of the silo wall and the scaffold platform where it was constructed around an obstruction. The employee was going to grab a tool and EE caught EE's left foot in the opening and twisted which resulted in a fracture.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: EE caught EE's left foot in the opening and twisted which resulted in a fracture.

Primary contributing factor: UNSTABLE_OR_IMPROPERLY_POSITIONED_MATERIAL
Factor support: HIGH
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: There was an opening between the outside of the silo wall and the scaffold platform where it was constructed around an obstruction.

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.9
Action rationale: Repair or replace the scaffold platform to eliminate the opening.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.618

Detailed Classification - 220212740023

Record 77 of 100

Source record ID: 220212740023
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Caught in, under or between a moving and a stationary object
Coal/metal indicator: M
Narrative characters: 236
Narrative may be truncated: False

FULL NARRATIVE

An employee was working on replacing a pin for a skid steer bucket quick connect when EE caught the tip of their finger between a bar and the bucket. The employee was diagnosed with a fracture to the tip of the right 5th (pinky) finger.

LLM CLASSIFICATION

Primary cause: CAUGHT_IN_BETWEEN
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: EE caught the tip of their finger between a bar and the bucket.

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: working on replacing a pin for a skid steer bucket quick connect

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: To prevent future catches, the quick connect mechanism should be inspected and repaired.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.476

Detailed Classification - 220223350003

Record 78 of 100

Source record ID: 220223350003
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 62
Narrative may be truncated: False

FULL NARRATIVE

Bending or reaching to install a pump. Muscle spasms in back.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Bending or reaching to install a pump.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: CONDUCT_PRE_JOB_HAZARD_REVIEW
Action support: HIGH
Action confidence: 1.0
Action rationale: To review the task and identify potential hazards.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 25.129

Detailed Classification - 220243050001

Record 79 of 100

Source record ID: 220243050001
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: SLIP OR FALL OF PERSON
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 71
Narrative may be truncated: False

FULL NARRATIVE

EE felt a pop in EE's knee while getting up into the drill carrier cab.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: EE felt a pop in EE's knee while getting up into the drill carrier cab.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: CONDUCT_PRE_JOB_HAZARD_REVIEW
Action support: HIGH
Action confidence: 1.0
Action rationale: To identify and mitigate the risk of similar incidents.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 26.264

Detailed Classification - 220261420003

Record 80 of 100

Source record ID: 220261420003
Severity group: 4_RESTRICTED_OR_TRANSFERRED
Degree of injury: DAYS RESTRICTED ACTIVITY ONLY
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 55
Narrative may be truncated: False

FULL NARRATIVE

Employee was using a shovel and strained EE's shoulder.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: Employee was using a shovel and strained EE's shoulder.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 1.0
Action rationale: Provide targeted training on proper lifting techniques to prevent shoulder strain.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 25.443

Detailed Classification - 220000380081

Record 81 of 100

Source record ID: 220000380081
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Accident type, without injuries
Coal/metal indicator: C
Narrative characters: 290
Narrative may be truncated: False

FULL NARRATIVE

A FALL OF ROOF OCCURRED IN THE 1ST SOUTH WEST SUBMAINS IN THE #4 ENTRY AT X-CUT 37 APPROX 2500 FT. OUTBY THE #1 UNIT. THE AREA WAS SUPPORTED WI TH 6 FT FULLY GROUTED BOLTS AND TRUSS BOLTS. THE APPARENT CAUSE WAS A SLIP WITH WATER INVOLVED ASWELL. THIS WAS A NEUTRAL OR LIMITED INTAKE ENTRY.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 0.9
Cause evidence valid: True
Cause evidence: A FALL OF ROOF OCCURRED

Primary contributing factor: POOR_HOUSEKEEPING_OR_SURFACE_CONDITION
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: False
Factor evidence: THE AREA WAS SUPPORTED WITH 6 FT FULLY GROUTED BOLTS AND TRUSS BOLTS. THE APPARENT CAUSE WAS A SLIP WITH WATER INVOLVED AS WELL.

Recommended action: IMPROVE_GROUND_CONTROL_OR_SCALING
Action support: HIGH
Action confidence: 0.9
Action rationale: Improve ground control and scaling to prevent future roof falls.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 14.161

Detailed Classification - 220001570177

Record 82 of 100

Source record ID: 220001570177
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (REPEATED TRAUMA)
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 300
Narrative may be truncated: False

FULL NARRATIVE

MECHANIC NOTICED DISCOMFORT IN HIS RIGHT SHOULDER WHILE CLIMBING FROM THE WEST SIDE OF #2 POC TO THE EAST SIDE. THIS WAS DONE DURING AN IDLER FRAME CHANGEOUT. RECENTLY, ASECOND INCIDENT RESULT ED IN A MEDICAL EVALUATION THAT VERIFIED THE BELOW DESCRIBED CONDITION AND PHYSICAL THERAPY WAS PRESCRIBED.

LLM CLASSIFICATION

Primary cause: AWKWARD_MOVEMENT_OR_BODY_MOTION
Cause support: HIGH
Cause confidence: 0.8
Cause evidence valid: True
Cause evidence: MECHANIC NOTICED DISCOMFORT IN HIS RIGHT SHOULDER WHILE CLIMBING FROM THE WEST SIDE OF #2 POC TO THE EAST SIDE

Primary contributing factor: PROCEDURE_OR_WORK_METHOD
Factor support: MEDIUM
Factor confidence: 0.8
Factor evidence valid: True
Factor evidence: THIS WAS DONE DURING AN IDLER FRAME CHANGEOUT

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.8
Action rationale: Mechanic should be trained on proper lifting and climbing techniques to prevent shoulder discomfort.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 30.739

Detailed Classification - 220002620079

Record 83 of 100

Source record ID: 220002620079
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Accident type, without injuries
Coal/metal indicator: C
Narrative characters: 154
Narrative may be truncated: False

FULL NARRATIVE

A ROOF FALL WAS DISCOVERED IN THE 23 MAIN RIGHT RETURN #3 AIRWAY AT THE #8 X-CUT. THE FALL WAS APPROX. 18' X 18' X 15' HIGH. VENTILATION WAS NOT AFFECTED.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: A ROOF FALL WAS DISCOVERED IN THE 23 MAIN RIGHT RETURN #3 AIRWAY AT THE #8 X-CUT.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Inspect and repair the failed roof to prevent future incidents.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 27.544

Detailed Classification - 220011300055

Record 84 of 100

Source record ID: 220011300055
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (REPEATED TRAUMA)
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 29
Narrative may be truncated: False

FULL NARRATIVE

CARPAL TUNNEL IN RIGHT WRIST.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 39.22

Detailed Classification - 220012110011

Record 85 of 100

Source record ID: 220012110011
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (REPEATED TRAUMA)
MSHA accident type: NEC
Coal/metal indicator: C
Narrative characters: 13
Narrative may be truncated: False

FULL NARRATIVE

HEARING LOSS.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...ng factors or actions.'}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 42.036

Detailed Classification - 220022960021

Record 86 of 100

Source record ID: 220022960021
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: HOISTING
MSHA accident type: Accident type, without injuries
Coal/metal indicator: M
Narrative characters: 144
Narrative may be truncated: False

FULL NARRATIVE

HOIST OUTAGE, EXCESS 30 MINUTES. ELECTRICAL PROBLEM WITH HOIST CONTROLLER. HOIST CONTROLLER REPAIRED, PUT BACK INTO SERVICE. DOWN 5:42 TO 6:42PM

LLM CLASSIFICATION

Primary cause: UNEXPECTED_EQUIPMENT_MOVEMENT
Cause support: HIGH
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence: ELECTRICAL PROBLEM WITH HOIST CONTROLLER

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 0.0
Action rationale: Repair the hoist controller to prevent future electrical problems.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 24.569

Detailed Classification - 220030290025

Record 87 of 100

Source record ID: 220030290025
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: IGNITION OR EXPLOSION OF GAS OR DUST
MSHA accident type: Accident type, without injuries
Coal/metal indicator: C
Narrative characters: 240
Narrative may be truncated: False

FULL NARRATIVE

BASED ON INFORMATION REC'D FROM THOSE PRESENT IT APPEARS THAT THE IGNITION WAS CAUSED WHEN THECONT MINER WAS CUTTING ROOF ROCK WHEN A SPARK IGNITED A UNK METHANE BLEEDER IN THE ROOF OR COAL RIB. MSHA WAS NOTIFIED AN INVESTIGATION CONDUCTED.

LLM CLASSIFICATION

Primary cause: ELECTRICAL_CONTACT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: THE IGNITION WAS CAUSED WHEN THE CONT MINER WAS CUTTING ROOF ROCK WHEN A SPARK IGNITED A UNK METHANE BLEEDER IN THE ROOF OR COAL RIB

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: ENGINEERING_REVIEW_REQUIRED
Action support: HIGH
Action confidence: 1.0
Action rationale: An engineering review is needed to identify and mitigate potential methane ignition risks.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 28.632

Detailed Classification - 220030840060

Record 88 of 100

Source record ID: 220030840060
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (REPEATED TRAUMA)
MSHA accident type: Over-exertion NEC
Coal/metal indicator: M
Narrative characters: 187
Narrative may be truncated: False

FULL NARRATIVE

THE EE ALLEGES CARPAL TUNNEL SYNDROME IN THE RIGHT WRIST, ALLEGEDLY DUE TO DRIVING A LOADER FOR 10-15 YEARS IN HIS EE. SURGERY ON 3-20-02 PUT EE OUT OF WORK FOR INCIDENT DATE OF 10-31-02.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 38.567

Detailed Classification - 220033000095

Record 89 of 100

Source record ID: 220033000095
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Accident type, without injuries
Coal/metal indicator: C
Narrative characters: 306
Narrative may be truncated: False

FULL NARRATIVE

A ROOF FALL OCCURRED ON SAT 10-18-03 AT APPROX 2:30 AM. NO EQUIPMENT OR PERSONS INVOLVED, FALL WAS IN #45 ENTRY OUT BY SPAD 1754. AREA WAS DEVELOPED 01-99, FALL WAS 65' LONG BY 25; WIDE BY 6' THICK. AREA WAS CLEARED UP AND REBOLTED AND ADDITIONAL SUPPORTS INSTALLED. REPORTED TO STATE AND FEDERAL AGENCIES.

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: A ROOF FALL OCCURRED ON SAT 10-18-03 AT APPROX 2:30 AM. NO EQUIPMENT OR PERSONS INVOLVED, FALL WAS IN #45 ENTRY OUT BY SPAD 1754. AREA WAS DEVELOPED 01-99, FALL WAS 65' LONG BY 25; WIDE BY 6' THICK.

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: The area was cleared up and additional supports installed, indicating a need for equipment repair or inspection.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 36.817

Detailed Classification - 220040330042

Record 90 of 100

Source record ID: 220040330042
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (REPEATED TRAUMA)
MSHA accident type: Over-exertion NEC
Coal/metal indicator: C
Narrative characters: 246
Narrative may be truncated: False

FULL NARRATIVE

WHILE PERFORMING HIS NORMAL DUTIES AS A HEAVY EQUIPMENT OPERATOR, EMPLOYEE EXPERIENCED PAIN/TINGLING IN BOTH HANDS/WRISTS. DIAGNOSED WITH CARPAL TUNNEL SYNDROME. EMPLOYEE CONTINUED WORKING UNT IL 1/22/04 AT WHICH TIME HE WENT OFF TO HAVE SURGERY.

LLM CLASSIFICATION

Primary cause: OTHER
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: PROVIDE_TARGETED_TRAINING
Action support: HIGH
Action confidence: 0.0
Action rationale: Provide targeted training to prevent future incidents.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 22.921

Detailed Classification - 220090900020

Record 91 of 100

Source record ID: 220090900020
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: OCCUPATIONAL SKIN DISEASES
MSHA accident type: Absorption of radiations, caustics, toxic and noxious substances
Coal/metal indicator: M
Narrative characters: 131
Narrative may be truncated: False

FULL NARRATIVE

Reaction to respirator mask seal on face due to warmer weather. Told employee to keep mask clean and use protective cream on face.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 35.586

Detailed Classification - 220092160035

Record 92 of 100

Source record ID: 220092160035
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (PHYSICAL AGENTS)
MSHA accident type: Contact with heat
Coal/metal indicator: M
Narrative characters: 92
Narrative may be truncated: False

FULL NARRATIVE

Employee felt ill after working on the leach stockpile. Employee was treated for dehydration

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 35.561

Detailed Classification - 220101800005

Record 93 of 100

Source record ID: 220101800005
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: FALL OF ROOF OR BACK
MSHA accident type: Accident type, without injuries
Coal/metal indicator: C
Narrative characters: 360
Narrative may be truncated: False

FULL NARRATIVE

A fall of roof was discovered in the 1st NW mains at x-cut 155 between the #3 and #4 entry. The fall was approximately 16ft long x 19ft wide x 6-8 ft high. This fall was previously reported on e-doc #1132254 on 6/2/10 per a discussion held with D10 Roof control specialist it was determined that (2) separate roof falls could not be recorded on the same 7000-1

LLM CLASSIFICATION

Primary cause: GROUND_OR_ROOF_FAILURE
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: A fall of roof was discovered in the 1st NW mains at x-cut 155 between the #3 and #4 entry.

Primary contributing factor: UNSTABLE_GROUND_OR_ROOF_CONDITION
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: This fall was previously reported on e-doc #1132254 on 6/2/10 per a discussion held with D10 Roof control specialist it was determined that (2) separate roof falls could not be recorded on the same 7000-1

Recommended action: ENGINEERING_REVIEW_REQUIRED
Action support: HIGH
Action confidence: 1.0
Action rationale: An engineering review is needed to understand the cause of the roof falls and prevent future occurrences.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 32.775

Detailed Classification - 220121110005

Record 94 of 100

Source record ID: 220121110005
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: HOISTING
MSHA accident type: Accident type, without injuries
Coal/metal indicator: C
Narrative characters: 203
Narrative may be truncated: False

FULL NARRATIVE

The 5 North Emergency Hoist would not start. All work was stopped in affected area. Battery was discharged. Corrective Action: "Changed Battery" Elevator released at 10:45a.m. All agencies were notified.

LLM CLASSIFICATION

Primary cause: LOSS_OF_CONTROL_OF_TOOL_OR_EQUIPMENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: False
Cause evidence: "The 5 North Emergency Hoist would not start. Battery was discharged."

Primary contributing factor: EQUIPMENT_CONDITION_OR_FAILURE
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: False
Factor evidence: "Battery was discharged"

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Replace the discharged battery to ensure proper functioning of the hoist.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 13.033

Detailed Classification - 220151190100

Record 95 of 100

Source record ID: 220151190100
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: INJURIES DUE TO NATURAL CAUSES
MSHA classification: OTHER
MSHA accident type: NEC
Coal/metal indicator: M
Narrative characters: 378
Narrative may be truncated: False

FULL NARRATIVE

Employee operating a excavator, throwing material off bench to pit below. Employee called Foreman asked him to come to excavator. Foreman arrived employee stated he did not feel well & left arm hurting. They immediately put employee in vehicle took to hospital. In route notified me I called 800# to report. Employee required 2 stents and will have open heart for one blockage.

LLM CLASSIFICATION

Primary cause: OTHER
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: HIGH
Action confidence: 0.0
Action rationale: An investigation is needed to determine the cause of the employee's condition.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 23.341

Detailed Classification - 220162160021

Record 96 of 100

Source record ID: 220162160021
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DISORDERS (PHYSICAL AGENTS)
MSHA accident type: Contact with heat
Coal/metal indicator: M
Narrative characters: 140
Narrative may be truncated: False

FULL NARRATIVE

Employee experienced muscle cramps while working in hot temperatures. Employee received 1 bag of fluid through an IV at the local hospital.

LLM CLASSIFICATION

Primary cause: OTHER
Cause support: HIGH
Cause confidence: 0.0
Cause evidence valid: True
Cause evidence: Employee experienced muscle cramps while working in hot temperatures.

Primary contributing factor: ENVIRONMENTAL_CONDITION
Factor support: HIGH
Factor confidence: 0.0
Factor evidence valid: True
Factor evidence: Employee experienced muscle cramps while working in hot temperatures.

Recommended action: IMPROVE_PPE_OR_PROTECTIVE_EQUIPMENT
Action support: HIGH
Action confidence: 0.0
Action rationale: Provide better hydration and cooling measures to prevent future incidents.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: True
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 12.592

Detailed Classification - 220163090038

Record 97 of 100

Source record ID: 220163090038
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: OCCUPATNAL ILLNESS NOT DEG 1-6
MSHA classification: DUST DISEASE OF LUNGS
MSHA accident type: Inhalation of radiations, caustics, toxic and noxious substances
Coal/metal indicator: M
Narrative characters: 34
Narrative may be truncated: False

FULL NARRATIVE

X Ray Diagnosis of pneumoconiosis.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'... contributing factors.'}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 38.017

Detailed Classification - 220163540019

Record 98 of 100

Source record ID: 220163540019
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: HOISTING
MSHA accident type: Accident type, without injuries
Coal/metal indicator: M
Narrative characters: 302
Narrative may be truncated: False

FULL NARRATIVE

While performing test trips on #1 hoist, the slack rope knocker got pulled and would not reset. It was found that the switch was broken causing the hoist to be down. The decision was made to evacuate the mine and MSHA was called. The electricians replaced the switch and everything went back to normal.

LLM CLASSIFICATION

Primary cause: UNEXPECTED_EQUIPMENT_MOVEMENT
Cause support: HIGH
Cause confidence: 1.0
Cause evidence valid: True
Cause evidence: slack rope knocker got pulled and would not reset

Primary contributing factor: EQUIPMENT_CONDITION_OR_FAILURE
Factor support: HIGH
Factor confidence: 1.0
Factor evidence valid: True
Factor evidence: switch was broken

Recommended action: REPAIR_REPLACE_OR_INSPECT_EQUIPMENT
Action support: HIGH
Action confidence: 1.0
Action rationale: Replace the faulty switch to prevent future unexpected movements.

QUALITY AND REVIEW

Factor-action alignment valid: True
Review required: False
Reviewer note:
Insufficient information reason:
Processing status: SUCCESS
Processing error:
Processing seconds: 12.502

Detailed Classification - 220211580015

Record 99 of 100

Source record ID: 220211580015
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ALL OTHER CASES (INCL 1ST AID)
MSHA classification: HANDLING OF MATERIALS
MSHA accident type: Over-exertion in lifting objects
Coal/metal indicator: M
Narrative characters: 107
Narrative may be truncated: False

FULL NARRATIVE

Patching roof holes, setting plates down and rib pop out of place, left side, aggravation of an old injury.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification Value error, Invalid primary cause category: UNSTABLE_GROUND_OR_ROOF_CONDITION [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict] For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 42.064

Detailed Classification - 220212040019

Record 100 of 100

Source record ID: 220212040019
Severity group: 5_NO_LOST_TIME_OR_OTHER
Degree of injury: ACCIDENT ONLY
MSHA classification: ELECTRICAL
MSHA accident type: Accident type, without injuries
Coal/metal indicator: M
Narrative characters: 348
Narrative may be truncated: False

FULL NARRATIVE

Lightning caused forest fire (Mud Lick Fire), Reported via MSHA hotline on 7/13/21 - fire had not advanced to mine site. US Forest Service issued evacuation order due to smoke and fire approaching mine permit boundary on 7/15/21. Follow-up MSHA Hotline Call provided on 7/15/21 due to Evac Order. No injuries, all site personnel safely evacuated.

LLM CLASSIFICATION

Primary cause: INSUFFICIENT_INFORMATION
Cause support: LOW
Cause confidence: 0.0
Cause evidence valid: False
Cause evidence:

Primary contributing factor: NOT_STATED
Factor support: LOW
Factor confidence: 0.0
Factor evidence valid: False
Factor evidence:

Recommended action: INVESTIGATION_REQUIRED
Action support: LOW
Action confidence: 0.0
Action rationale: The model response could not be validated.

QUALITY AND REVIEW

Factor-action alignment valid: False
Review required: True
Reviewer note:
Insufficient information reason: Generation or validation failed.
Processing status: FAILED
Processing error: ValidationError: 1 validation error for IncidentClassification   Value error, factor_support_level must be HIGH, MEDIUM, or LOW. [type=value_error, input_value={'primary_cause_category'...'', 'reviewer_note': ''}, input_type=dict]   For further information visit https://errors.pydantic.dev/2.12/v/value_error
Processing seconds: 40.822

Conclusions and Recommended Next Steps

1. The 100-record run demonstrates whether the local Hugging Face pipeline can generate consistent categorical fields across multiple injury-severity levels.

2. Distribution tables describe model assignments within the sample. They should not be treated as population estimates until sampling and classification performance have been validated.

3. Every record marked REVIEW_REQUIRED should be manually evaluated. A sample of records not marked for review should also be checked to detect confident but incorrect classifications.

4. Model confidence is not a calibrated probability. Human review, evidence relevance, and factor-action alignment provide stronger quality controls.

5. After review, calculate cause accuracy, factor accuracy, action appropriateness, macro-F1, confusion matrices, and error rates by severity group.

6. Review repeated use of OTHER, NOT_STATED, and INSUFFICIENT_INFORMATION to identify missing taxonomy categories.

7. Before processing the complete dataset, retain checkpointing, shorten the prompt if possible, and consider optimized batch inference.

8. Corrective-action categories remain preliminary analytical outputs. Final actions require qualified operational, engineering, and safety review.