MULTI-VEHICLE DAMAGE ASSESSMENT REPORT

AI-Assisted Automatic Insurance Appraisal System — Batch Assessment

Document No	VD-20261013-MULTI	**Issue Date**	13.10.2026 23:53
Report Type	Automated Preliminary Assessment (batch)	**Scope**	4 vehicles / 13 photographs

OVERALL SUMMARY

Vehicle	Make / Model	Photos	Damage	Detected Types	Total Area (%)
1	Audi RS6 Avant	3	8	Crack, Dent, Scratch	8.23
2	Peugeot 108	3	11	Crack, Dent, Scratch	9.29
3	Peugeot Partner Tepee	4	6	Crack, Dent	5.88
4	Hyundai Tucson	3	8	Dent, Scratch	21.03

VEHICLE 1 — Audi RS6 Avant

Make	Audi	**Colour**	Black
Model	RS6 Avant	**Photograph Count**	3
		Total Damage	8

Photo	View Angle	Part	Damage Type	Area (%)	Confidence (%)	Status
1	Rear right quarter	Back Bumper	Scratch	0.47	37.8	Uncertain
2	Front right quarter	Front Bumper	Crack	2.07	87.7	Confirmed
2	Front right quarter	unassigned	Scratch	0.38	30.8	Uncertain
3	Front	unassigned	Scratch	0.51	92.9	Confirmed
3	Front	unassigned	Dent	3.08	84.0	Confirmed
3	Front	unassigned	Crack	0.94	62.1	Probable
3	Front	unassigned	Crack	0.33	45.3	Probable
3	Front	unassigned	Scratch	0.47	33.7	Uncertain

Visual Analysis







Colour key: Scratch | Dent | Crack


VEHICLE 2 — Peugeot 108

Make	Peugeot	**Colour**	Silver
Model	108	**Photograph Count**	3
		Total Damage	11

Photo	View Angle	Part	Damage Type	Area (%)	Confidence (%)	Status
1	Front	Hood	Dent	0.44	63.6	Probable
1	Front	Front Left Light	Crack	0.41	53.3	Probable
1	Front	Front Bumper	Crack	1.49	49.1	Probable
1	Front	Hood	Dent	0.17	47.1	Probable
2	Front right quarter	Front Bumper	Crack	1.74	77.9	Confirmed
2	Front right quarter	unassigned	Dent	1.06	62.7	Probable
2	Front right quarter	Front Bumper	Dent	0.17	50.8	Probable
2	Front right quarter	Front Bumper	Dent	0.17	46.9	Probable
2	Front right quarter	Front Bumper	Crack	3.42	34.7	Uncertain
3	Rear right quarter	unassigned	Scratch	0.07	58.1	Probable
3	Rear right quarter	unassigned	Dent	0.16	36.4	Uncertain

Visual Analysis



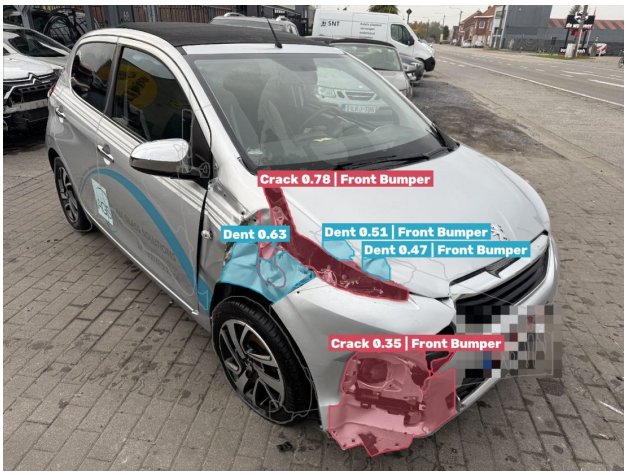



Colour key: Scratch | Dent | Crack

VEHICLE 3 — Peugeot Partner Tepee

Make	Peugeot	**Colour**	Blue
Model	Partner Tepee	**Photograph Count**	4
		Total Damage	6

Photo	View Angle	Part	Damage Type	Area (%)	Confidence (%)	Status
1	Rear left quarter	unassigned	Dent	3.02	84.9	Confirmed
1	Rear left quarter	unassigned	Crack	0.18	61.4	Probable
1	Rear left quarter	Wheel	Dent	0.39	58.6	Probable
2	Front left quarter	—	—	—	—	No damage detected from this angle
3	Front right quarter	—	—	—	—	No damage detected from this angle
4	Rear right quarter	Back Bumper	Crack	0.45	89.1	Confirmed
4	Rear right quarter	unassigned	Dent	1.49	81.6	Confirmed
4	Rear right quarter	Back Bumper	Dent	0.35	29.9	Uncertain

Visual Analysis



Colour key: Scratch | Dent | Crack


VEHICLE 4 — Hyundai Tucson

Make	Hyundai	**Colour**	Beige
Model	Tucson	**Photograph Count**	3
		Total Damage	8

Photo	View Angle	Part	Damage Type	Area (%)	Confidence (%)	Status
1	Rear	unassigned	Scratch	1.14	45.3	Probable
2	Front	Hood	Dent	17.28	76.3	Confirmed
2	Front	Hood	Scratch	0.89	43.9	Uncertain
2	Front	Front Bumper	Scratch	0.05	42.0	Uncertain
2	Front	Front Bumper	Scratch	0.09	33.1	Uncertain
2	Front	Hood	Scratch	0.10	27.0	Uncertain
3	Front right quarter	Front Left Light	Dent	1.32	94.4	Confirmed
3	Front right quarter	Front Left Light	Scratch	0.15	56.5	Probable

Visual Analysis



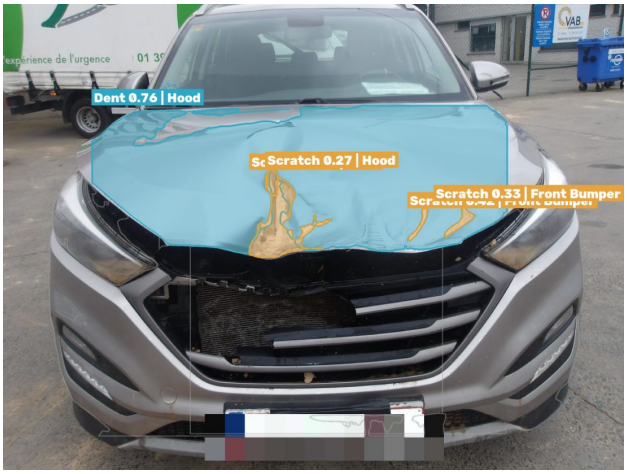



Colour key: Scratch | Dent | Crack

SYSTEM INFORMATION

Part Detection Model	YOLOv11m-seg (Carparts-Seg)
Damage Detection Model	YOLOv11l-seg (v6, fp32)
Damage Model mAP@50 (test)	0.7238
Inference Time	8.84 ms
Fusion Overlap Threshold	0.38
Inference Resolution	960 px

NOTES

Personal data: Vehicle registration plates in the photographs have been pixelated for data-protection reasons. Pixelation was applied BEFORE the models were run, not afterwards; the detection results were therefore produced from the redacted images.

IMPORTANT NOTICE: This report was generated automatically by an AI-based image analysis system and constitutes a preliminary assessment. The final damage assessment, repair scope and settlement amount are determined by a qualified claims adjuster. System outputs should be used for reference only, to accelerate the adjuster workflow. Image quality, viewing angle and lighting conditions may affect detection accuracy.