


Quick Guide

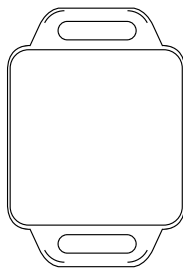

*For inclinometer series
WT61C、WT61PC、WT901C、WT901BC

PC Connection

Preparation 1. Software Installation

Scan the QR code, download "Standard Software for Windows PC" and unzip the files



My Drive > WITMOTION Document Center > WITMOTION New Software(Unzip)

Calibration Video

WitMotion New Software.zip .ZS

Software Instructions Manual.pdf .ZS


1

Preparation 2. Driver Installation

Scan the QR code to download driver.
(CH340 for 3-in-1 converter, CP2102 for 6-in-1 converter.)



Install the driver as below:

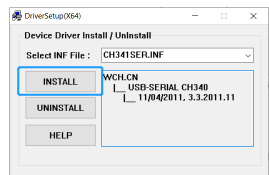

2

Preparation 3. Serial PIN Connection

Recommended Converter:



3-in-1 USB-UART converter
Driver CH340


Note: For detailed connection, please refer to the following
USB to serial based on the interface of the purchased sensor.

3

TTL Interface

PIN Definition:

RED	YELLOW	GREEN	BLACK
VCC 5V	TX	RX	GND



Sensor - Converter
VCC-----5V
TX-----RX
RX-----TX
GND-----GND


Note: TX and RX are cross-connected.

4

USB-RS232

PIN Definition:

RED	YELLOW	GREEN	BLACK
VCC 5-36V	232TX	232RX	GND

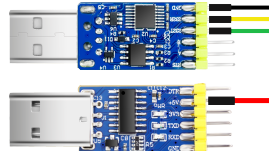

Sensor - Converter
VCC-----5V
232TX-----232R
232RX-----232T
GND-----GND


*232TX connected to the RS232 RX of the converter.
232RX connected to the RS232 TX of the converter.

5

USB-RS485

PIN Definition:

RED	YELLOW	GREEN	BLACK
VCC5-36V	A	B	GND

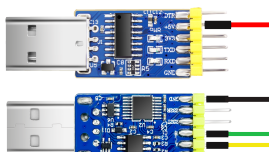


Sensor - Converter
VCC ----- 5~36V
B ----- B
A ----- A
GND ----- GND

Setup Steps


Step 1. Connect the sensor with a serial converter.
* Please check the Serial Connection part from page 3-6th.

Step 2. Insert the converter to USB slot
and confirm the "com port" in device manager.




7

Step 3. Double-hit "WitMotion.exe",(*new software)

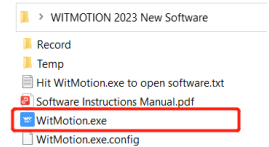

Step 4. Choose the right "Port", enter the model name,
then hit "Search devices"

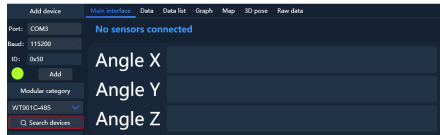

8

Step 5. Wait for 30seconds, the data will be displayed.




Step 6. Check out the data you want.



9

Config Menu

Preparation: Ensuring the sensor is "Online".
*For details, please kindly refer to the manual.

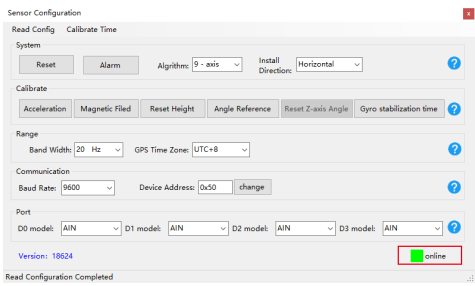

10

Document Center:

Scan the QR code to get the complete tutorial of

Inclinometer series



Google Drive



Youtube

Having troubles with our products?
We are here to help.

 support@wit-motion.com

11