# Quick Guide

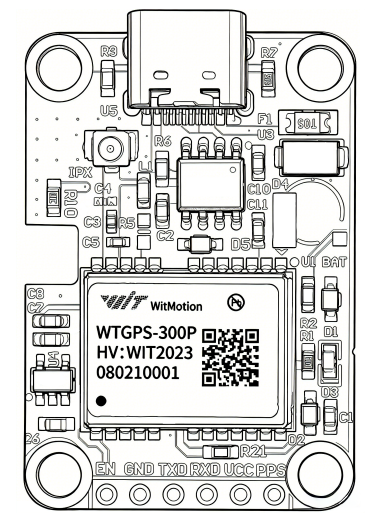

*For inclinometer series

WTGPS-300P、WTGPS-02H、
WTGPS+BD、WTGAHRS3

support@wit-motion.com

---

**PC Connection**

## Preparation 1. Software Installation

Scan the QR code, download "Standard Software for Windows PC" and unzip the files

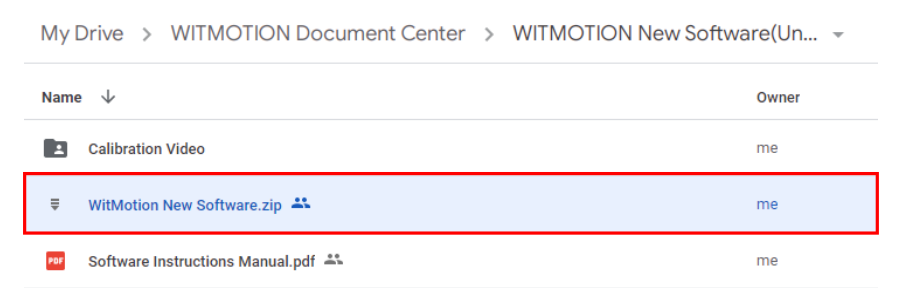

My Drive > WITMOTION Document Center > WITMOTION New Software(Un...

| Name | Owner |
|---|---|
| Calibration Video | me |
| WitMotion New Software.zip | me |
| Software Instructions Manual.pdf | me |

---

## Preparation 2. Driver Installation

Scan the QR code to download driver.
(CH340 for 3-in-1 converter, CP2102 for 6-in-1 converter.)

Install the driver as below:

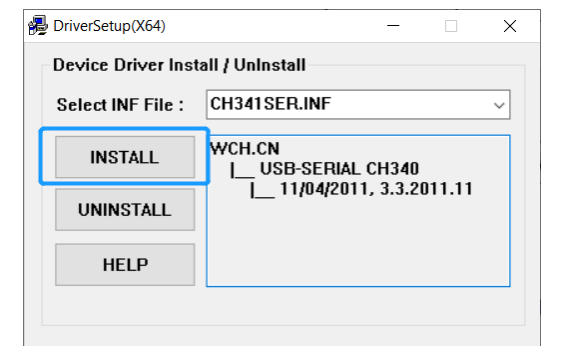

DriverSetup(X64)

Device Driver Install / UnInstall

Select INF File : CH341SER.INF

```
WCH.CN
  |__ USB-SERIAL CH340
       |__ 11/04/2011, 3.3.2011.11
```

---

## Preparation 3. Serial PIN Connection

Recommended Converter:

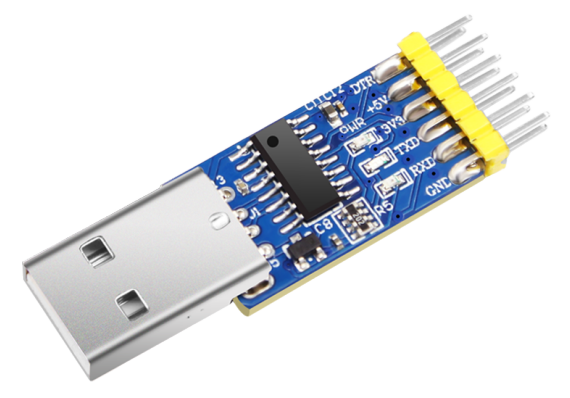

3-in-1 USB-UART converter
Driver CH340

Note: For detailed connection, please refer to the following USB to serial based on the interface of the purchased sensor.

---

## TTL Interface

PIN Definition:

| RED | YELLOW | GREEN | BLACK |
|---|---|---|---|
| VCC 5V | TX | RX | GND |



Sensor - Converter
VCC----------5V
TX------------RX
RX------------TX
GND---------GND

Note: TX and RX are cross-connected.

---

## USB-RS232

PIN Definition:

| RED | YELLOW | GREEN | BLACK |
|---|---|---|---|
| VCC 5-36V | 232TX | 232RX | GND |

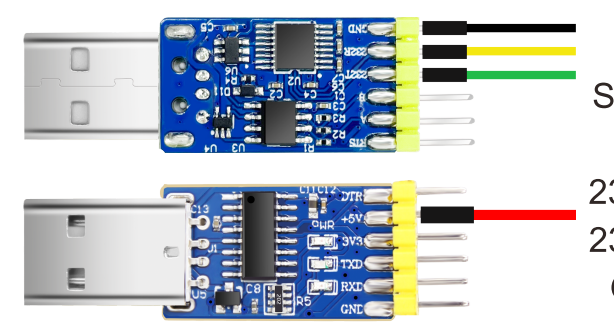

Sensor - Converter
VCC----------5V
232TX----------232R
232RX----------232T
GND---------GND

*232TX connected to the RS232 RX of the converter.
232RX connected to the RS232 TX of the converter.

---

## USB-RS485

PIN Definition:

| RED | YELLOW | GREEN | BLACK |
|---|---|---|---|
| VCC5-36V | A | B | GND |

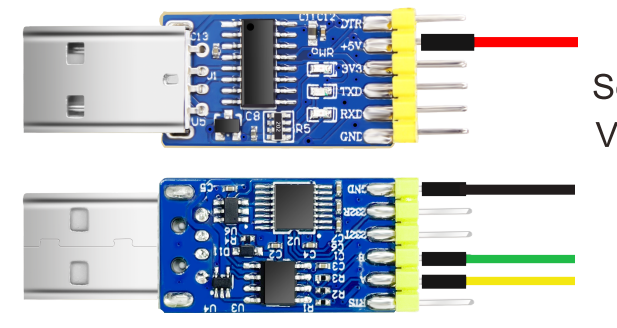

Sensor - Converter
VCC -------- 5~36V
B --------- B
A --------- A
GND ------ GND

---

## Setup Steps

Step 1. Connect the sensor with a serial converter.
* Please check the Serial Connection part from page 3-6th.

Step 2. Insert the converter to USB slot and confirm the "com port" in device manager.



Portable Devices
Device Manager
USB-SERIAL CH340 (COM8)

---

Step 3. Double-hit "WitMotion.exe".(*new software)

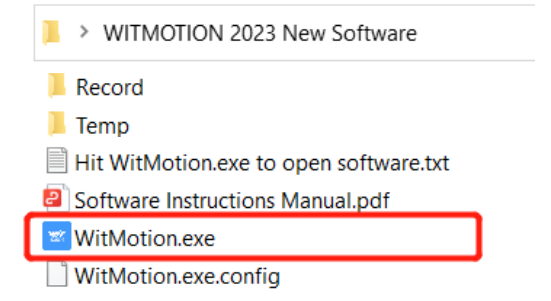

WITMOTION 2023 New Software
- Record
- Temp
- Hit WitMotion.exe to open software.txt
- Software Instructions Manual.pdf
- WitMotion.exe
- WitMotion.exe.config

Step 4. Choose the right "Port", enter the model name, then hit "Search devices"

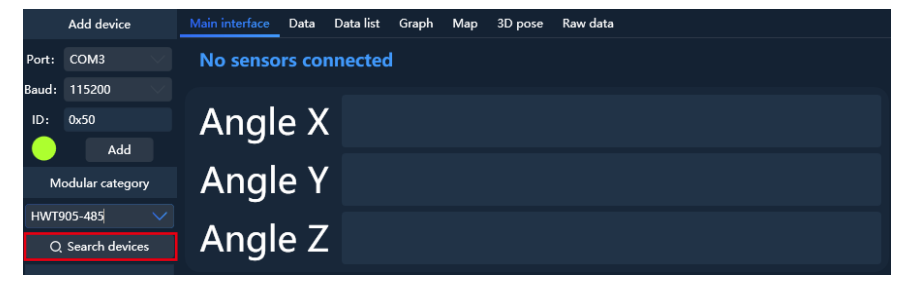

Port: COM3
Baud: 115200
ID: 0x50
Modular category: HWT905-485

No sensors connected

Angle X
Angle Y
Angle Z

---

Step 5. Wait for 30seconds, the data will be displayed.

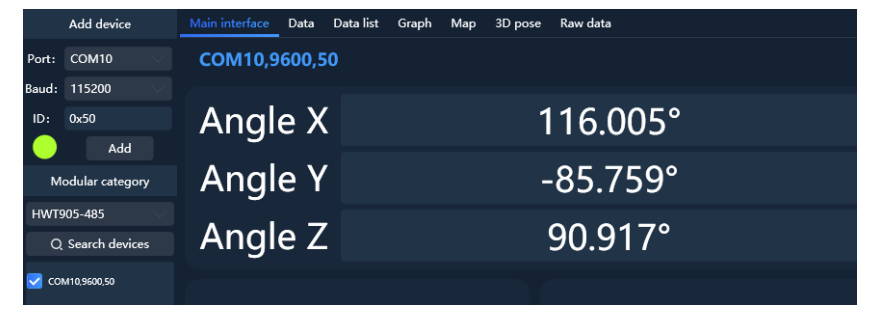

Port: COM10
Baud: 115200
ID: 0x50
Modular category: HWT905-485
☑ COM10,9600,50

COM10,9600,50

Angle X 116.005°
Angle Y -85.759°
Angle Z 90.917°

Step 6. Check out the data you want.

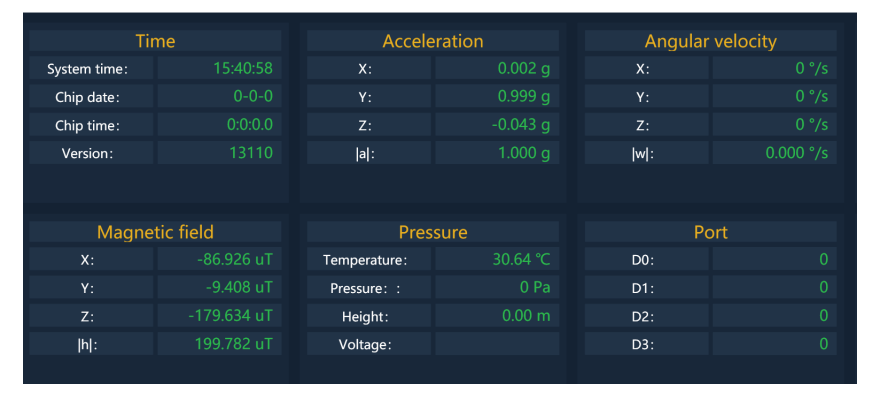

Time
System time: 15:40:58
Chip date: 0-0-0
Chip time: 0:0:0.0
Version: 13110

Acceleration
X: 0.002 g
Y: 0.999 g
Z: -0.043 g
|a|: 1.000 g

Angular velocity
X: 0 °/s
Y: 0 °/s
Z: 0 °/s
|w|: 0.000 °/s

Magnetic field
X: -86.926 uT
Y: -9.408 uT
Z: -179.634 uT
|h|: 199.782 uT

Pressure
Temperature: 30.64 ℃
Pressure: : 0 Pa
Height: 0.00 m
Voltage:

Port
D0: 0
D1: 0
D2: 0
D3: 0

---

## Config Menu

Preparation: Ensuring the sensor is "Online".
*For details, please kindly refer to the manual.

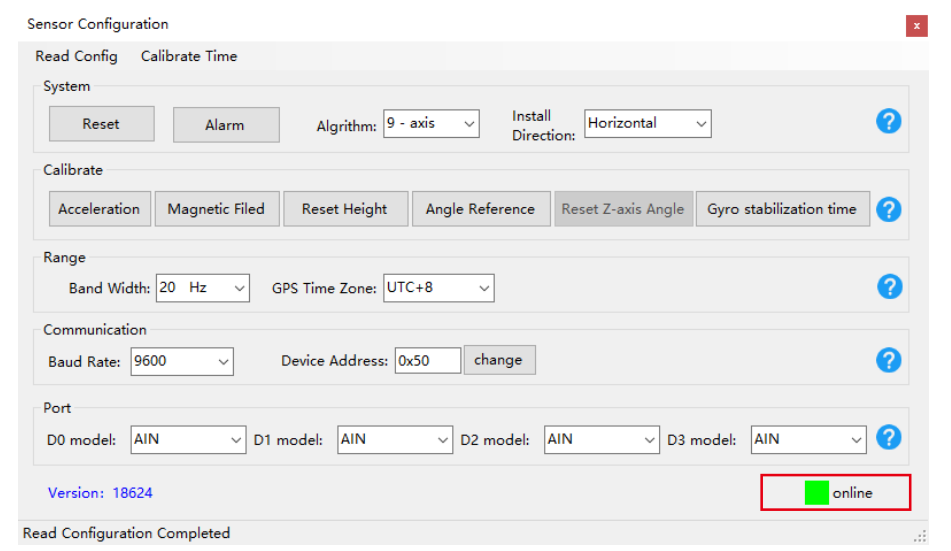

Algrithm: 9 - axis
Install Direction: Horizontal
Band Width: 20 Hz
GPS Time Zone: UTC+8
Baud Rate: 9600
Device Address: 0x50
D0 model: AIN
D1 model: AIN
D2 model: AIN
D3 model: AIN
Version: 18624
online
Read Configuration Completed

---

## Document Center:

Scan the QR code to get the complete tutorial of Module Series

Google Drive

Youtube

Having troubles with our products?
We are here to help.

support@wit-motion.com