

5585 E 56TH AVE

COMMERCE CITY CO 80022

PROPERTY TYPE
Commercial Transit Warehouse

YEAR BUILT

-

BUILDING AREA


18,611 SF

ROOF SQUARES

186

PARCEL ID

0182307408006

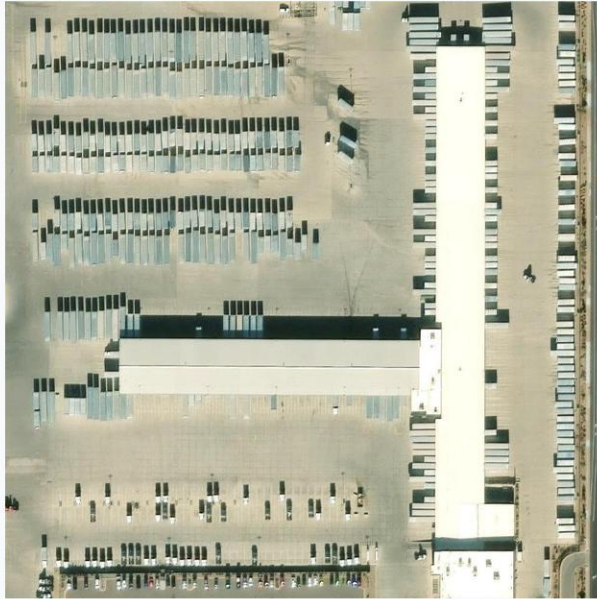

OVERALL ROOF CONDITION SCORE

67 /100
FAIR

RISK LEVEL

MODERATE



ROOF INFORMATION

ROOF TYPE	Low-slope commercial roof
ROOF SYSTEM	Likely single-ply membrane over a large low-slope warehouse roof, with multiple rooftop equipment rows and perimeter edge conditions visible
POSSIBLE TYPES	TPO/PVC (56%); Coating over membrane (44%); EPDM (28%)
VISIBLE CONCERNS	dark staining/color variation; many penetrations/units; Widespread tonal variation and darker bands/patches are visible across portions of the roof, which may indicate prior repairs, membrane aging, or localized moisture-related staining.
ROOF AGE EST.	Appears mid-life to older due to widespread equipment presence and color variation, but the aerial view does not support a precise age estimate.
ROOF AREA	18,611 SF

SELECTED AERIAL IMAGE - ESRI WORLD IMAGERY AS OF 11/13/2025

ROOF CONDITION BREAKDOWN

Membrane Condition		68/100
Ponding		63/100
Flashing & Seals		61/100
Penetrations		58/100
Overall Maintenance		62/100

AERIAL ROOF OBSERVATIONS

1. Visible risk factors include dark staining or inconsistent roof color, high penetration or rooftop-unit density.
2. Large commercial warehouse roof with extensive low-slope coverage and multiple rooftop mechanical units.
3. Roof surface shows broad light-colored field areas with darker lines, patches, and varied panel-like sections, suggesting multiple roof sections and/or repair areas.
4. Perimeter conditions and many rooftop penetrations increase maintenance and leak-management complexity.
5. A long central roof section appears brighter and more uniform than surrounding areas, while adjacent fields show more discoloration and tonal inconsistency.

BUILDING CHARACTERISTICS

LAND AREA	5.98 acres
STORIES	-
CONSTRUCTION TYPE	-
TAX DISTRICT	-
LAND VALUE	-

REPORT SUMMARY

The aerial imagery shows a large low-slope commercial warehouse roof with a likely single-ply membrane or coated membrane appearance, extensive rooftop equipment, and noticeable roof color variability across multiple sections. The roof appears serviceable overall, but darker patches, mixed surface tones, and numerous penetrations suggest elevated maintenance and leak-monitoring needs. No obvious heavy ponding or debris accumulation is visible in this image. Visible risk factors include dark staining or inconsistent roof color, high penetration or rooftop-unit density.

Recommendation:

Continue routine roof inspections and prioritize close-up review of flashing, unit curbs, seals, and areas with darker staining or color variation. Given the number of penetrations and the mixed surface appearance, a field inspection is advisable to verify whether any discoloration reflects benign aging versus localized moisture intrusion or prior repairs.

ROOF REPLACEMENT COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$502,962	Tear Off & Disposal	\$61,230
	Roof Membrane	\$122,460
	Insulation	\$74,351
	Flashing/Edging	\$48,109
	Labor	\$131,208
	Replacement Subtotal	\$437,358
	Contingency (15%)	\$65,604
	Total Project Cost	\$502,962

This replacement cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.

ROOF OVERLAY COST ESTIMATE

TOTAL PROJECT COST	COST COMPONENT	COST
\$194,485	Overlay Subtotal	\$176,804
	Contingency (10%)	\$17,680
	Total Project Cost	\$194,485

This overlay cost is an estimate derived from aerial imagery, public property records, and commercial roofing cost models. It is intended for budgeting purposes only and should not be considered a contractor quote or engineering assessment.